

Alert number **[A12/00612/21](#)**

Product **Toy make-up set**



Risk type **Chemical**

**The product contains the colorants CI 21090, CI 21110 and CI 12315. These colorants are not allowed in cosmetic products.**

**The product does not comply with the Cosmetics Regulation 1223/2009/EC and the Toy Safety Directive 2009/48/EC.**

Category **Toys**

Type **Consumer**

Description **Children's cosmetic set: cosmetic case with mirror, eye-shadow powders, lip gloss, jewel tattoos, cosmetic brushes**

Packaging description **Transparent cardboard box.**

Brand **make it real**

Name **Beauty collection, Girl-on-the-go!**

Type / number of model **n0. 2301-PAKINT-01-V3**

Batch number **IR1725INT**

Barcode **695929023010**

Weekly report number **Report-2021-18**

Alert submitted by	<b>Slovenia</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>14/01/2021</b>

Alert number

**[A12/00613/21](#)**

Product

**Plastic doll**



Risk type

**Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), dibutyl phthalate (DBP) and di-isonylephthalate (DINP) (measured values up to: 1.1%, 0.25% and 1.1% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system and/or liver.**

**The product does not comply with the REACH regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Plastic doll.**

Packaging description

**Printed cardboard box with plastic window.**

Brand

**Unknown**

Name

**La Regina Delle Nevi**

Type / number of model

**AP1901-06N/57**

Batch number

**jun.2019**

Barcode

**8010380380236**

Weekly report number

**Report-2021-18**

Alert submitted by	<b>Slovenia</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>21/01/2021</b>

Alert number

**[A12/00614/21](#)**

Product

**Plastic doll with accessories**



Risk type

**Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), dibutyl phthalate (DBP) and di-isonylephthalate (DINP) (measured values up to: 9.9%, 6.6% and 0.5% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system and/or liver.**

**The product does not comply with the REACH regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Plastic doll with accessories.**

Packaging description

**Transparent plastic packaging.**

Brand

**Unknown**

Name

**Mia fashion**

Type / number of model

**ref.B435**

Batch number

**201843505**

Barcode

**8033866414355**

Weekly report number

**Report-2021-18**

Alert submitted by	<b>Slovenia</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Retailer</b>
Date of entry into force	<b>26/01/2021</b>

Alert number **[A12/00594/21](#)**

Product **Skin cream**



Risk type **Chemical**

**According to the list of ingredients, the product contains Meclofenoxate, which is a sympathicomimetic amine. Sympathomimetic amines affect the function of the central nervous system and should not be applied on the skin.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Professional**

Description **5 ml vials, with white and black label bearing the words: MS Stretch Control Elasticity and Firmness**

Packaging description **The product is sold in a cardboard box containing five white 5 ml vials, with a grey and blue coloured multilingual text indicating: MesoStyle Stretch Control Elasticity and Firmness, face and body.**

Brand **MESOSTYLE STRETCH CONTROL**

Name **STRETCH CONTROL**

Batch number **L1 05-2021  
M1 10-2020  
N1 05-2021**

Weekly report number **Report-2021-18**

Alert submitted by	<b>Spain</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Spain</b>
Measures taken by economic operators	<b>Ban on the marketing of the product and any accompanying measures Manufacturer</b>
Date of entry into force	<b>26/11/2020</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Manufacturer</b>
Date of entry into force	<b>26/11/2020</b>



---

Alert number **[A12/00602/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The gas generator of the passenger airbag may be defective. This could result in uncontrolled inflation and the release of metal fragments when the airbag is activated, causing injury to the occupants.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Infiniti**

Name **S50, Y50**

EC-type approval/model **Type-approval number: Individual approval**

Production dates **S50: between 17 May 2006 and 6 June 2008; Y50: between 3 April 2006 and 12 March 2010**

Company recall code **R1622**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/00595/21](#)**

Product **Cosmetic clay**



Risk type **Chemical**

**The product contains nickel, arsenic and lead (measured values: up to 62 mg/kg, 4 mg/kg and 16 mg/kg, respectively). Nickel, arsenic and lead are prohibited substances in cosmetic products. Nickel can cause skin irritation and induce sensitisation or elicit allergic responses. Arsenic is toxic if swallowed or inhaled. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may affect breast-fed or unborn children.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Consumer**

Description **Cosmetic clay in the form of black fine-crystalline powder.**

Packaging description **Two plastic foil hoses, welded in a printed box with a nominal quantity of 100 g.**

Brand **Fitokosmetik**

Name **Fitokosmetik schwarzer kosmetischer Ton (Totes Meer)**

Type / number of model **475190650**

Batch number **05-2023 15.05.2020-1-22**

**4607051790650**

Barcode

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Russian Federation**

Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**


Date of entry into force **25/02/2021**

Alert number

**[A12/00606/21](#)**

Product

**Children's fancy dress costume**

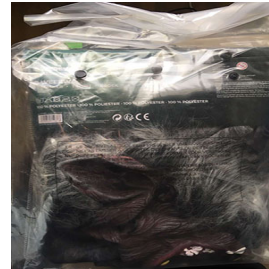

Risk type

**Burns**

**The fancy dress costume is easily flammable and the flame propagation is too high. If it catches fire, the child could suffer burns.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-2.**

Category

**Toys**

Type

**Consumer**

Description

**Dressing-up costume representing a werewolf, consisting of a mask, a top and trousers; for children from 7 to 10 years old.**

Packaging description

**Plastic bag and cardboard with a picture of a child dressed as a werewolf.**

Brand

**GIFI Diffusion SAS**

Name

**CREATURE loup-garou**

Type / number of model

**471980**

Batch number

**07/2020**

Barcode

**3491954719808**

Weekly report number

**Report-2021-18**

Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Singapore</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>

Alert number **[A12/00623/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

**Due to a manufacturing defect, the wheel bolts may be tightened with incorrect torque. This could lead to the detachment of a wheel, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **CITROËN**

Name **Citroën Spacetourer et Jumpy (K0)**

EC-type approval/model **e2\*2007/46\*0530\*14, e2\*2007/46\*0531\*13**

Production dates **The affected vehicles were manufactured between 24 September 10 November 2020.**

Company recall code **200884**

Weekly report number **Report-2021-18**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Poland**

Alert number **[A12/00624/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

**Due to a manufacturing defect, the wheel bolts may be tightened with incorrect torque. This could lead to the detachment of a wheel, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **PEUGEOT**

Name **Traveller, Expert (K0)**

EC-type approval/model **e2\*2007/46\*0532\*14, e2\*2007/46\*0533\*12, e2\*2007/46\*0533\*13**

Production dates **The affected vehicles were manufactured between 24 September and 10 November 2020.**

Company recall code **KFU/ KFV**

Weekly report number **Report-2021-18**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **21/12/2020**

Measures taken by economic **Recall of the product from end users**

operators

**Manufacturer**

Date of entry into force

**27/01/2021**

Products were found and  
measures were taken also in

**Poland**



Alert number **[A12/00603/21](#)**

Product **Snowmobile**



Risk type **Burns  
Fire  
Injuries**

**Excessive heat could develop in the muffler. This can cause the upper right hand vent grill to melt, increasing the risk of fire and injury.**

Category **Motor vehicles**

Type **Consumer**

Description **All 2021 models and serials of 2022 models equipped with 600 EFI engine.**

Brand **SKI-DOO**

Production dates **The affected vehicles were manufactured between 21 September 2020 - 26 January 2021.**

Company recall code **2022-1**

Weekly report number **Report-2021-18**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **Finland**

Measures ordered by public  
authorities

**Recall of the product from end users  
Importer**

Date of entry into force

**17/03/2021**

Alert number **[A12/00610/21](#)**

Product **Motorcycle**

Risk type **Injuries**

**Due to insufficient preload force of the return spring, the brake piston may not return to its original position. This could impair the functioning of the front brake, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Motorcycle**

Brand **KTM**

Name **KTM 790 Adventure**

EC-type approval/model  
**e1\*168/2013\*00149\*00 /790 Adventure R 2019/EU/F9603S3**  
**e1\*168/2013\*00149\*00 /790 Adventure, orange**  
**2019/EU/F9603S1**  
**e1\*168/2013\*00149\*00 /790 Adventure, white**  
**2019/EU/F9603S2**  
**e1\*168/2013\*00149\*01 /790 Adventure R 2020/EU/F9603T3**  
**e1\*168/2013\*00149\*01 /790 Adventure R Rally**  
**2020/EU/F9603T4**  
**e1\*168/2013\*00149\*01 /790 Adventure, orange**  
**2020/EU/F9603T1**  
**e1\*168/2013\*00149\*01 /790 Adventure, white**  
**2020/EU/F9603T2**

Production dates **Model year: 2019, 2020.**

Weekly report number **Report-2021-18**

Alert submitted by **Austria**

Is the product counterfeit? **No**

Country of origin **Austria**

Measures taken by economic operators **Recall of the product from end users**  
**Manufacturer**

Date of entry into force **27/04/2021**

Company recall code - <https://www.ktm.com/de-at/service/Safety.html>


Products were found and  
measures were taken also in  
**France**  
**Greece**  
**Poland**  
**Sweden**

Alert number

**[A12/00591/21](#)**

Product

**Particle filter mask**

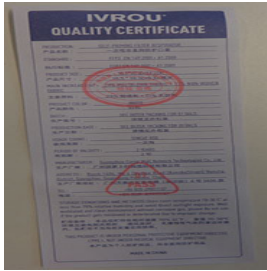

Risk type

**Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as 19%); additionally, the mask does not properly adapt to the face. Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**White half-face particle filter mask, sold as "FFP2"**

Packaging description

**The product is packed in single white-transparent plastic pouches, which are sold in cardboard boxes.**

Brand

**IVROU**

Name

**SELF-PRIMING FILTER RESPIRATOR**

Type / number of model

**IRYS-01**

Batch number

**HLB20200906W  
date of manufacture: 06.09.2020 (MFG: 20200906)  
expiry date: 20220905**

Barcode

**8719327230893**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Stop of sales  
Distributor**

Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

---

Alert number **[A12/00596/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The side spoilers on the boot lid may not be properly affixed. As a result, a spoiler could detach completely while the vehicle is in motion, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 247.**

Brand **Mercedes-Benz**

Name **GLB**

EC-type approval/model **e1\*2007/46\*1909\*03-09, Type: F2B**

Production dates **The affected vehicles were manufactured between 23 April 2019 and 8 October 2020.**

Company recall code **7792003**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code **- <https://www.Mercedes-Benz.de>**

Products were found and measures were taken also in **Greece  
Croatia  
Romania**

Alert number **[A12/00598/21](#)**

Product **Passenger car**

Risk type **Fire**

**Cracks could occur in the high pressure lines between the fuel rail and the injectors. As a result, diesel fuel could leak into the engine compartment, increasing the risk of fire. Moreover, due to the fuel leak the engine might not start, or the emergency operating mode might be activated.**

Category **Motor vehicles**

Type **Consumer**

Description **E-Class and CLS vehicles, model series BR 213 and 257, equipped with a 4-cylinder OM654 diesel engine.**

Brand **MERCEDES-BENZ**

Name **CLS, E-Class**

EC-type approval/model **e1\*2001/116\*0501\*35-\*37, e1\*2007/46\*1560\*09-\*11, e1\*2007/46\*1818\*01-\*02, Types: 212, R1ES, R1ECLS**

Production dates **The affected vehicles were manufactured between 12 and 17 October 2018.**

Company recall code **792206**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<https://www.Mercedes-Benz.de>**



Alert number **[A12/00599/21](#)**

Product **Screw jack**

Risk type **Injuries**

**The jack may fail while being used to hold the vehicle. This may lead to a sudden descend of the vehicle, increasing the risk of injury.**

Category **Motor vehicles**

Type **Consumer**

Description **Screw jack, offered as an accessory for certain Can-Am Maverick models.**

Brand **CAN-AM**

Name **Maverick**

EC-type approval/model **Item numbers: 715003610, 715006190**

Production dates **March 2020 to June 2020**

Company recall code **2021-2**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Canada**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<https://can-am.brp.com/off-road/de/de/kunden/sicherheit/off-road-screw-jack.html>**

Products were found and measures were taken also in **Slovenia**

---

Alert number **[A12/00600/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**A battery insert (crash pad) has not been fitted. As a result, the battery would not be adequately secured in the event of an accident, which could cause certain safety functions to become unavailable.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **BMW**

Name **X3**

EC-type approval/model **e1\*2007/46\*1797\*02, Type: G3X**

Production dates **The affected vehicles were manufactured between 3 May 2018 and 17 February 2021.**

Company recall code **51190500**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Poland  
Sweden**

Alert number **[A12/00604/21](#)**

Product **Lorry**

Risk type **Burns**

**An oil line connected to the gas turbocharger can leak. Fuel leakage close to a source of ignition will increase the risk of fire.**

Category **Motor vehicles**

Type **Professional**

Description **Lorry**

Brand **Mercedes-Benz LKW**

Name **Actros, Arocs, Atego, Econic**

EC-type approval/model **Type approval number: e1\*2007/46\*1553\*, 0726\*, 0735\*, 0732\*, 0736\*, 0727\*, 0729\*, 0728\*, 1170\*, 1171\*, 1174\*, 1175\*, 1176\*, 1223\*, 1222\*, 1641\*, 1650\*, 1651\*  
Type: 967PKX4-T, 963-0-A, 963-0-D, 963-0-C, 963-7-E, 963-4-E, 963-0-B, 963-2-A, 967PKX2, 967PKX3, 967KMU3, 967FWU2, 967FWU3, NGE-L42, NGE-L62N, 967PKX4, 967PKX3-T, 967PKX2-T**

Production dates **From 15/12/2020 to 11/02/2021**

Company recall code **OELDR-LTG**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and **Greece**

measures were taken also in **Poland**



---

Alert number **[A12/00601/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**Due to an error in the manufacturing process, the seat rail and seat-belt attachment may be defective. This will lead to increased the risk of injury in the event of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Peugeot**

Name **3008**

EC-type approval/model **e2\*2007/46\*0534\*16, Type: M**

Production dates **The affected vehicles were manufactured on 12 and 13 January 2021.**

Company recall code **KGZ**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France  
Poland  
Sweden**

Alert number **[A12/00597/21](#)**

Product **Mobile home / camper van**

Risk type **Fire**

**Water may enter into the wiring of the vehicle if it is operated in extreme weather conditions or washed with a pressure washer. This could result in an electrical short circuit, increasing the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Iveco Daily, Model year 2006; Daily S2000, Model year 2009; Daily 4x4, Model year 2009.**

Brand **Iveco**

Name **Daily, Daily S2000, Daily 4x4**

EC-type approval/model

**IS35CI2AA, IS52CC2AA  
L912\*02, L916\*02, L918\*02, L912\*03, L913\*03, L913\*04,  
L918\*06  
Types: C65CC, S2, S4, C30C, C35C, C50C, C65C, C35V,  
IS55W2EA, IS35SC2AA, IS56AC2DA, IS70CI2BA, IS35CC2AA,  
IS35SI2AA, IS56CC2BA, IS52CI2BA, IS70CC2BA, IS52CI2AA  
e3\*2007/46\*0083\*01, e3\*2007/46\*0120\*14,  
e3\*2007/46\*0168\*13, e3\*2007/46\*0115\*12,  
e3\*2007/46\*0116\*14, e3\*2007/46\*0118\*14,  
e3\*2007/46\*0119\*15, e3\*2007/46\*0120\*15,  
e3\*2007/46\*0122\*14,  
e3\*2007/46\*0118\*17, e3\*2007/46\*0119\*17,  
e3\*2007/46\*0120\*17, K843\*07, K665\*12, K843\*08, L910\*00,  
L912\*00, L916\*00, L918\*00, L918\*01, L910\*01,  
e3\*2007/46\*0123\*12, e3\*2007/46\*0151\*12,  
e3\*2007/46\*0117\*13, e3\*2007/46\*0152\*13,  
e3\*2007/46\*0115\*13, e3\*2007/46\*0117\*14,  
e3\*2007/46\*0118\*15, e3\*2007/46\*0122\*15,  
e3\*2007/46\*0151\*13,**

Production dates **The affected vehicles were manufactured between 28 June 1999 and 27 December 2013.**

Company recall code **8T2**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - <http://www.iveco.com>

Alert number **[A12/00593/21](#)**

Product **Hair dryer**



Risk type **Burns  
Electric shock  
Fire**

**The hair dryer does not have a thermal cut-out device. The plastic material of the casing is combustible. The hair dryer can overheat and catch fire during use causing burns to the user. The heating wire can accidentally be touched through the safety grille because the distance is less than required. The user may touch the live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60335-1 and EN 60335-2-23.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White and cyclamen foldable hair dryer with detachable transparent air reducer.**

Packaging description **Packaging: colourful cardboard box.**

Brand **GEMEI**

Name **PROFESSIONAL HAIR DRYER**

Type / number of model **GM-1709**

Barcode **9 581922 100142**



Weekly report number	<b>Report-2021-18</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>27/01/2021</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>27/01/2021</b>

Alert number **[A12/00592/21](#)**

Product **Hair dryer**



Risk type **Burns  
Electric shock  
Fire**

**The hair dryer does not have a thermal cut-out device. The plastic material of the casing is combustible. The hair dryer can overheat and catch fire during use causing burns to the user. The heating wire can accidentally be touched through the safety grille because the distance is less than required. The user may touch the live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60335-1 and EN 60335-2-23.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Black hair dryer with detachable air reducer part.**

Packaging description **Packaging: colourful cardboard box.**

Brand **GEMEI**

Name **PROFESSIONAL HAIR DRYER**

Type / number of model **GM-1776 (on the product); R19221-19 (on the packaging)**

Barcode **9 581922 100197**

Weekly report number **Report-2021-18**

Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>27/04/2021</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>27/01/2021</b>

Alert number **[A12/00607/21](#)**

Product **Autonomous electric bus**

Risk type **Injuries**

**The data from the engine speed sensor may be poorly transmitted to the equipment responsible for controlling and driving the torque and the direction of rotation of the engine. As a result, the vehicle may reverse and collide with anyone behind it.**

Category **Motor vehicles**

Type **Professional**

Description **12 meter autonomous electric bus, low floor throughout, with two steering axles; category M3, class 1**

Brand **APTIS**

Name **APTIS 12E**

EC-type approval/model **e2\*2007/46\*0715\*00, e2\*2007/46\*0715\*01, e2\*2007/46\*0715\*02**

Company recall code **2021-02**

Weekly report number **Report-2021-18**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **12/04/2021**

Alert number **[A12/00605/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

**Cracks may form at the point where the trailer hitch is connected to the vehicle. This could cause the trailer coupling to break, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **Mercedes-Benz**

Name **Sprinter**

EC-type approval/model **Types: 906BA50, 906BA35, 906BA50/4x4, 906BA35/4x4 e1\*2007/46\*0294\*11 - \*15, e1\*2007/46\*0300\*16 - \*20, e1\*2007/46\*0308\*06 - \*09, e1\*2007/46\*0312\*12 - \*15**

Production dates **The affected vehicles were manufactured between 15 December 2018 and 19 February 2021.**

Company recall code **VS3ANHAEBB (3191157)**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

---

Alert number **[A12/00615/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**Due manufacturing defect in the instrument panel, the deployment of the airbag could be impeded. This could impair its protective potential and could lead to plastic parts become detached when the airbag is activated, increasing the risk of injury in the event of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Audi**

Name **A6, A7**

EC-type approval/model **e1\*2007/46\*1801\*, Type F2**

Production dates **The affected vehicles were manufactured between December 2017 and December 2020.**

Company recall code **70i2**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Sweden  
Slovenia**

Alert number **[A12/00616/21](#)**

Product **Passenger car**

Risk type **Fire  
Injuries**

**A nut securing the Mild Hybrid Electric Vehicle (mHEV) battery terminal may not have been tightened correctly, which could result in a fault in the electrical connection. This may lead to the loss of the mHEV function and to local overheating and possible melting of the surrounding components during driving, increasing the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Mild Hybrid Electric Vehicle (mHEV)**

Brand **Ford**

Name **Focus**

EC-type approval/model **e13\*2007/46\*1911\*08, Type: DEH**

Production dates **The affected vehicles were manufactured between 25 June and 30 November 2020.**

Company recall code **21S01**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/00617/21](#)**

Product **Passenger car**

Risk type **Fire  
Injuries**

**The high-pressure fuel pump connection may be tightened incorrectly. This could result in a fuel leakage, increasing the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Renault**

Name **Master 3**

EC-type approval/model **Types: MA, VA, MB, VB  
e2\*2007/46\*0016\*34 - 39, e2\*2007/46\*0047\*33 - 34  
e2\*2007/46\*0019\*35 - 36, e2\*2007/46\*0049\*25 - 38,**

Production dates **The affected vehicles were manufactured between 3 June and 8 September 2020.**

Company recall code **ODEA**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France  
Sweden**



---

Alert number **[A12/00618/21](#)**

Product **Car tyre**

---

Risk type **Injuries**

**The tyres were not manufactured in accordance with specifications and may be defective. This could lead to a sudden loss of air pressure, resulting in a loss of control over the the vehicle.**

Category **Motor vehicles**

Type **Consumer**

Description **Car tyre, Article number 03588080000.**

Brand **Continental**

Name **315/35 R 22 111 Y TL XL CONTINENTAL PremiumContact 6 SSR**

EC-type approval/model **E4-02103967, E4-0013522, E4-0034499  
Types: 315/35 R 22 111 Y TL XL , LT 235/85 R 16 120S TL,  
LT 265/70 R 17 121Q TL**

Production dates **Calendar week 51/2018**

Company recall code **119\_2020**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code **- <https://www.continental-tires.com/car/tires/technical-services/voluntary-exchange-programs/continental>**

Alert number **[A12/00619/21](#)**

Product **Car tyre**

Risk type **Injuries**

**The tyres were not manufactured in accordance with specifications and may be defective. This could lead to a sudden loss of air pressure, resulting in a loss of control over the the vehicle.**

Category **Motor vehicles**

Type **Consumer**

Description **Car tyre, Article number: 0450700000**

Brand **General Tire**

Name **LT 235/85 R 16 120S TL GRABBER AT<sup>3</sup> ()**

EC-type approval/model **E4-02103967, E4-0013522, E4- 0034499  
Types: 315/35 R 22 111 Y TL XL , LT 235/85 R 16 120S TL,  
LT 265/70 R 17 121Q TL**

Production dates **Calendar weeks 13/2018 and 8/2019**

Company recall code **119\_2020**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code **- <https://www.generaltire.de/autoreifen/service/freiwillige-austauschprogramme/continental>**

---

Alert number **[A12/00620/21](#)**

Product **Car tyre**

---

Risk type **Injuries**

**The tyres were not manufactured in accordance with specifications and may be defective. This could lead to a sudden loss of air pressure, resulting in a loss of control over the the vehicle.**

Category **Motor vehicles**

Type **Consumer**

Description **Car tyre, Article number: 04506200000**

Brand **General Tire**

Name **LT 265/70 R 17 121Q TL GRABBER X<sup>3</sup>**

EC-type approval/model **E4- 0034499, Type: LT 265/70 R 17 121Q TL**

Production dates **Calendar week 15/18**

Company recall code **119\_2020**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<https://www.generaltire.de/autoreifen/service/freiwillige-austauschprogramme/continental>**

Alert number **[A12/00609/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The ignition unit of the head airbag may separate from the inflator and enter the vehicle's interior when the airbag is deployed. As a result, the inflation of the head airbag may be reduced or non-existent, increasing the risk of injury in the event of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **BMW  
Mini**

Name **1, 5, 7, M5, Countryman**

EC-type approval/model **Types: G5L, G5K, 7L, F5LM, FMX  
e1\*2007/46\*1688, e1\*2007/46\*1750, e1\*2007/46\*0276,  
e1\*2007/46\*1828, e1\*2007/46\*1682**

Production dates **The affected vehicles were manufactured between 8 July 2016 and 17 October 2017.**

Company recall code **0072140200, 0072150200, 0072160200, 0072170200**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**


Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and **Croatia  
Poland**

measures were taken also in

**Sweden**  
**Slovenia**

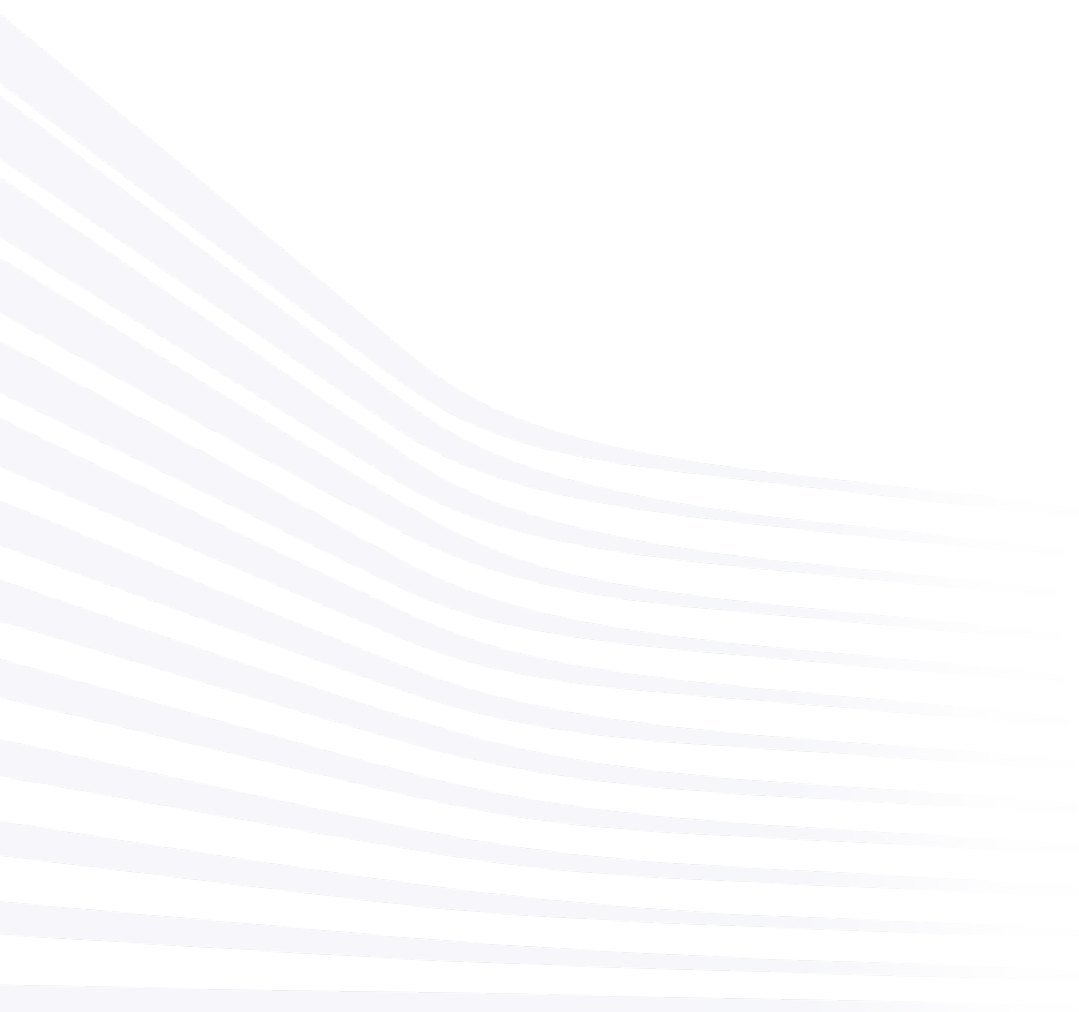

Alert number **[A12/00621/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Fire  
Injuries**

**The high-pressure fuel pump connection may be tightened incorrectly. This could result in a fuel leakage, increasing the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **OPEL**

Name **Movano**

EC-type approval/model **Types: MR, MS, MW, MV  
e1\*2007/46\*0362\*24, \*25, e1\*2007/46\*0471\*22, \*23,  
e1\*2007/46\*0579\*12, \*13, e1\*2007/46\*0580\*13, \*14**

Production dates **The affected vehicles were manufactured between 5 June  
and 22 July 2020.**

Company recall code **20-R-118**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France**

Alert number **[A12/00611/21](#)**

Product **Hair dryer**



Risk type **Burns  
Fire**

**The hair dryer does not have a thermal cut-out device. The plastic material of the casing is combustible. The hair dryer can overheat and catch fire during use causing burns to the user.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Black hair dryer with a black detachable air reducer.**

Packaging description **Black cardboard box with a picture of a blond person and one of the hair dryer on the front side.**

Brand **GOLD SRC**

Name **Professional Hair Dryer**

Type / number of model **SRC-9**

Barcode **8 038012 008587**

Weekly report number **Report-2021-18**

Alert submitted by **Hungary**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Distributor**

Date of entry into force

**30/01/2021**

Measures ordered by public authorities

**Recall of the product from end users  
Distributor**

Date of entry into force

**30/01/2021**



---

Alert number **[A12/00608/21](#)**

Product **Tractor**

---

Risk type **Fire**

**Due to a faulty oil-pressure line on the exhaust turbocharger, engine oil may leak. This may lead to an increased risk of fire.**

Category **Motor vehicles**

Type **Professional**

Description **Tractor**

Brand **Mercedes-Benz**

Name **Unimog U300/U527**

EC-type approval/model **Models: UGE-232, UGE-453  
Type-approval numbers: e1\*2007/46\*1215\*14,  
e1\*2007/46\*1216\*15**

Production dates **15 December 2020 to 3 February 2021**

Company recall code **2103U09W07**

Weekly report number **Report-2021-18**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**