



European Commission ([http://ec.europa.eu/index\\_en.htm](http://ec.europa.eu/index_en.htm)) Consumers ([http://ec.europa.eu/consumers/index\\_en.htm](http://ec.europa.eu/consumers/index_en.htm))

Consumers safety ([http://ec.europa.eu/consumers/consumers\\_safety/index\\_en.htm](http://ec.europa.eu/consumers/consumers_safety/index_en.htm))

Safety products ([http://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/index\\_en.htm](http://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/index_en.htm))

🏠 [Rapid Alert System home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2018\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2018)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search)

👍 [Safe Products Online \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=SafeProductsOnline\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=SafeProductsOnline)

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

week 38 - 2018

Corrigenda: Notification A12/0914/18 from Report-2018-028 has been updated to reflect more accurately the non-compliance and the resulting risk for consumers. The product category in notification A11/0147/17 from Report 2017-51 has been modified at the request of the notifying country.

**Alert number:** A12/1375/18

**Product:** Insect trap

**Name:** HoyHoy - Cockroach and silverfish trap

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** Aries

**Type / number of model:** Unknown

**Risk level:** Serious risk

The product contains diisobutyl phthalate, but lacks the authorization from REACH to be placed it in the market.

This phthalate may harm the health, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Cardboard box containing a set of six cockroach traps

**Batch number / Barcode:** 4018874023076

**Country of origin:** Germany

**Alert submitted by:** France



**Alert number:** A12/1346/18

**Product:** Girls' bikini

**Name:** Unknown

**Risk type:** Injuries

**Category:** Clothing, textiles and fashion items

**Brand:** YES ! DO KIDS

**Type / number of model:** 71390

**Risk level:** Serious risk

There are functional cords to be tied at the back of the bikini top and in the waist area of the bottom part. They may become trapped during various activities of the child, leading to injuries.

The product does not comply with the relevant European standard EN 14682.

**Measures ordered by public authorities (to: Distributor):** Withdrawal of the product from the market

**Description:** Orange-pink bikini for 7/8 year old girls. The top part has decorative and functional cords to be tied at the back.

**Batch number / Barcode:** 5299901119781

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1351/18

**Product:** Girls' bikini

**Name:** Unknown

**Risk type:** Injuries

**Category:** Clothing, textiles and fashion items

**Brand:** Sweet Secret

**Type / number of model:** NX1859

**Risk level:** Serious risk

The top part of the bikini has functional cords to be tied in the back area. They can become trapped during various activities of a child, leading to injury.

The product does not comply with the relevant European standard EN 14682.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** Bikini with a black, blue and white check pattern intended for 6 year old girls. The top part has decorative frills and functional cords to be tied at the back.

**Batch number / Barcode:** 12703231859

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1370/18

**Product:** Child's footwear

**Name:** Child's sandals

**Risk type:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** superfit

**Type / number of model:** Polly 0-00096-34

**Risk level:** Serious risk

The amount of chromium (VI) found in the leather of the strap is too high (measured value up to 6.8 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions.

The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Manufacturer)

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** Child's sandals: leather uppers; lining and insole, leather, textile; outer sole, other material

**Batch number / Barcode:** 161148/003; 9009452281532

**Country of origin:** Austria

**Alert submitted by:** Germany



**Alert number:** A12/1330/18

**Product:** Eye shadow

**Name:** New Attractive Fashion Color

**Risk type:** Microbiological

**Category:** Cosmetics

**Brand:** Meis

**Type / number of model:** MS0123S

**Risk level:** Serious risk

The product is microbiologically contaminated.

If used on damaged skin or if it comes into contact with the eyes, the product may cause infection or irritation.

The product does not comply with the Cosmetic Products Regulation

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Measures ordered by public authorities (to: Importer):** Ban on the marketing of the product and any accompanying measures

**Description:** Eyeshadow in sparkling silver colour staged in a black box with transparent cap.

**Batch number / Barcode:** 6950865402638

**Country of origin:** China

**Alert submitted by:** Bulgaria



**Alert number:** A12/1352/18  
**Product:** Travel plug adaptor  
**Name:** Unknown  
**Risk type:** Electric shock, Fire  
**Category:** Electrical appliances and equipment  
**Brand:** Unknown  
**Type / number of model:** 18-211  
**Risk level:** Serious risk

The product does not provide protection for users due to the absence of shutters on live parts. Moreover, it does not have a fuse. Users could therefore touch accessible live parts and receive an electric shock. Also, there is no fuse for over-current protection, which could lead to a fire.

The product does not comply with the standard BS 1363.

**Measures ordered by public authorities (to: Importer):** Withdrawal of the product from the market

**Description:** White travel plug adaptor with 3 pins.

**Batch number / Barcode:** 5291301182112

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1377/18  
**Product:** Steam brush  
**Name:** Balai vapeur  
**Risk type:** Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** SILVERCREST  
**Type / number of model:** SDM 1500 C2  
**Risk level:** Serious risk

The outer area of the handles can break.

As a consequence, the product becomes permeable to water and users might receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Retailer)

**Description:** Steam brush

**Batch number / Barcode:** serial number: 100328

**Country of origin:** Unknown

**Alert submitted by:** France



**Alert number:** A12/1339/18

**Product:** Earrings

**Name:** Accessories

**Risk type:** Chemical

**Category:** Jewellery

**Brand:** Unknown

**Type / number of model:** Article N°: 815669

**Risk level:** Serious risk

The amount of nickel released by the earrings is too high (value: up to 2.7 mg/cm<sup>2</sup>/week).

Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin.

The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Ear studs fixed to a cardboard label.

**Batch number / Barcode:** 8 718286 066895

**Country of origin:** China

**Alert submitted by:** Germany





**Alert number:** A12/1376/18  
**Product:** LED light  
**Name:** LED Party Light  
**Risk type:** Electric shock  
**Category:** Lighting equipment  
**Brand:** Unknown  
**Type / number of model:** X000SHRIG7

**Risk level:** Serious risk

The prism hemisphere can be removed without tools simply by turning.

As a result, live parts become accessible.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.


**Measures ordered by public authorities (to: Importer):** Withdrawal of the product from the market

**Description:** LED part light with a prism hemisphere, a black plastic housing and wall/ceiling attachment. A remote control is included.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Germany

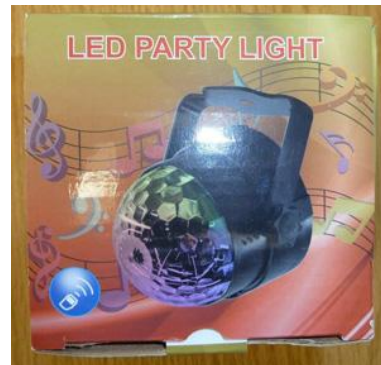

**Alert number:** A12/1329/18

**Product:** Passenger car

**Name:** LC500h

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Lexus

**Type / number of model:** - Type approval number: e6\*2007/46\*0195 - Model Code: LC500h (GWZ100)

**Risk level:** Serious risk

The vehicles' electronic control unit (ECU) has been improperly programmed and the throttle is not coordinated with the transmission and gear changes.

As a consequence, when accelerating in highway driving mode, the hybrid system could shut down, causing a loss of power, which can increase the risk of accidents.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Passenger car

**Batch number / Barcode:** The affected vehicles were manufactured between 2 August 2016 and 5 June 2018 - VIN: from JTHHY5AY#0A000106 to JTHHY5AY#0A001394 (# can be different characters, all affected)

**Country of origin:** Japan

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Slovenia

**Alert number:** A12/1331/18

**Product:** Passenger Car

**Name:** Edge, Mondeo, S-MAX, Galaxy

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Ford

**Type / number of model:** Type approval numbers : Mondeo: e13\*2001/116\*0249\*30 Edge: e1\*2007/46\*1524\*02 Galaxy: e13\*2001/116\*0185\*25 S-MAX: e13\*2001/116\*0185\*29

**Risk level:** Serious risk

The air conditioning clutch pulley plate could become loose.

This plate could therefore detach and fall onto the road surface, posing a risk of accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** Specific vehicles built between 01/09/2014 and 20/04/2018

**Country of origin:** Spain

**Alert submitted by:** United Kingdom

**Alert number:** A12/1333/18  
**Product:** Caravan  
**Name:** 390, 400, 455, 460, 650, 660, 720  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Hobby  
**Type / number of model:** Type-approval numbers: e1\*2007/46\*0219\*07, e1\*2007/46\*0221\*08, e1\*2007/46\*0222\*12; type: 30EG, 27EG, 19EG  
**Risk level:** Serious risk  
 Faulty welding in the drum brake may lead to a loss of brake function.  
 As a consequence, the wheel brake may be insufficiently effective in critical driving situations.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Caravan  
**Batch number / Barcode:** The vehicles affected were produced between March and April 2018.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/1334/18  
**Product:** Passenger car  
**Name:** Grandland  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Opel  
**Type / number of model:** EC type-approval: e2\*2007/46\*0597\*03 Type: Z  
**Risk level:** Serious risk  
 The axle and brake parts may not have been correctly screwed together.  
 This could consequently lead to loss of control over the vehicle.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Passenger car  
**Batch number / Barcode:** Vehicles manufactured on 6 June 2018 are affected.  
**Country of origin:** France  
**Alert submitted by:** Germany

**Alert number:** A12/1335/18  
**Product:** Motorcycle  
**Name:** F1 B1 B3  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** MV Agusta  
**Type / number of model:** Unknown  
**Risk level:** Serious risk  
 On some models the fork has an axle carrier with an excessive play of the wheel clamping screw.  
 This defect could cause a potential malfunction of the fork assembly, which would lead to loss of control of the vehicle during normal use.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Motorcycle  
**Batch number / Barcode:** Specific motorcycles built between 12/03/2018 and 30/04/2018  
**Country of origin:** Italy  
**Alert submitted by:** United Kingdom

**Alert number:** A12/1336/18  
**Product:** Passenger car  
**Name:** Cascada, Zafira  
**Risk type:** Fire  
**Category:** Motor vehicles  
**Brand:** Opel  
**Type / number of model:** Type-approval number: e4\*2007/46\*0204\*33; type: P-J/SW  
**Risk level:** Serious risk  
 There is a calibration error in the turbocharger's diagnostic monitoring which disables the turbocharger diagnostics.  
 In the event of damage to the turbocharger, it may overheat and lead to a fire.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Passenger car  
**Batch number / Barcode:** Vehicles manufactured between 2017 and 2018 are affected.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/1337/18**Product:** Passenger car**Name:** E-class cabriolet**Risk type:** Injuries**Category:** Motor vehicles**Brand:** Mercedes-Benz**Type / number of model:** Type-approval number: e1\*2007/46\*1666\*05; type: R1EC**Risk level:** Serious risk

The ISOFIX console, anchoring the child seat to the car body, may not be adequate.

As a result, the child seat installed in the back seat may not be anchored as intended and in the event of an accident, the child may be injured.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)**Description:** Passenger car**Batch number / Barcode:** Vehicles manufactured between October 2017 and November 2017 are affected.**Country of origin:** Germany**Alert submitted by:** Germany**Alert number:** A12/1338/18**Product:** Tyres**Name:** ContiPremiumContact 5**Risk type:** Injuries**Category:** Motor vehicles**Brand:** Continental**Type / number of model:** ECE type-approvals: R30: E4-30R-0261487; R117: E4-117R-023298 S2WR2 summer tyres 215/60 R16 99H XL**Risk level:** Serious risk

A manufacturing error / material defect may lead to tread separation.

This may affect drive and control over the vehicle.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)**Description:** Tyres**Batch number / Barcode:** The tyres concerned were manufactured in four production weeks in 2017 with the following codes: DOT 6G5MD85Y3317 up to ...3617**Country of origin:** Romania**Alert submitted by:** Germany**Alert number:** A12/1340/18**Product:** Truck**Name:** 300 Series Euro 5**Risk type:** Injuries**Category:** Motor vehicles**Brand:** Hino**Type / number of model:** XZU710, XZU720, XZU730**Risk level:** Serious risk

Due to insufficient protection against moisture absorption into the propellant, the front passenger airbag may be susceptible to moisture intrusion over time.

In this instance the inflator may rupture in the event that the airbag is activated.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)**Description:** Truck**Batch number / Barcode:** Specific vehicles built between 26/01/2012 and 31/07/2013**Country of origin:** Japan**Alert submitted by:** United Kingdom**Alert number:** A12/1341/18**Product:** Van**Name:** TGE**Risk type:** Injuries**Category:** Motor vehicles**Brand:** MAN**Type / number of model:** Type-approval numbers: e1\*2007/46\*1628\*, e1\*2007/46\*1634\*, e1\*2007/46\*1635\*; type: SYN1Z, SZN1Z, SZN2Z**Risk level:** Serious risk

Drive shaft vibration may occur at speeds of over 130 km/h. This could lead to complete failure of the drive shaft.

In such cases accidents could occur, and personal injury cannot be ruled out.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)**Description:** Van**Batch number / Barcode:** The vehicles affected were produced between October 2017 and July 2018.**Country of origin:** Poland**Alert submitted by:** Germany



**Alert number:** A12/1342/18

**Product:** Van

**Name:** TGE

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** MAN

**Type / number of model:** Type-approval number: e1\*2007/46\*1628\*01, e1\*2007/46\*1634\*01; Type: SYN1Z, SZN1Z

**Risk level:** Serious risk

Faulty expanding lock can cause the handbrake cable to bend or break. This may result in the failure of the parking brake.

There is a risk that the vehicle may roll away even though the parking brake is applied.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Van

**Batch number / Barcode:** The vehicles affected were produced between March and April 2018.

**Country of origin:** Poland

**Alert submitted by:** Germany

**Alert number:** A12/1344/18

**Product:** Passenger car

**Name:** Aspen, 300, 300 C

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Chrysler

**Type / number of model:** Type-approval number: individual approval; type: HG and LX

**Risk level:** Serious risk

A defect in the gas generator of the passenger airbag may cause uncontrolled inflation and the release of small metal fragments when the airbag is activated,

As a consequence, occupants may be injured.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** The vehicles in question were produced between 10 March 2008 and 18 December 2008.

**Country of origin:** United States

**Alert submitted by:** Germany

**Alert number:** A12/1353/18

**Product:** Van

**Name:** Jumpy 4

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroën

**Type / number of model:** e2\*2007/46\*0531\*00, e2\*2007/46\*0531\*01, e2\*2007/46\*0531\*02, e2\*2007/46\*0531\*03

**Risk level:** Serious risk

The tow hitch bracket can deform when it is placed under maximum pressure.

This may affect the driving behaviour of the vehicle and/or the retention of the trailer, which could lead to accidents.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Van

**Batch number / Barcode:** Vehicles manufactured between 13/11/2015 and 5/10/2017 — VIN: VF7VBBHVBFZ057902 to VF7VFAHHWHZ081658

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/1354/18

**Product:** Passenger car

**Name:** C4 PICASSO II

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroën

**Type / number of model:** Type approval numbers: e2\*2007/46\*0356\*09, e2\*2007/46\*0356\*12, e2\*2007/46\*0356\*13, e2\*2007/46\*256\*14

**Risk level:** Serious risk

The cars have an incorrect version of the engine's software, leading to errors in the cooling strategy and malfunction of the engine's "high temperature" warning system.

This could lead to unnoticed overheating of the engine, which may leak oil and also fail, increasing the risk of accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** The vehicles affected were manufactured 3 March 2016 and 8 March 2018 - VIN: from VF73AAHXTJJ611111 - Citroën code: GKA

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/1355/18

**Product:** Passenger car

**Name:** 3008II, 308II, 5008II

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** e2\*2007/46\*0534\*00, e2\*2007/46\*0534\*001 e2\*2007/46\*0534\*02, e2\*2007/46\*0534\*03, e2\*2007/46\*0534\*04, e2\*2007/46\*0405\*15, e2\*2007/46\*0405\*16, e2\*2007/46\*0405\*17, e2\*2007/46\*0405\*18,

**Risk level:** Serious risk

The car has an incorrect version of the engine's software, leading to errors in the cooling strategy and malfunction of the engine's "high temperature" warning system.

This could lead to unnoticed overheating of the engine, which may leak oil and also fail, increasing the risk of accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** 3008II: manufactured from 31/05/2016 to 06/04/2018 - VIN VF3MJAHWGS150801 to VF3MJAHWWKS004955., 308 II : manufactured from 23/02/2017 to 23/03/2018 - VIN VF3LHEHZRHS028975 to VF3LHEHZRKS001574. , 5008 II: manufactured from 5/10/2016 to 4/04/2018 - VIN VF3MJAHXHGL042040 to VF3MJAHWWKL001260.

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/1357/18

**Product:** Passenger car

**Name:** C3-IV

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroën

**Type / number of model:** e2\*2007/46\*0003\*50, e2\*2007/46\*0060\*18, e2\*2007/46\*0060\*19

**Risk level:** Serious risk

The steering column assembly may not be correct.

This could lead to a loss of steering control.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** Vehicles manufactured between 11.1.2018 and 22.1.2018 - VIN: VF7SZHMZ6HT49819 to VF7SXHMZ6JT516423

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/1358/18

**Product:** Van

**Name:** Spacetourer and Jumpy 4

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroën

**Type / number of model:** Type approval numbers: e2\*2007/46\*0440\*10, e2\*2007/46\*0530\*01, e2\*2007/46\*0530\*02, e2\*2007/46\*0530\*03, e2\*2007/46\*0530\*04, e2\*2007/46\*0531\*01, e2\*2007/46\*0531\*02, e2\*2007/46\*0531\*03, e2\*2007/46\*0531\*04

**Risk level:** Serious risk

The van has an incorrect version of the engine's software, leading to errors in the cooling strategy and malfunction of the engine's "high temperature" warning system.

This could lead to unnoticed overheating of the engine, which may leak oil and also fail, increasing the risk of accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Van

**Batch number / Barcode:** The vehicles affected were manufactured between 17 February 2016 and 26 February 2018 - VIN: from VF7VEAHXHGZ004437 to VF7VEAHXHKZ000356 - Citroën code: GKG

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/1359/18

**Product:** Van

**Name:** Traveller-Expert 4

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** Type approval numbers: e2\*2007/46\*0532\*01, e2\*2007/46\*0532\*02, e2\*2007/46\*0532\*03, e2\*2007/46\*0532\*04, e2\*2007/46\*0533\*01, e2\*2007/46\*0533\*02, e2\*2007/46\*0533\*03, e2\*2007/46\*0533\*04

**Risk level:** Serious risk

The van has an incorrect version of the engine's software, leading to errors in the cooling strategy and malfunction of the engine's "high temperature" warning system.

This could lead to unnoticed overheating of the engine, which may leak oil and also fail, increasing the risk of accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Van

**Batch number / Barcode:** The vehicles affected were manufactured between 10 March 2016 and 24 February 2018 - VIN: from VF3VFAHXHGZ010762 to VF3VEAHXHKZ000354 - Peugeot code: JBQ

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/1362/18

**Product:** Passenger car

**Name:** Grandland X

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Opel

**Type / number of model:** e2\*2007/46\*0597\*03, model: AM 2018

**Risk level:** Serious risk

The screws on the lower shock absorber mountings have been insufficiently tightened.

This may lead to a loss of control of the vehicle.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** Unknown

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/1363/18

**Product:** Passenger car

**Name:** C4 Picasso, Spacetourer, Jumpy, DS7 Crossback

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroën

**Type / number of model:** e2\*2007/46\*0356\*14, e2\*2007/46\*0356\*15, e2\*2007/46\*0530\*04, e2\*2007/46\*531\*04, e2\*2007/46\*601\*02

**Risk level:** Serious risk

The cylinder-housing oil gallery plug may not have been correctly tightened.

As a consequence oil might leak which presents a skid hazard for following traffic.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** C4 Picasso manufactured 4/5/2018 to 30/5/2018, VIN VF73AAHXTJJ675847 to VF73AAHXTKJ514384; ; , DS7 Crossback manufactured 27/4/2018 to 28/5/2018, VIN VR1JJJEHZRJY079141 to VR1JJJEHZRKY001328, Spacetour/Jumpy manufactured 30/4, VIN VF7VFAHXHJZ045656 to VF7VEAHHWKZ001086

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/1364/18  
**Product:** Passenger car  
**Name:** 308 - 3008 - 5008 - Traveller/expert  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Peugeot  
**Type / number of model:** 3008 : e2\*2007/46\*0534\*04, e2\*2007/46\*0534\*05 308 : e2\*2007/46\*405\*17, e2\*2007/46\*0405\*18, 5008 : e2\*2007/46\*0534\*04, e2\*2007/46\*0534\*05 Traveller/expert : e2\*2007/46\*0532\*04, e2\*2007/46\*0532\*05, e2\*2007/46\*0533\*04  
**Risk level:** Serious risk  
 The cylinder-housing oil gallery plug may not have been correctly tightened.  
 As a consequence oil might leak which presents a skid hazard for following traffic.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car  
**Batch number / Barcode:** 3008: manufactured between 27 April 2018 and 30 May 2018 VIN: VF3MJAHWWJS184411 to VF3MJAHXVKS007901, 308: manufactured between 27 April 2018 and 30 May 2018 VIN: VF3LHAHXWJS210762 to VF3LJEHZRJS259159, 5008: manufactured between 26 April 2018 and 2 June 2018 VIN: VF3MJAHXHJL034823 to VF3MJAHWWKL003025, Traveller/Expert: manufactured between 30 April 2018 and 31 May 2018 VIN: VF3VEAHHWJZ043136 to VF3VFAHXGKZ001117  
**Country of origin:** France  
**Alert submitted by:** France

**Alert number:** A12/1368/18  
**Product:** Passenger car  
**Name:** Insignia B  
**Risk type:** Fire  
**Category:** Motor vehicles  
**Brand:** Opel  
**Type / number of model:** - Model: Insignia B; - Model year: 2018; - EC-type approval number: e8\*2007/46\*0264\*00, e8\*2007/46\*0264\*01, e8\*2007/46\*0264\*02, e8\*2007/46\*0264\*03.  
**Risk level:** Serious risk  
 A clip of the fuel line bundle might chafe against the fuel pump hose.  
 This could result in fuel leaks, posing a risk of fire.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Passenger car - Recall code: 18-C-077 (E181800110).  
**Batch number / Barcode:** VIN numbers: W0LZT8EG3J1015458 W0VZT8EG8J1031016 W0LZT6EG7J1020215 W0VZT8EG9J1036743 W0LZT8EGXJ1014792 W0LZT8EG5J1015588 W0LZT8EG2J1015323 W0LZT8EG6J1015356 W0LZT8EG7J1014989 W0LZT8EG6J1014255, W0LZT8EG1J1014079 W0LZT8EG9J1015433 W0LZT8GG9J1018748 W0VZT8GG2J1030330 W0LZM8EG8J1020099 W0VZT8EG7J1040354 W0LZT8EG3J1015203 W0VZT8EG7J1034814 W0VZT8EG9J1036919, W0LZT8EG2J1014334 W0LZT8EGXJ1015182 W0LZT8EG6J1014983 W0LZT8EG3J1015024 W0LZT8EGXJ1012959 W0LZT8EG9J1013326 W0LZT8EG8J1014788 W0LZT6EGXJ1005496 W0VZT6EG8J1030663 W0LZT8EG5J1014540, W0LZT8EG5J1014022 W0LZT8EG8J1015133 W0LZT8EG0J1015191 W0LZT8EG6J1015082 W0LZT8EG8J1015679 W0LZT8EGXJ1014632 W0LZT8EG7J1014426 W0LZT8EG8J1012734 W0LZT8EG6J1013221 W0LZT8EG0J1015143, W0LZT8EG8J1015116 W0LZT8EG1J1014955 W0LZT8EGXJ1020642 W0LZT8EG2J1013037 W0LZT8EG7J1013339 W0LZT8EG2J1013801 W0LZT8EG9J1015495 W0LZT8EG4J1014285 W0LZT8EG7J1015074 W0LZT8EG5J1014179, W0VZM6EG5J1043335 W0LZT8EG2J1015161, W0VZT6EG1J1036711 W0VZT8EG0J1038896 W0VZT6EGXJ1036772 W0VZT8EG3J1038021 W0VZT8EG3J1032705 W0VZT8EGXJ1029901 W0LZT8EG5J1020547 W0VZT8EG5J1038392 W0VZT6EG6J1037210 W0LZT8EG9J1013861 W0VZT8EG7J1031685, W0VZT6EG2J1027144 W0VZT8EG7J1039396 W0LZT8EG1J1018648 W0LZT8EG0J1019936 W0LZT8EG4J1019972 W0LZT8EG1J1021338 W0LZT8EG3J1020773 W0LZT8EG9J1018381 W0VZT6EG8J1029481, W0VZT8EG9J1036550 W0VZT8EGXJ1038016 W0VZT8EG9J1036600 W0VZT8EG7J1032285 W0LZT8EG8J1014872 W0VZT6GGXJ1025364 W0VZT6EG2J1036636 W0LZT8EG5J1023688 W0VZT8GG7J1026550  
**Country of origin:** Germany  
**Alert submitted by:** Portugal

**Alert number:** A12/1372/18  
**Product:** Passenger car  
**Name:** C-Class  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Mercedes-Benz  
**Type / number of model:** Type-approval numbers: e1\*2001/116\*0431\*39-45, e1\*2001/116\*0464\*20-22; types: 205, 205 AMG  
**Risk level:** Serious risk  
 The decorative strips on the rear waist finisher have not been glued on correctly.  
 As a consequence they can detach, fall into the road, increasing the risk of accident of the following traffic.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Passenger car  
**Batch number / Barcode:** The affected vehicles were manufactured between January 2016 and November 2017.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/1374/18

**Product:** Bus

**Name:** Lion`s Intercity

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** MAN

**Type / number of model:** Type-approval number: e4\*2007/46\*0101\* Type: B.2007.46.008

**Risk level:** Serious risk

A defective bracket on the side-wall connection of the passenger seat could lead to the seat coming loose.

In the event of an accident, a passenger wearing the seatbelt would not be sufficiently restrained.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Bus

**Batch number / Barcode:** The vehicles affected were produced between June 2015 and April 2017.

**Country of origin:** Turkey

**Alert submitted by:** Germany

**Alert number:** A12/1366/18

**Product:** Children`s climbing helmet

**Name:** `Mercury Kid` helmet

**Risk type:** Injuries

**Category:** Protective equipment

**Brand:** BEAL

**Type / number of model:** size 48-58 cm

**Risk level:** Serious risk

The vertical impact energy absorption capacity is insufficient and the retention system is inadequate.

Consequently, the helmet does not provide sufficient protection in case of an impact and the user might suffer from head injuries.

The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European Standard EN 12492.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Children`s climbing and mountaineering helmet.

**Batch number / Barcode:** batch MK042632516, date 7/16

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/1379/18

**Product:** Firework

**Name:** Fyrværkerens Batteri 16 skud

**Risk type:** Burns

**Category:** Pyrotechnic articles

**Brand:** Unknown

**Type / number of model:** Battery of shot tubes

**Risk level:** Serious risk

The battery is unstable and does not stay upright during functioning: it is possible that it falls on its side, shooting remaining shots from this position.

As a consequence, burning projectiles could hit persons, causing burns.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Battery of shot tubes with 16 shot.

**Batch number / Barcode:** 57044777028865

**Country of origin:** China

**Alert submitted by:** Denmark





**Alert number:** A12/1332/18

**Product:** Toy gun set

**Name:** Hero - Super & Power Gun

**Risk type:** Choking

**Category:** Toys

**Brand:** Zhong Teng

**Type / number of model:** N° ZT1004 Ref. N° 2050078516

**Risk level:** Serious risk

The suction cup of the projectile can easily detach.

If a child puts the projectile in the mouth, the suction cup could detach and obstruct the airways.

The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Plastic toy gun with three projectiles with suction cups, packed in a cardboard box.

**Batch number / Barcode:** 5900851785161

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/1343/18

**Product:** Ride-on toy

**Name:** Kids Bicycle

**Risk type:** Injuries

**Category:** Toys

**Brand:** Gearbox

**Type / number of model:** Reference n°90383

**Risk level:** Serious risk

The steering tube might collapse or detach.

As a result, the child riding the toy might fall and suffer injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Ride-on toy in red/blue/yellow colours, packaged in a cardboard box.

**Batch number / Barcode:** EAN: 4012093903836

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/1345/18

**Product:** Bow and arrow set

**Name:** La tribu degli Indiani

**Risk type:** Chemical

**Category:** Toys

**Brand:** TU!Giochi

**Type / number of model:** Art. 104831

**Risk level:** Serious risk

The plastic of the product contains bis (2-ethylhexyl) phthalate (DEHP), di-butyl phthalate (DBP) and di-'isononyl' phthalate (DINP)(measured values: 5.7%, 12.7% and 4.1% by weight respectively).

These phthalates may harm the health of children, causing possible damage to the reproductive system (DEHP and DBP) or the liver (DINP).

The product does not comply with the REACH Regulation.


**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** Set consisting of bow, 3 arrows with suction cups, axe and a headdress with feathers, all made out of plastic. The set is sold in a blister pack.

**Batch number / Barcode:** Batch: 79/SH Code: 8015361166601

**Country of origin:** Italy

**Alert submitted by:** Cyprus

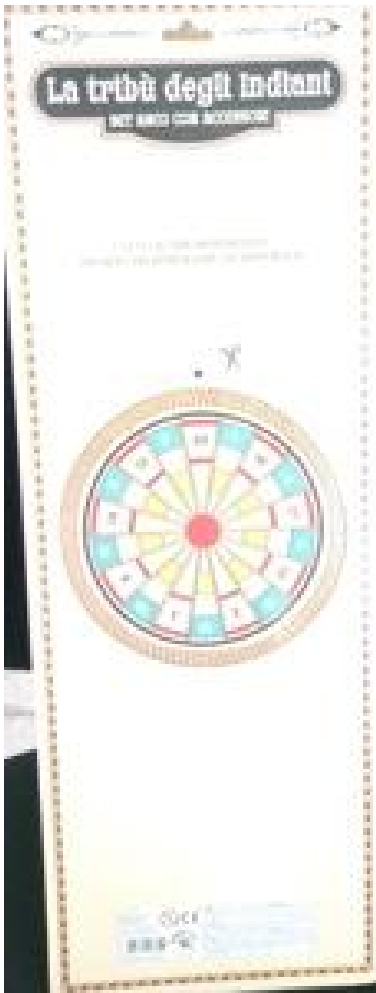

**Alert number:** A12/1347/18

**Product:** Water balloons

**Name:** Waterbommen

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** LO-51202B2359-G

**Risk level:** Serious risk

The amount of nitrosamines released by the balloons is too high (measured value: 0.40 mg/kg).

Nitrosamines are genotoxic carcinogens via inhalation, ingestion or dermal exposure.

A child can get exposed to them by putting the balloon in the mouth.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Multicoloured latex balloons packaged in a plastic bag.

**Batch number / Barcode:** EAN: 8711194112012

**Country of origin:** Unknown

**Alert submitted by:** France



**Alert number:** A12/1348/18

**Product:** Plastic doll

**Name:** Fashion Mermaid

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** ITEM N°. SN 152854

**Risk level:** Serious risk

The plastic material of the doll's head contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 21% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** A plastic doll in the form of a mermaid with accessories (hair brush, hand mirror and handbag). The doll is sold in a blister pack on cardboard.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus





**Alert number:** A12/1349/18

**Product:** Yo-yo wrist ball

**Name:** Wrist Ball

**Risk type:** Strangulation

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** TYB061

**Risk level:** Serious risk

The elastic cord of the ball is too long.

During play it could wrap around the child's neck and cause strangulation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


**Measures ordered by public authorities (to: Importer):** Withdrawal of the product from the market

**Description:** Rubber yo-yo ball with elastic cord, to be fixed around the wrist. They are packaged in a blister pack.

**Batch number / Barcode:** 3779012860663

**Country of origin:** China

**Alert submitted by:** Cyprus

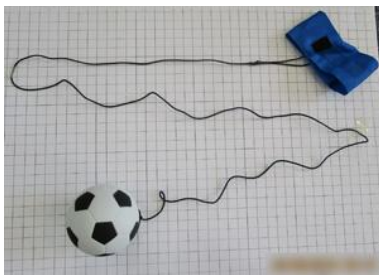



**Alert number:** A12/1350/18

**Product:** Plastic doll

**Name:** Beautiful

**Risk type:** Chemical

**Category:** Toys

**Brand:** ZD

**Type / number of model:** 333

**Risk level:** Serious risk

The plastic material of the doll's head contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 34% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** A plastic doll in the form of a mermaid. The doll is sold in a transparent plastic bag.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1356/18

**Product:** Plastic doll

**Name:** Moppet Shirley

**Risk type:** Chemical

**Category:** Toys

**Brand:** Bei Qi Le

**Type / number of model:** N°. 818 B

**Risk level:** Serious risk

The plastic material of the doll's head contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 15% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** A plastic doll in a yellow dress with furniture and other accessories, supplied in a transparent plastic bag.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1360/18

**Product:** Plastic doll

**Name:** Loving you

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** N°. 2011

**Risk level:** Serious risk

The plastic material of the dolls' heads contain bis (2-ethylhexyl) phthalate (DEHP) (measured value: more than 17% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** Set of two plastic dolls depicting a young girl and a woman, sold in a blister pack on cardboard.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1361/18

**Product:** Plastic doll set

**Name:** Faddism beautiful

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** N°. 92336

**Risk level:** Serious risk

The plastic material of the doll's head contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 23% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** A plastic doll provided with a plastic handbag and plastic pearl necklace (children's size). The set is sold in a transparent bag.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1365/18

**Product:** Water balloons

**Name:** Water Balloon Pump

**Risk type:** Chemical

**Category:** Toys

**Brand:** Tollkühn Shoppartner

**Type / number of model:** Reference: 90316

**Risk level:** Serious risk

The amount of N-nitrosatable substances (measured value up to: 9.5 mg/kg) released by the balloons is too high.

Nitrosatable compounds can be converted into nitrosamines, which are genotoxic carcinogens via inhalation, ingestion or dermal exposure.

A child can get exposed to them by putting the balloon in the mouth.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Balloons for making water bombs in a plastic container with a spray nozzle.

**Batch number / Barcode:** serial number: 2049403

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/1367/18

**Product:** Pull-along toy

**Name:** Pulling cracking animal

**Risk type:** Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** 1220

**Risk level:** Serious risk

The eyes can easily become detached from the toy, generating small parts.

A child could put one of the small parts into the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Wooden pull-along toy in the shape of a horse sold at markets, with no packaging and a free label attached to the horse's neck.

**Batch number / Barcode:** Unknown

**Country of origin:** Czech Republic

**Alert submitted by:** France



**Alert number:** A12/1369/18

**Product:** Fancy-dress costume for babies

**Name:** Pink Elephant - Infant Costume

**Risk type:** Burns

**Category:** Toys

**Brand:** InCharacter

**Type / number of model:** Style 16005

**Risk level:** Serious risk

The fancy-dress costume is highly flammable.

If it catches fire, the child could suffer burns.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-2.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

**Description:** Fancy-dress elephant costume for babies, packaged in a plastic bag with hanger.

**Batch number / Barcode:** 8 43269 01529 9

**Country of origin:** Vietnam

**Alert submitted by:** France





**Alert number:** A12/1371/18

**Product:** Soft toy

**Name:** Plüss elemes játék

**Risk type:** Choking

**Category:** Toys

**Brand:** Little Cucu

**Type / number of model:** Unknown

**Risk level:** Serious risk

The eyes can easily detach from the soft toy, generating small parts.

A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** Battery powered plush dog with plastic eyes and nose, supplied without packaging. The dog gives a barking sound by pressing his head.

**Batch number / Barcode:** 363-17103110

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1373/18

**Product:** Soft toy

**Name:** Plush Mascot / Plüss kabala figura

**Risk type:** Choking

**Category:** Toys

**Brand:** Hanya

**Type / number of model:** GB3964-4

**Risk level:** Serious risk

The eyes and the nose can easily detach from the soft toys, generating small parts.  
A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities (to: Distributor, Importer):** Recall of the product from end users, Recall of the product from end users, Withdrawal of the product from the market, Withdrawal of the product from the market

**Description:** Light brown plush teddy bear wearing a red knitted sweater, decorated with a teddy bear head. The product is sold without packaging.

**Batch number / Barcode:** 6933952950021

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1378/18

**Product:** Toy slime

**Name:** Knet-Schleim Dinosaurier

**Risk type:** Chemical

**Category:** Toys

**Brand:** Out of the blue

**Type / number of model:** Art. No.: 12/2079

**Risk level:** Serious risk

The migration of boron from the toy slime is too high (measured value up to 1870 mg/kg).  
Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Measures ordered by public authorities (to: Importer):** Withdrawal of the product from the market

**Company recall page:**

<https://www.tedi.com/kundeninformation/> (<https://www.tedi.com/kundeninformation/>)

**Description:** Orange-coloured toy slime with dinosaur skeleton figurine.

**Batch number / Barcode:** 4029811358311; 24090

**Country of origin:** Taiwan

**Alert submitted by:** Germany



**Alert number:** A12/1380/18

**Product:** Plastic doll

**Name:** Lin Da Doll

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Unknown

**Risk level:** Serious risk

The plastic material of the doll's head contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 3% by weight) and di-'isononyl' phthalate (DINP) (measured value: 21% by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system (DEHP) or the liver (DINP).

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market

**Description:** A plastic doll in a blue dress with a handbag, sold in a transparent bag.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A11/0070/18

**Product:** Firework

**Name:** Big Bang

**Risk type:** Burns

**Category:** Pyrotechnic articles

**Brand:** Unknown

**Type / number of model:** Unknown

**Risk level:** Other risk level

The rocket ascends at an angle which is too flat and explodes at too low altitude.

Bystanders could be hit by parts of the firework, causing burns.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Rocket

**Batch number / Barcode:** 5704777008966; Batch number: 601508-17

**Country of origin:** China

**Alert submitted by:** Denmark



**Alert number:** A11/0071/18

**Product:** Firework

**Name:** Royal Classic Bombe

**Risk type:** Burns

**Category:** Pyrotechnic articles

**Brand:** Unknown

**Type / number of model:** Rocket

**Risk level:** Other risk level

The duration of the initial fuse burning is too long and the rocket ascends at an angle which is too flat and explodes at too low altitude.

If there is a delay in the explosion, users may return to the product and could get burned by an unexpected explosion and bystanders could be hit by parts of the firework, causing burns.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Rocket Kat 2 -F2

**Batch number / Barcode:** 5704777013748

**Country of origin:** China

**Alert submitted by:** Denmark



**Alert number:** A11/0072/18

**Product:** Firework

**Name:** JR06

**Risk type:** Burns

**Category:** Pyrotechnic articles

**Brand:** Jorge

**Type / number of model:** Unknown

**Risk level:** Other risk level

The firework ascends at an angle which is too flat and explodes at too low altitude.

Bystanders could be hit by parts of the firework, causing burns.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.


**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Rocket

**Batch number / Barcode:** 5907704103011

**Country of origin:** China

**Alert submitted by:** Denmark



**Alert number:** A11/0068/18

**Product:** Musical toy

**Name:** Fairy of music - Electronic organ

**Risk type:** Injuries

**Category:** Toys

**Brand:** Buddy fun

**Type / number of model:** N° 88024 390-005PK

**Risk level:** Other risk level

The stool of the product is unstable.

If a child sits on it, the stool could tip over causing the child to fall.

The product does not comply with the requirements of the European Standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Child's electronic organ in pink and violet colours that includes a pink stool, both in plastic and sold in a cardboard box.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A11/0069/18

**Product:** Soft toy cushion

**Name:** éléphant peluche coussin en jouet

**Risk type:** Choking

**Category:** Toys

**Brand:** Rainbow fox

**Type / number of model:** Reference X000UBPLSN

**Risk level:** Other risk level

The seams on the belly and side of the elephant are too weak.

They could be easily opened, making the fibrous stuffing material accessible.

A child may take out the stuffing, put it in the mouth and choke on it.

The product does not comply with the Toy Safety Directive and the requirements of the relevant European standard EN 71-1

**Measures taken by economic operators:** Warning consumers of the risks, Withdrawal of the product from the market

**Description:** Soft toy cushion in the shape of an elephant. The product has been sold online (e.g. via Amazon).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** France

