



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👉 [Safe Products Online \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=SafeProductsOnline\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=SafeProductsOnline)

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

Week 3 - 2019

Corrigendum: Notification A12/1579/18 from Report-2018-044 has been updated to indicate the models affected and correct the country of origin.

**Alert number:** A12/0050/19

**Product:** Hammer

**Name:** Unknown

**Risk type:** Chemical

**Category:** Hand tools

**Brand:** Unknown

**Type / number of model:** TP313

**Risk level:** Serious risk

The grip of the hammer contains the polycyclic aromatic hydrocarbons (PAHs) benz(a)anthracene (measured value: 84 mg/kg) and chrysene (measured value: 22 mg/kg).

These PAHs are carcinogenic. The consumer can be exposed when the product comes into direct and prolonged or repetitive contact with the skin.

The product does not comply with the REACH Regulation.

Import rejected at border

**Description:** Metal hammer with a yellow and black coloured, plastic grip. An adhesive label is attached to the grip.

**Batch number / Barcode:** 6438443002604

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0062/19

**Product:** Self-balancing scooter

**Name:** Hoverboard

**Risk type:** Burns, Fire

**Category:** Hobby/sports equipment

**Brand:** IO HAWK

**Type / number of model:** 925-IO-HAWK 1

**Risk level:** Serious risk

The charging circuit of the product has no cut-off switch.

The battery can consequently overcharge and overheat which may lead to a fire.

Furthermore, the plastic housing of the hoverboard can easily catch fire.

The internal electric wiring of the hoverboard is in contact with sharp edges which may damage the isolation.

The product does not comply with the requirements of the Machinery Directive and the relevant European Standards EN 62133 and EN 60335-1.

Recall of the product from end users

**Description:** 2-wheel self-balancing scooter (hoverboard), including instructions, and charger. Charger Input: 100-240V~ Output: DC 42V.

Packaged in a rectangular cardboard box marked with 'IO HAWK' and a picture of a balance scooter.

**Batch number / Barcode:** 03051511183116

**Country of origin:** China

**Alert submitted by:** The Netherlands



**Alert number:** A12/0064/19

**Product:** Self-balancing scooter

**Name:** Electric Hoverboard

**Risk type:** Burns, Fire

**Category:** Hobby/sports equipment

**Brand:** Cool&Fun

**Type / number of model:** EL-ES01(JD-6.5)

**Risk level:** Serious risk

The charging circuit of the product has no cut-off switch. The battery can consequently overcharge and overheat which may lead to a fire. Furthermore, the plastic housing of the hoverboard can easily catch fire.

The product does not comply with the requirements of the Machinery Directive and the relevant European Standards EN 62133 and EN 60335-1. Recall of the product from end users

**Description:** 2-wheel, self-balancing scooter (hoverboard), including instructions and a charger. Charger Input: 100-240VAC Output: 29.4VDC 1550mA Packaged in a rectangular cardboard box.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** The Netherlands



**Alert number:** A12/0072/19

**Product:** Helmet for mountaineers

**Name:** Unknown

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** Xinda

**Type / number of model:** NT9907

**Risk level:** Serious risk

The vertical shock absorbing capacity is too small. In the event of impact to the helmet, for example as a result of falling rocks, the incident energy is insufficiently absorbed and can cause concussion and even loss of consciousness or coma.

Furthermore, the helmet is insufficiently stable. Stones impacting the helmet could perforate it, possibly leading to serious head injuries.

The product does not comply with the requirements of the Personal Protective Equipment Directive (since 21/04/2018 repealed by the Personal Protective Equipment Regulation) and the relevant European Standard EN 12492.

Ban on the marketing of the product and any accompanying measures

**Description:** Climbing helmet for mountaineers. The product was sold online (in particular via Amazon).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0073/19

**Product:** Helmet for mountaineers

**Name:** Unknown

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** Xinda

**Type / number of model:** XD-Q9664

**Risk level:** Serious risk

The vertical shock absorbing capacity is too small. In the event of impact to the helmet, for example as a result of falling rocks, the incident energy is insufficiently absorbed and can cause concussion and even loss of consciousness or coma.

Furthermore, the helmet is insufficiently stable. Impacts of rocks may cause the helmet to be perforated, possibly resulting in serious head injuries.

The product does not comply with the requirements of the Personal Protective Equipment Directive (since 21/04/2018 repealed by the Personal Protective Equipment Regulation) and the relevant European Standard EN 12492.

Ban on the marketing of the product and any accompanying measures

**Description:** Climbing helmet for mountaineers. The product was sold online (in particular via Amazon).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0074/19

**Product:** Helmet for mountaineers

**Name:** Unknown

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** Unknown

**Type / number of model:** STK0154016999

**Risk level:** Serious risk

The helmet is insufficiently resistant to penetration.

Impacting rocks may penetrate the helmet, possibly causing serious head injuries.

The product does not comply with the requirements of the Personal Protective Equipment Directive (since 21/04/2018 repealed by the Personal Protective Equipment Regulation) and the relevant European Standard EN 12492.

Ban on the marketing of the product and any accompanying measures

**Description:** Climbing helmet for mountaineers. The product was sold online (in particular on eBay).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0075/19

**Product:** Helmet for mountaineers

**Name:** Unknown

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** Unknown

**Type / number of model:** STK016600715

**Risk level:** Serious risk

The helmet is insufficiently resistant to penetration.

Impacting rocks may penetrate the helmet, possibly causing serious head injuries.

The product does not comply with the requirements of the Personal Protective Equipment Directive (since 21/04/2018 repealed by the Personal Protective Equipment Regulation) and the relevant European Standard EN 12492.


Ban on the marketing of the product and any accompanying measures

**Description:** Climbing helmet for mountaineers. The product was sold online (in particular on eBay).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Germany

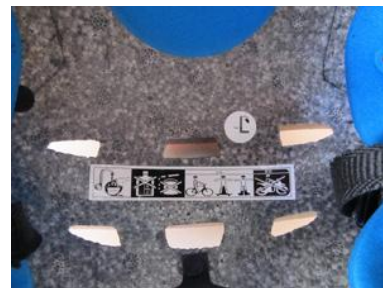

**Alert number:** A12/0078/19

**Product:** Novelty lighter

**Name:** Unknown

**Risk type:** Burns, Fire

**Category:** Lighters

**Brand:** Unknown

**Type / number of model:** Unknown

**Risk level:** Serious risk

The lighter is appealing to children due to its shape and colour.  
Children may play with it and suffer burns or cause a fire.

The product does not comply with the relevant European standard EN 13869.

This product listing was removed by Amazon., Withdrawal of the product from the market

**Description:** Novelty lighter in the form of a red fire-extinguisher. The product was sold online (in particular via Amazon).

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** France



**Alert number:** A12/0077/19

**Product:** LED lighting chain

**Name:** Lampki ozdobne LED

**Risk type:** Electric shock, Fire

**Category:** Lighting chains

**Brand:** Unknown

**Type / number of model:** Unknown

**Risk level:** Serious risk

The wires have inadequate insulation and do not provide sufficient resistance which can cause a short-circuit and fire.

The device is not sufficiently resistant to moisture and live parts may become accessible when handling, which can lead to an electric shock for users.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.


Withdrawal of the product from the market

**Description:** LED lighting chain with 200 lights, for indoor and outdoor use. Packaging: cardboard box

**Batch number / Barcode:** 6903157483822

**Country of origin:** Unknown

**Alert submitted by:** Poland

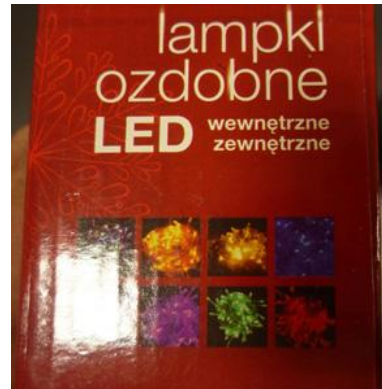

**Alert number:** A12/0052/19  
**Product:** LED floodlight  
**Name:** 30W LED valonheitin  
**Risk type:** Electric shock  
**Category:** Lighting equipment  
**Brand:** Lexxa

**Type / number of model:** Power supply unit: BDF-841A. Luminaire: 433 230.

**Risk level:** Serious risk

The electrical insulation of the transformer of the power supply unit is inadequate.

The creepage distances between the primary and accessible secondary circuit are not sufficient.

The user could receive an electric shock from accessible parts of the secondary circuit of the power supply unit.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598 and EN 61558.

Recall of the product from end users

**Description:** An LED floodlight packed in cardboard box.

**Batch number / Barcode:** 6430038492111

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0043/19

**Product:** Bus

**Name:** S431DT

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** EvoBus

**Type / number of model:** Type-approval number: e1\*2007/46\*0013; Type: 410 01

**Risk level:** Serious risk

A manufacturing defect could result in the wing mirror unit coming loose.

It may then fall onto the road, potentially leading to an accident or injury.

Recall of the product from end users

**Description:** Bus

**Batch number / Barcode:** The vehicles affected were produced between May and September 2018.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0044/19

**Product:** Van

**Name:** Mercedes-Benz

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Sprinter

**Type / number of model:** Type-approval numbers: e1\*2007/46\*1760\*, e1\*2007/46\*1763\* Type: KL3A4, FL3A5; sales description: Sprinter

**Risk level:** Serious risk

The connection between the steering rod and the steering box may come loose.

This could lead to loss of steering control.

Recall of the product from end users

**Description:** Van

**Batch number / Barcode:** The vehicles affected were produced between 17 September 2018 and 18 September 2018.

**Country of origin:** Germany

**Alert submitted by:** Germany



**Alert number:** A12/0054/19  
**Product:** Passenger car  
**Name:** Duster II, Logan II, Logan II MCV, Sandero II  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Dacia  
**Type / number of model:** Vehicles produced at Pitesti factory between 11/06/2018 and 14/06/2018.  
**Risk level:** Serious risk  
The positive terminal of the 12-volt battery, of the car is uncorrectly welded.  
This could make it impossible to start up the vehicle.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 0CY6.  
**Batch number / Barcode:** EC-type approval numbers: e2\*2007/46\*0030\*42, e2\*2007/46\*0013\*14, e2\*2001/116\*0323\*45; e2\*2001/116\*0323\*46; e2\*2001/116\*0323\*47; e2\*2001/116\*0323\*84; e2\*2001/116\*0323\*85;  
**Country of origin:** Romania  
**Alert submitted by:** Portugal

**Alert number:** A12/0063/19  
**Product:** Passenger car  
**Name:** Accord,City,Civic,CR-V,Jazz,Insight,Pilot,TSX  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Honda  
**Type / number of model:** GG3; GG5; GG6; GE6; GP1; ZE2; YF3; YF4, Type-approval numbers: e6\*2001/116\*0120\*04;\*05;\*06; e6\*2001/116\*0121\*03;\*04;\*05; e6\*2001/116\*0122\*04;\*05;\*06;\*07; e6\*2001/116\*0113\*03;\*04;\*05; e6\*2001/116\*0114\*04;\*05;\*06; , e11\*2001/116\*0302\*04;\*05; e11\*2001/116/0322\*03; e6\*2001/116\*0126\*04; e6\*2007/46\*0011\*00;\*01; e6\*2001/116\*0125\*04; e6\*2007/46\*0010\*00;\*01; e6\*2001/116\*0127\*04; e6\*2007/46\*0015\*00;\*01;\*02;\*03; , e6\*2001/116\*0115\*05;\*06;\*07;\*08; e11\*2001/116\*0254\*04; e11\*2001/116\*0271\*03; e11\*2001/116\*0292\*04; e11\*2001/116\*0293\*06; e11\*2001/116\*0294\*03;\*04;\*05;\*06; e11\*2001/116\*0301\*03;\*04;\*05; , e6\*2001/116\*0128\*04; e6\*2007/46\*0016\*00;\*01;\*02;\*03; e6\*2001/116\*0131\*02; e6\*2007/46\*0013\*00;\*01;\*02;\*03; e6\*2001/116\*0132\*02; e6\*2007/46\*0014\*00;\*01;\*02; e6\*2007/46\*0012\*00;\*01;\*02 , e6\*2001/116\*0130\*00;\*01;\*02;\*03;\*04; types: CP2; CP3; CS1; CS2; TF1; CW1; CW2; CW3; CU1; CU2; CU3; GM2; FA1; FA5; FG2; FA4; FD6; FD7; FD1; FD3; FD4; RE5; RE6; RE7; GG2; GG3; GG5; GG6; GE6; GG1; GG2;  
**Risk level:** Serious risk  
A defect in the gas generator of the front-seat passenger airbag leads to uncontrolled inflation and the release of metal fragments when the airbag is activated.  
This can cause the occupants of the vehicle to be injured.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 6CD, 6DD, 6ED  
**Batch number / Barcode:** Vehicles manufactured between 2010 and 2015 are affected.  
**Country of origin:** China, Japan, Turkey, United Kingdom, United States  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Croatia, The Netherlands

**Alert number:** A12/0065/19  
**Product:** Passenger car  
**Name:** Various  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Mercedes-Benz  
**Type / number of model:** Type-approval numbers:e1\*2001/116\*0431\*39 bis 49, e1\*2001/116\*0464\*19 to 22, e1\*2001/116\*0457\*32 to 40, e1\*2001/116\*0463\*18 to 20, e1\*2001/116\*0501\*25 to 38, e1\*2007/46\*1560\*00 to 11, , e1\*2007/46\*1666\*00 to 09, e1\*2001/116\*0335\*32 to 40, e1\*2001/116\*0396\*18 to 20, e1\*2007/46\*0485\*16, e1\*2007/46\*0643\*07, e1\*2001/116\*0480\*19 to 29, e1\*2007/16\*1884\*00, e1\*96/79\*0064\*36 to 38, , e1\*KS07/46\*0065\*00, sales description: CLA, GLA, SLC, A-Class, AMG GT, C-Class, E-Class, S-Class, SL, B-Class, GLC, CLS, G-Class , types: 204, 204AMG, 204K, 212, R1ES, R1EC, 221, 221AMG, 218, 218AMG, 204X, 463, G463Landulet  
**Risk level:** Serious risk  
The software of the communication module for the emergency call system (eCall) is faulty.  
As a result, it may be impossible to establish a speech connection with the Mercedes-Benz emergency call centre or to transmit vehicle data.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 5499637  
**Batch number / Barcode:** Vehicles manufactured between 2016 and 2018 are affected.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/0066/19  
**Product:** Tractors  
**Name:** New Holland, Case IH, Steyr  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** T5, Farmall C, Kompakt  
**Type / number of model:** Type-approval numbers: e13\*167/2013\*00010 to 12\*00; types: LE; LF; LG; sales description: T5; Farmall C; Kompakt  
**Risk level:** Serious risk  
 A lack of covers means that water can get into the braking system during the engine's wash process.  
 There is a risk of brake failure if the braking system reaches a high temperature.  
 Recall of the product from end users  
**Description:** Tractors  
**Batch number / Barcode:** The vehicles affected were produced between November 2016 and November 2018.  
**Country of origin:** Italy  
**Alert submitted by:** Germany

**Alert number:** A12/0069/19  
**Product:** Motorcycle  
**Name:** Beverly; Fuoco; MP3; X EVO; SRV  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Piaggio/Aprilia  
**Type / number of model:** Unknown  
**Risk level:** Serious risk  
 The welds in the tank may not be adequate.  
 As a consequence fuel may leak, leading to an accident.  
 Recall of the product from end users  
**Description:** Motorcycle.  
**Batch number / Barcode:** Unknown  
**Country of origin:** Italy  
**Alert submitted by:** Italy

**Alert number:** A12/0070/19  
**Product:** Motorcycle  
**Name:** Panigale V4, Panigale V4 S, Panigale V4 Speciale  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Ducati  
**Type / number of model:** Unknown  
**Risk level:** Serious risk  
 A crack may occur at the level of the outlet pipe of the oil cooler.  
 As a consequence, oil may leak leading to an accident.  
 Recall of the product from end users  
**Description:** Motorcycle.  
**Batch number / Barcode:**  
**Country of origin:** Italy  
**Alert submitted by:** Italy  
**Products were found and measures were taken also in:** The Netherlands

**Alert number:** A12/0071/19  
**Product:** Motorcycle  
**Name:** Panigale V4, Panigale V4 S, Panigale V4 Speciale  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Ducati  
**Type / number of model:** Unknown  
**Risk level:** Serious risk  
 There is the possibility for engine oil to leak from one of the hydraulic tensioners for the front and rear bank timing chains.  
 The oil may leak onto the engine sump and onto the tyre.  
 Recall of the product from end users  
**Description:** Motorcycle.  
**Batch number / Barcode:** Unknown  
**Country of origin:** Italy  
**Alert submitted by:** Italy  
**Products were found and measures were taken also in:** The Netherlands

**Alert number:** A12/0076/19

**Product:** Passenger car

**Name:** Mazda 2

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Mazda

**Type / number of model:** Type-approval number: e1\*2007/46\*1335\*14; type: DJ1 Sales description Mazda 2

**Risk level:** Serious risk

The high-pressure fuel pipe may be damaged through contact with other components.

This could cause a fuel leak, creating an increased risk of fire and/or accident.

Recall of the product from end users

**Description:** Passenger car. Company recall code: AJ030A.

**Batch number / Barcode:** Vehicles manufactured between 6 March 2018 and 20 April 2018 are affected.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0059/19

**Product:** Wooden playpen

**Name:** Unknown

**Risk type:** Choking, Entrapment, Injuries

**Category:** Childcare articles and children's equipment

**Brand:** Vertbaudet

**Type / number of model:** 70335-0011-6429 (grey), reference 99VB013 , 70335-0011-6509 (natural), reference 99VB019

**Risk level:** Serious risk

A screw from a plastic part enabling the playpen to be assembled and folded can come loose. As a result, the assembly system and locking mechanism (latch) can be damaged.

A small child may put the screw in the mouth and choke. There is also a risk of shearing of children's fingers because the latch is mobile and a risk of entrapment of the child's fingers due to a small, white, plastic part with a hole in it, located under the latch, which may become accessible to children.

The product does not comply with the relevant European standard EN 12227.

Recall of the product from end users

**Description:** Foldable, wooden playpen with three different levels.

**Batch number / Barcode:** Unknown

**Country of origin:** Romania

**Alert submitted by:** France



**Alert number:** A12/0048/19

**Product:** Bouncy toy

**Name:** Unknown

**Risk type:** Chemical, Choking, Suffocation

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** TP572

**Risk level:** Serious risk

The product contains 2-ethylhexyl phthalate (DEHP) (measured value: 3% by weight) and Dibutylphthalate (DBP) (measured value: 16% by weight).

A small part (valve plug) can be easily detached from the toy with fingers or teeth.

The plastic bag of the packaging is too thin.

Phthalates may harm the health of children, causing possible damage to the reproductive system.

A child could put the small part (valve plug) in the mouth and choke on it.

If a child plays with the packaging, the plastic bag can cover the mouth and nose, causing the child to suffocate.

The product does not comply with the REACH Regulation, with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Import rejected at border

**Description:** Inflatable, blue plastic, bouncy toy in the shape of a horse, with two yellow butterflies on both sides. Packaging: transparent plastic bag with sticker label.

**Batch number / Barcode:** 6438443004240

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0049/19

**Product:** Bouncy toy

**Name:** Unknown

**Risk type:** Chemical, Choking, Injuries, Suffocation

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** TP573

**Risk level:** Serious risk

The plastic material of the product contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 0.29% by weight), and dibutyl phthalate (DBP) (measured value 17% by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system.

In addition, the valve plug can be easily detached from the toy and could be put in the mouth by a small child, causing choking. The batteries are easily accessible and could cause choking if put in the mouth or damage the organs if swallowed.

The plastic bag, in which the toy is packed, is too thin. A child could put it over the mouth and nose, leading to suffocation.

The product does not comply with the REACH Regulation, with the requirements of the Toy Safety Directive and the relevant European Standards EN 71-1 and EN 62115.

Import rejected at border

**Description:** Inflatable, yellow plastic, bouncy toy in the shape of a horse. The horse is decorated with several coloured dots, black hooves, a red tail and a white muzzle. It also has a battery-operated, sound mechanism. The toy is packed in a transparent plastic bag with an adhesive label

**Batch number / Barcode:** 6438443004257

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0055/19

**Product:** Slime toy

**Name:** Pâte à Prout

**Risk type:** Chemical

**Category:** Toys

**Brand:** Kim'Play

**Type / number of model:** 460

**Risk level:** Serious risk

The migration of boron from the toy slime is too high (measured value up to 1000 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Recall of the product from end users, Temporary ban on the supply, offer to supply and display of the product, Temporary ban on the supply, offer to supply and display of the product

**Description:** Plastic jar containing 100g of sticky slime, available in four different colours (yellow, green, red and blue).

**Batch number / Barcode:** 3225430004603

**Country of origin:** Unknown

**Alert submitted by:** Luxembourg



**Alert number:** A12/0058/19

**Product:** Bubble gun

**Name:** Bubble Guns

**Risk type:** Choking

**Category:** Toys

**Brand:** Rama Tritón

**Type / number of model:** Ref.: 29086, 29079 and 29123

**Risk level:** Serious risk

Various pieces can detach from the toy, generating small parts.

A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Import rejected at border

**Description:** Soap bubble toy gun in the shape of fish (dolphins, goldfish, etc.) The toy contains batteries and is supplied in a blister pack.

**Batch number / Barcode:** 8436019629086, 8436019629079 and 8436019629123

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0046/19

**Product:** Leather gloves

**Name:** Unknown

**Risk type:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** Yimei

**Type / number of model:** 8 1/2

**Risk level:** Serious risk

The amount of chromium (VI) in the leather is too high (measured value 24.4 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions.

The product does not comply with the REACH Regulation.

Recall of the product from end users

**Description:** Ladies' dark red leather gloves with button.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Estonia



**Alert number:** A12/0068/19

**Product:** Key-ring

**Name:** Unknown

**Risk type:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** Unknown

**Type / number of model:** Part IVA 11095661002 A21

**Risk level:** Serious risk

The metal of the jewellery contains cadmium (measured value: 91% in weight).

Cadmium is harmful to human health, because it accumulates in the body, can damage organs and it may cause cancer.

The product does not comply with the REACH Regulation.

Destruction of the product

**Description:** Copper-coloured, key-ring attached to a cross set with rhinestones.

**Batch number / Barcode:** H8888885183

**Country of origin:** China

**Alert submitted by:** Germany





**Alert number:** A12/0047/19

**Product:** Battery charger

**Name:** Replacement AC/DC adaptor

**Risk type:** Burns, Fire

**Category:** Electrical appliances and equipment

**Brand:** Batterytec

**Type / number of model:** PN 2124531316474, TJ-65-195334

**Risk level:** Serious risk

The distance between the primary and secondary windings of the transformer is too small.

As a consequence, the cables may overheat and catch fire.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60335.

Return of goods to port of origin for reworking or disposal

**Description:** Black plastic adaptor in a blue cardboard box.

**Batch number / Barcode:** X00076P3WF

**Country of origin:** China

**Alert submitted by:** United Kingdom



**Alert number:** A12/0051/19  
**Product:** USB charger  
**Name:** Travel charger  
**Risk type:** Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** Xenic

**Type / number of model:** RT-29 Black

**Risk level:** Serious risk

The electrical insulation and the clearance /creepage distances between the primary and accessible secondary circuit are not sufficient. The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Recall of the product from end users

**Description:** Travel charger, sold in a white cardboard box with transparent windows.

**Batch number / Barcode:** 5907747839502

**Country of origin:** Poland

**Alert submitted by:** Finland



**Alert number:** A12/0061/19  
**Product:** Electric kettle  
**Name:** Cordless jug.kettle  
**Risk type:** Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** SCARLETT

**Type / number of model:** SC-20A

**Risk level:** Serious risk

The product does not have the required earth connection and the electrical insulation is inadequate.

In the event of a fault, the metal container of the kettle could become live, leading to an electric shock for users.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Import rejected at border

**Description:** Electric kettle with 2-litre metal container.

**Batch number / Barcode:** 6940032567352

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0067/19  
**Product:** USB charger  
**Name:** Fast charger  
**Risk type:** Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** Powerstar  
**Type / number of model:** PS-21

**Risk level:** Serious risk

The electrical insulation and the clearance /creepage distances between the primary and accessible secondary circuit of the USB charger are not sufficient.

As a consequence, accessible parts of the product may become live. The user could touch them and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Recall of the product from end users

**Description:** USB charger, sold in a black, windowed cardboard box.

**Batch number / Barcode:** 4054753600167

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A11/0002/19  
**Product:** Safety matches  
**Name:** Europa Hölzer  
**Risk type:** Burns, Fire  
**Category:** Other  
**Brand:** Unknown  
**Type / number of model:** Batch no: 18/21/19/06/01  
**Risk level:** Other risk levels

The glowtime of the matches is too long.

The user could place the still glowing match back in the matchbox, or onto/near inflammable material, which could then catch fire causing burns to the user.

The product does not comply with the relevant European standard EN 1783.

Ban on the marketing of the product and any accompanying measures

**Description:** Safety matches sold in a set of 10 matchbox packages.

**Batch number / Barcode:** 4004753042603

**Country of origin:** Germany

**Alert submitted by:** Finland

