



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

## The Rapid Alert System for Non-Food Products (RAPEX)

### *RAPEX - Weekly overview report of notifications*

Week 3 - 2020

Notification A12/0709/19 has been withdrawn from report 2019-18 of 03-05-2019 at the request of the notifying authority as new evidence was submitted that shows the product is compliant.

**Alert number:** A12/00016/20

**Product:** Self-balancing scooter (Hoverboard)

**Name:** P5B Hoverboard

**Risk type:** Electric shock, Fire, Injuries

**Category:** Hobby/sports equipment

**Brand:** ENet

**Type / number of model:** P5, P5B, P5C

**Type of alert:** Products with serious risks

The wheels of the hoverboard can inadvertently operate while the device is being held off the ground by the user. Consequently, the hand or other body parts of the person could become trapped, leading to injuries.

The charger lacks an adequate over-current protection device and has accessible live parts. Additionally, the creepage and clearance distances between primary and accessible secondary circuits are insufficient. Consequently, the user could receive an electric shock or cause the product to overheat leading to fire. The product does not comply with the requirements of the Low Voltage and Machinery Directives and the relevant European standard EN 62368-1.


Withdrawal of the product from the market

**Description:** Orange self-balancing two wheeled hoverboard for use as a personal transport device.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** United Kingdom

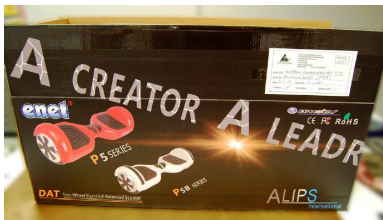

**Alert number:** A12/00020/20

**Product:** Exetube

**Name:** Exetube Strong

**Risk type:** Environment

**Category:** Hobby/sports equipment

**Brand:** BLACC

**Type / number of model:** Strong

**Type of alert:** Products with serious risks

The foam on the handles of the product contains short chain chlorinated paraffins (SCCPs)(measured value up to 2.83 %).

The placing on the market and use of articles containing SCCPs is banned. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment. The product does not comply with the Regulation on persistent organic pollutants (POP Regulation).

Making the marketing of the product subject to prior conditions, Withdrawal of the product from the market

**Description:** Red plastic cord used as a fitness training equipment.

**Batch number / Barcode:** 7325600060784

**Country of origin:** Unknown

**Alert submitted by:** Sweden



**Alert number:** A12/00023/20

**Product:** Self-balancing scooter (hoverboard)

**Name:** P10H Hoverboard

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** P10, Wheel New

**Type / number of model:** ZH-42-2000 (charger)

**Type of alert:** Products with serious risks

The wheels of the hoverboard can inadvertently operate while the device is being held off the ground by the user.

Consequently, the hand or other body parts of the person could become trapped, leading to injuries. The product does not comply with the requirements of the Machinery Directive.

Withdrawal of the product from the market

**Description:** Multicoloured self-balancing two wheeled hoverboard for use as a personal transport device.

**Batch number / Barcode:**

**Country of origin:** Unknown

**Alert submitted by:** United Kingdom



**Alert number:** A12/00026/20

**Product:** Children's bicycle seat

**Name:** Baby Seat 100 BCLIP

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** B'TWIN

**Type / number of model:** ref. 2538309

**Type of alert:** Products with serious risks

The attachment point of the buckle might break. A child may consequently fall out of the seat and get injured.

Recall of the product from end users

**Company recall page:** <https://www.decathlon.pl/ecpl/static/redesign/wycofane-produkty/invalid-products/pdf/Plakat%20apel%20do%20kliento%CC%81w%202002.01.2020-min.pdf> (<https://www.decathlon.pl/ecpl/static/redesign/wycofane-produkty/invalid-products/pdf/Plakat%20apel%20do%20kliento%CC%81w%202002.01.2020-min.pdf>)

**Description:** Children's bicycle seat.

**Batch number / Barcode:**

**Country of origin:** Portugal

**Alert submitted by:** Poland

**Products were found and measures were taken also in:** Austria, Bulgaria, Portugal



**Alert number:** A12/00032/20

**Product:** Brake disc for bicycles

**Name:**

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** Trickstuff

**Type / number of model:** Dächle UL 160 mm & 180 mm

**Type of alert:** Products with serious risks

Cracks may form on the brake disc friction ring, which could cause the disc to block the wheel. This could consequently lead to an accident or the cyclist to fall from the bicycle.

Recall of the product from end users


**Company recall page:** <http://trickstuff.de/rueckruf/> (<http://trickstuff.de/rueckruf/>)

**Description:** Brake disc for bicycles, 160 and 180 mm diameter

**Batch number / Barcode:** 4251189802237

**Country of origin:** Germany

**Alert submitted by:** Germany

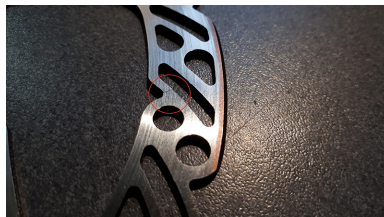

**Alert number:** A12/00030/20

**Product:** Bracelet

**Name:**

**Risk type:** Chemical

**Category:** Jewellery

**Brand:** Primark

**Type / number of model:** Art. N° 3444101

**Type of alert:** Products with serious risks

The metal in the bracelet contains an excessive amount of Cadmium (measured value up to 0.048% by weight). Cadmium is harmful to human health because it accumulates in the body and can damage organs and it may cause cancer.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Bracelet

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** Slovenia



**Alert number:** A12/00062/20

**Product:** Bracelet

**Name:**

**Risk type:** Chemical

**Category:** Jewellery

**Brand:** Xinshishi

**Type / number of model:**

**Type of alert:** Products with serious risks

The product poses a chemical risk because the metal contains cadmium (measure value 0.048% by weight), lead (measure value 1.7% by weight) and migration of nickel (measure value 0.83 µg/cm<sup>2</sup>/week). Cadmium is a toxic substance it accumulates in the body and can damage organs and it may cause cancer. Migration of nickel poses allergen risk. Lead is harmful to human health, accumulates in the body and may damage fertility, breast-fed children or the unborn child.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Gold coloured bracelet

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** Slovenia



**Alert number:** A12/00045/20

**Product:** Anti-corrosion coating

**Name:** AUTOKONSERVANTAS MOVILIS

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** MOVILIS

**Type / number of model:** 750 ml

**Type of alert:** Products with serious risks

The package does not have a child-resistant closure, as well as the labeling of the package does not include the corresponding hazard pictograms, the hazard and precautionary statements, the name of the substance containing skin sensitization.

The product does not comply with the CLP Regulations

Withdrawal of the product from the market

**Description:** Anti-corrosion coating for car windows, doors etc.

**Batch number / Barcode:** 4770286383079

**Country of origin:** Russian Federation

**Alert submitted by:** Lithuania



**Alert number:** A12/00002/20

**Product:** Passenger car

**Name:** Focus

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Ford

**Type / number of model:** Type-approval number: e13\*2007/46\*1911\*04

**Type of alert:** Products with serious risks

The engine wiring loom may be damaged by a stud on the transmission housing. This could lead to reduced engine power or engine stall, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Ford recall code : 19S50.

**Batch number / Barcode:** 19S50

**Country of origin:** Germany

**Alert submitted by:** United Kingdom

**Alert number:** A12/00008/20

**Product:** Bus

**Name:** Citaro, Capacity

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Evobus

**Type / number of model:** Models: 628 02, 628 03, 628 09, Type approval numbers: e1\*2007/46\*0087, e1\*2007/46\*0090, e1\*NKS\*0050

**Type of alert:** Products with serious risks

The roof unit may be defectively sealed. Rainwater may seep into the vehicle interior through the roof opening via the joints for the air-conditioning system's roof module. The roof opening is located directly above a circuit board in the transverse duct, posing a risk of fire.

No information.

Recall of the product from end users

**Description:** Bus

**Batch number / Barcode:** 83.30M19064A

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00009/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Rifter, Partner

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0624\*04+\*05, e2\*2007/46\*0625\*05, Type: E

**Type of alert:** Products with serious risks

The steering column may not have been manufactured in accordance with the specification. This may result in steering failure and, consequently, loss of control over the vehicle, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Peugeot recall code: JTV.

**Batch number / Barcode:** JTV

**Country of origin:** Spain

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/00010/20

**Product:** Car

**Name:** JPM

**Risk type:** Environment

**Category:** Motor vehicles

**Brand:** 2008 I, 208 I, 301, Peugeot

**Type / number of model:** e2\*2007/46\*0070\*38, e2\*2007/46\*0070\*40, e2\*2007/46\*0070\*41, e2\*2007/46\*0070\*42, e2\*2007/46\*0070\*43, e2\*2007/46\*0070\*44, e2\*2007/46\*0070\*45, e2\*2007/46\*0070\*46, e2\*2007/46\*0224\*09, e2\*2007/46\*0224\*10, e2\*2007/46\*0224\*11

**Type of alert:** Products with serious risks

NOx emission could be out of regulatory limits due to wrong engine calibration tuning. High emission of NOx are harmful to the environment

" "

Recall of the product from end users

**Description:** Passenger car

**Batch number / Barcode:** JPM

**Country of origin:** France

**Alert submitted by:** Malta

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00017/20

**Product:** Passenger Car

**Name:** Continental 24, Continental Supersports and Continental Supersports Convertible

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Bentley

**Type / number of model:** E11\*2001/116\*0221\*24

**Type of alert:** Products with serious risks

The connecting hose of the hydraulic power assisted steering system may detach from connecting pipe of the cooler.

Consequently, hydraulic steering fluid could leak, resulting in a loss of steering control and increasing the risks of an accident, to following traffic and of a fire.

Recall of the product from end users

**Description:** Passenger car under Bentley recall code: RE 19/27 (RB41).

**Batch number / Barcode:** RE 19/27 (RB41)

**Country of origin:** United Kingdom

**Alert submitted by:** United Kingdom

**Alert number:** A12/00018/20

**Product:** Passenger Car

**Name:** Fiesta

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Ford

**Type / number of model:** e9\*2007/46\*3142\*10

**Type of alert:** Products with serious risks

The steering column may rattle due to an incorrect tolerance.

After prolonged use, the steering column may fail, leading to a loss of steering control, increasing the risk of accident.

Recall of the product from end users

**Description:** Passenger car under Ford recall code: 19S47.

**Batch number / Barcode:** 19S47

**Country of origin:** Germany

**Alert submitted by:** United Kingdom

**Alert number:** A12/00019/20

**Product:** Passenger car

**Name:** Range Rover, Range Rover Sport

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Land Rover

**Type / number of model:** Type-approval numbers: E11\*2007/46\*0649, E11\*2007/46\*0909

**Type of alert:** Products with serious risks

The routing of the electrical harness within the steering column assembly has insufficient clearance to the metalwork of the steering column, causing the harness to be damaged or pulled out of the connector when the steering column is adjusted. This can result in impaired steering functionality and failure of the horn and the direction indicators, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Land Rover recall code: N306.

**Batch number / Barcode:** N306

**Country of origin:** United Kingdom

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/00022/20

**Product:** All-terrain vehicle

**Name:** Ranger XP 1000

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Polaris

**Type / number of model:** Ranger XP 1000

**Type of alert:** Products with serious risks

The drive belt may break or fail during operation, causing damage to an incorrectly routed fuel line. This may result in a fuel leak, increasing the risk of fire.

Directive 2001/95/EC on general product safety.

Recall of the product from end users

**Description:** All-terrain vehicle under Polaris recall code: R-19-05.

**Batch number / Barcode:** R-19-05

**Country of origin:** United States

**Alert submitted by:** United Kingdom

**Alert number:** A12/00027/20

**Product:** Lorry

**Name:** CN 280 UB4x2EB 11.9 CL1

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Scania

**Type / number of model:** Type-approval numbers: none known, Types: UB4x2EB

**Type of alert:** Products with serious risks

Cracks forming on the gas-pressure regulating device cause gas to leak leading to a risk of fire.

Recall of the product from end users

**Description:** Lorry

**Batch number / Barcode:** RC; Nr. noch nicht bekannt

**Country of origin:** Sweden

**Alert submitted by:** Germany

**Alert number:** A12/00028/20

**Product:** Lorry

**Name:** S410, S450, S500, S520, S580, S730 and others

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Scania

**Type / number of model:** Types: N323, N324, N333, N334, N322, N330, N331, N332, N340, N341, e4\*2007/46\*0040\*15, e4\*2007/46\*0045\*12, e4\*2007/46\*1128\*00-03, e4\*2007/46\*1129\*00-03, e4\*2007/46\*1130\*00-03, e4\*2007/46\*1131\*00-03, e4\*2007/46\*0030\*19, e4\*2007/46\*0031\*19, e4\*2007/46\*0032\*16, e4\*2007/46\*0038\*19, e4\*2007/46\*0039\*19

**Type of alert:** Products with serious risks

In some cases, the electronic parking brake may accidentally disengage, allowing the vehicle to roll away.

Recall of the product from end users

**Description:** Lorry

**Batch number / Barcode:** RC191624

**Country of origin:** Greece

**Alert submitted by:** Germany

**Alert number:** A12/00031/20

**Product:** Passenger car

**Name:** Z4

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** BMW

**Type / number of model:** Model series: G29, Type-approval number: e1\*2007/46\*1949, Type: G4Z

**Type of alert:** Products with serious risks

The headlight control unit may have been damaged in the course of the supplier's production process. This could result in a short circuit in the control unit, causing the headlights, headlamp illumination or the turn-signals to fail, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under BMW recall code: 0063660100.

**Batch number / Barcode:** 0063660100

**Country of origin:** Austria

**Alert submitted by:** Germany

**Alert number:** A12/00034/20

**Product:** Passenger van / Light commercial vehicle

**Name:** C3 Aircross, Berlingo

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroen

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0624\*04+\*05, e2\*2007/46\*0625\*05, e4\*2007/46\*1241\*07, Types: E, 2

**Type of alert:** Products with serious risks

The steering column is not manufactured according to specifications. This may result in steering failure and loss of control over the vehicle, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Citroen recall code: HAR.

**Batch number / Barcode:** HAR

**Country of origin:** Spain

**Alert submitted by:** Germany



**Alert number:** A12/00037/20

**Product:** Passenger car

**Name:** Elantra, IONIQ Hybrid, IONIQ Elektro

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Hyundai

**Type / number of model:** Type-approval numbers: e4\*2007/46\*1054, e4\*2007/46\*1157 , Types: AD, AE

**Type of alert:** Products with serious risks

The wheel nuts may not have been tightened to the correct torque. As a result, they could become detached, thus limiting driving stability and increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Hyundai recall code: 91C064.

**Batch number / Barcode:** 91C064

**Country of origin:** Republic of Korea

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/00039/20

**Product:** Passenger car

**Name:** 1, 3, M3, X1, Z4

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** BMW

**Type / number of model:** Type-approval numbers: e1\*2001/116\*0287, e1\*2007/46\*0273, e1\*2001/116\*0352, e1\*2007/46\*0277, e1\*2007/46\*0283, e1\*2007/46\*0275, e24\*2007/46\*0024, e1\*2007/46\*0373, e1\*2001/116\*0308, e1\*2007/46\*0314,, Types: 187, 1K2, 182, 1C, 1K4, X1, X1-N1, ZR, 390L, 3L, 3K, 3K-N1, 392C, 3C, M3, e1\*2007/46\*0315, e24\*2007/46\*0022, e1\*2001/116\*0346, e1\*2007/46\*0316, e1\*2007/46\*0377

**Type of alert:** Products with serious risks

The connector of the positive battery cable on the front power distribution box may be damaged over the lifetime of the vehicle by vibrations and currents. This may lead to failure of the engine and of the vehicle's electrical system, including headlights and occupant protection which will increase the risk of an accident and injuries to the occupants.

Recall of the product from end users

**Description:** Passenger car under BMW recall codes: 0061950400, 0061670400, 0061120500.

**Batch number / Barcode:** 0061950400, 0061670400, 0061120500

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00040/20

**Product:** Passenger car

**Name:** A-Class

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Model series: BR177, Type-approval number: e1\*2007/46\*1829\*03, Type: F2A

**Type of alert:** Products with serious risks

A weld on the seat-height adjustment system of the left-hand front seat may be defective and can break, causing the seat cushion to tilt forward in the event of a crash. As a result, the protective effect of the restraint system will be impaired, increasing the risk of an injury.

Recall of the product from end users

**Description:** Passenger car under Mercedes-Benz recall code: 9190203.

**Batch number / Barcode:** 9190203

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00041/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Combo, Vauxhall Combo

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Opel

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0622\*04, e2\*2007/46\*0623\*05, Type: E

**Type of alert:** Products with serious risks

The steering column has not been manufactured in accordance with the specification. This can cause steering failure and, consequently, loss of control of the vehicle, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Opel recall code: E19-190492.

**Batch number / Barcode:** E19-190492

**Country of origin:** Spain

**Alert submitted by:** Germany

**Alert number:** A12/00042/20

**Product:** Passenger car

**Name:** X6, X6M

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** BMW

**Type / number of model:** Type-approval numbers: 1\*2007/46\*0412\*17, e1\*2007/46\*0172\*10, Types: X6, M7X

**Type of alert:** Products with serious risks

The four ISOFIX child-seat attachment brackets on the rear seats may not have the necessary structural durability. As a result, one or more of the brackets could break under increased fatigue loading during operation. This may increase the risk of injury in the event of an accident.

Recall of the product from end users

**Description:** Passenger car under BMW recall code: 0052920200.

**Batch number / Barcode:** 0052920200

**Country of origin:** United States

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Ireland, Poland

**Alert number:** A12/00044/20

**Product:** Passenger car

**Name:** Cherokee

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Jeep

**Type / number of model:** Type-approval number: e4\*2007/46\*0783\*17, Type: KL

**Type of alert:** Products with serious risks

A pinion in the power steering system may be defective and could break. As a result, the steering wheel may lock up, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Jeep recall code: V99.

**Batch number / Barcode:** V99

**Country of origin:** United States

**Alert submitted by:** Germany

**Alert number:** A12/00048/20

**Product:** Passenger Car

**Name:** Elise

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Lotus

**Type / number of model:** e4\*2001/116\*0008\*71 to e4\*2001/116\*0008\*72 e4\*KS07/46\*0011\*00 to e4\*KS07/46\*0011\*24

**Type of alert:** Products with serious risks

The plastic spacers between the engine fuel rail and cylinder head may expand and contract.

Consequently, the cylinder head's securing bolts might suffer excessive fatigue, leading to fuel leak, increasing the risk of accident and fire.

Recall of the product from end users

**Description:** Passenger car under Lotus recall code: 2019/02R.

**Batch number / Barcode:** 2019/02R

**Country of origin:** United Kingdom

**Alert submitted by:** United Kingdom

**Alert number:** A12/00049/20

**Product:** Motorcycle

**Name:** Chief, Chieftain, FTR1200, Roadmaster and Springfield

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Indian Motorcycle

**Type / number of model:** Indian Motorcycle Chief, Springfield, Chieftain, Roadmaster, FTR1200

**Type of alert:** Products with serious risks

The 10A circuit breakers might not meet the required functional specifications.

Consequently, they might fail, causing the engine to unexpectedly stop running, increasing the risk of an accident.

Recall of the product from end users

**Description:** Motorcycle under Indian Motorcycle recall codes: I-19-05 A and I-19-05 B.

**Batch number / Barcode:** I-19-05 A and I-19-05 B

**Country of origin:** United States

**Alert submitted by:** United Kingdom

**Alert number:** A12/00050/20

**Product:** Passenger Car

**Name:** Fiesta

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Ford

**Type / number of model:** e9\*2007/46\*3142\*11

**Type of alert:** Products with serious risks

An insufficient torque might have been applied to the bolts of the rear seat latches and centre seat belt retractor.

Consequently, in the event of an accident these elements might detach, increasing the risk of injuries.

Recall of the product from end users

**Description:** Passenger car under Ford recall code: 19S46.

**Batch number / Barcode:** 19S46

**Country of origin:** Germany

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Germany

**Alert number:** A12/00053/20

**Product:** Passenger Car

**Name:** Focus

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Ford

**Type / number of model:** e13\*2007/46\*1911\*

**Type of alert:** Products with serious risks

The pins of the Power Distribution Box (PDB) might have been defectively manufactured and cause an intermittent or poor connection.

Consequently, some functions of the PCB might be intermittently disrupted, causing the vehicle to stall or to run under in-optimal conditions, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Ford recall code: 19S42.

**Batch number / Barcode:** 19S42

**Country of origin:** Germany

**Alert submitted by:** United Kingdom

**Alert number:** A12/00055/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Ducato

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Fiat

**Type / number of model:** Type-approval number: e3\*2007/46\*0044\*29, Type: 250

**Type of alert:** Products with serious risks

The cabling may come into contact with the exhaust pipe. This may cause the ABS and the rear lights to fail, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Fiat recall code: 6263.

**Batch number / Barcode:** 6263

**Country of origin:** Italy

**Alert submitted by:** Germany

**Alert number:** A12/00056/20

**Product:** Passenger car

**Name:** Optima

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** KIA

**Type / number of model:** Type-approval number: e4\*2007/46\*1018, Type: JF

**Type of alert:** Products with serious risks

The non-return valve in the vacuum pump may not function properly. This may lead to failure of braking power assistance thus increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under KIA recall code: 191112.

**Batch number / Barcode:** 191112

**Country of origin:** Republic of Korea

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00065/20

**Product:** Tractor/Agricultural tractor

**Name:** Claas

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Arion, Axion

**Type / number of model:** e1\*167/2013\*00096\*03, e13\*167/2013\*00070\*03 and individual approvals, A44, A74, A09, A23

**Type of alert:** Products with serious risks

Defective brake valve may lead to impaired braking performance.

Recall of the product from end users

**Description:** Tractor/Agricultural tractor

**Batch number / Barcode:** S114467

**Country of origin:** France

**Alert submitted by:** Germany

**Alert number:** A12/00066/20

**Product:** Passenger car

**Name:** 208I, 2008I, 301I

**Risk type:** Environment

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** e2\*2007/46\*0070\*38, e2\*2007/46\*0070\*40, e2\*2007/46\*0070\*41, e2\*2007/46\*0070\*42, e2\*2007/46\*0070\*43, e2\*2007/46\*0070\*44, e2\*2007/46\*0070\*45, e2/2007/46\*0070\*46, e2\*2007/46\*0071\*14, e2/2007/46\*0071\*18, e2\*2007/46\*00701\*19, e2/2007/46\*0224\*09, e2\*2007/46\*0224\*10, e2\*2007/46\*0224\*11

**Type of alert:** Products with serious risks

Wrong engine calibration tuning might cause the exhaust emissions' level of nitrogen oxides (NOx) to exceed regulated limits. Nitrogen oxides are harmful to human health and the environment.

Recall of the product from end users

**Description:** 2008I from 07/12/2017 to 08/03/2019 - VIN: VF3CUHMRPHY179596 to VF3CUHMRPKY054432 208I from 01/02/2017 to 12/04/2019 - VIN: VF3CCHMRPHT048291 to VF3CCHMMPKW050685 301 FROM 06/09/2017 TO 29/03/2019 - VIN: VF3DDHMRPHJ793927 to VF3DDHMRPKJ641509

**Batch number / Barcode:** JPM

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00067/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Ducato III

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Fiat

**Type / number of model:** Model: 250, Type-approval number: e3\*2007/46\*0049\*24

**Type of alert:** Products with serious risks

The incorrectly installed positive cable of the generator may come into contact with the drive shaft. This may lead to a short-circuit and, in some cases, to a fire in the vehicle.

Recall of the product from end users

**Description:** Lorry

**Batch number / Barcode:** 6268

**Country of origin:** Italy

**Alert submitted by:** Germany

**Alert number:** A12/00046/20  
**Product:** Soother holder  
**Name:** Apple red soother holder  
**Risk type:** Choking  
**Category:** Childcare articles and children's equipment  
**Brand:** Franck&Fischer  
**Type / number of model:** № 1501-5104  
**Type of alert:** Products with serious risks  
The product has small parts that can be easily detached.

A child may put one of these small parts in the mouth and choke. The product does not comply with the European standard EN 12586.  
Withdrawal of the product from the market

**Description:** Textile soother holder with a textile toy - red apple.  
**Batch number / Barcode:** 5704361005760  
**Country of origin:** Thailand  
**Alert submitted by:** Slovenia  
**Products were found and measures were taken also in:** Germany



**Alert number:** A12/00051/20  
**Product:** Soother holder  
**Name:** Pacifier holder  
**Risk type:** Choking  
**Category:** Childcare articles and children's equipment  
**Brand:** hevea  
**Type / number of model:**  
**Type of alert:** Products with serious risks

The garment fastener breaks easily, generating small parts. A child could put the small parts in the mouth and choke on them.

The product does not comply with the relevant European standard EN 12586.

Recall of the product from end users  
**Description:** Textile soother holder.  
**Batch number / Barcode:** EAN 5710087334206  
**Country of origin:** People's Republic of China  
**Alert submitted by:** Slovenia  
**Products were found and measures were taken also in:** Germany



**Alert number:** A12/00001/20

**Product:** Fireworks

**Name:** Valencianets

**Risk type:** Damage to hearing

**Category:** Pyrotechnic articles

**Brand:** Cialfir

**Type / number of model:** 0163-F2-0656, 0314

**Type of alert:** Products with serious risks

The sound pressure level of the fireworks is too high (> 120 dB). Excessive noise levels may cause damage to hearing.

The product does not comply with the requirements of the pyrotechnics Directive and the relevant European standard EN 15947.

Recall of the product from end users

**Company recall page:** <https://nl-nl.facebook.com/LootsVuurwerk/> (<https://nl-nl.facebook.com/LootsVuurwerk/>)

**Description:** Banger cat. F2, 20 per box

**Batch number / Barcode:** 8435033803144

**Country of origin:** Spain

**Alert submitted by:** Belgium



**Alert number:** A12/00003/20

**Product:** Soft toys with keyring

**Name:**

**Risk type:** Choking

**Category:** Toys

**Brand:** Kaskimatti

**Type / number of model:** KM2098, KM2100

**Type of alert:** Products with serious risks

Small parts (plastic eyes) can be easily detached from the toy. A small child could put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Import rejected at border

**Description:** A soft toy (husky/reindeer) attached to a keyring

**Batch number / Barcode:** 6430067030445, 6430067030469

**Country of origin:** People's Republic of China

**Alert submitted by:** Finland



**Alert number:** A12/00004/20

**Product:** Finger paint

**Name:** Finger Paint

**Risk type:** Chemical

**Category:** Toys

**Brand:** Hipo

**Type / number of model:** art. nr H6781

**Type of alert:** Products with serious risks

The paints contain an excessive amount of 5-Chloro-2-methyl-isothiazolin-3(2H)-one (CMI), 2-methylisothiazolin-3(2H)-one (MI), 1,2-benzoisotiazol-3(2H)-on (BIT) (measured values up to 36 mg/kg, 29.1 mg/kg and 34.1 mg/kg respectively). These substances can cause eye and skin irritation, burns and are toxic.

The product does not comply with the requirements of the Toy Safety Directive.

Withdrawal of the product from the market

**Description:** Set of finger paints, eight colours.

**Batch number / Barcode:** 5907700602525

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland



**Alert number:** A12/00006/20

**Product:** Plastic rattle

**Name:** Grzechotka

**Risk type:** Damage to hearing

**Category:** Toys

**Brand:** Gazelo Toys

**Type / number of model:** G100946-2823-5920

**Type of alert:** Products with serious risks

The sound level produced by the toy is too high which could lead to permanent or partial hearing loss.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


Withdrawal of the product from the market

**Description:** Plastic turtle-shaped rattle mounted on four wheels without packaging but with a label attached to the toy.

**Batch number / Barcode:** 5900949404004

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland

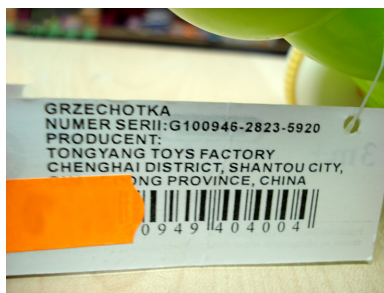

**Alert number:** A12/00011/20

**Product:** Plastic gun

**Name:** Police Force Super Weapon Set

**Risk type:** Choking, Injuries

**Category:** Toys

**Brand:**

**Type / number of model:** G089756-610-7-4424

**Type of alert:** Products with serious risks

The suction cups may be easily detached. If a child puts the projectile in the mouth, the suction cup could detach and obstruct the airways. Moreover, the kinetic energy of the projectiles, when hitting a person, is too high. This could cause injuries, especially to the eyes.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


Withdrawal of the product from the market

**Description:** Plastic toy police set which consists of two toy guns with projectiles.

**Batch number / Barcode:** 5907773982050

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland

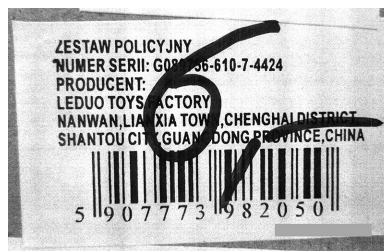

**Alert number:** A12/00012/20

**Product:** Toy gun set

**Name:** Soft Play Gun

**Risk type:** Injuries

**Category:** Toys

**Brand:**

**Type / number of model:** G096428-781B-4821

**Type of alert:** Products with serious risks

The kinetic energy of the projectiles, when hitting a person, is too high. This may cause injuries, especially to the eyes.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Plastic toy gun that shoots with foam made projectiles.

**Batch number / Barcode:** 5907773989677

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland





**Alert number:** A12/00014/20

**Product:** Toy musical instrument set

**Name:** Zestaw instrumentow

**Risk type:** Choking, Damage to hearing, Strangulation

**Category:** Toys

**Brand:** Fansheng, Pegaz Toys

**Type / number of model:** N° 733A-35

**Type of alert:** Products with serious risks

Small parts can easily be detached from the toy and it can easily break, releasing small parts. A small child may put the small parts in the mouth and choke. The toy's handle is too long: a child could put the protruding part into the mouth, which could block the airways. The strap attached to the toy does not have a quick release mechanism. If worn around the neck, it could form a loop and become trapped, leading to strangulation. The sound pressure level is too high and could lead to permanent or partial hearing loss.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1

Withdrawal of the product from the market

**Description:** Set of plastic toy musical instruments, consisting of a drum and rattles.

**Batch number / Barcode:** 5902385965781

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland



**Alert number:** A12/00015/20

**Product:** Plastic ball

**Name:** Pilka

**Risk type:** Chemical

**Category:** Toys

**Brand:** TOYS Group

**Type / number of model:** TG406393- 3080

**Type of alert:** Products with serious risks

The toy contains diisobutyl phthalate (DIBP) (measured value more than 50% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive.

Withdrawal of the product from the market

**Description:** Plastic ball with pendant attached.

**Batch number / Barcode:** 5902553815122

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland



**Alert number:** A12/00021/20

**Product:** Plastic toy set

**Name:** Battle Royale Collection

**Risk type:** Chemical, Environment

**Category:** Toys

**Brand:** EPIC Games, Fortnite

**Type / number of model:** 63519, 63519-00/03/11-R1, Amazon nr B07JKVTNM4

**Type of alert:** Products with serious risks

The plastic material of the figures contains short chain chlorinated paraffins (SCCPs) and an excessive amount of bis(2-ethylhexyl) phthalate (DEHP)(measured values up to: 0.50 % and 25 % by weight, respectively).

DEHP is a phthalate and may harm the health of children, causing possible damage to their reproductive system. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment. The product does not comply with the REACH and Persistent Organic Pollutants (POP) Regulations.


Removal of this product listing by the online marketplace

**Description:** Set of four plastic action figures from the videogame Fortnite with 8 armor and guns accessories and 4 figure bases.

**Batch number / Barcode:** 630996635193

**Country of origin:** People's Republic of China

**Alert submitted by:** Sweden

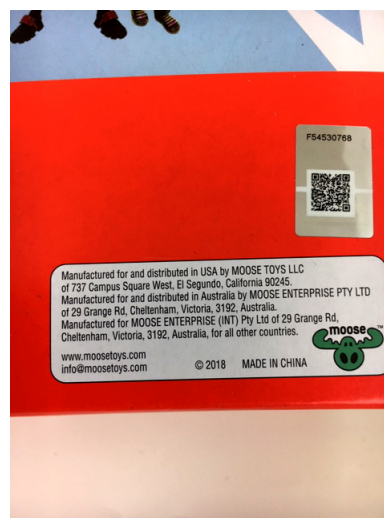

**Alert number:** A12/00029/20

**Product:** Plastic doll

**Name:** GIRL BEAUTIFUL/Flower language

**Risk type:** Chemical

**Category:** Toys

**Brand:**

**Type / number of model:** N° 097

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains an excessive amount of di-(2-ethylhexyl) phthalate (DEHP) (measured value up to 46.7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive organs.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll about 15 cm tall.

**Batch number / Barcode:** 8590042112639

**Country of origin:** People's Republic of China

**Alert submitted by:** Czechia



**Alert number:** A12/00047/20

**Product:** Plastic Doll

**Name:** Sweet Fashion

**Risk type:** Chemical

**Category:** Toys

**Brand:**

**Type / number of model:**

**Type of alert:** Products with serious risks

The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP)(measured values: 35.5 % by weight).

This phthalate may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.


Recall of the product from end users

**Description:** Plastic doll depicting the character of Elsa from the movie 'Frozen'.The doll wears wearing different coloured outfits.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** United Kingdom

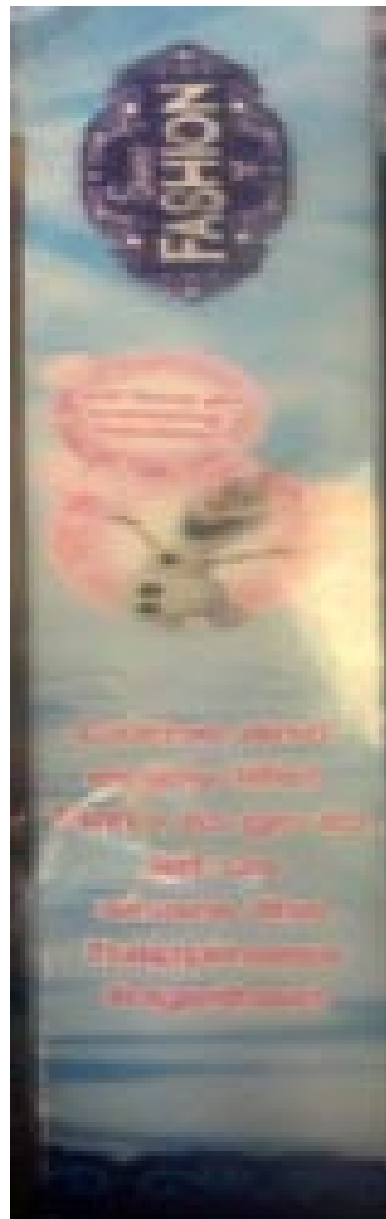

**Alert number:** A12/00052/20

**Product:** Toy slime

**Name:** Blue

**Risk type:** Chemical

**Category:** Toys

**Brand:** Crystal Slime

**Type / number of model:**

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high (measured value up to 1450 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Ban on the marketing of the product and any accompanying measures

**Description:** Small plastic container with blue crystal slime.

**Batch number / Barcode:**

**Country of origin:** Unknown

**Alert submitted by:** United Kingdom



**Alert number:** A12/00054/20

**Product:** Plastic balls

**Name:** Pilka

**Risk type:** Chemical

**Category:** Toys

**Brand:** Gazelo Toys

**Type / number of model:** Z5221-Z5221-2412

**Type of alert:** Products with serious risks

The plastic material of the product contains an excessive amount of dibutyl phthalate (DBP)(measured value: 0.21 % by weight).

This phthalate may harm the health of children, causing possible damage to their reproductive system. The product does not comply with the REACH Regulation.


Withdrawal of the product from the market

**Description:** Set of three plastic balls with spikes. Packaging: net bag.

**Batch number / Barcode:** 5907773991793

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland

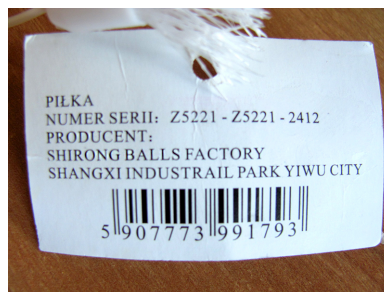

**Alert number:** A12/00058/20

**Product:** Wooden toy

**Name:** Magic Ball

**Risk type:** Strangulation

**Category:** Toys

**Brand:** little tikes

**Type / number of model:** 401908

**Type of alert:** Products with serious risks

The toy's elastic cord is too long and may form a loop. It might tighten around the child's neck and lead to strangulation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Ban on the marketing of the product and any accompanying measures

**Description:** Wooden baby toy with elastic cords, packed in cardboard box

**Batch number / Barcode:** 5713428004639

**Country of origin:** People's Republic of China

**Alert submitted by:** Finland



**Alert number:** A12/00063/20

**Product:** Plastic doll

**Name:** my first FASHION PERFECT lovely

**Risk type:** Chemical

**Category:** Toys

**Brand:** lovely

**Type / number of model:** N0 969

**Type of alert:** Products with serious risks

The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: up to 8.7 % by weight.)

This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll about 17 cm tall; AGES 3+.

**Batch number / Barcode:** 8598801800001

**Country of origin:** People's Republic of China

**Alert submitted by:** Czechia



**Alert number:** A12/00064/20

**Product:** Soft Musical Toy

**Name:** Forest Friends

**Risk type:** Strangulation

**Category:** Toys

**Brand:** Canpol babies

**Type / number of model:** CODE 0180430, N0 68/048\_pin

**Type of alert:** Products with serious risks

The cord attached to the toy is too long. The cord can wrap around child's neck and become trapped, leading to strangulation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** An owl-shaped soft musical toy with cord attached. Packaging: foil bag

**Batch number / Barcode:** EAN 5901691811546

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland



**Alert number:** A12/00057/20

**Product:** hair-dye

**Name:** KPEM-XHA

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Fitocosmetic

**Type / number of model:** TY 9158-019-59830731-2014

**Type of alert:** Products with serious risks

The product contains preservative 2-phenoxyethanol (measured value: 1.4%) that may cause sensitization, irritation, contact allergic reactions. Phenoxyethanol is haematotoxic and a mild irritant, and may damage blood and liver.

The product does not comply with Regulation (EC) No 1223/2009 of the European Parliament and of the Council of 30 November 2009 on cosmetic products.

Withdrawal of the product from the market

**Description:** Natural Iranian henna cream with burdock oil

**Batch number / Barcode:** 4607051797055

**Country of origin:** Lao People's Democratic Republic

**Alert submitted by:** Lithuania



**Alert number:** A12/00025/20

**Product:** Oil lamp

**Name:** Haze Oil lamp

**Risk type:** Chemical

**Category:** Decorative articles

**Brand:** House Doctor

**Type / number of model:** 206062

**Type of alert:** Products with serious risks

The lamp may leak oil when being tilted. Lamp oils can be harmful if swallowed or inhaled. The user or a child could become exposed to the oil and get poisoned.

The product does not comply with the REACH Regulation and the relevant European Standard EN 14059.

Withdrawal of the product from the market

**Description:** Black cylindrical oil lamp, operated with paraffin oil.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** Sweden





**Alert number:** A12/00033/20

**Product:** Hairdryer

**Name:** 3000W High Power

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** PluieSoleil

**Type / number of model:** CF-JXZ

**Type of alert:** Products with serious risks

The handle can be easily bent, giving access to the live parts of the product. A user could consequently receive an electric shock.

The product does not comply with requirements of the Low Voltage Directive and the relevant European standards EN 60335-1 and EN 60335-2-23.

Destruction of the product

**Description:** Black plastic hairdryer. Black packaging with coloured accessories.

**Batch number / Barcode:** X0010NL93L

**Country of origin:** People's Republic of China

**Alert submitted by:** United Kingdom



**Alert number:** A12/00035/20

**Product:** Kettle

**Name:** Electric Kettle

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** BLUPOP

**Type / number of model:** BEN203KS

**Type of alert:** Products with serious risks

The mains plug has incorrect dimensions and is not adequately earthed. A person can consequently touch live parts when inserting the plug into a socket and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60335-2-15.

Removal of this product listing by the online marketplace

**Description:** Stainless steel kettle with black lid, handle and base.

**Batch number / Barcode:**

**Country of origin:** Unknown

**Alert submitted by:** United Kingdom



**Alert number:** A12/00036/20

**Product:** Steamer

**Name:** Handy Steamer

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Steam Magic

**Type / number of model:** BI-55

**Type of alert:** Products with serious risks

The supply cord is not protected against excessive flexing and can consequently split, exposing live parts. A user could consequently receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-2-3.

Withdrawal of the product from the market

**Description:** Domestic steam iron fitted with a C18 appliance inlet. The item was supplied with a separate mains to C13 supply cord.

**Batch number / Barcode:**

**Country of origin:** Unknown

**Alert submitted by:** United Kingdom



**Alert number:** A12/00038/20

**Product:** USB charger

**Name:** Universal AC Adapter

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Makant

**Type / number of model:** Product Nr. 1154

**Type of alert:** Products with serious risks

The clearance/creepage distances between the primary and accessible secondary circuits are not sufficient. Consequently, the accessible USB ports could become live, leading to an electric shock if touched by the user.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.


Recall of the product from end users

**Description:** USB charger in grey and black colour. Input: AC 100 -230 V, 50/ 60 Hz; output: DC 5V, 10000 mA.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** Finland

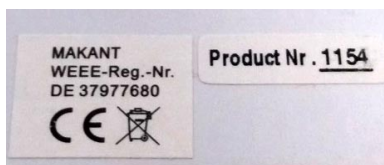

**Alert number:** A12/00043/20

**Product:** Vegetable Spiralizer

**Name:** 2-in-1 Spiralizer

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** HOFFEN

**Type / number of model:** SP-3108

**Type of alert:** Products with serious risks

Elements of processed food can enter into the device and come in contact with live parts. As a result, the user may receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-2-14.

Withdrawal of the product from the market

**Description:** 2-in-1 Spiralizer destined for vegetable processing. Packaging: cardboard box.

**Batch number / Barcode:** 5609288140573

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland



**Alert number:** A12/00059/20  
**Product:** Laptop power supply  
**Name:** notebook power supply  
**Risk type:** Burns, Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** akyga  
**Type / number of model:** AK-ND-44  
**Type of alert:** Products with serious risks

The electrical insulation is inadequate and the product can overheat. This can consequently lead to an electric shock or burns.

The product does not comply with the requirements of the Low Voltage Directive.

Withdrawal of the product from the market

**Description:** Black notebook power supply.

**Batch number / Barcode:** 5901720133755

**Country of origin:** People's Republic of China

**Alert submitted by:** Lithuania



**Alert number:** A11/00005/20  
**Product:** Self-balancing scooter (hoverboard)  
**Name:** P10X Hoverboard  
**Risk type:** Fire  
**Category:** Hobby/sports equipment  
**Brand:**

**Type / number of model:** FCA131-4220 (charger)

**Type of alert:** Products with other risk levels

The charger lacks an adequate over-current protection device and the creepage and clearance distances between its primary and accessible secondary circuits are insufficient.

Consequently, the user could receive an electric shock or cause the product to overheat leading to fire. The product does not comply with the requirements of the Low Voltage and Machinery Directives and the relevant European Standards EN 62368-1.


Withdrawal of the product from the market

**Description:** Off road multicoloured self-balancing two wheeled hoverboard for use as a personal transport device.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** United Kingdom

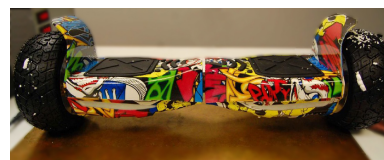

**Alert number:** INFO/00005/20

**Product:** Saddle cover

**Name:**

**Risk type:** Environment

**Category:** Hobby/sports equipment

**Brand:**

**Type / number of model:**

**Type of alert:** Products with other risk levels

The material of the product d contains short chain chlorinated paraffins (SCCPs) (measured value up to 1.3 % by weight).

The placing on the market and use of articles containing SCCPs is banned. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. The product does not comply with the Regulation on Persistent Organic Pollutants.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Purple saddle cover made in PVC.

**Batch number / Barcode:**

**Country of origin:** Unknown

**Alert submitted by:** Sweden



**Alert number:** A11/00002/20

**Product:** Floor lamp

**Name:**

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** EMIBIG

**Type / number of model:** Narta LP2 Wenge 249/LP2

**Type of alert:** Products with other risk levels

The insulation between the cables and the external metal housing (which has sharp edges) is inadequate.

As a consequence, accessible parts could become live, and the user receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.



Making the marketing of the product subject to prior conditions

**Description:** Standing floor lamp with to 2 bulbs screws.

**Batch number / Barcode:** 5901738886414

**Country of origin:** Poland

**Alert submitted by:** Poland

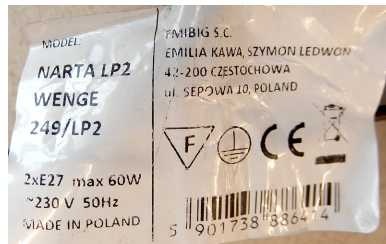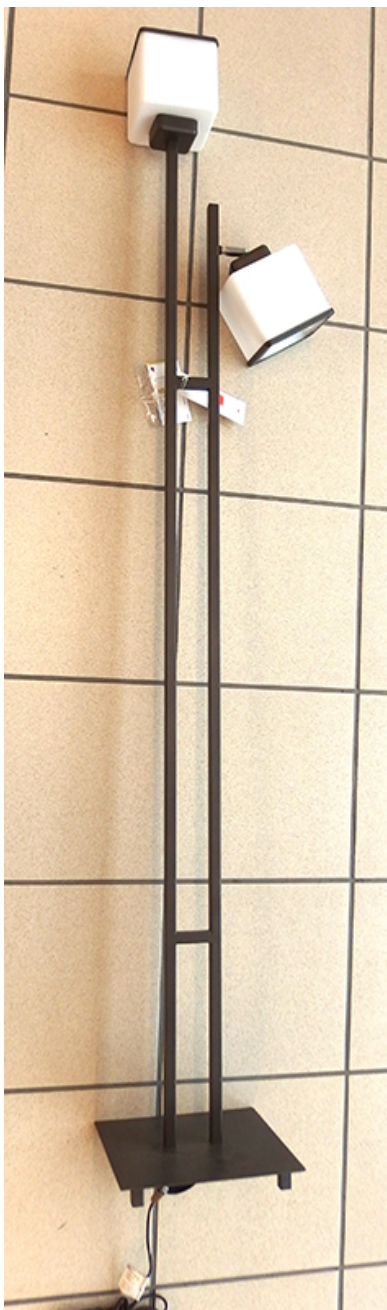

**Alert number:** A11/00003/20

**Product:** Floor lamp

**Name:**

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** EMIBIG

**Type / number of model:** Bingo LP2 727/LP2

**Type of alert:** Products with other risk levels

The insulation between the cables and the external metal housing (which has sharp edges) is inadequate.

As a consequence, accessible parts could become live, and the user receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.


Making the marketing of the product subject to prior conditions

**Description:** Standing floor lamp.

**Batch number / Barcode:** 5901738881310

**Country of origin:** Poland

**Alert submitted by:** Poland

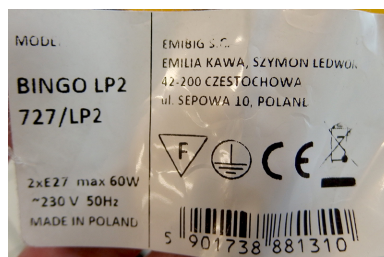

**Alert number:** A11/00004/20

**Product:** Floor lamp

**Name:**

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** EMIBIG

**Type / number of model:** Altro LP2 507/LP2

**Type of alert:** Products with other risk levels

The insulation between the cables and the external metal housing (which has sharp edges) is inadequate.

As a consequence, accessible parts could become live, and the user receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Making the marketing of the product subject to prior conditions

**Description:** Standing floor lamp.

**Batch number / Barcode:** 5901738881051

**Country of origin:** Poland

**Alert submitted by:** Poland





**Alert number:** INFO/00003/20

**Product:** Mobile phone case

**Name:**

**Risk type:** Chemical

**Category:** Other

**Brand:**

**Type / number of model:**

**Type of alert:** Products with other risk levels

The leather of the product contains hexavalent chromium and an excessive amount of lead (measured values up to: 4 mg/kg and 0,2 % by weight, respectively).

Chromium (VI) is sensitising and can trigger allergic reactions. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children. The product does not comply with the REACH Regulation. Recall of the product from end users, Withdrawal of the product from the market

**Description:** Brown leather case for Iphone 5/5S/SE. The product was sold online.

**Batch number / Barcode:** 5712579107770

**Country of origin:** People's Republic of China

**Alert submitted by:** Sweden



**Alert number:** INFO/00004/20

**Product:** Mobile phone case

**Name:**

**Risk type:** Chemical

**Category:** Other

**Brand:**

**Type / number of model:**

**Type of alert:** Products with other risk levels

The material of the product contains an excessive amount of lead (measured value up to: 0,38% by weight).

Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children. The product does not comply with the REACH Regulation.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Phone case in red leather intended for a Samsung Galaxy S6. The product was sold online.

**Batch number / Barcode:** 5712579564061

**Country of origin:** People's Republic of China

**Alert submitted by:** Sweden



**Alert number:** A11/00001/20

**Product:** Washing machine

**Name:**

**Risk type:** Fire

**Category:** Electrical appliances and equipment

**Brand:** Hotpoint, Indesit

**Type / number of model:** FML 742P UK, WMAOD 743G UK, WMAOD 743P UK, WMAQB 721P UK.M, WMAQC 641P UK.M, WMAQC 741G UK, WMAQC 741P UK, WMAQC 741P UK.M, WMAQF 621G UK, WMAQF 621P UK, WMAQF 641 P UK.M, WMAQF 721G UK, WMAQF 721P UK.M, WMAQL 621G UK, WMBF 742G UK, WMBF 742K UK, WMBF 742P UK, WMBF 742P UK.M, WMEF 722 BC UK, WMEF 742 P UK, WMEUF 722P UK, WMEUF 743G UK, WMEUF 743P UK, WMFG 741P UK, WMFG 741P UK.M, WMFUG 742 P UK.M, WMFUG 742G UK, WMFUG 742P UK, WMFUG 842P UK.M, WMJLF 842P UK, WMJLL 742P UK, WMSAQG 621P UK, WMXTF 742G UK, WMXTF 742K UK, WMXTF 742P UK, WMXTF 742P UK.M, WMXTF 842P UK.M, WMYL 7151PS UK, XWA 81252X K UK, XWA 81252X W UK, XWD 71452X K UK

**Type of alert:** Products with other risk levels

Due to fretting corrosion between connectors of the harness and door lock terminals, the door lock connection can overheat. Under certain circumstances, this can lead to a fire.

The product does not comply with the requirements of the Low Voltage Directive.

Recall of the product from end users, Warning consumers of the risks

**Company recall page:** <http://washingmachinerecall.whirlpool.co.uk> (<http://washingmachinerecall.whirlpool.co.uk>)

**Description:** Front-loading washing machines manufactured between October, 2014 and February, 2018.

**Batch number / Barcode:**

**Country of origin:** Poland

**Alert submitted by:** United Kingdom

