



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

Week 24 - 2020

A12/00861/20: On request of the notifying authority the notification has been updated with two voluntary measures by the distributor, the number of affected units, the recall notice of the product and an updated distribution list.

**Alert number:** A12/00859/20

**Product:** Laser pointer

**Name:** Wireless Presenter - ultra slim - puntero

**Risk type:** Damage to sight

**Category:** Laser pointers

**Brand:** TRUST

**Type / number of model:** 20430-02

**Type of alert:** Products with serious risks

The laser beam is too powerful and lacks the necessary labelling. Direct viewing of the laser beam could cause damage to sight. / The product does not comply with the requirements of the Radio Equipment Directive and the relevant European Standard EN 60825-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Laser pointer (with red laser)

**Batch number / Barcode:** 8713439204308

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** France



**Alert number:** A12/00857/20

**Product:** Vehicle lift

**Name:**

**Risk type:** Injuries

**Category:** Machinery

**Brand:** Launch

**Type / number of model:** TLT235SB

**Type of alert:** Products with serious risks

The latch of the product might fail, causing the carrying device to fall, leading to injuries. The lifting arm, nips of the lifting chains and ropes lack the appropriate protective element. Consequently, the feet or hands of the user could become trapped leading to injuries. There is no protection of the hoses and against hydraulic fluid spray. If the hydraulic fluid hose is damaged, the high pressure fluid may cause injuries to the operator. The product's pressure gauge and pressure relief valve did not properly work. This could lead to excessive pressure of the hydraulic system of the lift, causing hydraulic fluid to leak under high pressure, causing injuries to a person close the lift. The carrying device is not stable enough. Consequently, while lowering a vehicle, it inadvertently move, leading to injuries to persons close to the vehicle. Moreover, there is no limiting of the lowering speed, which could result in a fast descend of the lift, causing injuries to a person close to or underneath the lift. / The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 1493.

Recall of the product from end users

**Description:** Red vehicle hydraulic lift for up to 3500 kg, with two support columns.

**Batch number / Barcode:**

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Finland



**Alert number:** A12/00870/20

**Product:** Vehicle scissor lift

**Name:**

**Risk type:** Injuries

**Category:** Machinery

**Brand:** Biltema

**Type / number of model:** 15-8406

**Type of alert:** Products with serious risks

The latch of the product might fail, causing the carrying device to fall, leading to injuries. The product lacks the appropriate protective element. Consequently, the feet or hands of the user could become trapped leading to injuries. There is no protection of the hoses and against hydraulic fluid spray. If the hydraulic fluid hose is damaged, the high pressure fluid may cause injuries to the operator. The product's pressure gauge and pressure relief valve did not properly work. This could lead to excessive pressure of the hydraulic system of the lift, causing hydraulic fluid to leak under high pressure, causing injuries to a person close the lift. The carrying device is not stable enough. Consequently, while lowering a vehicle, it inadvertently move, leading to injuries to persons close to the vehicle. / The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 1493.

Recall of the product from end users

**Description:** Mobile blue vehicle hydraulic scissor lift for up to 3000 kg.

**Batch number / Barcode:**

**NO**

**Country of origin:** Unknown

**Alert submitted by:** Finland



**Alert number:** A12/00849/20

**Product:** Passenger car

**Name:** A4, A6, A8, TT

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Audi

**Type / number of model:** Type-approval numbers: e1\*96/27\*0051\*, e1\*93/81\*0005\*, e1\*93/81\*0013\*, e1\*98/14\*0089\*, e1\*92/53\*0002\*; Types: 4B, D2, B5, 8N, 89

**Type of alert:** Products with serious risks

The ammonium nitrate propellant used in the airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, it may underinflate or the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants. /

Recall of the product from end users

**Description:** Vehicles equipped with Takata NADI (Non-Azide Driver Inflator) airbag inflator.

**Batch number / Barcode:** 69AE

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00850/20

**Product:** Passenger car

**Name:** E-Class

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Type-approval number: e1\*2007/46\*1666\*13, Type: R1EC

**Type of alert:** Products with serious risks

The seat belt on the left-hand front seat may not have been fitted correctly and can be damaged by coming into contact with sharp-edged metal parts. This will impair its restraint function, increasing the risk of injury in the event of an accident. /

Recall of the product from end users

**Description:** E-Class coupé/cabriolet vehicles, model series BR 238.

**Batch number / Barcode:** 9190205

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00851/20

**Product:** Passenger car

**Name:** Passat, Golf

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** VW

**Type / number of model:** Type-approval numbers: e1\*98/14\*0043\*, e1\*98/14\*0070, Types: 3B, 1E

**Type of alert:** Products with serious risks

The ammonium nitrate propellant used in the airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, it may underinflate, or the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants. /

Recall of the product from end users

**Description:** Vehicles equipped with Takata NADI (Non-Azide Driver Inflator) airbag inflator.

**Batch number / Barcode:** 69AR

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00852/20

**Product:** Passenger car

**Name:** 3er

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** BMW

**Type / number of model:** Type-approval numbers: e1\*98/14\*0097, e1\*98/14\*0144, e1\*2001/116\*0144, e1\*98/14\*0167, e1\*2001/116\*0167, e1\*98/14\*0112, e1\*2001/116\*0112, e1\*98/14\*0146, e1\*2001/116\*0146, Types: 346L, 346X, 346K, 346C, 346R

**Type of alert:** Products with serious risks

The ammonium nitrate propellant used in the airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, it may underinflate, or the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants. /

Recall of the product from end users

**Description:**

**Batch number / Barcode:** 0032960200, 0032970200, 0032980200

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Slovenia

**Alert number:** A12/00853/20

**Product:** Passenger car

**Name:** B, Xedos

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mazda

**Type / number of model:** Type-approval numbers: e13\*95/54\*0002\*01, K270\*00-\*02, Types: TA, UN

**Type of alert:** Products with serious risks

The ammonium nitrate propellant used in the airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, it may underinflate, or the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants. /

Recall of the product from end users

**Description:**

**Batch number / Barcode:** AL003A, AL003B

**NO**

**Country of origin:** Japan

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Slovenia

**Alert number:** A12/00854/20

**Product:** Passenger car

**Name:** AMG GT

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Type-approval number: e1\*2007/46\*0233\*15 to 17 Type: 197

**Type of alert:** Products with serious risks

An earth cable may be missing from the wiring harness of the communication module, which will cause the earth connection to run via the shielding of the microphone. This will impair the proper functioning of the communication module, increasing the risk that emergency call could not be made. /

Recall of the product from end users

**Description:** Model series BR190.

**Batch number / Barcode:** 5491018

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00855/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Expert, Traveller

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0532\*01 to \*05, e2\*2007/46\*0533\*01 to \*06 Type: V

**Type of alert:** Products with serious risks

The rear brake hoses may be attached incorrectly and can be damaged. This will impair the braking performance, increasing the risk of an accident. /

Recall of the product from end users

**Description:**

**Batch number / Barcode:** JNL

**NO**

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Ireland, Poland

**Alert number:** A12/00856/20

**Product:** Bus

**Name:** Citaro

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Evobus

**Type / number of model:** Models: 628 02, 628 03 , Type-approval numbers: e1\*2007/46\*0087, e1\*2007/46\*0090

**Type of alert:** Products with serious risks

The prop for the gas cover may come into contact with a gas pipe and damage it. There would then be a risk of gas escaping. /

Recall of the product from end users

**Description:** Bus

**Batch number / Barcode:** 65.10M20098A

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00871/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Jumpy, Spacetourer

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroen

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0530\*07 to \*09, e2\*2007/46\*0531\*04 to \*07, Type: V

**Type of alert:** Products with serious risks

The bolts attaching the seat belts have not been tightened correctly. This will impair the seat belts' protective function, increasing the risk of an injury in the event of an accident. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle.

**Batch number / Barcode:** HBB

**NO**

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland, Slovenia

**Alert number:** A12/00872/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Spacetourer, Jumpy

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroen

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0530\*08, e2\*2007/46\*0530\*10, e2\*2007/46\*0530\*11, e2\*2007/46\*0531\*06, e2\*2007/46\*0531\*07; Type: V

**Type of alert:** Products with serious risks

The front wheel arches may be inadequately sealed, allowing moisture to ingress. This can cause electronic components such as the airbags to malfunction. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle.

**Batch number / Barcode:** HBT

**NO**

**Country of origin:** United Kingdom

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00873/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Jumpy, Spacetourer

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroen

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0530\*01 to \*05, e2\*2007/46\*0531\*00 to \*06, Type: V

**Type of alert:** Products with serious risks

The rear brake hoses have been incorrectly attached and may be damaged. As a result, the braking performance will be impaired, increasing the risk of an accident. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle.

**Batch number / Barcode:** GVK

**NO**

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00874/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Expert, Traveller

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0532\*05 to \*09, e2\*2007/46\*0533\*04 to \*07 Type: V

**Type of alert:** Products with serious risks

The bolts on the safety belts are not correctly screwed. This can impair the safety belts' restraining effect, increasing the risk of injury in the event of an accident. /

Recall of the product from end users

**Description:**

**Batch number / Barcode:** JUG

**NO**

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00875/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Expert, Traveller

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0532\*10, e2\*2007/46\*0533\*06 to \*09 Type: V

**Type of alert:** Products with serious risks

The front wheel arches may be inadequately sealed, allowing moisture to ingress. This can cause electronic components such as the airbags to malfunction. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle.

**Batch number / Barcode:** JVB

**NO**

**Country of origin:** United Kingdom

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00876/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Jumpy, Spacetourer

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroen

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0530\*07 to \*09, e2\*2007/46\*0531\*05 to \*07 Type: V

**Type of alert:** Products with serious risks

The rear brake callipers can be defective. This will impair the functioning of the parking brake, increasing the risk of an accident. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle.

**Batch number / Barcode:** HBC

**NO**

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00877/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Expert, Traveller

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0532\*07 and \*09, e2\*2007/46\*0533\*02, \*05, \*06 and \*07, Type: V

**Type of alert:** Products with serious risks

The rear brake callipers can be defective. This will impair the functioning of the parking brake, increasing the risk of an accident. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle.

**Batch number / Barcode:** JUH

**NO**

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/00878/20

**Product:** Passenger car

**Name:** Bentayga V8

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Bentley

**Type / number of model:** e11\*2007\*/46\*3609\*

**Type of alert:** Products with serious risks

The fuel low-pressure hose quick connect located in the engine compartment can overheat and consequently to soften, allowing fuel to leak. Fuel leakage close to a source of ignition increases the risk of fire. /

Recall of the product from end users

**Description:** Passenger car equipped with a V8 petrol engine.

**Batch number / Barcode:** RE20/14 (RB56)

**NO**

**Country of origin:** United Kingdom

**Alert submitted by:** United Kingdom

**Alert number:** A12/00879/20

**Product:** Passenger car

**Name:** Q3

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Audi

**Type / number of model:** Type-approval number: e1\*2007/46\*1900\*, Type: F3

**Type of alert:** Products with serious risks

The breaking point for the release of the front passenger airbag in the console may not have been fabricated correctly. As a result, the airbag may not penetrate the console as required in the event of deployment. This will impair its restraining and protective functions, increasing the risk of an injury. /

Recall of the product from end users

**Description:** Passenger car.

**Batch number / Barcode:** 70H7

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00863/20

**Product:** Protective coverall

**Name:**

**Risk type:** Health risk / other

**Category:** Protective equipment

**Brand:** Minateks

**Type / number of model:**

**Type of alert:** Products with serious risks

The material of the product is permeable to sprayed liquids. Consequently, contagious fluids could penetrate the material allowing microorganisms to cross the coverall, increasing the risk of infection. / The product does not comply with the Personal Protective Equipment Regulation and the relevant European standards EN 14126 and EN 14605.

Ban on the marketing of the product and any accompanying measures


**Description:** Protective coverall of type 4 according to EN 14126 and EN 14605, indicated against microbial contamination.

**Batch number / Barcode:**

**UNKNOWN**

**Country of origin:** Unknown

**Alert submitted by:** Poland

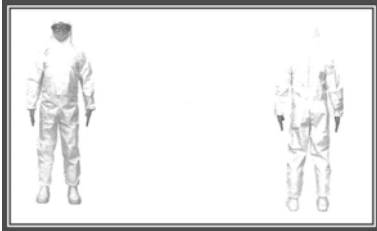



**Alert number:** A12/00862/20

**Product:** Child bicycle seat

**Name:**

**Risk type:** Choking, Cuts, Entrapment, Injuries

**Category:** Childcare articles and children's equipment

**Brand:** BONIN

**Type / number of model:** CURIOSO

**Type of alert:** Products with serious risks

The fastening rivet of the upholstery can easily be detached, generating a small part. A small child may put it in the mouth and choke on it. The effectiveness of the restraint system is inadequate and the child may fall out of the seat and the strength and durability of the seat is insufficient. Moreover, there are sharp edges and accessible gaps which can lead to cuts or entrapment of fingers. / The product does not comply with the relevant European standard EN 14344.

Withdrawal of the product from the market

**Description:** Child bicycle seat made of plastic with upholstery.


**Batch number / Barcode:** 8055320657450

**NO**

**Country of origin:** Italy

**Alert submitted by:** Croatia

**Products were found and measures were taken also in:** Slovenia

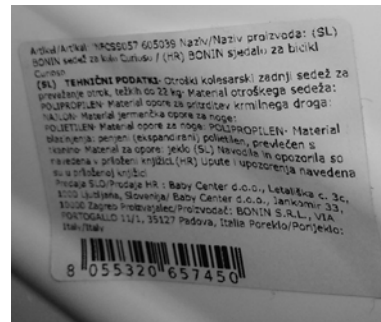

**Alert number:** A12/00866/20

**Product:** Fireworks

**Name:** Exhibition

**Risk type:** Burns

**Category:** Pyrotechnic articles

**Brand:** Tristar SD

**Type / number of model:** S5701

**Type of alert:** Products with serious risks

The battery is unstable and does not stay upright during functioning: it is possible that it falls on its side, shooting remaining shots from this position. As a consequence, burning projectiles could hit persons, causing burns. / The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

Recall of the product from end users


**Description:** Battery of single shot tubes (19 shots). Dimensions: length = 135mm, width = 90mm, height = 173mm. Lit with a single wick.

**Batch number / Barcode:** 5425017851653

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Belgium

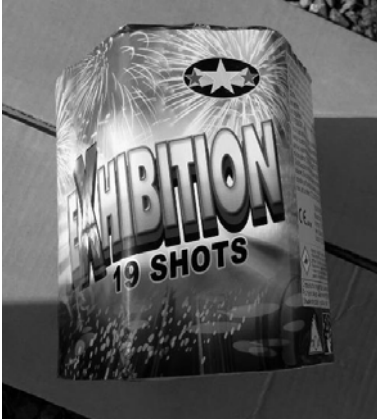

**Alert number:** A12/00847/20

**Product:** Toy slime

**Name:** Slime - Glow in the dark

**Risk type:** Chemical

**Category:** Toys

**Brand:** Nickelodeon

**Type / number of model:** 507971 204194

**Type of alert:** Products with serious risks

The migration of strontium from the toy is too high (measured value: 1700 mg/kg). Ingestion or contact with an excessive quantity of strontium may harm the health of children by impairing the normal development of their skeleton and irritating their skin. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Ban on the marketing of the product and any accompanying measures


**Description:** 80 g green toy slime that glows in the dark.

**Batch number / Barcode:** 6 412167 005950

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Finland

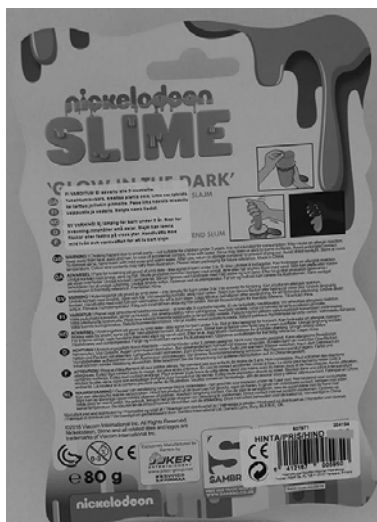

**Alert number:** A12/00864/20

**Product:** Toy slime

**Name:** Xtreme Glitterz

**Risk type:** Chemical

**Category:** Toys

**Brand:** Orb Slimy

**Type / number of model:** TP-508402

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high (measured value up to 1100 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Ban on the marketing of the product and any accompanying measures

**Description:** Red toy slime with glitter. The glitter is in many different shapes and colours.

**Batch number / Barcode:** 6412163012952

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Finland



**Alert number:** A12/00865/20

**Product:** Plastic doll with accessories

**Name:** Charm Girl

**Risk type:** Chemical

**Category:** Toys

**Brand:**

**Type / number of model:** N0. 826

**Type of alert:** Products with serious risks

The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP), di-'isononyl' phthalate (DINP) (measured values: 30.4% , 0.81 % and 1% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system and liver. / The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll with accessories.

**Batch number / Barcode:** 0753626420430

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Germany



**Alert number:** A12/00858/20

**Product:** Baby wet wipes

**Name:** Baby wet wipes

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Melani

**Type / number of model:** Contains Aloe Vera & Vitamin E

**Type of alert:** Products with serious risks

According to the list of ingredients the product contains a mixture of the preservatives methylchloroisothiazolinone and methylisothiazolinone (MCI and MI), which are forbidden in leave-on cosmetics. Dermal contact with MCI and MI containing products can provoke allergic contact dermatitis to sensitised persons. / The product does not comply with the Cosmetic Products Regulation.

Ban on the marketing of the product and any accompanying measures

**Description:** Baby wet wipes for cleaning the skin.

**Batch number / Barcode:** 3 800200 580381

**NO**

**Country of origin:** Bulgaria

**Alert submitted by:** Bulgaria



**Alert number:** A12/00861/20

**Product:** Skin-lightening product

**Name:** Caro bright+ Lemon

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** BSQ

**Type / number of model:**

**Type of alert:** Products with serious risks

The product contains an unsafe amount of kojic acid (measured value: 2.95 %). Kojic acid can affect the balance of the thyroid system and also induce skin sensitisation, when used at high concentrations on hand and face, or if used on large areas of skin. / The product does not comply with the Cosmetic Products Regulation.

Recall of the product from end users, Stop of sales, Stop of sales


**Description:** 500 ml of skin lightening yellow body lotion with lemon scent.

**Batch number / Barcode:**

**UNKNOWN**

**Country of origin:** The Netherlands

**Alert submitted by:** Germany

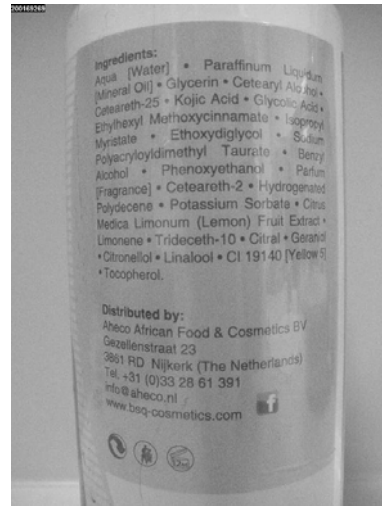

**Alert number:** A12/00867/20

**Product:** Sunscreen

**Name:** mlieko na opalovanie

**Risk type:** Health risk / other

**Category:** Cosmetics

**Brand:** NUBIAN 15

**Type / number of model:** Rakytníkový olej, Betakaroten, D-Panthenol; Vitamin E, SPF 15, Water and sand resistant

**Type of alert:** Products with serious risks

The actual protection factor of the sunscreen is lower than declared (measured value: SPF 9.1). Consequently, the user might be under-protected against UV radiation increasing the risk of sunburns or skin cancer. / The product does not comply with the Cosmetic Products Regulation.

Withdrawal of the product from the market

**Description:** 200 ml of sunscreen lotion with protection factor SPF 15 (UVA/UVB).

**Batch number / Barcode:** 8 586000 081857

**UNKNOWN**

**Country of origin:** Slovakia

**Alert submitted by:** Czechia



**Alert number:** A12/00868/20

**Product:** Perfume

**Name:** KEEN ZONET

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Beautiful Parfum

**Type / number of model:** N°:9806-23

**Type of alert:** Products with serious risks

The perfume contains the fragrances geraniol, citronellol, hexyl cinnamal, linalool, hydroxyisohexyl 3-cyclohexene carboxaldehyde, alpha-isomethyl ionone, butylphenyl methylpropional, eugenol, benzyl alcohol and d-limonene (measured values: 0.12 %, 0.096 %, 0.067 %, 0.062 %, 0.045 %, 0.026 %, 0.023 %, 0.011 %, 0.0072 % and 0.0031 % by weight, respectively). Since these substances, which can induce allergic reactions and sensitisation, are not indicated in the list of ingredients, consumers are not aware of their presence. / The product does not comply with the Cosmetic Products Regulation.

Withdrawal of the product from the market


**Description:** 55 ml of yellowish eau de parfum in a glass bottle, with built-in spray nozzle and a grey plastic cap.

**Batch number / Barcode:** 6 937926 316387

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Czechia

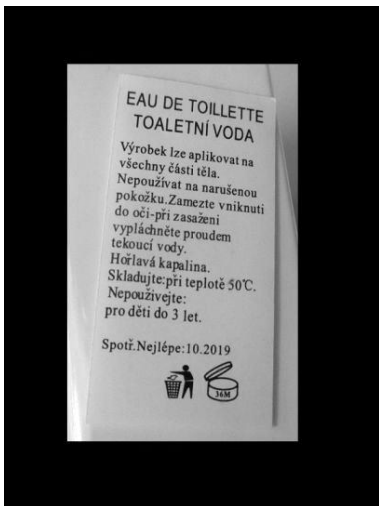

**Alert number:** A12/00869/20

**Product:** Perfume

**Name:** CHOCO MADEMOISELLE

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:**

**Type / number of model:**

**Type of alert:** Products with serious risks

The perfume contains the fragrances hexyl cinnamal, benzyl salicylate, citronellol, hydroxycitronellal, geraniol and coumarin (measured values: 0.065 %, 0.062 %, 0.045 %, 0.044 %, 0.038 % and 0.022 % by weight, respectively). Since these substances, which can induce allergic reactions and sensitisation, are not indicated in the list of ingredients, consumers are not aware of their presence. / The product does not comply with the Cosmetic Products Regulation.

Withdrawal of the product from the market

**Description:** 55 ml of pink eau de parfum in a glass bottle, with built-in spray nozzle and a silver plastic cap.

**Batch number / Barcode:** 7 369412 419613

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Czechia



**Alert number:** INFO/00070/20

**Product:** Adaptor

**Name:**

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** maxexcell

**Type / number of model:** art.3675

**Type of alert:** Products with other risk levels

Live parts of the product are accessible. The user could receive an electric shock. / The product does not comply with the relevant international standard CEI 23-50.

Other

**Description:** Universal adaptor for mobile phones.

**Batch number / Barcode:** 8058168036760

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Italy

