



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

# The Rapid Alert System for Non-Food Products (RAPEX)

## RAPEX - Weekly overview report of notifications

Week 29 - 2020

**Alert number:** A12/01051/20

**Product:** Nightlight for children

**Name:** Veilleuse à pile panda

**Risk type:** Chemical, Choking

**Category:** Lighting equipment

**Brand:** PANDY

**Type / number of model:** #EL 0562

**Type of alert:** Products with serious risks

The battery compartment can be easily opened, leaving the button batteries accessible. A child may put them in the mouth and swallow them, which could cause choking or damage to the child's gastrointestinal tract. / The product does not comply with the relevant European standard EN 60598

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Battery-powered nightlight (takes button-cell batteries) for children, in the form of a panda.

**Batch number / Barcode:** 5024418199014

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** France



**Alert number:** A12/0908/19

**Product:** Log splitter

**Name:** Fast log splitter

**Risk type:** Injuries

**Category:** Machinery

**Brand:** Preeco

**Type / number of model:** 7T

**Type of alert:** Products with serious risks

The two hand control does not function adequately. Thus the user may take his/her hand(s) in the splitting zone while using the machine. Furthermore, the emergency stop does not stop all movement, it stops only the engine. / The user's hand(s) may get caught in between the moving pressure plate/log and the splitting wedge of the machine, leading to injury.

Recall of the product from end users

**Description:** Kinetic log splitter. The product was sold online.

**Batch number / Barcode:**

NO

**Country of origin:** People's Republic of China

**Alert submitted by:** Finland



**Alert number:** A12/01024/20

**Product:** Motorcycle

**Name:** VITPILEN 701 , SVARTPILEN 701 and SVARTPILEN STYLE 701

**Risk type:** Burns, Fire

**Category:** Motor vehicles

**Brand:** Husqvarna

**Type / number of model:** 701 SVARTPILEN STYLE: Model year 2019, 701 SVARTPILEN: Model year 2019-2020, 701 VITPILEN: Model year 2018-2020,

**Type of alert:** Products with serious risks

The seal between the fuel pump and the fuel sensor might deform with time. Consequently, fuel could leak, which in the presence of an ignition source could lead to a fire and burns. /

Recall of the product from end users

**Description:** Motorcycle.

**Batch number / Barcode:** 07\_1776254

NO

**Country of origin:** Austria

**Alert submitted by:** Austria

**Products were found and measures were taken also in:** Greece

**Alert number:** A12/01025/20

**Product:** Lorry

**Name:** Work

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Streetscooter

**Type / number of model:** Models: B16C, B16, D16A, Type-approval numbers: e1\*2007/46\*1866\*01; e1\*2007/46\*1866\*02; e1\*KS07/46\*0056\*00; e1\*KS07/46\*0056\*01, e1\*KS07/46\*0070\*00

**Type of alert:** Products with serious risks

Due to a damage to the low-voltage battery charger and corrosion in the cable duct, smoke and heat may develop, thus causing scorching and fire. /

Recall of the product from end users

**Description:** Lorry

**Batch number / Barcode:**

NO

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/01036/20

**Product:** Passenger car

**Name:** TPEUGEOT 208II, 2008II, DS3 CROSSBACK

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** DS, Peugeot

**Type / number of model:** Type-approval: e2\*2007/46\*0639\*01, e2\*2007/46\*0639\*02, e2\*2007/46\*0639\*03, e2\*2007/46\*0639\*04, e2\*2007/46\*0639\*05, e2\*2007/46\*0639\*06, e2\*2007/46\*0639\*07, e2\*2007/46\*639\*08

**Type of alert:** Products with serious risks

The rear brake hoses may have been incorrectly routed. This could result in rupture of a hose, affecting the vehicle's braking performance and increasing the risk of an accident. /

Recall of the product from end users

**Description:** Peugeot 208 II VIN: VR3UBYHYJKT037089 to VR3UPMHDKT099265. Peugeot 2008 II VIN: VR3UDYHYJKJ838596 to VR3USHNSKLJ533853. DS3 CROSSBACK VIN: VR1UCYHZRKW031090 to VR1URHNLNLW000981

**Batch number / Barcode:** JTX - HAU

**NO**

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Greece, Ireland, Poland

**Alert number:** A12/01037/20

**Product:** Passenger car

**Name:** 508II, DS7 crossback

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** e2\*2007/46\*0628\*04, e2\*2007/46\*0628\*05, e2\*2007/46\*0628\*06, e2\*2007/46\*0628\*07, e2\*2007/46\*0601\*07, e2\*2007/46\*0601\*09, e2\*2007/46\*0601\*10

**Type of alert:** Products with serious risks

Some fixing screws in the rear axle could break, resulting in the rear wheels giving away and a loss of control over the vehicle. /

Recall of the product from end users

**Description:** VIN: VR3F35GFTKY194589 to VR3FJEHZRLY008206 / VIN: VR1J45GGUKY212007 to VR1J4EGZDMY000131

**Batch number / Barcode:** JWX & HDD

**NO**

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Greece, Poland

**Alert number:** A12/01038/20

**Product:** Motorcycle

**Name:** NINJA ZX-10R, NINJA ZX-10RR

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Kawasaki

**Type / number of model:** e4\*168/2013\*00091, Type: ZXT02E

**Type of alert:** Products with serious risks

Misprogramming of the engine control unit (ECU) may result in 'after-fire' of the engine at high engine load and simultaneous use of the Kawasaki Quick Shifter (KQS). This may cause damage to the engine and lead to fire due to the high temperature of the exhaust gas. /

Recall of the product from end users

**Description:** Motorcycle

**Batch number / Barcode:** DAJ88

**NO**

**Country of origin:** Japan

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Greece, Poland, Slovenia

**Alert number:** A12/01039/20

**Product:** Passenger car

**Name:** I3, X1, X2

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** BMW

**Type / number of model:** e1\*2007/46\*1213, e1\*2007/46\*1676, e1\*2007/46\*0371,e1\*2007/46\*1824; Types: BMWi-1, F1X, UKL-L, F2X

**Type of alert:** Products with serious risks

A rollover detection sensor inside the airbag control unit might be defective. Consequently, in the event of an accident in which the vehicle tips over its roof, the airbag might not properly deploy, increasing the risk of injuries of the passengers. /

Recall of the product from end users

**Description:** Passenger car

**Batch number / Barcode:** 0065350300, 0065370300

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Poland, Slovenia

**Alert number:** A12/01040/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Jumpy, Spacetourer

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Citroen

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0532\*03 to \*10, e2\*2007/46\*0533\*03 to \*07; Type: V

**Type of alert:** Products with serious risks

The seat belts have not been attached correctly. This will impair their protective function, increasing the risk of injury in the event of an accident. In addition, incorrectly attached earth cables may cause the electronic stability program (ESP) to fail and can increase the risk of fire. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle.

**Batch number / Barcode:** GYK

**NO**

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Greece, Ireland, Poland

**Alert number:** A12/01041/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Expert, Traveller

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0530\*04 to \*10, e2\*2007/46\*0531\*04 to\*07, Type: V

**Type of alert:** Products with serious risks

The seat belts have not been attached correctly. This will impair their protective function, increasing the risk of injury in the event of an accident. In addition, incorrectly attached earth cables may cause the electronic stability program (ESP) to fail and can increase the risk of fire. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle

**Batch number / Barcode:** JRJ

**NO**

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Greece, Poland

**Alert number:** A12/01044/20

**Product:** Passenger car

**Name:** Gladiator, Wrangler

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Jeep

**Type / number of model:** Type-approval number: Individual approval

**Type of alert:** Products with serious risks

The clutch pressure plate may overheat and fail due to friction. This could result in a loss of power transmission or to increased risk of fire. /

Recall of the product from end users

**Description:** Passenger car

**Batch number / Barcode:** W12

**NO**

**Country of origin:** United States

**Alert submitted by:** Germany

**Alert number:** A12/01046/20

**Product:** Passenger car

**Name:** E-Class, S-Class, G-Class, AMG GT

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Type-approval numbers: e1\*2007/46\*1830\*00, e1\*2001/116\*0501\*36 to \*37, e1\*2001/116\*0335\*38 to \*39, e1\*2007/46\*1878\*00, Types: 463A, 212, 221, R1EAMG

**Type of alert:** Products with serious risks

The elastomer material of the oil feed line for the exhaust-gas turbocharger may not comply with the specification, allowing oil to leak out. Consequently, the leaking oil could come into contact with hot components, increasing the risk of fire. /

Recall of the product from end users

**Description:** Passenger car

**Batch number / Barcode:** 0993102

**NO**

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Greece, Ireland, Poland

**Alert number:** A12/01047/20

**Product:** Passenger car

**Name:** HR-V, Jazz

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Honda

**Type / number of model:** e6\*2007/46\*0158\*, e6\*2007/46\*0162\*05.

**Type of alert:** Products with serious risks

Due to improper adjustment of the assembling equipment, some springs were installed in the rear seat belt retractor locking mechanisms in a bent state. As a result, the seat belt may not be locked when it is pulled out quickly, increasing the risk of injury in the event of an accident. /

Recall of the product from end users

**Description:** Model code: HR-V (RU1), Jazz (GK3).

**Batch number / Barcode:** 6SY

**NO**

**Country of origin:** Japan

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Germany, Greece

**Alert number:** A12/01048/20

**Product:** Passenger car

**Name:** Civic, CR-V and HR-V

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Honda

**Type / number of model:** Civic (e11\*2007/46\*3633\*), CR-V (e6\*2007/46\*0265\*01, e6\*2007/46\*0265\*02), HR-V (e6\*2007/46\*0158\*).

**Type of alert:** Products with serious risks

Due to inappropriate molding conditions, the density of the resin for the low-pressure fuel pump impeller is reduced, causing it to swell and deform by the fuel. Consequently, the impeller interferes with the pump cover and makes the fuel pump inoperative. As a result the engine may stall, increasing the risk of an accident. /

Recall of the product from end users

**Description:** Model codes: Civic (FC1, FK6, FK7, FK8), CR-V (RT5, RT6, RW1, RW2), HR-V (RU1). Countries of production: México, Japan, Turkey and United Kingdom.

**Batch number / Barcode:** 6FE

**NO**

**Country of origin:** Mexico

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Greece, Ireland, Slovenia

**Alert number:** A12/01049/20

**Product:** Passenger car

**Name:** Auris HV, Prius, Prius+

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Toyota

**Type / number of model:** e11\*2007/46\*0018\*, e11\*2001/116\*0264\*

**Type of alert:** Products with serious risks

Specific transistors in the boost converter of the Intelligent Power Module (IPM) can be damaged by the high thermal stress caused by repeated driving under certain high-load driving patterns (e.g. from a stop, applying nearly full throttle and then gradually further accelerating to full throttle). This may cause the hybrid system to be shut down without entering a failsafe mode. As a result the vehicle may lose motive power while driving at higher speeds, increasing the risk of an accident. /

Recall of the product from end users

**Description:** Model code: Auris HV (ZWE186), Prius (ZVW30), Prius+ (ZVW41).

**Batch number / Barcode:** 20SMD-058

**NO**

**Country of origin:** Japan

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Bulgaria, Greece, Ireland, Poland

**Alert number:** A12/01050/20

**Product:** Passenger car

**Name:** DS7 crossback

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** DS

**Type / number of model:** e2\*2007/46\*0601\*08, e2\*2007/46\*0601\*09, e2\*2007/46\*0601\*10

**Type of alert:** Products with serious risks

An incorrect rear tray support trim may be mounted on the affected vehicles (long trim instead of a short trim). As a result, it will not be possible to lock the rear seat-back, increasing the risk of an injury. /

Recall of the product from end users

**Description:** Vehicles with reclining rear seat-back.VIN range: VR1JJEHZRKY220252 to VR1J45GGUKY221474.

**Batch number / Barcode:** HCU

**NO**

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Poland

**Alert number:** A12/01052/20

**Product:** Passenger car

**Name:** 308

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** e2\*2007/46\*0405\*27

**Type of alert:** Products with serious risks

The mechanical strength of the brake booster does not comply with the specification which may lead to impaired functioning of the braking assistance. As a result, the braking performance will be reduced, increasing the risk of an accident. / -

Recall of the product from end users

**Description:** VIN range: VF3LBYHYPLS046623 to VF3LBYHZPLS055091.

**Batch number / Barcode:** JWW

**NO**

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/01053/20

**Product:** Bus

**Name:** CNG12; CNG10,5; NBG12; BNG 10,5; NSG12

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:**

**Type / number of model:** e8\*2007/46\*0048\*06, e8\*2007/46\*0059\*09, e8\*2007/46\*0059\*10, e8\*2007/46\*0067\*04, e8\*2007/46\*0313\*04

**Type of alert:** Products with serious risks

The pressure relief device of the compressed natural gas (CNG) tank might not properly vent when necessary. Consequently, if the CNG tank is exposed to heat, it may break and leak gas increasing the risk of fire or explosion. /

Other

**Description:** Bus

**Batch number / Barcode:**

NO

**Country of origin:** Czechia

**Alert submitted by:** Czechia

**Alert number:** A12/01054/20

**Product:** Light commercial vehicle

**Name:** Master

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type / number of model:** e2\*2007=46\*0342\*09

**Type of alert:** Products with serious risks

The two seats in the medical cabin may be insufficiently anchored. As a result, they may become detached in the event of an accident, increasing the risk of an injury. /

Recall of the product from end users

**Description:** Type B ambulances, manufactured for Romania, with a series of 300 vehicles converted in 2018 and a series of 75 vehicles converted in 2019.

**Batch number / Barcode:**

NO

**Country of origin:** France

**Alert submitted by:** France

**Alert number:** A12/01056/20

**Product:** Passenger car

**Name:** S80, S60, V70, XC70, S60cc, V60, XC60, V60cc, V40, V40cc

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** VOLVO

**Type / number of model:** Type-approval number ranges: e9\*2001/116\*0057\*26~ e9\*2001/116\*0057\*31, e9\*2007/46\*0023\*14~e9\*2007/46\*0023\*25, e9\*2001/116\*0065\*24~e9\*2001/116\*0065\*28, e9\*2001/116\*0068\*16~e9\*2001/116\*0068\*24, Type: 124, 134, 135, 136, 137, 155, 156, 157, 525, 526, e4\*2001/116\*0076\*32~e4\*2001/116\*0076\*40

**Type of alert:** Products with serious risks

Air bubbles may remain in the engine's cooling system after filling with coolant. Consequently, the cooling of the engine might be impaired, causing the engine to overheat, leading to its damage or even to fire.

Recall of the product from end users

**Description:** Passenger car

**Batch number / Barcode:** R10025

NO

**Country of origin:** Sweden

**Alert submitted by:** Belgium

**Products were found and measures were taken also in:** Greece, Ireland, Poland

**Alert number:** A12/01026/20

**Product:** Particle filter mask

**Name:** Disposable protective mask

**Risk type:** Health risk / other

**Category:** Protective equipment

**Brand:** Isu

**Type / number of model:** ISU-001

**Type of alert:** Products with serious risks

The product bears a CE marking but is not certified as protective equipment by a relevant body. Additionally, the particle/filter retention of the material is insufficient (measured value  $\leq 88\%$ ), the elastic cords of the mask easily detach and the mask does not properly adapt to the face leading to an insufficient total filtration capacity (measured mean value  $\leq 39\%$ ). Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. / The product does not comply with the Personal Protective Equipment Regulation.

Import rejected at border


**Description:** Protective respiratory filtration half-face mask according to EN 149.

**Batch number / Barcode:**

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Belgium

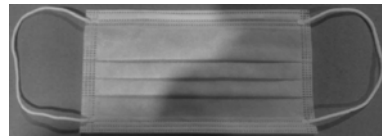



**Alert number:** A12/01027/20

**Product:** Particle filter mask

**Name:** Self-Imbibing Filter Particle Respirator / Disposable Face Mask KN95

**Risk type:** Health risk / other

**Category:** Protective equipment

**Brand:** Gulibear

**Type / number of model:** HB0095, KN95 MASK

**Type of alert:** Products with serious risks

The particle/filter retention of the material is insufficient (measured value  $\leq 90\%$ ) and the mask does not properly adapt to the face. Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. / The product does not comply with the Personal Protective Equipment Regulation.

Marking the product with appropriate warnings on the risks

**Description:** KN95 protective respiratory filtration half-face mask.

**Batch number / Barcode:** 6 934253 019578

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Belgium



**Alert number:** A12/01030/20

**Product:** Particle filter mask

**Name:** KN95 Face mask

**Risk type:** Health risk / other

**Category:** Protective equipment

**Brand:** XO Simple is beauty

**Type / number of model:** XO-01

**Type of alert:** Products with serious risks

The particle/filter retention of the material is insufficient (measured value  $\leq 86\%$ ) and the mask does not properly adapt to the face. Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. / The product does not comply with the Personal Protective Equipment Regulation.

Marking the product with appropriate warnings on the risks

**Description:** KN95 protective respiratory filtration half-face mask.

**Batch number / Barcode:** 6 920680 867851

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Belgium



## 合格证 CERTIFICATE

产品名称:一次性民用KN95口罩  
Product name: Disposable KN95 Respirator

产品型号: XO-01 数量: 5个  
Model: XO-01 Quantity: 5 Pcs

产品尺寸: 15.5 x 10.5cm  
Specification: 15.5\*10.5cm

执行标准: GB/2626-2006  
Executive Standard: GB/2626-2006

生产批号: MK2020041  
Production batch No.: MK2020041

生产日期: 2020.04.14  
Production date: 2020.04.14

有效期: 36 Month Valid until: 36 Month

执行监制: 香港克劳福德科技有限公司  
Executive Company: Crawford Technology (HK) Co., Ltd.

制造商: 深圳市克劳福德科技有限公司  
Manufacturer: ShenZhen Crawford Technology Co., Ltd.

地址: 深圳市龙岗区宏德辉工业园C1栋2楼  
Add: 2nd floor, C1 building, HongDeHui industrial park, Longgang district, ShenZhen

主要成份: 无纺布(71.4%) 熔喷布(28.6%)  
Main materials: Non-woven fabric(71.4%) Meltblown fabric(28.6%)

产地: 中国 Place of origin: Made in China

**Alert number:** A12/01031/20

**Product:** Particle filter mask

**Name:** Face Mask Earloop protective

**Risk type:** Health risk / other

**Category:** Protective equipment

**Brand:**

**Type / number of model:** KN95 BFE 95%

**Type of alert:** Products with serious risks

The particle/filter retention of the material is insufficient (measured value  $\leq 36\%$ ) and the mask does not properly adapt to the face. Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. / The product does not comply with the Personal Protective Equipment Regulation.

Marking the product with appropriate warnings on the risks



**Description:** KN95 protective respiratory filtration half-face mask.

**Batch number / Barcode:** 3 701403 800415

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Belgium

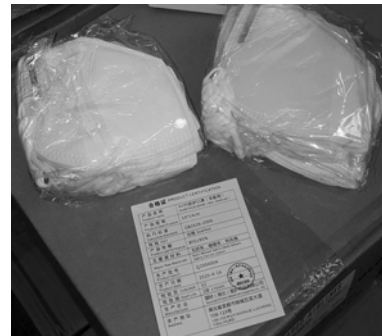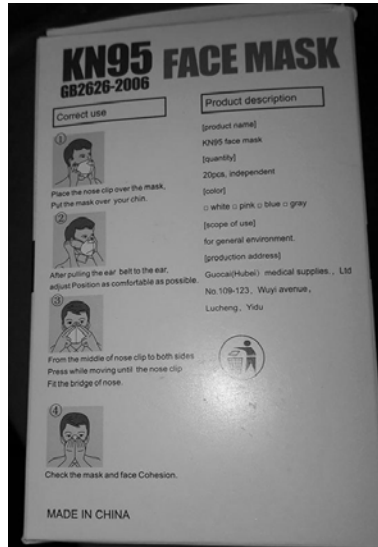

**Alert number:** A12/01032/20

**Product:** Particle filter mask

**Name:** Particulate respirator

**Risk type:** Health risk / other

**Category:** Protective equipment

**Brand:** ZX

**Type / number of model:** KN95, ZX9001

**Type of alert:** Products with serious risks

The total filtration capacity of the mask is insufficient (measured mean value  $\leq 59\%$ ). Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. / The product does not comply with the Personal Protective Equipment Regulation.

Marking the product with appropriate warnings on the risks

**Description:** KN95 protective respiratory filtration half-face mask.

**Batch number / Barcode:**

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Belgium



**Alert number:** A12/01033/20

**Product:** Particle filter mask

**Name:** Ear face mask

**Risk type:** Health risk / other

**Category:** Protective equipment

**Brand:**

**Type / number of model:** KN95

**Type of alert:** Products with serious risks

The mask does not properly adapt to the face. Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. / The product does not comply with the Personal Protective Equipment Regulation.

Marking the product with appropriate warnings on the risks


**Description:** KN95 protective respiratory filtration half-face mask.

**Batch number / Barcode:**

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Belgium

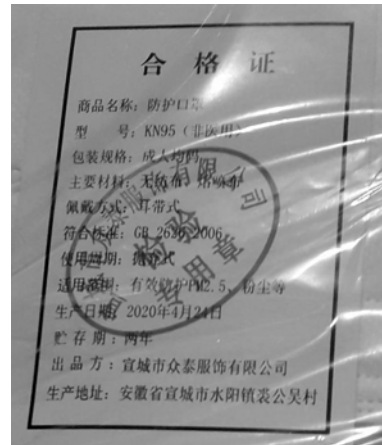

**Alert number:** A12/01055/20

**Product:** Particle filter mask

**Name:** KN95 Respirator mask

**Risk type:** Health risk / other

**Category:** Protective equipment

**Brand:** APT

**Type / number of model:**

**Type of alert:** Products with serious risks

The product bears a CE marking but is not certified as protective equipment by a relevant body. Additionally, the particle/filter retention of the material is insufficient (measured value  $\leq 86\%$ ) and the mask does not properly adapt to the face leading to an insufficient total filtration capacity (measured mean value  $\leq 72\%$ ). Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. / The product does not comply with the Personal Protective Equipment Regulation.

Marking the product with appropriate warnings on the risks


**Description:** KN95 protective respiratory filtration half-face mask of category FFP2 according to EN 149.

**Batch number / Barcode:**

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** Belgium

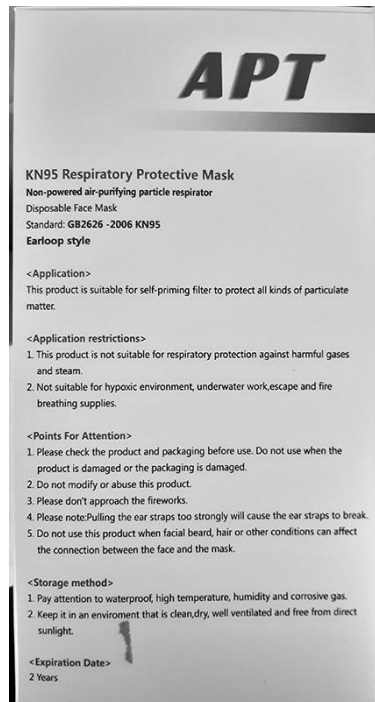

**Alert number:** A12/01028/20  
**Product:** Finger flickers toy  
**Name:** Aeroplane Finger Lights  
**Risk type:** Chemical  
**Category:** Toys  
**Brand:** Baker Ross

**Type / number of model:** AV619

**Type of alert:** Products with serious risks

The battery compartment can be easily opened without the use of any tools, leaving button cell batteries accessible. A child might put them in the mouth and swallow them, causing damage to the gastrointestinal tract. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115.

Recall of the product from end users


**Description:** Aeroplane shaped LED light-up toy designed with elastic strap to be attached to the fingers.

**Batch number / Barcode:** 5051174078062

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** United Kingdom

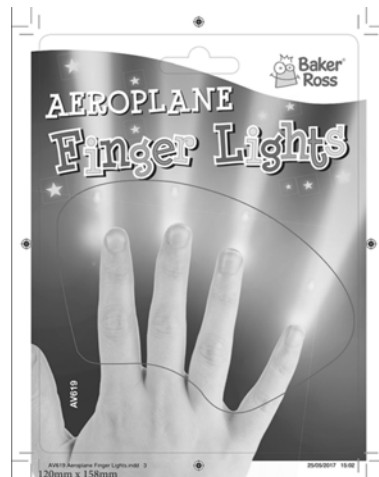

**Alert number:** A12/01029/20

**Product:** Finger flickers toy

**Name:** Finger Lights

**Risk type:** Chemical

**Category:** Toys

**Brand:** Baker Ross

**Type / number of model:** AF103

**Type of alert:** Products with serious risks

The battery compartment can be easily opened without the use of any tools, leaving button cell batteries accessible. A child might put them in the mouth and swallow them, causing damage to the gastrointestinal tract. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115.

Recall of the product from end users


**Description:** LED light-up toy designed with elastic straps so that they can be attached to the fingers.

**Batch number / Barcode:** 5051174052833

**NO**

**Country of origin:** People's Republic of China

**Alert submitted by:** United Kingdom

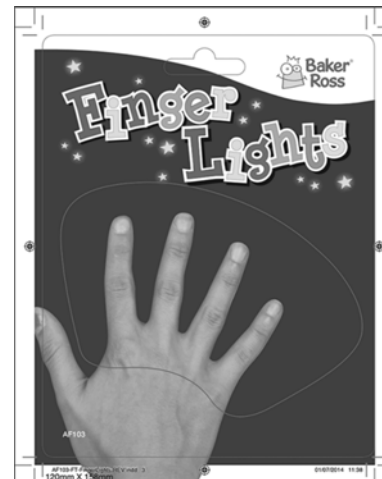

**Alert number:** A12/01035/20

**Product:** Plastic duck

**Name:** FANCY BABY

**Risk type:** Chemical

**Category:** Toys

**Brand:**

**Type / number of model:** A170607

**Type of alert:** Products with serious risks

The product contains 2-ethylhexyl phthalate (DEHP) (measured value: 0,29 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. / The product does not comply with the REACH Regulation.

Destruction of the product

**Description:** Four plastic ducks in different colours (blue, green, red, yellow).

**Batch number / Barcode:** EAN 4814723004179

**UNKNOWN**

**Country of origin:** Belarus

**Alert submitted by:** Latvia



**Alert number:** A12/01042/20

**Product:** Toy slime

**Name:** Fortnite Funny

**Risk type:** Chemical

**Category:** Toys

**Brand:**

**Type / number of model:** Item N0: 862-B

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high (measured value: 925 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Ban on the marketing of the product and any accompanying measures, Withdrawal of the product from the market

**Description:** Brown toy slime and a plastic straw in a transparent plastic coffee cup with semispherical cup.

**Batch number / Barcode:** 4606998037279

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Greece



**Alert number:** A12/01043/20

**Product:** Battery-operated toy

**Name:** Phone / Music in light

**Risk type:** Chemical

**Category:** Toys

**Brand:**

**Type / number of model:** Item NO: Y2340

**Type of alert:** Products with serious risks

The battery compartment can be opened without the need of a tool, leaving batteries accessible. A child might put them in the mouth and suck on them. If the batteries leak, this could cause damage to the gastrointestinal tract. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115.

Withdrawal of the product from the market


**Description:** Battery-operated telephone toy.

**Batch number / Barcode:** 5907714494802

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland

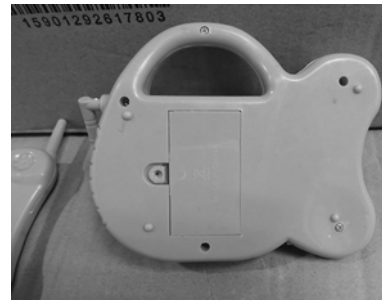



**Alert number:** A12/01034/20

**Product:** Children clothing set

**Name:**

**Risk type:** Injuries, Strangulation

**Category:** Clothing, textiles and fashion items

**Brand:** Happy Tree

**Type / number of model:** HR-9388, size 3

**Type of alert:** Products with serious risks

The product has long functional cords with free ends in the neck and in the waist area. These can become trapped during various activities of a child, leading to injuries or strangulation. / The product does not comply with the relevant European standard EN 14682.

Withdrawal of the product from the market

**Description:** The set consists of a mauve sweatshirt with hood and trousers, intended for children up to three years, with free ends cords and toggles. The sweatshirt contains inscriptions with words in English ( love, be music , etc).

**Batch number / Barcode:**

**UNKNOWN**

**Country of origin:** People's Republic of China

**Alert submitted by:** Romania



**Alert number:** A12/01045/20

**Product:** Hair growth serum

**Name:** hair serum crocodylinae

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** 4 MEGA, INOVEL

**Type / number of model:** ZG 400

**Type of alert:** Products with serious risks

The product contains triclosan (measured value: 0.02 %), which is not allowed in this type of product. Triclosan is persistent and bioaccumulates, can damage the liver, cause blood disorders and it may affect the reproductive system. / The product does not comply with the Cosmetic Products Regulation

Recall of the product from end users, Withdrawal of the product from the market

**Description:** 30 ml of liquid for hair and scalp treatment based on crocodile oil.

**Batch number / Barcode:**

**UNKNOWN**

**Country of origin:** Thailand

**Alert submitted by:** France



**Alert number:** INFO/0151/19

**Product:** Magic LED ball

**Name:**

**Risk type:** Chemical, Choking

**Category:** Toys

**Brand:** Toys

**Type / number of model:**

**Type of alert:** Products with other risk levels

The electrical circuit and the button batteries can easily detach from the toy. / A child may put the batteries in the mouth, which could damage to the child's gastrointestinal tract if swallowed. Also, the circuit could be placed in the mouth and the child choke on it.

The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 62115.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Magic ball with an LED system that lights up upon impact, powered with button batteries. The product is packed in a transparent plastic bag.

**Batch number / Barcode:**

**UNKNOWN**

**Country of origin:** Unknown

**Alert submitted by:** France



**Alert number:** INFO/00103/20

**Product:** Platform Listing: hair clipper set

**Name:** Professional Pet Clipper

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Kemei

**Type / number of model:**

**Type of alert:** Products with other risk levels

The product is advertised with a substandard adaptor for permanent use with inadequate insulation. As a result, a person could touch the live part of the adaptor and receive an electric shock. / The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard BS 1363.

Removal of this product listing by the online marketplace

**Description:** Rechargeable hair clipper set. According to the listing, the product is supplied with an adaptor and with a set of shaver heads.

**Batch number / Barcode:**

**UNKNOWN**

**Country of origin:** Unknown

**Alert submitted by:** United Kingdom

