

# The Rapid Alert System for Non-Food Products (RAPEX)

## RAPEX - Weekly overview report of notifications

week 20 - 2016

1) Notification A12/0165/16, published in Web Report-2016-007, has been modified further to additional information on the risk (NEW number: A11/0051/16). 2) Following a reassessment by the notifying authority, the risk level for the notification A12/1758/15 in Report 2016-001 has been changed. The notification is now published in the same report as A11/0049/16 in the section on products posing "Other risk levels".

**Alert number:** A12/0610/16

**Product:** Children's fancy dress/pyjamas with hat

**Name:** Unknown

**Risk:** Chemical

The red fabric contains azo dyes releasing the aromatic amine 2-Naphthylamine (measured value: up to 82 mg/kg). When the product is in direct and prolonged contact with the skin, the aromatic amine may be absorbed by the skin. Aromatic amines can cause cancer, cell mutations and affect reproduction. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

**Description:** Santa Claus red, white and black pyjamas with press-stud fastening down the front and legs; sold with a red and white hat.

**Batch number/Barcode:** 7713441000036

**Country of origin:** China

**Category:** Clothing, textiles and fashion items

**Brand:** PLUS

**Type/number of model:** Ref. 7713441

**Risk level:** Serious risk



**Alert submitted by:** France

**Alert number:** A12/0626/16

**Product:** Bedspread

**Name:** Cotton Printed Bed Sheet Double

**Risk:** Chemical

The red textile material contains azo dyes releasing aromatic amine benzidine (measured value: 870 mg/kg). When the product is in direct and prolonged contact with the skin, this aromatic amine may be absorbed by the skin. Aromatic amines can cause cancer, cell mutations and affect reproduction. The product does not comply with the REACH Regulation.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Big cotton bedspread (size: 210 x 240 cm) with zodiac patterns and inscriptions. The bedspread is dyed with red and black colours. It is packed in a transparent plastic bag.

**Category:** Clothing, textiles and fashion items

**Brand:** Unknown

**Type/number of model:** Zodiac printed

**Risk level:** Serious risk

**Batch number/Barcode:** Unknown**Country of origin:** India**Alert submitted by:** Finland**Alert number:** A12/0628/16**Product:** Lederhose (Leather shorts)**Name:** Lederhose Madl**Risk:** Chemical**Category:** Clothing, textiles and fashion items**Brand:** Krüger**Type/number of model:** Model 35012 colour 715**Risk level:** Serious risk

The amount of Chromium (VI) found in the leather is too high (measured value: up to 40 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

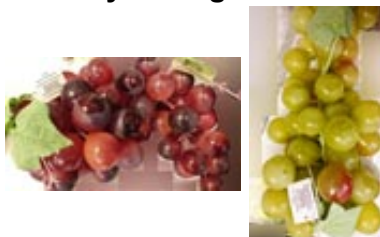
**Description:** Khaki lederhose, embroidered; composition: 100% leather, pocket lining: 100% polyester. sample size 40.

**Batch number/Barcode:** 533516**Country of origin:** India**Alert submitted by:** Germany**Alert number:** A12/0615/16**Product:** Decorative grapes**Name:** Grappe raisin PVC (PVC bunch of grapes)**Risk:** Choking**Category:** Decorative articles**Brand:** CHAKS**Type/number of model:** 2029 / PVC red grapes , 20028 / PVC green grapes**Risk level:** Serious risk

This decorative article, due to its characteristic form, colour and size, may be mistaken for foodstuff. Small parts can be easily detached from the product and this may lead children to put them in the mouth, swallow or ingest them. The product does not comply with the requirements of the Directive 87/357/EEC on products which, appearing to be other than they are, endanger the health or safety of consumers.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** A bunch of red or green PVC grapes measuring 30cm X 15cm, with an attached label.

**Batch number/Barcode:** 3661652032572, 3661652032589**Country of origin:** China**Alert submitted by:** France**Alert number:** A12/0591/16**Category:** Electrical appliances and

**Product:** Mains extension lead  
**Name:** 3-WAY SOCKET WITH SURGE PROTECTION

**Risk:** Electric shock

There is no earth conductor which could lead to a risk of electric shock if an appliance which should be earthed was connected.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** White mains extension lead with three sockets, supplied in a transparent plastic bag stapled with a cardboard label. Length: 1,5 m.

**Batch number/Barcode:** 5901299902257

**Country of origin:** China

equipment

**Brand:** TITANUM

**Type/number of model:** TL 101

**Risk level:** Serious risk

**Alert submitted by:** Slovakia



**Alert number:** A12/0607/16

**Product:** USB power supply

**Name:** USB Power Adapter

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Unknown

**Type/number of model:** Model: A1265; Serial No: 1X91029Y459T

**Risk level:** Serious risk

The insulation between the primary and secondary circuits is not sufficient, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** White USB power supply / charger supplied with a USB lead. Packaging: box with transparent windows.

**Batch number/Barcode:** 6 417182 108402

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/0608/16

**Product:** Electric mosquito-repellent device

**Name:** TRAVEL Mosquito Plug

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Unknown

**Type/number of model:** WQM165A (on the product); A-00277 (on the packaging)

**Risk level:** Serious risk

The casing of the product does not have sufficient mechanical strength which could lead to live parts becoming accessible. It is possible to touch the live parts of pins of the plug when inserting or removing the device from the mains socket. The product does not comply with the requirements of

the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Yellow, mains-operated, mosquito repellent device which plugs directly into a mains socket outlet. Supplied with 10 tablets. Blister packaging.

**Batch number/Barcode:** 5 995780 281501

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/0611/16

**Product:** Hair brush straightener

**Name:** Hair Auto Straightener

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** NASV Beauty Your World

**Type/number of model:** NASV-100

**Risk level:** Serious risk

The electrical insulation is inadequate: there is access to metal parts of the brush separated from live parts by basic insulation and the dimensions of the plug fuse are not correct. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335 and the relevant national standard BS1363.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Hair straightening brush with attached mains lead and 3 pin plug. Packaged in black box.

**Batch number/Barcode:** 6931444319714

**Country of origin:** China

**Alert submitted by:** United Kingdom



**Alert number:** A12/0593/16

**Product:** Via ferrata set

**Name:** Easy Rider and Iron Cruiser

**Risk:** Injuries

**Category:** Hobby/sports equipment

**Brand:** Black Diamond

**Type/number of model:** Easy Rider: model number 620105; Iron Cruiser: model number 620110; Iron Cruiser Via Ferrata Packages: model number 620122.

**Risk level:** Serious risk

The safety stitching may be missing. This would cause the immediate failure of the product when loaded. The user could consequently fall from a height resulting in serious or fatal injury. The product does not comply with the Personal Protective Equipment Directive.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Climbing equipment: via ferrata set.

**Batch number/Barcode:** Manufactured between 26 October 2015 and 18 January 2016, with production codes from 5293 to 5350.

**Country of origin:** United States

**Alert submitted by:** Austria



**Alert number:** A12/0594/16

**Product:** Ascender

**Name:** Index

**Risk:** Injuries

**Category:** Hobby/sports equipment

**Brand:** Black Diamond

**Type/number of model:** Right (model number 620003) and left (model number 620004) versions.

**Risk level:** Serious risk

The rivets attaching the toothed cam to the ascender body may not have been fitted correctly. The cam and indeed the entire ascender may therefore become detached from the rope. There is also a risk that the rivets which attach the safety catch to the toothed cam have not been fitted correctly, thus increasing the risk that the ascender may become detached from the rope. If the ascender becomes detached from the rope, the user could fall from a height resulting in serious or fatal injury. The product does not comply with the Personal Protective Equipment Directive.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Climbing equipment: ascender

**Batch number/Barcode:** Manufactured between 22 December 2014 and 25 February 2016; manufacturer's codes from 4356 to 6015.

**Country of origin:** United States

**Alert submitted by:** Austria



**Alert number:** A12/0595/16

**Product:** Camming devices

**Name:** Camalots and Camalot Ultralights

**Risk:** Injuries

**Category:** Hobby/sports equipment

**Brand:** Black Diamond

**Type/number of model:** Camalots of all sizes which were manufactured between 18 May 2015 and 9 March 2016 and have a production code of between 5133 and 6067. , Camalot Ultralights of all sizes manufactured between 10 November 2015 and 4 March 2016 and with a production code of between 5309 and 6061.

**Risk level:** Serious risk

In a very high percentage of the products, it is possible that the axles of the camming devices are not correctly riveted. This could result in the camming device not being fully resilient or falling apart when used. As a consequence, the climber could fall from a height and sustain serious or fatal injuries. The product does not comply with the Personal Protective Equipment Directive.



**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Spring-loaded camming devices used for rock climbing.

**Batch number/Barcode:** CAMALOT: Size / Style Number: .4 262164 .5 262165 .75 262167 #1 262171 #2 262172 #3 262173 #4 262174 , CAMALOT ULTRALIGHTS: Size / Style Number: .3 262103 .4 262104 .5 262105 .75 262107 #1 262110 #2 262120 #3 262130 #4 262140 #5 262150 #6 262160

**Country of origin:** United States

**Alert submitted by:** Austria



**Alert number:** A12/0597/16

**Product:** LED floodlight

**Name:** LED Flood Light

**Risk:** Electric shock

**Category:** Lighting equipment

**Brand:** REALM

**Type/number of model:** Item Number: FLOOD LIGHT-20W-S

**Risk level:** Serious risk

The cables are not properly secured against pulling and twisting and the wire ends can be pulled out easily. The PVC cables do not protect properly against the penetration of water. As a result of these defects, the user could touch live parts during normal use. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Grey LED floodlight with motion sensor and free wire ends for mains connection. The product is intended for indoor and outdoor use. Packaging: cardboard box.

**Batch number/Barcode:** 6 927766 070129

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/0604/16

**Product:** Night-light

**Name:** Vintage Night Lamp Porcelain

**Risk:** Electric shock

**Category:** Lighting equipment

**Brand:** Unknown

**Type/number of model:** 15416 / GL-088

**Risk level:** Serious risk

Live parts become accessible when a different sized light bulb is used in the lamp holder. In addition, the clearance between the accessible parts and the lateral contacts of the lamp holder is too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Night-light which can be plugged directly into a socket outlet. The light bulb has an E12 cap. The lamp shade is made of porcelain with two different patterns and inscriptions. Blister

packaging.

**Batch number/Barcode:** 3 427000 154163

**Country of origin:** Unknown

**Alert submitted by:** Hungary



**Alert number:** A12/0625/16

**Product:** LED ceiling light

**Name:** LED Panel Light

**Risk:** Electric shock

**Category:** Lighting equipment

**Brand:** Faro Barcelona

**Type/number of model:** Light:42862, LED power supply:WG-(6W--9W)

**Risk level:** Serious risk

The electrical insulation of the power supply unit is not sufficient. The creepage distance between the primary and secondary circuits is too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598 and EN 61347.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** LED ceiling light supplied with a power supply ("LED Driver"). Sold in a brown cardboard box.

**Batch number/Barcode:** 8421776085404

**Country of origin:** Spain

**Alert submitted by:** Finland



**Alert number:** A12/0627/16

**Product:** Torch

**Name:** High Intensity LED Flashlight

**Risk:** Electric shock

**Category:** Lighting equipment

**Brand:** Ferei

**Type/number of model:** Torch: 730 , Battery charger: GM-042120

**Risk level:** Serious risk

The electrical insulation of the battery charger is not sufficient. The creepage distance between the primary and secondary circuits is too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Rechargeable LED torch supplied with a battery charger. Sold in a purple cardboard box.

**Batch number/Barcode:** 6951620500644

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0596/16**Product:** Motorcycle**Name:** Super Adventure**Risk:** Injuries

An oil leak can cause damage inside the strut of the semi-active suspension, thereby leading to a functional impairment of the suspension system.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Motorcycle.**Batch number/Barcode:** Model year 2015/16 vehicles are affected.**Country of origin:** Austria**Category:** Motor vehicles**Brand:** KTM**Type/number of model:** 1290**Risk level:** Serious risk**Alert submitted by:** Austria**Alert number:** A12/0599/16**Product:** Car**Name:** B-class**Risk:** Injuries

The back screws on the rear seats could be missing on one side. Passengers would therefore not be protected from unsecured luggage in the event of a frontal collision, because the rear seat could be lifted from behind. Furthermore, the required seat belt anchorage may not be guaranteed.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** The vehicles in question were manufactured between December 2012 and March 2015 and are fitted with the Easy-Vario seat

**Country of origin:** Germany**Category:** Motor vehicles**Brand:** Mercedes-Benz

**Type/number of model:** Type approval numbers: e1\*2001/116\*0470\*04-13, e1\*2007/46\*0751\*05-06 Types: 245 G, 246

**Risk level:** Serious risk**Alert submitted by:** Germany**Alert number:** A12/0600/16**Product:** Passenger car**Name:** 2008**Risk:** Injuries

The tightening torque of the right-hand, lower seatbelt fixing bolts may not be correct. In this case, the performance of the seatbelt may not be guaranteed in the event of an impact.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Passenger car.**Batch number/Barcode:** Production period: 14/07/2015.**Country of origin:** France**Category:** Motor vehicles**Brand:** Peugeot**Type/number of model:** Unknown**Risk level:** Serious risk**Alert submitted by:** Portugal**Alert number:** A12/0602/16**Product:** Passenger car**Name:** Corsa D**Risk:** Fire

Water can penetrate into the connector of the relay box located on the electronic vacuum pump causing a short circuit which could lead to a fire.

**Category:** Motor vehicles**Brand:** Vauxhall

**Type/number of model:** Right hand drive model equipped with the LUH engine and 5-speed manual transmission.

**Risk level:** Serious risk



**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Certain vehicles built between 03/07/2012 and 03/09/2014.

**Country of origin:** United Kingdom

**Alert submitted by:** United Kingdom

**Alert number:** A12/0603/16

**Category:** Motor vehicles

**Product:** All-terrain vehicle

**Brand:** Polaris

**Name:** RZR 900, RZR 1000

**Type/number of model:** Unknown

**Risk:** Fire

**Risk level:** Serious risk

The fuel tank vent line may have insufficient clearance to the exhaust pipe causing the fuel tank to build pressure and expand, which may result in a fuel leak.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** All-terrain vehicle / side-by-side vehicle.

**Batch number/Barcode:** Certain vehicles built between 22/07/2013 to 04/11/2015.

**Country of origin:** United States

**Alert submitted by:** United Kingdom

**Alert number:** A12/0605/16

**Category:** Motor vehicles

**Product:** All-terrain vehicle

**Brand:** Polaris

**Name:** RZR 900, RZR 1000

**Type/number of model:** Unknown

**Risk:** Fire

**Risk level:** Serious risk

In the event of an engine misfire, unburned fuel can be routed into the exhaust system, which can cause excessive exhaust heat that may lead to a fire.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** All-terrain vehicle / side-by-side vehicle.

**Batch number/Barcode:** Certain vehicles built between 08/07/2014 and 15/02/2016

**Country of origin:** United States

**Alert submitted by:** United Kingdom

**Alert number:** A12/0606/16

**Category:** Motor vehicles

**Product:** Passenger car

**Brand:** Renault

**Name:** Clio

**Type/number of model:** Clio IV

**Risk:** Injuries

**Risk level:** Serious risk

The front wheel arch may be incorrectly installed. As a result, the brake hose may come into contact with the front wheel arch, causing wear of the brake hose by fretting. If the brake hose breaks and the brake fluid leaks out, the performance of braking could be compromised.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number/Barcode:** e2\*2001/116\*0327; e2\*2007/46\*0008. The affected vehicles were manufactured from 15/04/2014 to 06/10/2014 in France and 05/03/2013 to 02/04/2015 in Turkey

**Country of origin:** France

**Alert submitted by:** Malta

**Alert number:** A12/0609/16

**Category:** Motor vehicles

**Product:** Lorry

**Brand:** Mercedes-Benz

**Name:** Actros, Antos, Arocs

**Type/number of model:** Type-approval numbers e1\*2007/46\*0726 e1\*2007/46\*0727 e1\*2007/46\*0728 e1\*2007/46\*0729

**Risk:** Injuries

e1\*2007/46\*0730 e1\*2007/46\*0731  
 e1\*2007/46\*0732 e1\*2007/46\*0733  
 e1\*2007/46\*0734 e1\*2007/46\*0735  
 e1\*2007/46\*0736 e1\*2007/46\*0737  
 e1\*2007/46\*0738 e1\*2007/46\*0739  
 e1\*2007/46\*0740 e1\*2007/46\*0741  
 e1\*2007/46\*0742 e1\*2007/46\*0743 Types:  
 963002, 963003, 963004, 963005, 963020,  
 963021, 963022, 963024, 963025, 963026,  
 963402, 963403, 963404, 963405, 963406,  
 963420, 963424, 963425, 963426, 963427,  
 964000, 964001, 964002, 964003, 964007,  
 964008, 964014, 964016, 964018, 964020,  
 964022, 964024, 964025, 964026, 964030,  
 964031, 964038, 964041, 964200, 964201,  
 964202, 964203, 964207, 964208, 964214,  
 964216, 964218, 964224, 964226, 964230,  
 964231, 964232, 964233, 964238, 964241,  
 964314, 964316, 964326, 964330, 964331,  
 964341, 964401, 964402, 964403, 964407,  
 964408, 964414, 964416, 964418, 964420,  
 964424, 964425, 964426

**Risk level:** Serious risk

The exhaust pipe may work loose and fall onto the road leading to an accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Lorry

**Batch number/Barcode:** The vehicles affected were produced between 1 October 2011 and 5 March 2016.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0613/16

**Category:** Motor vehicles

**Product:** Suspension bracket

**Brand:** Lowtec

**Name:** Unknown

**Type/number of model:** Type:

**Risk:** Injuries

87260901/87260951 Authorisation No:

SA1161797/I Sales description: 60901/60951

**Risk level:** Serious risk

The product could break owing to a production defect. If this happened, the resulting loss of driving stability would increase the risk of an accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Front suspension bracket for the VW Golf IV.

**Batch number/Barcode:** Concerns components produced in May 2014.

**Country of origin:** China

**Alert submitted by:** Germany

**Alert number:** A12/0614/16

**Category:** Motor vehicles

**Product:** Passenger car

**Brand:** Nissan

**Name:** NV400

**Type/number of model:** Type: NV400 (X62)

**Risk:** Injuries

with M9T engine (engine index 700, 702, 706);

EC type-approval: EC-BE-No e2\*2007/46\*0137  
 EC-BE-No e2\*2007/46\*0138 EC-BE-No  
 e2\*2007/46\*0140 EC-BE-No e2\*2007/46\*0141  
 EC-BE-No e2\*2007/46\*0142 EC-BE-No  
 e2\*2007/46\*0143 EC-BE-No e2\*2007/46\*0144  
 EC-BE-No e2\*2007/46\*0145.

**Risk level:** Serious risk

The turbo-charger oil hose may be incorrectly crimped. If the oil hose becomes completely detached, oil may escape endangering following vehicles.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number/Barcode:** The vehicles concerned were manufactured between 18 September 2015 and 26 October 2015.

**Country of origin:** France

**Alert submitted by:** Germany

**Alert number:** A12/0617/16

**Product:** Passenger car

**Name:** C-class

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type/number of model:** Type-approval numbers: e1\*2001/116\*0431\*32, e1\*2001/116\*0457\*25; Type: 204, 204 K.

**Risk level:** Serious risk

The connection between the high-pressure pipe from the fuel rail and the high-pressure pump may loosen. If fuel leaks onto the road as a result, it could increase the risk of accidents for following vehicles.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles produced from December 2013 to April 2016 are affected.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0619/16

**Product:** Passenger car

**Name:** Espace and Talisman

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type/number of model:** Espace V (JRA4, JRA5, JRME) and Talisman (KPA3, KPA4, KPA5, LPA3, LPA4, LPA5, LPMJ, LPMV).

**Risk level:** Serious risk

Possible incorrect assembly of the left or right front flexible brake hose could lead to wear of the flexible brake hose by fretting on the wheel rim and on the tyre. Possible brake fluid leakage, which results as a consequence, could lead to long brake pedal travel and a decrease of braking efficiency.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger cars.

**Batch number/Barcode:** Production period: until 03/02/2016.

**Country of origin:** France

**Alert submitted by:** Portugal

**Alert number:** A12/0620/16

**Product:** Passenger car

**Category:** Motor vehicles

**Brand:** Renault

**Name:** Espace and Talisman**Risk:** Injuries**Type/number of model:** Espace V (JRA4, JRA5, JRME) and Talisman (LPA3, LPA4, LPA5, LPMJ, LPMV).**Risk level:** Serious risk

The webbing of the front seat belts may have been partially cut. If this is the case, it could result in a loss of efficiency of the safety belt protection performance in the event of an accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)**Description:** Passenger car**Batch number/Barcode:** Production period: until 11/01/2016.**Country of origin:** France**Alert submitted by:** Portugal**Alert number:** A12/0621/16**Product:** Passenger car**Name:** Espace**Risk:** Injuries**Category:** Motor vehicles**Brand:** Renault**Type/number of model:** Espace V (JRA4, JRA5, JRME).**Risk level:** Serious risk

The front wheel alignment may be incorrect. The lower suspension arm may not be properly fixed and could slip. Possible premature and asymmetrical wear of the front tyres which arises as a result could, in extreme cases, lead to a sudden loss of tyre pressure.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)**Description:** Passenger car**Batch number/Barcode:** Production period: until 18/09/2015.**Country of origin:** France**Alert submitted by:** Portugal**Alert number:** A12/0622/16**Product:** Passenger car**Name:** Espace**Risk:** Injuries**Category:** Motor vehicles**Brand:** Renault**Type/number of model:** Espace V (JRA4, JRA5, JRME).**Risk level:** Serious risk

Due to the absence of primer when bonding, the sun roof may not be properly attached. Part of the sunroof could consequently detach from the vehicle whilst driving, posing risk for following vehicles.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)**Description:** Passenger car**Batch number/Barcode:** Production period: until 14/12/2015.**Country of origin:** France**Alert submitted by:** Portugal**Alert number:** A12/0632/16**Product:** Van**Name:** T5**Risk:** Fire**Category:** Motor vehicles**Brand:** VW**Type/number of model:** Type approval numbers: e1\*KS07/46\*0027\*03  
e1\*KS07/46\*0036\*02 Type: 7HC, 7J0.**Risk level:** Serious risk

Due to a leak between the composite natural gas container valve and the container itself, natural gas may leak into the interior/cargo space.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)**Description:** Van using natural gas.**Batch number/Barcode:** The vehicles in question were manufactured between 9 August 2013

and 30 June 2015.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0631/16

**Category:** Other

**Product:** Telescopic ladder

**Brand:** Halverwerk

**Name:** 3.8M TELESCOOP LADDER

**Type/number of model:** 02150-09-07/HA380

**Risk:** Injuries

**Risk level:** Serious risk

The ladder does not have sufficient mechanical strength and can bend or break during use, causing the user to fall from a height. In addition, the space between the rungs/steps is not equal when the ladder is not completely extended and the user could therefore miss his step, lose balance and fall from a height. Also, whilst unlocking the locking mechanism of certain rungs/steps, parts of the ladder above may descend very quickly and crush the user's fingers. The product does not comply with the relevant European standard EN 131.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Telescopic ladder - length 3.8m, packed in cardboard packaging.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** The Netherlands



**Alert number:** A12/0589/16

**Category:** Toys

**Product:** Wooden musical toy (castanets)

**Brand:** Die Spiegelburg

**Name:** Die Lieben Sieben

**Type/number of model:** Article No 12200

**Risk:** Chemical

**Risk level:** Serious risk

The red and yellow paint of the wooden toy contains lead (measured value up to 330 mg/kg). Exposure to lead can result in severe and irreversible neurotoxicity, particularly in the case of children. The product does not comply with the requirements of the the Toy Safety Directive and the relevant European standard EN 71-3.

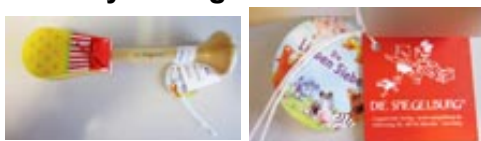
**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Wooden castanet painted red and yellow.

**Batch number/Barcode:** 4029753122001

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0590/16

**Category:** Toys

**Product:** Plastic swan with eggs

**Brand:** Unknown

**Name:** Lay egg - swan toys

**Type/number of model:** NO.1401A

**Risk:** Choking

**Risk level:** Serious risk

The toy contains small parts (the eggs) that can be swallowed by small children and cause choking. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Warning consumers of the risks, Ban on the marketing of the product and any accompanying measures

**Description:** Colourful plastic swan operated by three „AA“ batteries. After pressing the red button the swan moves and emits lights and sounds. The package also includes three plastic eggs. The product is supplied in a white/blue cardboard box with a transparent window.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Slovakia



**Alert number:** A12/0592/16

**Product:** Set of rattles

**Name:** Baby Toys

**Risk:** Choking

**Category:** Toys

**Brand:** FEI PAN

**Type/number of model:** NO.326-475 (on the cardboard label) NO.326-944 (on the attached paper label)

**Risk level:** Serious risk

The rattles can easily break, generating small parts which could be put in the mouth by a small child and cause choking. Moreover, the handles of some „rattles are too long. A small child could put them in the mouth where they can get stuck and obstruct the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Warning consumers of the risks, Ban on the marketing of the product and any accompanying measures

**Description:** A set of ten plastic rattles of different shapes and colours, supplied in a transparent plastic bag stapled with a cardboard label.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Slovakia



**Alert number:** A12/0598/16

**Product:** Rattle

**Name:** Pumpkin

**Risk:** Choking

**Category:** Toys

**Brand:** Kids Concept

**Type/number of model:** Art no: 412968, 412951, 412944

**Risk level:** Serious risk

Some of the pins on the rattle have not been glued correctly and the sides can detach. If the rattle falls apart, the bell inside is released and a small child could put the bell into the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Manufacturer)

**Description:** Babies' multicoloured bell rattle. The rattles comes in white and blue, white and pink or white and green. On each of the sides there are pictures of an owl.



**Batch number/Barcode:** 7340028713968, Only batches ID373 and ID365 are affected., 7340028713944, 7340028713951

**Country of origin:** China

**Alert submitted by:** Sweden



**Alert number:** A12/0601/16

**Category:** Toys

**Product:** Rattle set

**Brand:** Unknown

**Name:** Baby Rattle - Baby Love Play Set

**Type/number of model:** Unknown

**Risk:** Choking

**Risk level:** Serious risk

The elephant rattle can easily break, releasing small parts which children may put in the mouth and choke upon. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Retailer)

**Description:** Babies' rattle set consisting of five different rattles in the shape of animals (elephant, giraffe, bear), a boat and a bottle. Packed a cardboard box with transparent window. Approximate size of box is 31 x 25 cm.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Estonia



**Alert number:** A12/0612/16

**Category:** Toys

**Product:** Wooden puzzle

**Brand:** Classic world

**Name:** Discovery Cubes with Animal Puzzle

**Type/number of model:** 3522

**Risk:** Choking

**Risk level:** Serious risk

Children can easily access the small parts contained in the cubes (bell, wooden roller, marble, and rotating ball). Small children could put these small parts in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Toy wooden puzzle cubes with openings. Each cube contains a small part (a bell, a wooden roller, a marble, and a rotating ball) blocked by a small stick. Different images are printed on the cubes (cow, chicken, ladybird, sun). The product is sold in a cardboard packaging.

**Batch number/Barcode:** 6940351735227

**Country of origin:** China

**Alert submitted by:** Estonia

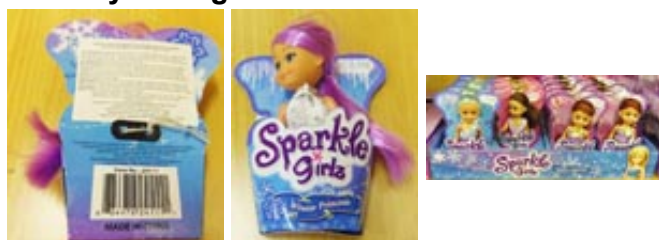


**Alert number:** A12/0616/16**Category:** Toys**Product:** Plastic Doll**Brand:** Sparkle Girlz**Name:** Winter Princess**Type/number of model:** Item No. 24111**Risk:** Chemical**Risk level:** Serious risk

The plastic material of the doll contains both di-(2-ethylhexyl) phthalate (DEHP) and dibutylphthalate (DBP) (measured values: 1.2 and 15.2% by weight respectively). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.

**Measures taken by economic operators:** Warning consumers of the risks, Withdrawal of the product from the market (By: Retailer)

**Description:** 10 cm doll with long purple hair. The toy is supplied in blue cardboard packaging (size 12 x 10 cm).

**Batch number/Barcode:** 884978241111**Country of origin:** China**Alert submitted by:** Estonia**Alert number:** A12/0618/16**Category:** Toys**Product:** Plastic doll**Brand:** Braizlllaz (COUNTERFEIT)**Name:** Cloetta Spelletta Beautiful Fashion**Type/number of model:** 8501**Risk:** Chemical**Risk level:** Serious risk

The plastic material of the head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: more than 20% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.

**Measures taken by economic operators:** Recall of the product from end users (By: Retailer)

**Description:** Doll with long pink hair and red eyes wearing a black and white dress. The doll is approximately 25 cm, made of flexible plastic, and packed in a cardboard box bearing various inscriptions.

**Batch number/Barcode:** Unknown**THE PRODUCT IS OR MAY BE COUNTERFEIT****Country of origin:** China**Alert submitted by:** Estonia**Alert number:** A12/0623/16**Category:** Toys**Product:** Set of whistles**Brand:** TIGER**Name:** 4 FLØJTER - 4 WHISTLES**Type/number of model:** Item no. 2600226**Risk:** Choking**Risk level:** Serious risk

The sound unit of the toy may become loose if pulled or picked at, creating a small part. Small children could put this small part in the mouth and choke. The product does not comply with the

requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Whistles in different colours designed as lips with a sound mechanism in the middle. Sold in a plastic bag with cardboard blister.

**Batch number/Barcode:** Batch 79468

**Country of origin:** China

**Alert submitted by:** Denmark



**Alert number:** A12/0624/16

**Category:** Toys

**Product:** Plastic doll

**Brand:** NOWA|Xiangxing toys

**Name:** Beautiful Children

**Type/number of model:** NO.XX2822 (on the package) NG8472033 (on the label)

**Risk:** Chemical

**Risk level:** Serious risk

The plastic material of the head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 20.8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

**Measures ordered by public authorities:** Warning consumers of the risks, Ban on the marketing of the product and any accompanying measures

**Description:** Plastic doll with long blond hair and pink dress. Packaged in a cardboard box with a transparent plastic window on the front side.

**Batch number/Barcode:** 6991284720330 (on the label)

**Country of origin:** China

**Alert submitted by:** Slovakia



**Alert number:** A12/0629/16

**Category:** Toys

**Product:** Toy gun

**Brand:** Unknown

**Name:** City Police Soft Bullets Gun

**Type/number of model:** art. E058-064

**Risk:** Choking

**Risk level:** Serious risk

The red plastic suction cups of the projectiles can easily detach. A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toys Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Plastic toy gun with five projectiles. The gun is a black-silver-orange coloured handgun. "Force" is written on the barrel. The projectiles are made of golden plastic with red suction cups. The gun and the projectiles are packed in a cardboard and plastic blister packaging.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0630/16

**Category:** Toys

**Product:** Pull-along toy telephone

**Brand:** bionyi

**Name:** Unknown

**Type/number of model:** ART. #769K

**Risk:** Suffocation, Choking, Strangulation

**Risk level:** Serious risk

The stickers on the toy can easily detach, generating small parts. A small child may put them in the mouth and choke. Moreover, the cord is too long which can lead to strangulation while playing with the toy. Also, the plastic bag of the packaging is too thin. If a child plays with the packaging, the plastic can cover the mouth and nose causing suffocation. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Toy telephone with wheels and a cord with which a child may pull it along.

**Batch number/Barcode:** 5900700105423

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0633/16

**Category:** Toys

**Product:** Toy scooter

**Brand:** Unknown

**Name:** KIDS TRI SCOOTER

**Type/number of model:** Art. NA01010

**Risk:** Choking

**Risk level:** Serious risk

The product poses a risk of choking because small parts (the screw nuts of the wheels) easily detach from the scooter: a child may put the small part in the mouth and choke. In addition, the scooter is not sufficiently stable, causing the child to lose balance and fall. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Destruction of the product (By: Importer)

**Description:** Toy scooter in blue and pink with three wheels (one in front and two rear wheels). Packaging - cardboard box.

**Batch number/Barcode:** 7331210032639; Batch Nr.:0115

**Country of origin:** China

**Alert submitted by:** Latvia



**Alert number:** A11/0048/16

**Category:** Electrical appliances and

**Product:** Battery charger  
**Name:** Lead Acid Charger  
**Risk:** Electric shock

equipment  
**Brand:** Unknown  
**Type/number of model:** TS-1012C  
**Risk level:** Other risk level

The electrical insulation is not sufficient which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Battery charger for lead acid batteries. Output: DC 6 V / 1000 mA. Packaging: plain white cardboard box.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A11/0045/16

**Product:** Sky lantern

**Name:** Lanterne Volante ('Flying lantern')

**Risk:** Fire

**Category:** Other

**Brand:** Sky Lantern

**Type/number of model:** Unknown

**Risk level:** Other risk level

The air inside the lantern is heated by an open burner (lacking protective system for the flame). If the lantern lands on a rooftop or on other flammable material, this may cause a fire.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Paper sky lantern wrapped in transparent packaging.

**Batch number/Barcode:** 3700498930571

**Country of origin:** Unknown

**Alert submitted by:** The Netherlands



**Alert number:** A11/0046/16

**Product:** Sky lantern

**Name:** HIMMELSLATERNE ('Sky lantern')

**Risk:** Fire

**Category:** Other

**Brand:** RAINBOW

**Type/number of model:** Unknown

**Risk level:** Other risk level

The air inside the lantern is heated by an open burner (lacking protective system for the flame). If the lantern lands on a rooftop or other flammable material, this may cause a fire.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Paper sky lantern, wrapped in transparent packaging.

**Batch number/Barcode:** 4250137504285

**Country of origin:** Unknown

**Alert submitted by:** The Netherlands





**Alert number:** A11/0047/16

**Product:** Sky lantern

**Name:** Happiness balloon

**Risk:** Fire

**Category:** Other

**Brand:** Funny Fashion

**Type/number of model:** Unknown

**Risk level:** Other risk level

The air inside the lantern is heated by an open burner (lacking protective system for the flame). If the lantern lands on a rooftop or other flammable material, this may cause a fire.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Paper sky lantern, wrapped in transparent packaging.

**Batch number/Barcode:** 8712364840292

**Country of origin:** Unknown

**Alert submitted by:** The Netherlands



**Alert number:** A11/0050/16

**Product:** Soft toy and ball

**Name:** DEVIL INSIDE

**Risk:** Choking

**Category:** Toys

**Brand:** TIF 8

**Type/number of model:** Item No 36937 (bag) + item 36933 (soft toys) .

**Risk level:** Other risk level

The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. The stuffing material may cause choking if put in the mouth by children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Red and black soft ball with a zip-fastener and a red and black soft toy (devil) wearing a football shirt and carrying a small soft football.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** France

