

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

week 31 - 2016

Notification A12/0180/16 in Report-2016-007, has been updated at the request of the notifying authority following extension of the recall. Notification A12/0393/16 in Report-2016-013, has been withdrawn at the request of the notifying authority following re-assessment of the risk.

**Alert number:** A12/0929/16

**Product:** Liquid for electronic cigarettes

**Name:** Milk and Chocolate

**Risk:** Chemical

**Category:** Chemical products

**Brand:** Quickie

**Type/number of model:** 6 mg of nicotine

**Risk level:** Serious risk

The product contains nicotine yet the presence of nicotine is not adequately reported on the labelling. The bottle containing the mixture does not bear an adequate label; the user therefore has no information on the dangers incurred when the product comes into contact with the skin or if it is ingested. In addition, the product can be misleading for consumers as it refers to a drink both in respect of packaging and in terms of organoleptic characteristics, i.e. intense aroma of cocoa. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP) and the requirements of Directive 87/357/EEC on products which, appearing to be other than they are, endanger the health or safety of consumers.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Liquid for e-cigarettes. External packaging: a container made of yellow plastic with an adhesive label. Inside, there is one bottle containing the refill liquid for electronic cigarettes, accompanied by two bottles that are empty.

**Batch number/Barcode:** Unknown

**Country of origin:** United States

**Alert submitted by:** Italy



**Alert number:** A12/0931/16

**Product:** Wooden high-chair

**Name:** Unknown

**Risk:** Choking, Injuries

**Category:** Childcare articles and children's equipment

**Brand:** MS INNOVACIONES

**Type/number of model:** Advance 2021

**Risk level:** Serious risk

The restraint system for the child is inadequate and the child could fall from the high-chair. In addition, the spring of the tray fastening mechanism easily becomes detached, generating a small part which a child could put in the mouth and choke upon. The tray can be moved easily due to an inappropriate locking mechanism and there are gaps and holes in the high-chair, creating a risk of injuries. The product does not comply with the relevant European standard EN 14988.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Red, wooden high-chair, 'Advance' model. Packaged in a sealed cardboard box. There are no instructions for assembly.

**Batch number/Barcode:** 8436046384484

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0950/16

**Product:** Women's shoes

**Name:** Unknown

**Risk:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** 5th Avenue

**Type/number of model:** Article number 11535201 01190

**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value: 13 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Women's high-heeled shoes; leather upper, lined in black material, insole with black leather; sample size: 38.

**Batch number/Barcode:** Unknown

**Country of origin:** Vietnam

**Alert submitted by:** Germany



**Alert number:** A12/0952/16

**Product:** Leather trousers

**Name:** Unknown

**Risk:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** Spirit Motors

**Type/number of model:** 1) classic velour leather trousers 2.0 brown 48 - Art. 11018806 2) classic velour leather trousers 1.0 black 50 - Art. 110225

**Risk level:** Serious risk

The amount of Chromium (VI) in the leather of the trousers is too high (measured value: up to 13.8 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Brown or black leather trousers lined with polyester.

**Batch number/Barcode:** Unknown

**Country of origin:** Pakistan

**Alert submitted by:** Germany



**Alert number:** A12/0917/16

**Product:** Hair colouring product

**Name:** Permanent Powder Hair Colour - HENNA

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Profix Organics Olive Oil / EBOCOS

**Type/number of model:** Auburn, Exp. date 03/2018

**Risk level:** Serious risk

The product contains 2-nitro-p-phenylenediamine and barium peroxide according to the list of ingredients. 2-nitro-p-phenylenediamine may cause an allergic skin reaction and barium peroxide is harmful if swallowed or inhaled. The product does not comply with the Cosmetics Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market, Withdrawal of the product from the market

**Description:** Henna hair colouring product. 6 sachets of 10g each. The product comes in a light green cardboard box.

**Batch number/Barcode:** 4053743392501, E-04MFGD5

**Country of origin:** India

**Alert submitted by:** Sweden





**Alert number:** A12/0918/16

**Product:** Hair dye

**Name:** Colors

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Creme of Nature

**Type/number of model:** Golden Brown 7.31

**Risk level:** Serious risk

The product contains o-aminophenol according to the list of ingredients. O-aminophenol is harmful if swallowed or inhaled. The product has no appropriate labelling and lacks the required warnings, thus users are not sufficiently informed of the dangers of the product. The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Permanent hair colour. The product comes in an orange cardboard box with a photo print.

**Batch number/Barcode:** 7.31L473

**Country of origin:** United States

**Alert submitted by:** Sweden





**Alert number:** A12/0919/16

**Product:** Body lotion

**Name:** COCOA BUTTER LOTION

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Ultra Glow

**Type/number of model:** Unknown

**Risk level:** Serious risk

According to the ingredients list, the product contains the substance Cholecalciferol (vitamin D3). An excessive amount of this substance is toxic and can cause damage to organs through prolonged or repeated exposure. The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market, Withdrawal of the product from the market

**Description:** Body lotion in a white bottle of 473 ml with a red label. The product information is printed in white and yellow.

**Batch number/Barcode:** 070596099160; LAQK, PMBT 099-16

**Country of origin:** United States

**Alert submitted by:** Sweden



**Alert number:** A12/0920/16

**Product:** Hair dye pomade

**Name:** The Original

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Morgan's Pomade

**Type/number of model:** Unknown

**Risk level:** Serious risk

The hair pomade contains the dye Solvent Red 23 (CI 26100), Solvent Yellow 33 (CI 47000) and Solvent Green 3 (CI 61565) which may cause allergic skin reactions. The pomade of batch 02044 contains, in addition, lead acetate which is harmful if swallowed or inhaled and may cause damage to organs or the reproductive system through prolonged or repeated exposure. The product does not comply with the Cosmetic Products Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Retailer)

**Measures ordered by public authorities:** Withdrawal of the product from the market, Withdrawal of the product from the market, Withdrawal of the product from the market

**Description:** Hair dye pomade - darkening grey hair. The pomade comes in a brown glass bottle with metal lid; content 50 g. On the bottle there is a bright yellow label with red and black print.

**Batch number/Barcode:** 1) batch 02044, 2) batch: 140400041, 3) batch: 150400056

**Country of origin:** United Kingdom

**Alert submitted by:** Sweden



**Alert number:** A12/0923/16

**Product:** Hair dye

**Name:** Unknown

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Soft sheen Karizma

**Type/number of model:** 7c - Red hot

**Risk level:** Serious risk

The product contains o-aminophenol which is harmful if swallowed or inhaled. The label is not adequate and lacks the appropriate warnings required for oxidative hair dyes. The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market,  
Withdrawal of the product from the market

**Description:** Hair dye in a purple cardboard box.

**Batch number/Barcode:** 8W029

**Country of origin:** Canada

**Alert submitted by:** Sweden





**Alert number:** A12/0924/16

**Product:** Hand cream

**Name:** Crème main Au Beurre de Karité - Lavande

**Risk:** Microbiological

**Category:** Cosmetics

**Brand:** Un été en provence / SB

**Type/number of model:** Unknown

**Risk level:** Serious risk

The product is contaminated with *Pseudomonas aeruginosa* and a high level of aerobic mesophilic bacteria (measured value  $9.7 \times 10^5$  cfu/g). There is a risk of contracting infections as the solution may come in contact with the mouth, hands and eyes. The product does not comply with the Cosmetic Products Regulation.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Hand cream with lavender scent in an aluminium tube with black screw cap and round adhesive label, sold in a purple coloured cardboard box.

**Batch number/Barcode:** 3760209490589; lot CMF95

**Country of origin:** France

**Alert submitted by:** Germany



**Alert number:** A12/0925/16

**Product:** Skin lightening product

**Name:** Skin Beautifying Milk - Maxi Tone

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Clear Essence

**Type/number of model:** Platinum

**Risk level:** Serious risk

The product contains 2.5 % by weight of hydroquinone. Hydroquinone causes skin irritation and dermatitis. The product does not comply with the Cosmetic Products Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Retailer)  
**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Body lotion with skin lightening effect in a bottle of 227g, supplied in a yellow-pink cardboard packaging.

**Batch number/Barcode:** On the container: #150803-1. On the packaging: EF141, MHD: EXP.10/17.

**Country of origin:** United States

**Alert submitted by:** Germany



**Alert number:** A12/0953/16

**Product:** Henna Hair Colour

**Name:** Vatika Henna Hair Colour

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Vatika Naturals

**Type/number of model:** 1. Natural Brown, 2. Rich Black, 3. Dark Brown, 4. Burgundy

**Risk level:** Serious risk

The list of ingredients indicates that the hair dye contains sodium perborate. Sodium perborate in high doses is toxic and it may damage fertility or the unborn child. The product does not comply with the Cosmetic Products Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Retailer)

**Description:** Pack Size: 60g Contents of the pack: 6 x 10 g sachet with colour and developer in one.

**Batch number/Barcode:** 1. Natural Brown: EP003/ 5022496006330, 1. Natural Brown: EP027 / 5022496006330 , 2. Rich Black: EP009/ 502249006309, 2. Rich Black: EP016 / 502249006309, 3. Dark Brown: EP010/ 5022496006361, 4. Burgundy: EP014/ 5022496006392

**Country of origin:** India

**Alert submitted by:** Ireland





**Alert number:** A12/0945/16

**Product:** Cupcake-Maker

**Name:** Máquina para hacer mini cupcakes y magdalenas caseras ('Machine to make home made mini-cupcakes and muffins')

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** SOGO

**Type/number of model:** SS-7180

**Risk level:** Serious risk

The appliance does not have sufficient mechanical resistance and live parts can become accessible; the user might receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Small electrical appliance for domestic use for making mini cupcakes and muffins. The packaging is a cardboard box.

**Batch number/Barcode:** 8425490030405, batch 08/14

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0946/16

**Product:** Bicycle repair kit

**Name:** KITS DE REPARACIONES ('Repair kit'), RUBBER CEMENT (glue)

**Risk:** Chemical

**Category:** Hobby/sports equipment

**Brand:** RAX

**Type/number of model:** ref. 601224

**Risk level:** Serious risk

The glue contains 1,2 dichloroethane and benzene (measured values: dichloroethane 70% and benzene 0.6%). Benzene and 1,2 dichloroethane are carcinogenic and toxic if inhaled or if they get in contact with the skin. The product does not comply with the REACH Regulation.


**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Glue included in a puncture repair kit for bicycles; sold in a blister pack containing also patches and tools.

**Batch number/Barcode:** 6900101314232

**Country of origin:** Unknown

**Alert submitted by:** Spain

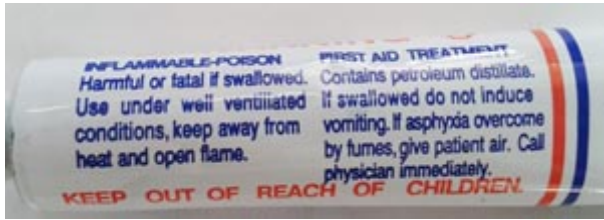

**Alert number:** A12/0934/16

**Product:** Jewellery kit

**Name:** Fleur Perles ('Beads flower')

**Risk:** Chemical

**Category:** Jewellery

**Brand:** RICO Design

**Type/number of model:** Ref. 709030.02 RICO Design Renaissance set black/white.

**Risk level:** Serious risk

The beads contain lead (measured value up to 0.41% by weight). Exposure to lead is harmful for human health. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Craft jewellery set in a flower-shaped box containing beads of three different colours and a variety of silver-coloured metal parts (rods, bead, bead rod, wires).

**Batch number/Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** France



**Alert number:** A12/0935/16

**Product:** Earrings

**Name:** Unknown

**Risk:** Chemical

**Category:** Jewellery

**Brand:** Fossetti

**Type/number of model:** Article 100866 (importer)

**Risk level:** Serious risk

The earrings contains cadmium (measured value 57 % by weight). Cadmium is harmful to human health, because it accumulates in the body and can damage organs and it may cause cancer. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market, Withdrawal of the product from the market (By: Distributor, Importer)

**Description:** Silver-coloured metal earrings with a transparent rhinestone, supplied in a transparent plastic bag.

**Batch number/Barcode:** 4040315008663

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0921/16

**Product:** Laser pointer

**Name:** NEW LASER & LED LIGHT

**Risk:** Damage to sight

**Category:** Laser pointers

**Brand:** HJ

**Type/number of model:** ZL 2008 3028 7657.6 ZL 2006 2004 1106.7 (on the display boxes)

**Risk level:** Serious risk

The laser is too powerful and may cause damage to sight. The product does not comply with the relevant European standard EN 60825.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** The product is a laser pointer with a torch. It has two buttons and comes with a carabiner. The product is sold in black display boxes.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Spain





**Alert number:** A12/0932/16

**Product:** Laser pointer

**Name:** 2 in 1 LASER & LED LIGHT

**Risk:** Damage to sight

**Category:** Laser pointers

**Brand:** QX

**Type/number of model:** Refs. SIN 2012805 and SIN 2015805

**Risk level:** Serious risk

The laser beam is too powerful and the product is not correctly labelled. Direct viewing of the laser beam could cause damage to sight. The product does not comply with the relevant European standard EN 60825-1 with respect to labelling.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** The product is a class 3B laser pointer (marked as class 3A) with a key-ring and a torch. It is sold in a cardboard display box (24 items).

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0951/16

**Product:** Lighting chain

**Name:** DECOFETES

**Risk:** Electric shock, Fire

**Category:** Lighting chains

**Brand:** SIPLEC

**Type/number of model:** LEC 511 / Reference DFRP2T-008MC36-IP44-CLEAR , LEC 512 / Reference DFRP2T-008MC36-IP44-MULTI, LEC 513 / Reference DFRP2T-008MC36-IP44-RED , LEC 514 / Reference DFRP2T-008MC36-IP44-BLUE, LEC 515 / Reference DFRP2T-008MC36-IP44-YELLOW

**Risk level:** Serious risk

The product is not protected against moisture but is recommended for outdoor use. Water penetration may cause an electric shock or lead to a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

**Description:** Multicoloured lighting chains, 9.5 m long.

**Batch number/Barcode:** 3603312920805

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0954/16

**Product:** Electric bicycle

**Name:** Elops

**Risk:** Injuries

**Category:** Machinery

**Brand:** B'TWIN

**Type/number of model:** ELOPS 900 E code 8300083

**Risk level:** Serious risk

The rear drum brakes may suddenly lose braking power, causing the cyclist to fall and suffer injuries.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Electric bicycle.

**Batch number/Barcode:** Affected products were distributed between 8.12.2015 and 28.1.2016.

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0922/16

**Product:** Passenger car

**Name:** Civic

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Honda

**Type/number of model:** Model: Civic 5 door, MY 2015. Types: FK1 (1.4 Petrol) , FK2 (1.8 Petrol) and FK3 (1.6 diesel); EC-type approval numbers: e11\*2001/116\*0255\*12, e11\*2001/116\*0256\*13, e11\*2001/116\*0256\*14, e11\*2001/116\*0257\*12, e11\*2001/116\*0257\*13

**Risk level:** Serious risk

The plastic filter of the vehicle stability assist (VSA) /anti-lock braking modulator may be misaligned and a small piece of broken filter might enter the modulator. As a result, the vehicle stability system may not be able to control the vehicle as intended.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles affected have been manufactured between 12th April 2016 and 18th April 2016.

**Country of origin:** United Kingdom

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Estonia, Germany, Ireland

**Alert number:** A12/0936/16

**Product:** Pick-up truck

**Name:** RAM 1500

**Risk:** Fire

**Category:** Motor vehicles

**Brand:** Dodge

**Type/number of model:** Type-approval numbers: Individual approval numbers. Type: DS

**Risk level:** Serious risk

Incorrect routing of the positive battery cable may lead to short-circuit and fire.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Pick-up truck.

**Batch number/Barcode:** The vehicles affected were produced between 8/8/2013 and 13/6/2014.

**Country of origin:** United States

**Alert submitted by:** Germany

**Alert number:** A12/0937/16

**Product:** Passenger car

**Name:** A-, B-, GLA-Class

**Risk:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type/number of model:** Type: 245 G EC type-approval: e1\*2001/116\*0470\*16

**Risk level:** Serious risk

Incorrect fitting of the pre-fuse box may lead to fire and to the loss of electrical power. In the case of a break in the contact, the engine can cut out while the vehicle is in motion and the steering assistance, the SRS system (e.g. airbags), ESP or instrument panel can fail, with an increased risk of injuries.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles produced from March 2016 to April 2016 are affected.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0938/16

**Product:** Passenger car

**Name:** C-Class

**Risk:** Fire

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type/number of model:** Type: 204, 204 K; EC type-approval: e1\*2001/116\*0431\*38 ff, e1\*2001/116\*0457\*31 ff.

**Risk level:** Serious risk

An incorrect cover has been fitted at the bottom of the engine compartment. If it comes into

contact with the exhaust system decoupling element, the cover may catch fire.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles produced in February 2016 are affected.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0939/16

**Product:** Passenger car

**Name:** Continental Flying Spur

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Bentley

**Type/number of model:** EC type approval: e11\*2001/116\*0221; SCBBE53W47C048927-SCBBF53W29C061062

**Risk level:** Serious risk

The glass panel in the roof may be insufficiently bonded to the sliding sunroof panel. The glass panel could fall and injure car occupants and/or cause a vehicle crash.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles affected have been produced between 25/4/07-31/10/08

**Country of origin:** United Kingdom

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Germany

**Alert number:** A12/0940/16

**Product:** Motorcycles

**Name:** Touring and Softail

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Harley-Davidson

**Type/number of model:** FLHTCU, FLHTCU TC, FLHTCUL, FLHTCUL TC, FLHTK, FLHTKL, FLHTP, FLHX, FLHXS, FLTRX, FLTRXS, FLTRU, FLHXSE, FLSS, FLSTFBS, FXSE

**Risk level:** Serious risk

The motorcycles may lose the ability to generate enough lift to disengage the clutch after being parked for an extended period. If this condition remains undetected, it could lead to a loss of control of the vehicle when it is either started in gear or when it is first put into gear.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Motorcycles.

**Batch number/Barcode:** MY 2016 motorcycles built from 17/07/15 through 31/03/16 in the USA and from 17/09/15 through 20/05/16 outside the USA, with black master cylinder part numbers 36700049B, 36700056B, 36700146 and 36700186.

**Country of origin:** United States

**Alert submitted by:** Greece

**Products were found and measures were taken also in:** Croatia, Germany, Slovakia

**Alert number:** A12/0941/16

**Product:** Scooters

**Name:** Sprinter, Nova and DY

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** DAYTONA

**Type/number of model:** Types SPRINTER 125 (DS1), SPRINTER 50 (DS0), NOVA 100 (DV1) and DY 125

**Risk level:** Serious risk

Incorrect treatment of the stem during production can result in loss of front suspension and lead to an accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Scooters.

**Batch number/Barcode:** MY 2013 – 2015

**Country of origin:** China

**Alert submitted by:** Greece

**Alert number:** A12/0947/16

**Product:** Passenger car

**Name:** Auris

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Toyota

**Type/number of model:** Unknown

**Risk level:** Serious risk

The vehicles concerned may have been equipped with a headlamp service part with incorrect specification. As a result, light distribution may be affected and there is a risk of the lights blinding drivers coming in the opposite direction.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles produced from October 2012 through May 2015.

**Country of origin:** Turkey, United Kingdom

**Alert submitted by:** Greece

**Products were found and measures were taken also in:** Estonia, Germany

**Alert number:** A12/0949/16

**Product:** Passenger car

**Name:** Cruze

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Chevrolet

**Type/number of model:** Vehicles equipped with Euro 4 Diesel Engine.

**Risk level:** Serious risk

Fretting corrosion of an Engine Control Unit (ECU) terminal, caused by the insufficiently tight fit of the ECU bracket and battery trays, may cause the engine to stall intermittently without early warning.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger car.

**Batch number/Barcode:** Production year: 2010

**Country of origin:** Republic of Korea

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Germany

**Alert number:** A12/0955/16

**Product:** Passenger car

**Name:** Espace V, Megane IV and Talisman

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type/number of model:** EC-type approval numbers: E2\*2007/46\*0470\*03 (Espace V); E2\*2007/46\*0546\*02 (Megane IV); E2\*2007/46\*2969\*02 and E2\*2007/46\*2969\*03 (Talisman)

**Risk level:** Serious risk

The hydraulic unit of the anti-lock braking /electronic stability control system may have been contaminated with plastic or metallic particles during the manufacturing process. This could lead to a decrease in the efficiency of the anti-lock braking and/or the electronic stability control.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles equipped with ABS-ESC hydraulic unit assembled between 12/02/2016 and 03/03/2016 or 17/03/2016 and 12/04/2016 and fitted on Espace V and Talisman, manufactured between 19/02/2016 and 20/04/2016, or Megane IV, manufactured between 26/02/2016 and 22/04/2016, are affected.

**Country of origin:** France

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Germany

**Alert number:** A12/0956/16

**Product:** Passenger car

**Name:** Dokker and Lodgy

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Dacia

**Type/number of model:** EC type approval: E2\*2001/116\*0314\*79

**Risk level:** Serious risk

The hydraulic unit of the anti-lock braking /electronic stability control system may have been contaminated with plastic or metallic particles during the manufacturing process. This could lead to a decrease in the efficiency of the anti-lock braking and/or the electronic stability control.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles equipped with ABS-ESC hydraulic unit assembled between 12/02/2016 and 03/03/2016 or between 17/03/2016 and 12/04/2016 and possibly fitted on Dacia Dokker, manufactured between 26/02/2016 and 21/04/2016, and Dacia Lodgy, manufactured between 26/02/2016 and 22/04/2016, are affected.

**Country of origin:** Morocco

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Germany

**Alert number:** A12/0944/16

**Product:** Firework

**Name:** Match Thunder

**Risk:** Damage to hearing

**Category:** Pyrotechnic articles

**Brand:** SVEA Fireworks

**Type/number of model:** Match Thunder 540

**Risk level:** Serious risk

The sound level is too high and this can cause damage to hearing. The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Flash banger firework. The housing body is made of paper and cardboard and inside there is a pyrotechnic composition. The flash banger has a protruding initiator to be ignited. The product is sold in a box containing six individual flash bangers.

**Batch number/Barcode:** 7331444020693

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0926/16

**Product:** Plush toy

**Name:** Moogy Fastening Doll

**Risk:** Choking

**Category:** Toys

**Brand:** Miniland Educational

**Type/number of model:** ref. 96295

**Risk level:** Serious risk

The red button on the toy becomes easily detached, generating a small part. A small child may



put it in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Colourful, educational, plush toy with zips, buttons, buckles and laces for children aged between 12 and 36 months. The toy is 47 cm tall. The packaging is a blue cardboard box with pictures on the sides.

**Batch number/Barcode:** Batch: 01151402813085 Barcode: 8413082962951

**Country of origin:** India

**Alert submitted by:** Spain



**Alert number:** A12/0927/16

**Product:** Beach toy set

**Name:** Unknown

**Risk:** Choking

**Category:** Toys

**Brand:** ZEEMAN

**Type/number of model:** Unknown

**Risk level:** Serious risk

Small parts (e.g. a prong of the rake) can come off. A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Toy set with water wheel and rake, sold in different colours, for children of +1 years and older.

**Batch number/Barcode:** 8711197558992; Batch 55899

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0928/16

**Product:** Modelling clay with magnet

**Name:** INTELLIGENTE

**Risk:** Injuries

**Category:** Toys

**Brand:** CLVA

**Type/number of model:** Unknown

**Risk level:** Serious risk

The product includes a small loose magnet with a high magnetic flux. If a child swallows this small magnet and other metallic objects, they could attract one another causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Destruction of the product, Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** 'Intelligent' modelling clay with a magnet, supplied in a metallic tin.

**Batch number/Barcode:** 8594164760358

**Country of origin:** Czech Republic

**Alert submitted by:** France



**Alert number:** A12/0930/16

**Product:** Balloons

**Name:** Ballons lumineux ('Luminous balloons')

**Risk:** Chemical

**Category:** Toys

**Brand:** WAKADABALOON

**Type/number of model:** ref # 700032

**Risk level:** Serious risk

The amount of nitrosamines released by the balloons is too high (measured value up to 0.31 mg/kg). A child could put the balloon in the mouth to blow or suck it; nitrosamines are carcinogenic via inhalation and ingestion. The product does not comply with the requirements of the Toy Safety Directive.

**Measures taken by economic operators:** Destruction of the product, Withdrawal of the product from the market (By: Importer)

**Description:** Balloons in different colours, containing a device to light them up.

**Batch number/Barcode:** 6955621100032; lot : 1201003

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0933/16

**Product:** Expandable toys

**Name:** AMAZING CAPSULE CREATURES - DINOSAURS

**Risk:** Choking, Injuries

**Category:** Toys

**Brand:** YUDA

**Type/number of model:** ref. 06062

**Risk level:** Serious risk

The capsule with the foam dinosaur can be put into the mouth and swallowed by children. As the toy expands, it can cause fatal occlusion of the respiratory track or intestinal blockage of small children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** 12 coloured capsules which increase in size and turn into soft foam dinosaurs when put in water. Packaging: a cardboard and plastic blister pack.

**Batch number/Barcode:** 8431878811795

**Country of origin:** China  
**Alert submitted by:** Spain



**Alert number:** A12/0942/16

**Product:** Toy excavator

**Name:** Friction Power Engineering car [Maszyny budowlane]

**Risk:** Choking

**Category:** Toys

**Brand:** BRIMAREX

**Type/number of model:** Art. no. 1312A710

**Risk level:** Serious risk

Small parts can easily detach from the toy excavator (e.g. digger of the excavator, back wheel). Small children may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market


**Description:** Toy excavator made of plastic. The toy is sold in a cardboard box.

**Batch number/Barcode:** 5907791568885

**Country of origin:** China

**Alert submitted by:** Poland



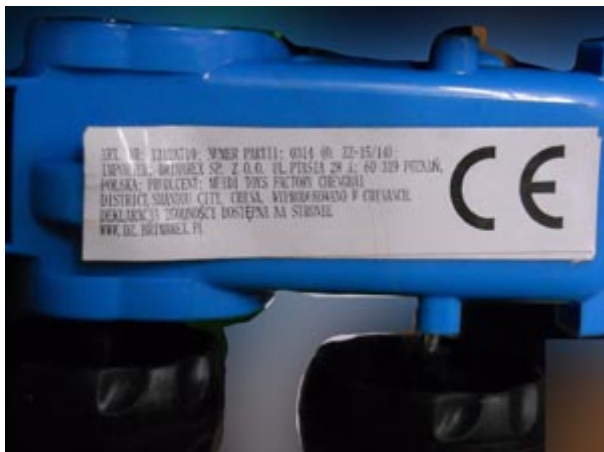

**Alert number:** A12/0943/16

**Product:** Toy pushchair

**Name:** Lovely Baby Barrow - Beautiful Pram

**Risk:** Cuts, Injuries

**Category:** Toys

**Brand:** iCOM

**Type/number of model:** #588280

**Risk level:** Serious risk

The metal tubes which support the seat lack an appropriate cover and may stab the child during play. In addition, there are sharp points and edges, leading to cuts. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market

**Description:** Pink toy pushchair for dolls, made of metal tubes and plastic with a detachable seat made of fabric.

**Batch number/Barcode:** 140210588280/6925882800804

**Country of origin:** China

**Alert submitted by:** Poland





**Alert number:** A12/0948/16

**Product:** Toy gun

**Name:** CAP GUN

**Risk:** Damage to hearing

**Category:** Toys

**Brand:** PIR

**Type/number of model:** 85205

**Risk level:** Serious risk

The sound level of the toy is too high and can consequently cause damage to hearing. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Retailer)

**Description:** Revolver-type toy gun with a metal barrel and brown plastic grip (drum 8-shot), packed in a plastic bag.

**Batch number/Barcode:** 5901353047351

**Country of origin:** China

**Alert submitted by:** Estonia





**Alert number:** A12/0957/16

**Product:** Wooden toy

**Name:** Parking garage

**Risk:** Choking

**Category:** Toys

**Brand:** New Classic Toys

**Type/number of model:** Art. n° 1016

**Risk level:** Serious risk

The toy contains small parts that could be put in the mouth by small children, causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Wooden toy parking garage with different accessories, in the form of a kit to be assembled; packed in a cardboard box.


**Batch number/Barcode:** 8718446010164, batch 910815

**Country of origin:** China

**Alert submitted by:** The Netherlands





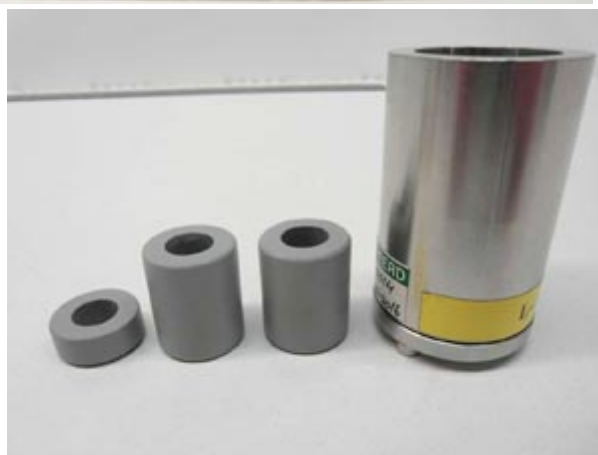

**Alert number:** A11/0069/16

**Product:** Doorbell

**Name:** Mehrklang Gong - Melody 230 V

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Heidemann

**Type/number of model:** Art.-No: 70618

**Risk level:** Other risk level

Neither the operating instructions nor the product itself indicate how the product is to be properly connected to the electricity network. If the electricity is switched off before installation, as the operating instructions require, but the device is not connected properly and the electricity switched on again, this may, under certain circumstances, cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive.

**Measures taken by economic operators:** Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market (By: Manufacturer)

**Description:** Doorbell packaged in a cardboard and blister pack.

**Batch number/Barcode:** 4011150706182

**Country of origin:** Germany

**Alert submitted by:** Germany

