

v

Commissione europea (http://ec.europa.eu/index_en.htm) I consumatori (http://ec.europa.eu/consumers/index_en.htm) Sicurezza dei consumatori (http://ec.europa.eu/consumers/consumers_safety/index_en.htm) Prodotti di sicurezza (http://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/index_en.htm)

A Sistema di allarme rapido a casa (https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.hr

E Torna a segnalare elenchi (https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2018)

Q Cerca avvisi (https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search)

🖷 Prodotti sicuri online (https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=SafeProductsOnline)

Il sistema di allarme rapido per prodotti non alimentari (RAPEX)

RAPEX - Rapporto di notifica settimanale delle notifiche

settimana 4 - 2018

La notifica A12 / 1242/17 della relazione 2017-037 è stata temporaneamente rimossa dal web, in attesa di chiarimenti sul rischio.

Numero dell'avviso : A12 / 0089/18 Prodotto: inchiostro per tatuaggio Nome: GIALLO LUMINOSO Tipo di rischio: chimico Categoria: prodotti chimici Marca: inchiostro eterno. Tipo / numero di modello: sconosciuto Livello di rischio: rischio grave Il prodotto contiene l'o-anisidina ammina aromatica (valore misurato 23 mg / kg) e l'ammina o-toluidina (valore misurato: 90 mg / kg). Le ammine aromatiche possono provocare il cancro, le mutazioni delle cellule e influire sulla riproduzione.

La risoluzione del Consiglio d'Europa ResAP (2008) 1 sui requisiti e i criteri per la sicurezza dei tatuaggi e del trucco permanente, raccomanda che le ammine aromatiche con proprietà cancerogene, mutagene, tossiche per la riproduzione o sensibilizzanti non siano presenti nei tatuaggi e nei prodotti per il trucco permanente né rilasciato dagli azo-coloranti.

Il prodotto non è conforme alla legislazione nazionale

Misure ordinate dalle autorità pubbliche (a: importatore): vietare la commercializzazione del prodotto e le eventuali misure di accompagnamento Descrizione: flacone da 30 ml di inchiostro giallo.

Numero di lotto / codice a barre: numero di lotto 10/10/16 Paese di origine: Stati Uniti Avviso presentato da: Italia



Numero dell'avviso: A12/0101/18 Prodotto: Teether Nome: sconosciuto Tipo di rischio: soffocamento Categoria: articoli per l'infanzia e attrezzature per bambini Marchio: MATCHSTICK MONKEY Tipo / numero di modello: rif. 003041763-001 Livello di rischio: rischio grave La coda della scimmia può essere tirata fuori, generando una piccola parte. Un bambino può mettere la piccola parte in bocca e soffocare. Misure ordinate dalle autorità pubbliche (a: importatore): ritiro del prodotto dal mercato Descrizione: Massaggiagengive a forma di scimmia in vari colori. Viene fornito in una scatola trasparente di plastica a forma di tubo. 0714119515781-0714119515804 Paese di origine: Regno Unito Avviso presentato da: Spagna









Numero dell'avviso : A12 / 0080/18 Prodotto: tuta per bambini Nome: sconosciuto Tipo di rischio: soffocamento Categoria: Abbigliamento, tessuti e articoli di moda Marca: Jikko Type / number of model: MODEL NO: 527 Risk level: Serious risk

The small decorative elements may be easily detached.

A small child may put them in the mouth and choke.

Measures ordered by public authorities (to: Distributor): Recall of the product from end users, Withdrawal of the product from the market Description: Colourful baby romper suit with sewn bolero. The product is decorated with textile flowers, rhinestones and sequins. Size: 0-3 M Batch number / Barcode: 1431935075273

Country of origin: Turkey

Alert submitted by: Hungary






Alert number: A12/0090/18 Product: Girls' clothing set Name: Unknown Risk type: Injuries Category: Clothing, textiles and fashion items Brand: Child Face Type / number of model: W – 2418 Risk level: Serious risk The drawstrings at the back of the garment may become trapped during various activities of the child. This could lead to injuries. The product does not comply with the relevant European Standard EN 14682. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Clothing set for 10-year-old girls consisting of a red jacket with a rose and the inscription 'First Love' on it, a grey T-shirt and dark trousers.

Batch number / Barcode: Unknown Country of origin: China Alert submitted by: Cyprus



Alert number: A12/0094/18 Product: Children's pyjamas Name: Unknown Risk type: Strangulation Category: Clothing, textiles and fashion items Brand: Sunshine INTIMO NOTTE Type / number of model: C606# Risk level: Serious risk The pyjamas have drawstrings in the neck area. These can become trapped during various activities of a child, leading to strangulation.

The product does not comply with the relevant European Standard EN 14682. Measures ordered by public authorities (to: Distributor): Withdrawal of the product from the market Description: Childrens pyjama set, size 4/6, with a panda face on the front. Batch number / Barcode: Unknown Country of origin: Unknown Alert submitted by: Cyprus

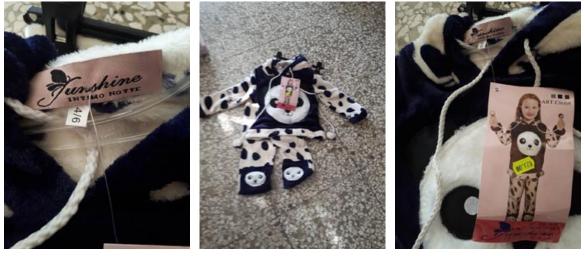

Alert number: A12/0115/18 Product: Girls' clothing set Name: SPRING SUMMER Risk type: Choking Category: Clothing, textiles and fashion items Brand: Glo-Story Type / number of model: GLT-4048 Risk level: Serious risk The small decorative elements may be easily detached. A small child may put them in the mouth and choke.

Measures ordered by public authorities (to: Distributor): Recall of the product from end users, Withdrawal of the product from the market Description: Black and white clothing set consisting of a T-shirt and trousers. The product is decorated with glued rhinestones. Size: 98 Batch number / Barcode: 5 996525 240487

Country of origin: China Alert submitted by: Hungary




Alert number: A12/0088/18 Product: Game controller Name: G-Tron Classic FC SNES Risk type: Environment Category: Electrical appliances and equipment Brand: SNES Type / number of model: JG-SNES204 Risk level: Serious risk The black wire contains short-chain chlorinated paraffins (SCCPs) (measuring value 5.3%). The placing on the market and use of articles containing SCCPs is banned. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment. The product does not comply with the Regulation on persistent organic pollutants (POP Regulation). Measures ordered by public authorities (to: Retailer): Destruction of the product, Recall of the product from end users Company recall page: https://www.verkkokauppa.com/fi/takaisinveto (https://www.verkkokauppa.com/fi/takaisinveto) Description: Game controller in a cardboard box Batch number / Barcode: 780625158453 Country of origin: China Alert submitted by: Finland



Alert number: A12/0091/18 Product: Thermos flask Name: Unknown Risk type: Chemical Category: Kitchen/cooking accessories Brand: KITCHEN CLUB Type / number of model: Article 2170297 Risk level: Serious risk The separators of the double glass wall of the thermos contain asbestos fibres. If the thermos breaks, the user may inhale asbestos fibres, which are carcinogenic.

The product does not comply with the REACH Regulation. Measures ordered by public authorities (to: Importer): Ban on the marketing of the product and any accompanying measures Description: Coloured thermos, capacity 0,35 I. Batch number / Barcode: Bar code 8-029121702978 Country of origin: China Alert submitted by: Italy

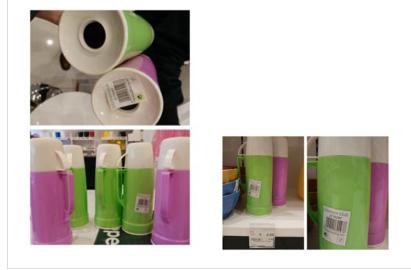

Alert number: A12/0066/18 Product: Laser pointer Name: Lantern Risk type: Damage to sight Category: Laser pointers Brand: Unknown Type / number of model: 1501A/501A/14876-1 Risk level: Serious risk The product does not have the necessary warnings related to its use. The direct entry of the laser beam into the eye can lead to damage to sight.

The product does not comply with the relevant European standard EN 60825-1 with regard to labelling. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Laser pointer Batch number / Barcode: 2999747825220 Country of origin: China Alert submitted by: Cyprus







Alert number: A12/0084/18 Product: Novelty lighter Name: Unknown Risk type: Fire Category: Lighters Brand: YOMIN Type / number of model: Unknown Risk level: Serious risk The lighter is appealing to children. Children may play with it and cause a fire.

The product does not comply with the relevant European standard EN 13869. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Novelty lighter in the form of a lipstick Batch number / Barcode: Unknown Country of origin: Unknown Alert submitted by: Cyprus



Alert number: A12/0085/18 Product: Novelty lighter Name: LIGHTER BULLET 2009 Risk type: Fire Category: Lighters Brand: Unknown Type / number of model: Unknown Risk level: Serious risk The lighter is appealing to children. Children may play with it and cause a fire.

The product does not comply with the relevant European standard EN 13869. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Novelty lighter in the form of a bullet. Batch number / Barcode: Unknown Country of origin: Unknown Alert submitted by: Cyprus



Alert number: A12/0086/18 Product: Novelty lighter Name: The World Over Risk type: Fire Category: Lighters Brand: Unknown Type / number of model: Unknown Risk level: Serious risk The lighter is appealing to children. Children may play with it and cause a fire.

The product does not comply with the relevant European standard EN 13869. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Novelty lighter in the form of a gold bar with various texts inscribed on it. Batch number / Barcode: Unknown Country of origin: Unknown Alert submitted by: Cyprus



Alert number: A12/0069/18 Product: Led lamp Name: LED Spot Risk type: Electric shock Category: Lighting equipment Brand: GT Industrial Type / number of model: GT-SP0023D Risk level: Serious risk The electrical insulation between the live parts and the accessible metal body of the lamp is insufficient. The accessible metal body of the lamp could consequently become live.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 62560. Measures ordered by public authorities (to: Importer): Recall of the product from end users Description: LED lamp, sold in brown-white cardboard box. Electrical specifications: DR-4W-GU10, 230V. Batch number / Barcode: Unknown Country of origin: China Alert submitted by: Finland



	Commissione europea - Sistema di alianne rapido
	Alert number: A12/0093/18 Product: Passenger car Name: Spacetourer, Jumpy Risk type: Injuries Category: Motor vehicles Brand: Citroën Type / number of model: e2*2007/46*0530*03, e2*2007/46*0531*03 Risk level: Serious risk A defect concerning a machined part of the engine could cause a loss of power. As a result the engine could stall or fail. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles manufactured between 2/10/2017 and 25/11/2017 Country of origin: France Alert submitted by: France Products were found and measures were taken also in: Estonia, Ireland, Poland, The Netherlands Alert number: A12/0095/18
	Product: Passenger car Name: Odyssey Risk type: Injuries Category: Motor vehicles Brand: Honda
	Type / number of model: RL5 Risk level: Serious risk The second row outboard seats are not properly secured. This could increase the risk of injury in the event of an accident. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Researces are
_	Description: Passenger car Batch number / Barcode: The vehicles affected were manufactured between 2011 and 2016. Country of origin: United States Alert submitted by: Germany Alert number: A12/0096/18
	Product: Passenger car Name: S-Class Risk type: Injuries Category: Motor vehicles
	Brand: Mercedes-Benz Type / number of model: Type-approval number: e1*2001/116*0335*32-*35; Type: 221 Risk level: Serious risk In the event of a crash, the disconnection of the power supply by the pyrofuse prevents the automatic unlocking of the doors and the operation of other safety features.
	This could increase the risk of injury for the occupants. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Company recall page: http://keine Angabe (http://keine Angabe) Decorrigina Processors or company of the second s
	Description: Passenger car Batch number / Barcode: The vehicles affected were produced between 16 January 2017 and 17 July 2017. Country of origin: Germany Alert submitted by: Germany Products were found and measures were taken also in: Finland, Poland
	Alert number: A12/0097/18 Product: Passenger car Name: SLS AMG Risk type: Injuries Category: Motor vehicles Brand: Mercedes-Benz
	Type / number of model: Type approval number: e1*2007/46*0233*09-*13 Type: 197 Risk level: Serious risk The seatbelt can become stuck in the guide loop. In the event of an accident, this would reduce the effectiveness with which the seatbelt restrains the occupant.
	Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: The vehicles affected were manufactured between 17 October 2016 and 11 December 2017. Country of origin: Germany Alert submitted by: Germany

Alert number: A12/0098/18	
Product: Passenger car	
Name: ASX	
Risk type: Injuries	
Category: Motor vehicles	
Brand: Mitsubishi	
Type / number of model: GA0W	
Risk level: Serious risk	
The door lock mechanism might not operate properly in high temperatures.	
As a result, the door may not be locked properly and could open while the vehicle is moving.	
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)	
Description: Passenger car	
Batch number / Barcode: Model year: 2015	
Country of origin: Japan	
Alert submitted by: Poland	
Products were found and measures were taken also in: Ireland, Sweden	
Alert number: A12/0099/18	
Product: Passenger car	
Name: ASX	
Risk type: Injuries	
Category: Motor vehicles	
Brand: Mitsubishi	
Type / number of model: GAOW	
Risk level: Serious risk	
The engine electronic control unit relay may heat up abnormally.	
This could lead to the engine stalling while driving and not being able to restart the engine.	
Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)	
Description: Passenger car	
Batch number / Barcode: Model year: 2015	
Country of origin: Japan	
Alert submitted by: Poland	
Products were found and measures were taken also in: Ireland, Sweden	
Alert number: A12/0105/18	
Product: Passenger car	
Product: Passenger car Name: DB9, DBS, Vanquish,Virage	
Product: Passenger car Name: DB9, DBS, Vanquish,Virage Risk type: Fire	
Product: Passenger car Name: DB9, DBS, Vanquish,Virage Risk type: Fire Category: Motor vehicles	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown	
Product: Passenger car Name: DB9, DBS, Vanquish,Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk	
Product: Passenger carName: DB9, DBS, Vanquish, VirageRisk type: FireCategory: Motor vehiclesBrand: Aston MartinType / number of model: UnknownRisk level: Serious riskThe battery supply cable may be damaged by movement of right side front seat.	
Product: Passenger carName: DB9, DBS, Vanquish, VirageRisk type: FireCategory: Motor vehiclesBrand: Aston MartinType / number of model: UnknownRisk level: Serious riskThe battery supply cable may be damaged by movement of right side front seat.This could create a short circuit causing the supply cable to overheat.	
Product: Passenger carName: DB9, DBS, Vanquish, VirageRisk type: FireCategory: Motor vehiclesBrand: Aston MartinType / number of model: UnknownRisk level: Serious riskThe battery supply cable may be damaged by movement of right side front seat.This could create a short circuit causing the supply cable to overheat.Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)	
Product: Passenger carName: DB9, DBS, Vanquish, VirageRisk type: FireCategory: Motor vehiclesBrand: Aston MartinType / number of model: UnknownRisk level: Serious riskThe battery supply cable may be damaged by movement of right side front seat.This could create a short circuit causing the supply cable to overheat.Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)Description: Passenger car	
Product: Passenger carName: DB9, DBS, Vanquish, VirageRisk type: FireCategory: Motor vehiclesBrand: Aston MartinType / number of model: UnknownRisk level: Serious riskThe battery supply cable may be damaged by movement of right side front seat.This could create a short circuit causing the supply cable to overheat.Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)	
Product: Passenger carName: DB9, DBS, Vanquish, VirageRisk type: FireCategory: Motor vehiclesBrand: Aston MartinType / number of model: UnknownRisk level: Serious riskThe battery supply cable may be damaged by movement of right side front seat.This could create a short circuit causing the supply cable to overheat.Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)Description: Passenger carBatch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015.	
Product: Passenger carName: DB9, DBS, Vanquish, VirageRisk type: FireCategory: Motor vehiclesBrand: Aston MartinType / number of model: UnknownRisk level: Serious riskThe battery supply cable may be damaged by movement of right side front seat.This could create a short circuit causing the supply cable to overheat.Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)Description: Passenger carBatch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015.Country of origin: United Kingdom	
Product: Passenger car Name: DB9, DBS, Vanquish,Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Products were found and measures were taken also in: Germany, The Netherlands	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Products were found and measures were taken also in: Germany, The Netherlands	
Product: Passenger carName: DB9, DBS, Vanquish, VirageRisk type: FireCategory: Motor vehiclesBrand: Aston MartinType / number of model: UnknownRisk level: Serious riskThe battery supply cable may be damaged by movement of right side front seat.This could create a short circuit causing the supply cable to overheat.Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)Description: Passenger carBatch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015.Country of origin: United KingdomAlert submitted by: United KingdomProduct: were found and measures were taken also in: Germany, The NetherlandsAlert number: A12/0106/18 Product: Passenger car	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Products were found and measures were taken also in: Germany, The Netherlands Alert number: A12/0106/18 Product: Passenger car Name: DB9,DBS,Rapide,Vanquish	
Product: Passenger car Name: DB9, DBS, Vanquish,Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Product: Passenger car Alert number: A12/0106/18 Product: Passenger car Name: DB9,DBS,Rapide,Vanquish Risk type: Injuries	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Product: Passenger car Name: DB9, DBS, Rapide, Vanquish Risk type: Injuries Category: Motor vehicles	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Products were found and measures were taken also in: Germany, The Netherlands Alert number: A12/0106/18 Product: Passenger car Name: DB9,DBS,Rapide,Vanquish Risk type: Injuries Category: Motor vehicles Brand: Aston Martin	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Product: Passenger car Alert number: A12/0106/18 Product: Passenger car Name: DB9,DBS,Rapide,Vanquish Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Products: Passenger car Nalert submitted by: United Kingdom Products: Passenger car Name: DB9,DBS,Rapide,Vanquish Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Product: A12/0106/18 Product: A12/0106/18 Product: Passenger car Name: DB9, DBS, Rapide, Vanquish Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk There is a defect related to the software for the Transmission Control Module.	
Product: Passenger car Name: DB9, DBS, Vanquish,Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By; Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Product: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Products were found and measures were taken also in: Germany, The Netherlands Alert number: A12/0106/18 Product: Passenger car Name: DB9,DBS, Rapide, Vanquish Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk kevel: Serious risk There is a defect related to the software for the Transmission Control Module. There is a defect r	
Product: Passenger car Name: DB9, DBS, Vanquish,Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Product: Passenger car Name: DB9,DBS,Rapide,Vanquish Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk There is a defect related to the software for the Transmission Control Mo	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Product: Passenger car Name: DB9, DBS, Rapide, Vanquish Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk tevel: Serious risk There is a defect related to the software for the Transmission Control Module. The vehicle may roll away from its parked position and create a hazard to pedestrians and other road users. Measures taken by economic operators: Recall of	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This is could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Product: Wave found and measures were taken also in: Germany, The Netherlands Alert number: A12/0106/18 Product: Passenger car Name: DB9,DBS,Rapide,Vanquish Risk type: Injuries Category: Motor whicles Brand: Aston Martin Type / number of model: Unknown Risk type: Injuries Category: Motor whicles Brand: Aston Martin Type / number of model: Unknown Risk tevel: Serious risk There is a defect related to the software for the Transmission Control Module. There vehicle may roll away from its parked position and create a hazard to pedestrians	
Product: Passenger car Name: DB9, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recail of the product from end users (By: Manufacturer) Desoription: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Alert submitted by: United Kingdom Product: Passenger car Name: DB9,DBS,Rapide,Vanguish Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk type: Injuries Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk type: Serious risk There is a defect related to the software for the Transmission Control Mo	
Product: Passenger car Name: DB3, DBS, Vanquish, Virage Risk type: Fire Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk level: Serious risk The battery supply cable may be damaged by movement of right side front seat. This is could create a short circuit causing the supply cable to overheat. Measures taken by economic operators: Recall of the product from end users (By: Manufacturer) Description: Passenger car Batch number / Barcode: Vehicles built between 19/12/2003 and 17/11/2015. Country of origin: United Kingdom Product: Passenger car Batch number: A12/0106/18 Product: Passenger car Name: DB9,DBS,Rapide,Vanquish Risk type: Injires Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk type: Injires Category: Motor vehicles Brand: Aston Martin Type / number of model: Unknown Risk kevel: Serious risk There is a defect related to the software for the Transmission Control Module. There vehicle may roll away from its parked position and create a hazard to pedestrians and other road users. <td< td=""><td></td></td<>	

Alert number: A12/0087/18 Product: Work gloves Name: Tegera classic Risk type: Chemical Category: Protective equipment Brand: ejendals Type / number of model: Unknown Risk level: Serious risk The amount of chromium (VI) in the leather is too high (measured value up to 9.9 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions.

The product does not comply with the requirements of the Personal Protective Equipment Directive and with the REACH Regulation. **Measures taken by economic operators:** Recall of the product from end users (By: Retailer) **Description:** Work gloves, palm and back in brown leather, partly lined with beige fabric, black suede cuff edged with black fabric. **Batch number / Barcode:** 7 392626036932 **Country of origin:** Sweden

Alert submitted by: Germany



Alert number: A12/0067/18 Product: Fancy-dress costume Name: Little bear Risk type: Choking Category: Toys Brand: Belly babies UNDERWRAPS Type / number of model: CS810109/XL CS810109/L CS810109/M Risk level: Serious risk The product contains small parts (the eyes) that can easily be detached. A small child may put these parts in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1. Measures taken by economic operators: Recall of the product from end users (By: Importer) Description: Brown plush costume in the shape of a bear, comprising bodysuit, two booties and a bear character hood. Batch number / Barcode: Unknown Country of origin: China Alert submitted by: France



Alert number: A12/0070/18 Product: Plush toy Name: Unknown Risk type: Chemical, Choking Category: Toys Brand: Unknown Type / number of model: GB-VH14 Risk level: Serious risk The battery compartment can easily be opened without use of any tools and the button cell batteries inside are accessible. Children might put them in the mouth and swallow them, causing damage to their gastrointestinal tract.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: A plush monkey that emits sound when its belly is pushed. Toy has attached a paper label with a warning. Batch number / Barcode: GB-VH14-780360 Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/0071/18 Product: Squeeze toy Name: Mini Kitty in the Bag Risk type: Chemical, Choking Category: Toys Brand: Unknown Type / number of model: 528 Risk level: Serious risk The battery compartment can easil

The battery compartment can easily be opened without use of any tools and the button cell batteries inside are accessible. Children might put them in the mouth and swallow them, causing damage to the gastrointestinal tract.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Product from the market

Description: A squeezable, hessian fabric toy – emits a sound like a cat meowing when squeezed. A small pink snap-hook and a label are attached to the toy.

Batch number / Barcode: Unknown Country of origin: China Alert submitted by: Czech Republic



Alert number: A12/0072/18 Product: Plastic doll Name: Angel in white Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: No. 277 Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 16.3% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic doll with accessories. The package includes plastic medical instruments (first aid kit, syringe, phonendoscope, etc.). Batch number / Barcode: 8 595 500 003 757, BM375K62 Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/0073/18 Product: Plastic doll Name: Charm Magic Girl Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: NO: 910 Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 12% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic doll Charm Magic Girl / Happy Girl trend - about 23 cm tall with blue skin color Batch number / Barcode: 225222025016, 6B 6675-2003 Country of origin: China



Alert number: A12/0074/18 Product: Plastic doll Name: FAD GIRL Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: NO: 807 Risk level: Serious risk The doll's head contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 11.4% by weight). This phthalate may harm the health of children, causing possible damage of the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic doll with a textile dress, about 23cm tall. Other inscriptions: MAGIC GIRL / Hong SHENG Batch number / Barcode: Unknown Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/0075/18 Product: Plastic doll Name: HENGFA/Happy Day Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: NO: 798 Risk level: Serious risk The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 10.4% by weight).

This pthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Individually packaged plastic doll, about 11cm tall with different hair and dress. Batch number / Barcode: 1225222025016, 6B 6675-2003 Country of origin: China



Alert number: A12/0076/18 Product: Plastic doll Name: Fashion Girl Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: 8623322306081 , No. 825 Risk level: Serious risk The plastic material of the dolls contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 10% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Two dolls in one box, about 28 cm tall with different dress. Batch number / Barcode: Unknown Country of origin: China Alert submitted by: Czech Republic



Alert number: A12/0077/18 Product: Plastic doll Name: SWEET days Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: No. 503 Risk level: Serious risk The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 12.1% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The product does not comply with the REACH Regulation. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic doll packed in a cardboard box, about 27 cm tall with long hair and different long dress. Batch number / Barcode: 8141740105357, ITEM NO 503AA

Country of origin: China



Alert number: A12/0078/18 Product: Plastic toy Name: My Little Pegasus Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: NO. 6619-Risk level: Serious risk The plastic material of the toy contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 5.5% by weight) This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic horse with wings and unicorn with mane and tail for combing, 15 cm tall. The set includes also plastic combs and hairclips. Batch number / Barcode: 6951449644543 , Item No: 4964454 Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/0079/18 Product: Plastic doll Name: for you Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: Unknown Risk level: Serious risk The plastic material of the dolls contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 14.8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Set of 3 plastic dolls about 12 cm tall, with different colorful textile dresses, long hair and red shoes. Batch number / Barcode: 8625511304816, ITEM NO: 13048 Country of origin: China

Alert submitted by: Czech Republic





Alert number: A12/0081/18 Product: Plastic doll Name: BEAUTIFUL / FASHION GIRL Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: NO. 2430 Risk level: Serious risk

9/2/2018

Commissione europea - Sistema di allarme rapido

The plastic material of the blue-haired doll contains di- (2-ethylhexyl) phthalate (DEHP) (measured value 26.8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic doll with long hair. The dress can be n different colours. Batch number / Barcode: 859000024301, ITEM NO: 2430 6d8x144 Country of origin: China Alert submitted by: Czech Republic

https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.weeklyReport.Print&web_report_id=2722







Alert number: A12/0082/18 Product: Plastic doll Name: JING PIN MEI SHAO NV Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: Unknown Risk level: Serious risk The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 5.2 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic doll about 24 cm tall with long hair and textile dress. Batch number / Barcode: 6927833184902, item NO: AH 2618490 Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/0083/18 Product: Plastic doll Name: My Baby Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: Unknown Risk level: Serious risk The plastic material of the blue-haired doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 15.2% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Set of three dolls about 10 cm tall in a one packaging Batch number / Barcode: 00410301, 8592190413019 Country of origin: China Alert submitted by: Czech Republic

00410301 Parenta



Alert number: A12/0100/18 Product: Wind-up toy mouse Name: RUNNING MOUSE Risk type: Choking Category: Toys Brand: FORUM NOVELTIES Type / number of model: Item 67417. Ref.: 194374 Risk level: Serious risk The handle to wind up the toy can detach, generating a small part. A child may put the small part in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1. Measures ordered by public authorities (to: Importer): Withdrawal of the product from the market Description: Wind-up toy mouse on wheels, sold in a purple cardboard box. Batch number / Barcode: 721773674174 Country of origin: China

Alert submitted by: Spain









A C CO

Alert number: A12/0102/18 Product: Baby doll Name: Smile Annie Baby Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: Unknown Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 12% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The product does not comply with the REACH Regulation. Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Baby doll, dressed in overall with text "rough pear", beanie and dummy. Batch number / Barcode: 8009040009396, ITEM NO: K358A, K358B, ITEM No: TC142939 Country of origin: China Alert submitted by: Czech Republic ITEM NO: K358A K358B

Alert number: A12/0103/18 Product: Plastic doll Name: Beauty Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: NO.509 Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 20.1% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic doll "Beauty, greet fashion house" with blond and pink hair. Packed in a pink cardboard cone. Batch number / Barcode: 6901234066760, TM6676-203 Country of origin: China





Alert number: A12/0107/18 Product: Puzzle mat Name: Eva Puzzle Mats Risk type: Choking Category: Toys Brand: Unknown Type / number of model: ALG862408 Risk level: Serious risk The mat has detachable small parts. Small children could detach and put the small parts in the mouth and choke on them.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1. Measures taken by economic operators: Withdrawal of the product from the market (By: Importer) Description: Colourful puzzle foam mat including removable numbers and letters. Plastic packaging. Batch number / Barcode: 6991208624089

Country of origin: China

Alert submitted by: Poland



Alert number: A12/0108/18 Product: Plastic doll Name: SWEET days Risk type: Chemical Category: Toys Brand: Unknown Type / number of model: NO. WX502 Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 2.67% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market Description: Plastic doll about 29 cm tall with accessories, packed in a cardboard box with transparent window. Batch number / Barcode: 8599900047694, ITEM NO 4769-5489 Country of origin: China



Alert number: A12/0109/18 Product: Plastic doll set Name: MIX & MATCH ACCESSORIES Risk type: Chemical Category: Toys Brand: L.Q.L. SURPRISE! Type / number of model: Unknown Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 0.28% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities: Import rejected at border

Description: Small doll about 5 cm tall in a plastic ball - house (10cm) with accessories. Packed in a cardboard box with transparent window Batch number / Barcode: 6924880214026, AM511900

Country of origin: China









Alert number: A12/0110/18 Product: Police set Name: Super battle Military Risk type: Chemical Category: Toys Brand: X XIN YE Type / number of model: Unknown Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 13.7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The product does not comply with the REACH Regulation. Measures ordered by public authorities: Import rejected at border Description: The police set includes: baton, handcuffs, 3-shot pistols, targets, binoculars. Packed in a blister with a cardboard back. Batch number / Barcode: 8590439604303, Batch no: 150517, item No: M60430 Country of origin: China Alert submitted by: Czech Republic





Alert number: A12/0111/18 Product: Plastic doll Name: Happy girl Risk type: Chemical Category: Toys Brand: Style Fashion Type / number of model: Unknown Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 19.7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation. **Measures ordered by public authorities (to: Retailer):** Withdrawal of the product from the market **Description:** Plastic doll about 10 cm tall, packed in transparent box. **Batch number / Barcode:** 00410076, 8592190041762 **Country of origin:** China **Alert submitted by:** Czech Republic



Alert number: A12/0112/18 Product: Baby doll set Name: Doll Stroller Deluxe Play Risk type: Chemical Category: Toys Brand: Tutu love Type / number of model: 08/2017, 86836 Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 30.2% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation. Measures ordered by public authorities: Import rejected at border Description: Plastic baby doll approx. 32 cm tall. The pack includes a folding pushchair with baby accessories. Packed in a cardboard box with transparent window. Batch number / Barcode: 114487, 8590331144877 Country of origin: China Alert submitted by: Czech Republic





Alert number: A12/0113/18 Product: Plastic doll Name: Magic Pegasus Risk type: Chemical Category: Toys Brand: JIN MEI TOY Type / number of model: NO.7713-4 Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 30.3% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The product does not comply with the REACH Regulation. Measures ordered by public authorities: Import rejected at border Description: Plastic doll about 14 cm tall. The package includes a pink comb and a yellow unicorn with purple wings. Batch number / Barcode: 47217, 170295, 8592117472174

Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/0114/18 Product: Plastic doll Name: Aesthetic fashion Risk type: Chemical Category: Toys Brand: CHARMING GIRLS Type / number of model: NO.TY-918 Risk level: Serious risk The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value 12.9% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Doll about 24 cm tall, packed in a cardboard box with transparent window. Other inscriptions: "THE BABY OF HAPPINESS, beautiful young girl in vogue".

Batch number / Barcode: 00420000025577, ITEM NO: NM2557 Country of origin: China Alert submitted by: Czech Republic



