



European Commission ([http://ec.europa.eu/index\\_en.htm](http://ec.europa.eu/index_en.htm)) Consumers ([http://ec.europa.eu/consumers/index\\_en.htm](http://ec.europa.eu/consumers/index_en.htm))

Consumers safety ([http://ec.europa.eu/consumers/consumers\\_safety/index\\_en.htm](http://ec.europa.eu/consumers/consumers_safety/index_en.htm))

Safety products ([http://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/index\\_en.htm](http://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/index_en.htm))

🏠 [Rapid Alert System home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.ht](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.ht)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2018\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2018)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search)

👉 [Safe Products Online \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=SafeProductsOnline\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=SafeProductsOnline)

## The Rapid Alert System for Non-Food Products (RAPEX)

### *RAPEX - Weekly overview report of notifications*

week 34 - 2018

Alert number: A12/1236/18

Product: Baby blanket

Name: Blanket cot animal face

Risk type: Injuries, Strangulation

Category: Childcare articles and children's equipment

Brand: HEMA

Type / number of model: Artikel code 33.32.8025

Risk level: Serious risk

The thread can easily loosen from the edge of the blanket.

It could get wrapped around a child's limbs or neck, resulting in injuries or strangulation.

Measures taken by economic operators: Recall of the product from end users (By: Distributor)

Description: Baby blanket in grey with an image of a cat face. Along the edge the blanket is trimmed with a white decorative stitching.

Dimensions: 100 x 150 cm

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: The Netherlands

Products were found and measures were taken also in: France



Alert number: A12/1217/18

Product: Girls' bikini

Name: Unknown

Risk type: Injuries

Category: Clothing, textiles and fashion items

Brand: Power Flower

Type / number of model: AA111

Risk level: Serious risk

The bikini top bears functional cords to be tied at the back.

These cords can become trapped during various activities of a child, leading to injuries.

The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Bikini intended for 8/10 year old girls. Both parts have multicoloured zigzag line patterns. The upper part bears functional cords to be tied at the back.

Batch number / Barcode: 5553724141115

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/1218/18

Product: Children's sweatshirt

Name: Unknown

Risk type: Injuries, Strangulation

Category: Clothing, textiles and fashion items

Brand: G. S. KALLI

Type / number of model: Unknown

Risk level: Serious risk

The drawstrings in the neck area may become trapped during various activities of a child, leading to strangulation.

In addition, the drawstrings in the waist area are too long and could become trapped during various activities of a child, leading to injuries.

The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Blue sweatshirt with white stripes on the sleeves and pockets, intended for 8 year old children. This garment bears functional cords, with free ends, along with 3D embellishments, in the neck and waist area.

Batch number / Barcode: Unknown

Country of origin: Greece

Alert submitted by: Cyprus



Alert number: A12/1219/18

Product: Boys' shorts

Name: Unknown

Risk type: Injuries

Category: Clothing, textiles and fashion items

Brand: BOY & STUDIO

Type / number of model: H6876

Risk level: Serious risk

There are functional cords on the lower hems that hang below the crotch.

The cords can become trapped during various activities of a child, leading to injuries.

The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Shorts for children up to 4 years. The garment has functional cords at the lower edge, hanging below the crotch.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/1220/18

Product: Girls' bikini

Name: Beach

Risk type: Injuries, Strangulation

Category: Clothing, textiles and fashion items

Brand: MONNALISA

Type / number of model: ART 9021, MOD 999000

Risk level: Serious risk

The drawstrings in the neck area may become trapped during various activities of a child, leading to strangulation.

In addition, the drawstrings going around the back are too long and could become trapped during various activities of a child, leading to injuries.

The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities (to: Distributor, Retailer): Withdrawal of the product from the market, Withdrawal of the product from the market

Description: Bikini set intended for 3 year old girls. The garment has a multicoloured, floral pattern and bears functional cords on the upper and lower part to be tied at the neck and back area respectively.

Batch number / Barcode: 999990149299

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/1221/18

Product: Girls' bikini

Name: Unknown

Risk type: Injuries

Category: Clothing, textiles and fashion items

Brand: Hello Bikini

Type / number of model: HELLO -019

Risk level: Serious risk

The top part of the bikini set has functional cords to be tied at the back area.

The cords can become trapped during various activities of a child, leading to injuries.

The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Bikini intended for 4 year old girls. Both upper and lower parts of the set are pink and decorated with frills and flower shapes. The upper part bears functional cords to be tied at the back.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/1222/18  
 Product: Girls' jumpsuit  
 Name: Unknown  
 Risk type: Injuries  
 Category: Clothing, textiles and fashion items  
 Brand: DANSHAN / TAOSHUANG  
 Type / number of model: YIDENGPIN - G53075006  
 Risk level: Serious risk  
 The functional cords in the waist area are too long.  
 The cords can become trapped during various activities of a child, leading to injuries.

The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Short denim jumpsuit for 4 year old girls. This garment has functional cords with three dimensional embellishments in the waist area.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/1223/18  
 Product: Girls' swimsuit  
 Name: Unknown  
 Risk type: Strangulation  
 Category: Clothing, textiles and fashion items  
 Brand: YES ! DO KIDS  
 Type / number of model: YES - 070  
 Risk level: Serious risk

The garment is produced with functional cords with free ends in the upper area to be tied around the neck.

The cords in the neck area may become trapped during various activities of a child, leading to strangulation.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Girls' floral swimsuit, intended for 7/8 year olds, decorated with tassel trims in the waist area. This bathing suit bears functional cords with free ends to be tied in the upper neck area.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Cyprus



Alert number: A12/1228/18

Product: Children's sweatshirt

Name: Unknown

Risk type: Strangulation

Category: Clothing, textiles and fashion items

Brand: SENIOR

Type / number of model: Unknown

Risk level: Serious risk

There are drawstrings with free ends in the hood.

The drawstrings may become trapped during various activities of the child, leading to strangulation.

The product does not comply with the relevant European standard EN 14682.

Measures taken by economic operators: Making the marketing of the product subject to prior conditions (By: Distributor)

Description: Children's sweatshirt with different patterns (elephant head or sunglasses) and with drawstrings with free ends in the hood.

Batch number / Barcode: art. AB-CDS05

Country of origin: Thailand

Alert submitted by: Slovenia





**Alert number:** A12/1238/18

**Product:** Scarf

**Name:** Cashmy

**Risk type:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** A + more

**Type / number of model:** Style 1810

**Risk level:** Serious risk

The scarf contains azo dyes releasing 790 mg/kg of benzidine.

When the product is in direct and prolonged contact with the skin, the aromatic amine may be absorbed by the skin.

Aromatic amines can cause cancer, cell mutations and affect reproduction.

The product does not comply with the REACH Regulation.

**Measures ordered by public authorities (to: Importer):** Import rejected at border

**Description:** A dark blue cashmere scarf.

**Batch number / Barcode:** 1234567323671

**Country of origin:** India

**Alert submitted by:** Finland



**Alert number:** A12/1237/18

**Product:** Baby Lotion

**Name:** Lait de toilette Hydratant pour Bébé

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Pr.FRANCOISE BEDON Paris

**Type / number of model:** Unknown

**Risk level:** Serious risk

Methylchloroisothiazolinone (MCI) and Methylisothiazolinone (MI) are listed in the ingredients of this leave-on product.

MI and MCI are sensitizing agents and can provoke allergic contact dermatitis to sensitised persons.

The product does not comply with the Cosmetic Products Regulation.



**Measures taken by economic operators:** Withdrawal of the product from the market, Withdrawal of the product from the market (By: Retailer)

**Description:** Moisturising lotion intended for use when changing a baby. Packaged in a white 1000ml bottle with a white cap. The text on the product is in English and French.

**Batch number / Barcode:** Batch: 216/06/17/10 Barcode: 3 045050 086277

**Country of origin:** France

**Alert submitted by:** Ireland

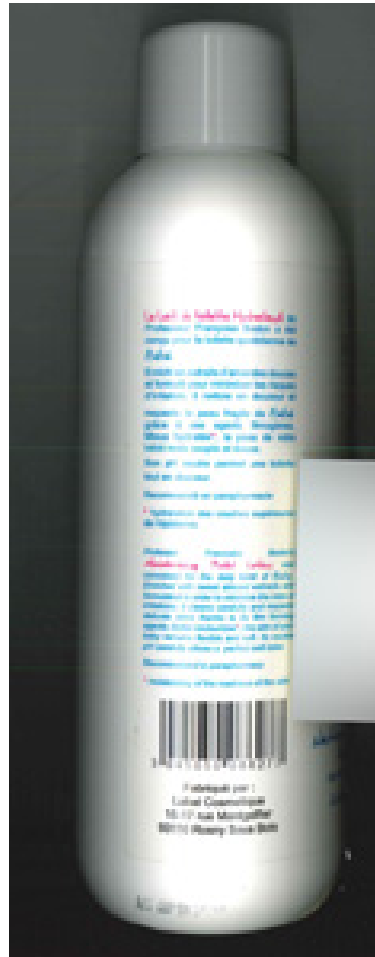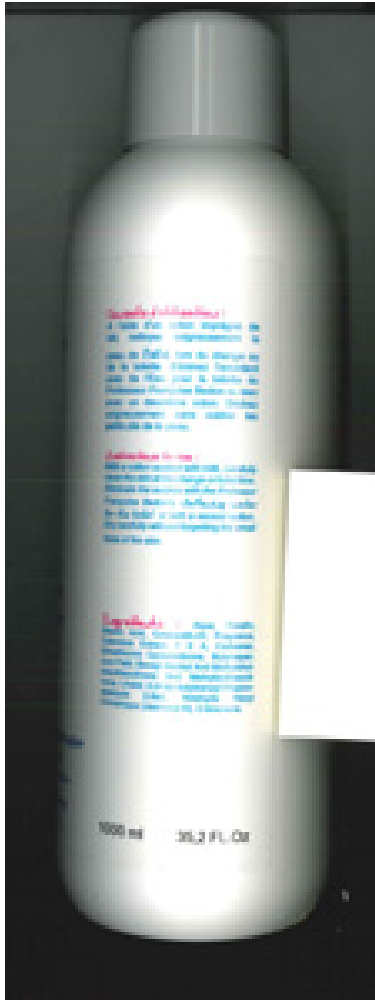

Alert number: A12/1240/18

Product: Chimney starter

Name: House piippusytytin

Risk type: Burns, Fire

Category: Kitchen/cooking accessories

Brand: House

Type / number of model: Unknown

Risk level: Serious risk

The wooden handle of the product may come loose or break when the product is being used.

The ignition source may fall out causing fire or burns to users.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Measures ordered by public authorities (to: Importer): Ban on the marketing of the product and any accompanying measures, Recall of the product from end users

Company recall page:

[https://www.s-kanava.fi/web/s-ryhma/uutinen/takaisinvento-house-piippusytytin-puukahvalla-musta/4610804\\_384136](https://www.s-kanava.fi/web/s-ryhma/uutinen/takaisinvento-house-piippusytytin-puukahvalla-musta/4610804_384136) ([https://www.s-kanava.fi/web/s-ryhma/uutinen/takaisinvento-house-piippusytytin-puukahvalla-musta/4610804\\_384136](https://www.s-kanava.fi/web/s-ryhma/uutinen/takaisinvento-house-piippusytytin-puukahvalla-musta/4610804_384136))

Description: Black metal chimney starter with wooden handle.

Batch number / Barcode: 6412988485405

Country of origin: China

Alert submitted by: Finland



Alert number: A12/1241/18

Product: Light fixture

Name: LOLLY fali, mennyezeti lámpa, fehér

Risk type: Electric shock

Category: Lighting equipment

Brand: HOFOZ

Type / number of model: 400 XXX 110; 400 000 110/1

Risk level: Serious risk

When removing the lamp shade, live parts are accessible.

The user can touch these live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures ordered by public authorities (to: Distributor): Recall of the product from end users, Withdrawal of the product from the market

Description: Ceiling or wall light (fixed luminaire) with an E27 cap. Packaging: transparent plastic bag.

Batch number / Barcode: 5 999084 918552

Country of origin: Turkey

Alert submitted by: Hungary



Alert number: A12/1225/18  
 Product: Passenger car  
 Name: A-Class  
 Risk type: Injuries  
 Category: Motor vehicles  
 Brand: Mercedes-Benz  
 Type / number of model: Type-approval number: e1\*2007/46\*1829\*00-01; Type: F2A  
 Risk level: Serious risk  
 The navigation software may be faulty, storing the wrong location of the vehicle.  
 As a result, when the emergency call system (eCall) is used, the location communicated to the emergency centre might not correspond to the current vehicle location. In such cases, emergency services would not be correctly directed to the vehicle.  
 Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)  
 Description: Passenger car  
 Batch number / Barcode: The vehicles affected were produced between 19 January 2018 and 17 April 2018.  
 Country of origin: Germany  
 Alert submitted by: Germany

Alert number: A12/1226/18  
 Product: Passenger car  
 Name: 6  
 Risk type: Injuries  
 Category: Motor vehicles  
 Brand: Mazda  
 Type / number of model: Type-approval number: e1\*98/14\*0188\*00-10; Type: GG/GY  
 Risk level: Serious risk  
 Due to excessive internal pressure, the housing of the driver airbag gas generator can burst when the airbag is activated.  
 This can cause the occupants of the vehicle to be injured by metal splinters.  
 Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)  
 Description: Passenger car  
 Batch number / Barcode: The vehicles affected were produced between 3 June 2002 and 31 June 2005.  
 Country of origin: Japan  
 Alert submitted by: Germany  
 Products were found and measures were taken also in: The Netherlands

Alert number: A12/1229/18  
 Product: Van  
 Name: Sprinter  
 Risk type: Injuries  
 Category: Motor vehicles  
 Brand: Mercedes-Benz  
 Type / number of model: Type-approval numbers: e1\*2001/116\*0354; e1\*2007/46\*0294, \*0296, \*0300, \*0301, \*1760, \*1761, \*1762, 1763; types: 906 AC 35, 906BA50, 906BB50, 906BA35, 906BB35, KL3A4, FL3A4, KL3A5, FL3A5  
 Risk level: Serious risk  
 Due to a faulty software, the backlighting of the hazard warning switch may be deactivated.  
 The switch is therefore poorly visible in darkness. This could result in an increased accident risk.  
 Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)  
 Description: Van  
 Batch number / Barcode: The vehicles affected were produced between 4 December 2017 and 28 May 2018.  
 Country of origin: Germany  
 Alert submitted by: Germany

Alert number: A12/1230/18  
 Product: Commercial vehicle/heavy goods vehicle  
 Name: Hako  
 Risk type: Injuries  
 Category: Motor vehicles  
 Brand: Multicar  
 Type / number of model: Multicar M31 = e1\*2007/46\*1136\*00 Multicar M30 (FUMO) = e1\*2007/46\*0493\*01 Multicar M27 = e1\*19/2011\*249/2012\*0032\*00 Typ: M27, M31, M30 (Fumo)  
 Risk level: Serious risk  
 The ABS may be activated inadvertently when starting on a slippery slope, with the car moving backwards and the brake pedal is locked.  
 In this operating state it is not possible to initiate service braking for about 3 sec. This could lead to an increased risk of accident and injuries.  
 Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)  
 Description: Commercial vehicle/heavy goods vehicle  
 Batch number / Barcode: Vehicles manufactured between 2010 and 2014 are affected. Only vehicles equipped with Euro V engines.  
 Country of origin: Germany  
 Alert submitted by: Germany

**Alert number:** A12/1235/18  
**Product:** Camper van  
**Name:** T5, T6  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** VW/VW commercial vehicles  
**Type / number of model:** Type-approval numbers: e1\*2001/116\*0220\*; e1\*2001/116\*0289\*; types: 7HC, 7HMA  
**Risk level:** Serious risk  
The screw connections in the gas installation of the built-in kitchen may be inadequate.  
As a consequence, gas may leak and, due to poor ventilation, an explosion cannot be ruled out if an ignition source is simultaneously present.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Camper van  
**Batch number / Barcode:** California vehicle models with built-in kitchen produced between 14/1/2015 and 19/5/2018 are affected.  
**Country of origin:** Germany  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** The Netherlands

**Alert number:** A12/1242/18  
**Product:** Commercial vehicle / Heavy goods vehicle  
**Name:** Crafter NF  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** VW  
**Type / number of model:** Type approval number: e1\*2007/46\*1616, e1\*2007/46\*1621 Type: SYN2Z, SZN1Z  
**Risk level:** Serious risk  
The actuator is inadequate and the handbrake cables are incorrectly positioned.  
As a result, the cables can slip and bend when the parking brake is applied, causing them to tear over time.  
**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Commercial vehicle / Heavy goods vehicle  
**Batch number / Barcode:** The vehicles affected were manufactured between 23 February 2018 and 12 March 2018.  
**Country of origin:** Poland  
**Alert submitted by:** Germany

**Alert number:** A12/1243/18  
**Product:** Passenger car  
**Name:** Ibiza  
**Risk type:** Fire  
**Category:** Motor vehicles  
**Brand:** Seat  
**Type / number of model:** Type approval number: e9\*2007/46\*3134 Type: KJ  
**Risk level:** Serious risk  
The nuts of the gas pipes may not be sufficiently tightened, causing a leak of gas.  
In the presence of an ignition source, the gas may ignite.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)  
**Description:** Passenger car.  
**Batch number / Barcode:** The vehicles affected are powered by compressed natural and were manufactured in 2018.  
**Country of origin:** Spain  
**Alert submitted by:** Germany

**Alert number:** A12/1224/18

**Product:** Plastic doll set

**Name:** FASHION GO Shopping

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** NO.032

**Risk level:** Serious risk

The plastic material of the doll contains di (2-ethylhexyl phthalate (DEHP) (measured value: 12.7 % by weight) and dibutyl phthalate (DBP) (measured value: 0.16% by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Plastic doll with accessories, supplied in a colourful cardboard box with window.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/1227/18

**Product:** Plastic doll

**Name:** Vogue lovely girl

**Risk type:** Chemical

**Category:** Toys

**Brand:** Hayley / Daffi

**Type / number of model:** B-624 (on attached label) No.HB879 (on packaging)

**Risk level:** Serious risk

The plastic material of the doll's leg contains 2-ethylhexyl phthalate (DEHP) (measured value: 1.2 % by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Plastic doll packaged in a cardboard box with plastic window.

**Batch number / Barcode:** 5905422026247

**Country of origin:** China

**Alert submitted by:** Poland



Alert number: A12/1231/18

Product: Wax crayons

Name: Crayon Rocks

Risk type: Chemical

Category: Toys

Brand: Rubeez

Type / number of model: CR.CMU.16

Risk level: Serious risk

The migration of aluminium from the dark blue crayon is too high (measured value: 8,992 mg/kg).

Aluminium is potentially toxic if ingested.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-3.

Measures taken by economic operators: Recall of the product from end users (By: Retailer)

Description: Cardboard box containing a small textile bag of wax crayons in different colours in the form of small pebbles, with cardboard, cut-out shapes and a multi-coloured crayon.

Batch number / Barcode: 3806369490615

Country of origin: United States

Alert submitted by: France



Alert number: A12/1232/18

Product: Toy slime

Name: Slime animal

Risk type: Chemical

Category: Toys

Brand: Toi-toys

Type / number of model: article number 35488

Risk level: Serious risk

The migration of boron from the toy slime is too high (measured value: 529 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Measures taken by economic operators: Recall of the product from end users (By: Distributor)

Description: Toy slime with a flexible, plastic octopus figurine.

Batch number / Barcode: 8714627354881, batch number 815057

Country of origin: Unknown

Alert submitted by: France





Alert number: A12/1233/18

Product: Baby book with light

Name: Belly Bear

Risk type: Chemical, Choking

Category: Toys

Brand: Toi-Toys

Type / number of model: 71641

Risk level: Serious risk

When swallowed, button cells can trigger the generation of sodium hydroxide in the body. Sodium Hydroxide is a highly corrosive substance. Exposure to sodium hydroxide leads to severe burns and tissue damage.

Moreover, the button batteries and a piece of foam rubber can be easily detached from the toy. A small child could put either of them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

Measures ordered by public authorities (to: Retailer): Withdrawal of the product from the market

Description: Plastic book with pictures of animals for babies. Inside one of the pages there is a case with two button cells CR 1220. The product packaging reads "Battery powered 3 x Button Cell LR55".

Batch number / Barcode: 814030 / 8714627716412

Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/1234/18

Product: Toy slime

Name: Slim'pop - Pâte gluante

Risk type: Chemical

Category: Toys

Brand: Flypop's, MGM

Type / number of model: Unknown

Risk level: Serious risk

The migration of boron from the toy slime is too high (measured value: 3151 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Measures taken by economic operators: Recall of the product from end users (By: Importer)

Description: Toy slime in a plastic pot of approximately 300 g with a cardboard packaging. Available in green, blue, red, yellow.

Batch number / Barcode: 3301040310751, CF18006-D-031075

Country of origin: China

Alert submitted by: France



Alert number: A12/1239/18

Product: Balloons

Name: Party the Factory

Risk type: Chemical

Category: Toys

Brand: Haza Original

Type / number of model: Purple 30 cm 446731

Risk level: Serious risk

The amount of nitrosamines released by the balloons is too high (measured value up to 0.36 mg/kg).

Nitrosamines are genotoxic carcinogens via inhalation, ingestion or dermal exposure.

A child can get exposed to them by putting the balloon in the mouth.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

Measures ordered by public authorities: Withdrawal of the product from the market

Description: 100 purple balloons in transparent and blue packaging.

Batch number / Barcode: Ean 8711319467317

Country of origin: Spain

Alert submitted by: The Netherlands



Alert number: A12/1244/18

Product: Push-along toy

Name: Funny Toys / Kogut pchacz

Risk type: Choking

Category: Toys

Brand: P.H. Kris TAEM

Type / number of model: ITM.NO.00-58269 (on packaging) NO.318-1 (on a product)

Risk level: Serious risk

Small plastic parts (wheel pins, cylindrical elements on the rooster's tail and on the rod) can easily be detached from the toy.

A child may put the small parts in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Description: Plastic, rooster-shaped push-along toy. Packaged in plastic bag.

Batch number / Barcode: 5906160158269

Country of origin: China

Alert submitted by: Poland

