



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

## The Rapid Alert System for Non-Food Products (RAPEX)

### *RAPEX - Weekly overview report of notifications*

Week 47 - 2018

Corrigenda : Notification A12/1053/18 from Report 2018-030 has been permanently removed at the request of the notifying authority following new test results which show that the product complies. Notification A11/0084/18 from Report-2018-045 has been modified to correct the product description and applicable legal basis.

**Alert number:** A12/1738/18

**Product:** Bunk bed

**Name:** ŁÓZKO OLI

**Risk type:** Strangulation

**Category:** Furniture

**Brand:** MK - Kamos Meble

**Type / number of model:** Olle III

**Type of alert:** Products with serious risks

There is an opening between the safety barrier and the side of the upper bed.

A child may slide between the safety barrier and the bed base and get trapped by the head, leading to strangulation.

The product does not comply with the relevant European standard EN 747.

Stop of sales

**Description:** Bunk bed made of wood and MDF. The product has been sold online.

**Batch number / Barcode:** 77 DM 19

**Country of origin:** Poland

**Alert submitted by:** Sweden



**Alert number:** A12/1751/18

**Product:** Folding camping table

**Name:** Fernsehtisch

**Risk type:** Injuries

**Category:** Furniture

**Brand:** Unknown

**Type / number of model:** 14576626/I-9109-L

**Type of alert:** Products with serious risks

The table is unstable and can collapse under load causing injuries.

The product does not comply with the relevant European Standard EN 581.

Ban on the marketing of the product and any accompanying measures

**Description:** Folding table for outdoor use with a rectangular table top made of woodbased panels (MDF) and metal legs. Packed in plastic film.

**Batch number / Barcode:** 2014576626005

**Country of origin:** Germany

**Alert submitted by:** Lithuania



**Alert number:** A12/1732/18

**Product:** Self-balancing scooter (hoverboard)

**Name:** smartboard alpha I5

**Risk type:** Electric shock, Fire, Injuries

**Category:** Hobby/sports equipment

**Brand:** Alpha Ride

**Type / number of model:** Alpha JY-420201

**Type of alert:** Products with serious risks

The product has insufficient resistance to moisture and water could come into contact with live parts (the external charging connector in the battery compartment). This could lead to an electric shock or fire.

The discharge voltage of the connector pins of the power supply unit is too high and could lead to an electric shock.

The appliance can suddenly start up without use of the control device intended for that purpose which could lead to injuries.

The product does not comply with the requirements of the Machinery Directive and the relevant European Standard EN 60335-1.

Recall of the product from end users

**Description:** Electric self-balancing scooter ("hoverboard")

**Batch number / Barcode:** Alpha 1711067

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/1773/18

**Product:** Laser pointer

**Name:** Green Laser Pointer

**Risk type:** Damage to sight

**Category:** Laser pointers

**Brand:** YL

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

The laser beam is too powerful.

Direct viewing of the laser beam could cause damage to sight.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Pen-shaped laser pointer in a set with two 1.5V batteries. Packaging: gift box in a cardboard cover. Product size: 16.7 cm

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1752/18

**Product:** LED floodlight

**Name:** IP65 LED FLOOD LIGHT REFLECTOR

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** Global

**Type / number of model:** FL-APPLE-50W

**Type of alert:** Products with serious risks

Live parts may become directly accessible as there is no proper information for the user on safe installation of the connecting leads.

The user could consequently touch the live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** White LED floodlight. Packaging: colourful cardboard box. The product has been sold online.

**Batch number / Barcode:** 5 997882 127411

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1765/18

**Product:** LED lamp

**Name:** Rechargeable emergency lamp

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** JunAi

**Type / number of model:** JA-599

**Type of alert:** Products with serious risks

The lamp shade can be removed easily while the lamp is connected to the lamp holder.

Live parts can consequently become accessible.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Remote-controlled LED lamp with an E27 bulb and an egg-shaped, plastic cover. The lamp can be hung by a metal hook. The LED lamp can be operated either from mains voltage or battery. Packaging: a colourful cardboard box

**Batch number / Barcode:** 6 495741 515991 (on the packaging); 8 021012 001931 (on a label)

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1735/18

**Product:** Passenger car

**Name:** 500X

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Fiat

**Type / number of model:** Type-approval number: e3\*2007/46\*0318\*02; Type: 334

**Type of alert:** Products with serious risks

A faulty latch could cause the seat back to fold forward.

In the event of an accident, there is a greater risk of injury for the passengers.

Recall of the product from end users

**Description:** Passenger car. Company recall code: 6199

**Batch number / Barcode:** The vehicles in question were manufactured between 2 June 2015 and 17 August 2018.

**Country of origin:** Italy

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Finland, Iceland, Luxembourg, Poland, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1739/18

**Product:** Passenger car

**Name:** Avensis, Corolla, Verso

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Toyota

**Type / number of model:** EC-type approval number: e11\*2001/116\*0196, e11\*98/14\*0180, e11\*98/14\*0179, e11\*98/14\*0181, e11\*2001/116\*0222, e21\*PS2001/116\*0024.

**Type of alert:** Products with serious risks

The airbag control module for the supplemental restraint system (SRS ECU) has been assembled with application-specific integrated circuits (ASICs) that are susceptible to internal shorting when exposed to high inductive electrical noise from various vehicle electrical components.

If this occurs, there is a possibility that the ASIC could become damaged, leading to the airbag(s) and/or seat belt pretensioners being deactivated or deploying inadvertently.

Recall of the product from end users

**Description:** Passenger car. Company recall code: 18SMD103.

**Batch number / Barcode:** Model year: 2002 to 2006

**Country of origin:** Japan, Turkey, United Kingdom

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Finland, Iceland, Poland, Romania, Slovakia, Slovenia, Sweden

**Alert number:** A12/1740/18

**Product:** Passenger car

**Name:** Avensis, Corolla, Picnic, SC430, Yaris

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Toyota and Lexus

**Type / number of model:** EC-type approval number: e11\*2001/116\*0196, e11\*98/14\*0180, e6\*98/14\*0083, e2\*98/14\*0248, e6\*2001/116\*0084, e11\*98/14\*0179.

**Type of alert:** Products with serious risks

The ammonium nitrate propellant used in the air bag inflator may degrade over time due to heat cycles and exposure to moisture.

In the event of the airbag being deployed, the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the rider.

Recall of the product from end users

**Description:** Passenger car. Company recall code: 18SMD104.

**Batch number / Barcode:** Model year: 2001 to 2006

**Country of origin:** United Kingdom

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Finland, Iceland, Poland, Romania, Slovakia, Slovenia, Sweden

**Alert number:** A12/1741/18  
**Product:** Motorcycle  
**Name:** Softail, Touring, Trike, CVO & Police  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Harley-Davidson  
**Type / number of model:** Type-approval numbers: e4\*168/2013\*00016\*01 - e4\*168/2013\*00016\*02 – e4\*2002/24\*0002\*33; types: FS2 & FL3  
**Type of alert:** Products with serious risks  
An internal leak in the hydraulic clutch control mechanism may mean that the power transmission system cannot be disengaged.  
This may result in a loss of control over the vehicle.  
Recall of the product from end users  
**Description:** Motorcycle. Company recall code: 0173  
**Batch number / Barcode:** Vehicles produced between 2017 and 2018 are affected.  
**Country of origin:** United States  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Estonia, Finland, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1742/18  
**Product:** Passenger car  
**Name:** 6  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Mazda  
**Type / number of model:** Type-approval numbers: e1\*98/14\*0188\*03 - e1\*98/14\*0188\*09; type: GG/GY  
**Type of alert:** Products with serious risks  
The housing of the passenger air bag gas generator may burst when the airbag is activated, owing to excessive internal pressure.  
This can cause the occupants of the vehicle to be injured by metal fragments.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: AF058A  
**Batch number / Barcode:** The vehicles affected were manufactured between 3 June 2002 and 31 June 2005.  
**Country of origin:** Japan  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Bulgaria, Denmark, Finland, Luxembourg, Poland, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1743/18  
**Product:** Van  
**Name:** Mercedes-Benz  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Sprinter  
**Type / number of model:** Type-approval numbers: e1\*2001/116\*0354, e1\*2007/46\*0296, e1\*2007/46\*0301, e1\*2007/46\*1760, e1\*2007/46\*1763; types: 906 AC 35, 906BB50, 906BB35, KL3A4, FL3A5  
**Type of alert:** Products with serious risks  
Faulty coding of the door control unit can lead to the cancelling of the protective function of the exit warning assistance system. If a door is opened after the ignition is switched off in a hazardous situation there is no optical or acoustic warning.  
This may increase the risk of injury to the occupants of the vehicle.  
Recall of the product from end users  
**Description:** Van  
**Batch number / Barcode:** The vehicles in question were manufactured between 30/5/2018 and 18/7/2018.  
**Country of origin:** Germany  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Denmark, Finland, Poland, Sweden

**Alert number:** A12/1746/18  
**Product:** Trailer  
**Name:** FTK, Universal, Balios, Xanthos, Zephir, and more  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Humbaur  
**Type / number of model:** FTK, Universal, Balios, Xanthos, Zephir, HKT, Maximus, Startraile, Notos  
**Type of alert:** Products with serious risks  
 Faulty welding in the drum brake may lead to a loss of brake function.  
 As a consequence, the wheel brake may be insufficiently effective.

Recall of the product from end users

**Description:** Trailer. Company recall code: Humbaur-Knott  
**Batch number / Barcode:** The vehicles affected were produced in March and April 2018.  
**Country of origin:** Germany  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Croatia, Slovenia, The Netherlands

**Alert number:** A12/1754/18  
**Product:** Motorcycle/spare part  
**Name:** RSV4 1000/Tuono V4 1100-Radial master cylinder PR  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** APRILIA  
**Type / number of model:** Vehicles RSV4 1000 RR - RSV4 1000 RF - TUONO V4 1100 RR - TUONO V4 1100 FACTORY; spare parts code B044584 - code 2B002023 - code 2B002995  
**Type of alert:** Products with serious risks  
 There is a manufacturing defect on the piston that forms part of the front brake master cylinder.  
 This could affect the hydraulic circuit, which may increase the motorcycle's stopping distance.

Recall of the product from end users

**Description:** Motorcycle and spare part (front brake master cylinder).  
**Batch number / Barcode:** Aprilia RSV4 1000, Aprilia Tuono V4 1100 , Code 2B002023: from 5CXX to 5MXX - from 6AXX to 6MXX - from 7AXX to 7JXX, Code 2B002995: from 6GXX to 6MXX - from 7AXX to 7JXX , Code B044584: from 5EXX to 5MXX - from 6AXX to 6DXX  
**Country of origin:** Italy  
**Alert submitted by:** Italy  
**Products were found and measures were taken also in:** Bulgaria, Estonia, Slovakia, Slovenia, Sweden

**Alert number:** A12/1755/18  
**Product:** Motorcycle  
**Name:** Panigale and Hypermotard  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** DUCATI  
**Type / number of model:** Panigale 1299 FE Panigale V4 (all version) Panigale 959 HYM939  
**Type of alert:** Products with serious risks  
 On specific vehicles, the friction material on the rear brake pads may detach from the backing plate.  
 As a consequence the rear brake could become less effective, which could lead to accidents.  
 Recall of the product from end users  
**Description:** Motorcycle. Recall code SRV-RCL-18-004.  
**Batch number / Barcode:** Model year 2018  
**Country of origin:** Italy  
**Alert submitted by:** Italy  
**Products were found and measures were taken also in:** Croatia, Denmark, Estonia, Ireland, Poland, Slovenia, Sweden



**Alert number:** A12/1756/18  
**Product:** Lorry  
**Name:** FUSO Canter  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Mitsubishi  
**Type / number of model:** Type-approval numbers: e4\*2007/46\*0379\*00 -02, e4\*2007/46\*0380\*00-04, e4\*2007/46\*0784\*00-03, e4\*2007/46\*0785\*00-05; Types: FE4P10-01, FE4P10-02, FE4P10TF1N1, FE4P10TF1N2  
**Type of alert:** Products with serious risks  
The electrical wiring of the airbag control unit could be damaged in the event of accident  
As a result, the airbag might not be activated.  
Recall of the product from end users  
**Description:** Lorry  
**Batch number / Barcode:** The vehicles affected were produced between 29 September 2011 and 12 December 2017.  
**Country of origin:** Portugal  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Croatia

**Alert number:** A12/1757/18  
**Product:** Passenger car  
**Name:** Ibiza  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Seat  
**Type / number of model:** Ibiza 1,4 I TDI , Ibiza 6J  
**Type of alert:** Products with serious risks  
In the event of an impact the battery can get damaged, which leads to lack of power supply.  
If this occurs, it might not be possible to unlock the doors.  
Recall of the product from end users  
**Description:** Passenger car. Company recall codes: 27G7 (Ibiza 1,4 I TDI) and 97CY (Ibiza 6J)  
**Batch number / Barcode:** Vehicles affected were manufactured between July 2015 - June 2017 (Ibiza 1,4 I TDI) and July 2015 - February 2017 (Ibiza 6J)  
**Country of origin:** Spain  
**Alert submitted by:** Romania  
**Products were found and measures were taken also in:** Bulgaria, Denmark, Finland, Luxembourg, Portugal, Slovenia, Sweden

**Alert number:** A12/1760/18  
**Product:** Passenger car  
**Name:** Forester  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Subaru  
**Type / number of model:** Type-approval numbers: e1\*2001/116\*0485\*00 - 07, e13\*2001/116\*0982\*00; Types: SHS, SH  
**Type of alert:** Products with serious risks  
A defect in the gas generator of the front-seat passenger airbag leads to uncontrolled inflation.  
Metal fragments may be released when the airbag is activated, which can cause injury to passengers.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 201802  
**Batch number / Barcode:** Vehicles manufactured between 2009 and 2012 are affected.  
**Country of origin:** Japan  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Bulgaria, Denmark, Iceland, Luxembourg, Slovakia, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1761/18  
**Product:** Passenger car  
**Name:** Evora  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Lotus  
**Type / number of model:** EC-type approval: e4\*KS07/46\*0024\*09 e4\*KS07/46\*0024\*10 e4\*KS07/46\*0024\*11 e4\*KS07/46\*0024\*12; Types 122  
**Type of alert:** Products with serious risks  
The cartridge that enables the partial collapse of the steering column in a crash might not work as expected due to an incorrectly tightened screw.  
This could increase the risk of injuries to vehicle occupants in the event of an accident.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 2018/01R  
**Batch number / Barcode:** Specific vehicles built between 26 March 2018 and 2 October 2018  
**Country of origin:** United Kingdom  
**Alert submitted by:** United Kingdom  
**Products were found and measures were taken also in:** Denmark



**Alert number:** A12/1769/18

**Product:** Passenger car

**Name:** Aygo

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Toyota

**Type / number of model:** EC-type approval number: e11\*2001/116\*0236. Model Name (Model Code): Aygo (KGB10, WNB10);

**Type of alert:** Products with serious risks

The glass on the rear door is not properly glued.

The glass could consequently detach and only remain attached by one fixation point on the door panel or detach completely from the vehicle.

Recall of the product from end users

**Description:** Passenger car

**Batch number / Barcode:** Model year: 2005 to 2014.

**Country of origin:** Japan

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Estonia, Finland, Iceland, Poland, Romania, Slovakia, Slovenia, Sweden

**Alert number:** A12/1730/18

**Product:** Musical toy

**Name:** PEPPA PIG

**Risk type:** Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** 011A / 8986

**Type of alert:** Products with serious risks

Small parts can easily be detached from the toy.

A small child may put the small parts in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Withdrawal of the product from the market

**Description:** Battery-operated, plastic toy in the shape of a scooter, with a pig as a driver. The toy emits light and sounds. Packed into a cardboard box.

**Batch number / Barcode:** 5291410110280

**THE PRODUCT IS COUNTERFEIT**

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1731/18

**Product:** Musical toy

**Name:** Mini Music Piano Fruit

**Risk type:** Choking

**Category:** Toys

**Brand:** XIN NA FENG

**Type / number of model:** 805D / 9344312

**Type of alert:** Products with serious risks

The toy can easily break generating also small parts.

A child may put the small parts in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1. Withdrawal of the product from the market

**Description:** Battery-operated toy in the shape of a piano, emitting lights and sounds. Packed into a cardboard window box.

**Batch number / Barcode:** 5291410080477

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1733/18

**Product:** Set of toy cars

**Name:** Race hard speed

**Risk type:** Injuries

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** G2362 / 2015

**Type of alert:** Products with serious risks

The kinetic energy of the launcher is too high.

This could cause injuries, including to the eyes.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1. Withdrawal of the product from the market

**Description:** Set of plastic cars with a spring launcher. The toys are packed in a blister with cardboard back.

**Batch number / Barcode:** 5291410105590

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1736/18

**Product:** Musical toy

**Name:** BUMP-N-GO AIRPLANE

**Risk type:** Choking

**Category:** Toys

**Brand:** JUMBO

**Type / number of model:** 1111

**Type of alert:** Products with serious risks

Small parts can easily be detached from the toy.

A small child may put the small parts in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Withdrawal of the product from the market

**Description:** Battery-operated, plastic toy in the shape of an aeroplane, emitting lights and sounds. The toy is packed into a cardboard box.

**Batch number / Barcode:** 20170920 / 0464142000036

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1744/18

**Product:** Toy shooting set

**Name:** Target Shooter Games

**Risk type:** Choking

**Category:** Toys

**Brand:** Phoxx

**Type / number of model:** Article number 1097067

**Type of alert:** Products with serious risks

The suction cups can easily detach.

If a child puts the arrow in the mouth, the suction cup could detach and obstruct the airways.

The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Children's crossbow with five arrows/projectiles with suction-cups, packed in a cardboard box with a window.

**Batch number / Barcode:** 1000000179811

**Country of origin:** China

**Alert submitted by:** Austria



**Alert number:** A12/1745/18

**Product:** Toy pushchair

**Name:** Baby Barrow

**Risk type:** Injuries

**Category:** Toys

**Brand:** KYD (KAI YUAN DA TOYS)

**Type / number of model:** 886

**Type of alert:** Products with serious risks

The pushchair has only one safety lock, is not sufficiently resistant to load and can easily collapse.

A child sitting in the pushchair may therefore fall to the ground.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Pink toy pushchair made up of plastic tubes and textile seating. It is equipped with one locking device and packed in a plastic bag.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1747/18

**Product:** Toy baby-walker

**Name:** Tutulove Baby doll

**Risk type:** Injuries

**Category:** Toys

**Brand:** Doll Stroller

**Type / number of model:** 8828

**Type of alert:** Products with serious risks

The locking device of the toy does not work properly. The space between the moving elements is insufficient.

The toy baby-walker could consequently collapse during use, causing injuries.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Toy, foldable baby-walker made up of metal tubes and a textile seat. The height of the seat can be adjusted to three positions.

Packaging: plastic bag.

**Batch number / Barcode:** 4792167180010

**Country of origin:** China

**Alert submitted by:** Hungary





**Alert number:** A12/1748/18

**Product:** Toy highchair

**Name:** Tutulove Baby doll

**Risk type:** Injuries

**Category:** Toys

**Brand:** Doll Stroller

**Type / number of model:** 899

**Type of alert:** Products with serious risks

The locking device of the toy does not work properly. In addition, the space between the moving elements is insufficient.

The toy highchair could consequently collapse during use, causing injuries.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Pink, foldable, toy highchair made of plastic, with a white metal frame and textile seat. The height can be adjusted in three positions. Packaging: plastic bag.

**Batch number / Barcode:** 4792852725014

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1749/18

**Product:** Plastic doll

**Name:** Aidella

**Risk type:** Chemical

**Category:** Toys

**Brand:** Shuang Le Er

**Type / number of model:** No.SLE006-A

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains 2-ethylhexyl phthalate (DEHP) (measured value: 36 % by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Purple-haired, butterfly doll with green-gold wings, in purple dress. Packaging: cone-shaped cardboard package.

**Batch number / Barcode:** 6998812008656

**Country of origin:** China

**Alert submitted by:** Hungary





**Alert number:** A12/1758/18

**Product:** Bath toy

**Name:** Origami boat

**Risk type:** Choking

**Category:** Toys

**Brand:** Oli & Carol

**Type / number of model:** White/LOB-WHITE; Pink/LOB-PINK; Vanilla/LOB-VANILLA; Mint/LOB-MINT; Nude/LOB-NUDE

**Type of alert:** Products with serious risks

A part of the toy protrudes.

A child could put this part of the toy in the mouth, which could block the airways and cause choking.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users

**Description:** Coloured latex toy in the shape of a boat. The product has been sold online.

**Batch number / Barcode:** 8437015928685, OC15, OC18

**Country of origin:** Morocco

**Alert submitted by:** France

**Products were found and measures were taken also in:** Denmark



**Alert number:** A12/1759/18

**Product:** Soft toy

**Name:** Unknown

**Risk type:** Choking

**Category:** Toys

**Brand:** Impexit

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

The bell can be detached easily, generating a small part.

A small child may put it in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Recall of the product from end users

**Description:** Soft toy representing a ram with a bell hanging from its neck. The toy is sold without packaging.

**Batch number / Barcode:** 3700829462573; Batch Y05029214108

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/1762/18

**Product:** Toy police set

**Name:** POLICE FORCE Swat Power

**Risk type:** Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** No.888 MKJ351601

**Type of alert:** Products with serious risks

The suction cups can detach from the projectiles.

If a child puts the projectile in the mouth, the suction cup may detach and obstruct the airways.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Police set with two plastic guns and five projectiles with suction cups, supplied in a blister pack with cardboard back.

**Batch number / Barcode:** 6991203516013

**Country of origin:** China

**Alert submitted by:** Cyprus

**Products were found and measures were taken also in:** Romania



**Alert number:** A12/1764/18

**Product:** Shooting play set

**Name:** GUNPLAY SHOOTING GAME

**Risk type:** Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** MKH806400

**Type of alert:** Products with serious risks

The suction cups can easily detach from the projectiles.

If a child puts the projectile in the mouth, the suction cup may detach and obstruct the airways.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Shooting play set with two plastic guns and six projectiles with suction cups, supplied in a blister pack with cardboard back.

**Batch number / Barcode:** 6991208064007

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1766/18

**Product:** Balloons

**Name:** 20 balloons

**Risk type:** Chemical

**Category:** Toys

**Brand:** HEMA

**Type / number of model:** 1974 / 14.20.0127

**Type of alert:** Products with serious risks

The amount of nitrosamines released by the balloons is too high (measured value up to 0.12 mg/kg).

Nitrosamines are genotoxic carcinogens via inhalation, ingestion or dermal exposure.

A child can get exposed to them by putting the balloon in the mouth.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

Withdrawal of the product from the market

**Description:** Transparent plastic bag containing 20 multi-coloured balloons (23 cm).

**Batch number / Barcode:** Unknown

**Country of origin:** The Netherlands

**Alert submitted by:** France

**Products were found and measures were taken also in:** Romania, The Netherlands



**Alert number:** A12/1770/18

**Product:** Plastic doll

**Name:** Beautiful Girl

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** SC2447

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains 2-ethylhexyl phthalate (DEHP) (measured value: 33 % by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market, Withdrawal of the product from the market


**Description:** Blonde-haired, plastic doll. Packaging: colourful box with transparent window

**Batch number / Barcode:** 5999100611016

**Country of origin:** China

**Alert submitted by:** Hungary



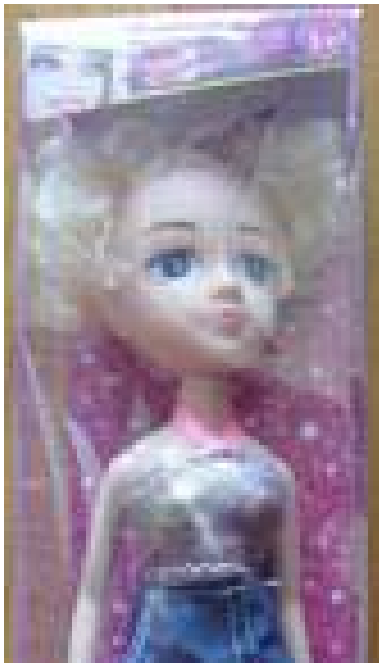





**Alert number:** A12/1771/18

**Product:** Plastic doll set

**Name:** My First Fashion Perfect

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** No.968

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains 2-ethylhexyl phthalate (DEHP) (measured value: 33 % by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Plastic doll set with 3 dolls dressed as princesses. Packaging: colourful box with a transparent window.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary





**Alert number:** A12/1772/18

**Product:** Plastic doll set

**Name:** Aidella

**Risk type:** Chemical

**Category:** Toys

**Brand:** Shuang Le Er

**Type / number of model:** N° SLE030

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains 2-ethylhexyl phthalate (DEHP) (measured value: 25 % by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll set containing 2 dolls with butterfly wings, 1 bouquet of flowers and 1 comb. Packaging: colourful box with transparent window.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1763/18

**Product:** Girls' jumper

**Name:** Bluzki

**Risk type:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** Happy House

**Type / number of model:** 88301-2, FOFO-017

**Type of alert:** Products with serious risks

Decorative elements on the clothing can easily detach.

A small child can put them in the mouth and choke.

Recall of the product from end users

**Description:** Girls' purple/grey top with decorative elements, a white cat motif and the text "WOW".

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Estonia



**Alert number:** A12/1767/18

**Product:** Girls' clothing set

**Name:** STYLE GIRL ORIGINAL NEW

**Risk type:** Strangulation

**Category:** Clothing, textiles and fashion items

**Brand:** Mini Angel Baby

**Type / number of model:** LK-798

**Type of alert:** Products with serious risks

The jacket has cords in the neck area.

These can become trapped during various activities of a child, leading to strangulation.

The product does not comply with the relevant European standard EN 14682.

Withdrawal of the product from the market

**Description:** Clothing set consisting of a pair of leggings, a blouse and a jacket in white and pink colour, intended for 12-month old girls.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1734/18

**Product:** Oral hygiene product / mouthwash

**Name:** Anti-Plaque Mundspülung

**Risk type:** Microbiological

**Category:** Cosmetics

**Brand:** Elina med

**Type / number of model:** Batch No 710001

**Type of alert:** Products with serious risks

The mouthwash contains mesophilic aerobic bacteria (measured quantity 16000 cfu/g) and the presence of *Pseudomonas aeruginosa* has been detected.

There is a risk of contracting infection as the solution comes into contact with the mouth and may also come into contact with the hands and eyes.

The product does not comply with the Cosmetic Products Regulation.

Withdrawal of the product from the market

**Description:** Ready-to-use mouthwash for dental care. Turquoise-coloured, clear, free-flowing solution with mint flavouring in a 500 ml bottle.

**Batch number / Barcode:** 4326470477941

**Country of origin:** Bulgaria

**Alert submitted by:** Germany



**Alert number:** A12/1729/18

**Product:** Multiplug

**Name:** 2 Way T-Shape Adapter

**Risk type:** Fire

**Category:** Electrical appliances and equipment

**Brand:** Eastern

**Type / number of model:** 7008 (on the package); U7008 (on the product)

**Type of alert:** Products with serious risks

The product does not have fuse.

In case of current overload, the product does not provide adequate protection and this could lead to a fire.

The product does not comply with the relevant British standard BS 1363.


Withdrawal of the product from the market

**Description:** White, two-way plug adapter with 3 pins.

**Batch number / Barcode:** 7546128757523

**Country of origin:** China

**Alert submitted by:** Cyprus

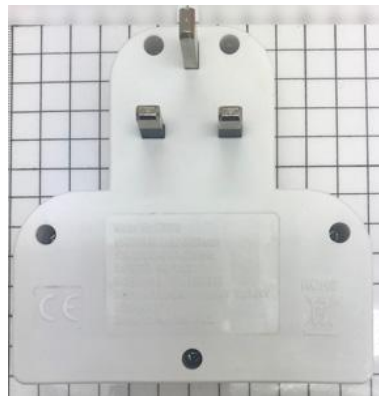

**Alert number:** A12/1737/18  
**Product:** Travel plug adaptor  
**Name:** Unknown  
**Risk type:** Electric shock, Fire  
**Category:** Electrical appliances and equipment  
**Brand:** WD

**Type / number of model:** 853669

**Type of alert:** Products with serious risks

The product does not provide protection to users due to the absence of shutters on live parts and the absence of a fuse.

Users could touch accessible live parts and receive an electric shock. In the case of an overload, the absence of a fuse could lead to a fire.

The product does not comply with the standard BS 1363.

Withdrawal of the product from the market

**Description:** White travel plug adaptor with 3 pins.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1750/18

**Product:** Voltage tester

**Name:** TEST PENCIL / Voltage Test Screwdriver

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** SHEN TONG

**Type / number of model:** 216 and JFGJCDB (on the product); STDZ-88216 (on the packaging)

**Type of alert:** Products with serious risks

The uninsulated metal tip of the voltage tester is too long.

The user could accidentally touch the live metal tip during normal use and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60900.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Voltage tester pencil in the shape of a screwdriver. Packaging: blister pack.

**Batch number / Barcode:** 5 995858 120022

**Country of origin:** China

**Alert submitted by:** Hungary









**Alert number:** A12/1753/18

**Product:** Vacuum cleaner

**Name:** 1) Handy 2) Handy 2-in-1

**Risk type:** Fire

**Category:** Electrical appliances and equipment

**Brand:** Nilfisk

**Type / number of model:** 1) Handy 25.2V , 2) Handy 2-in-1 25.2V

**Type of alert:** Products with serious risks

The charge control unit and the battery pack may be defective.

This can cause the product to overheat while charging, posing a risk of fire or short-circuit.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Recall of the product from end users

**Company recall page:** <https://consumer.nilfisk.dk/da/campaigns/handy-recall/Pages/handy-recall.aspx>

(<https://consumer.nilfisk.dk/da/campaigns/handy-recall/Pages/handy-recall.aspx>)

**Description:** 2-in-1 cordless, rechargeable, stick vacuum cleaners with a detachable, handheld vacuum cleaner and a free-standing charger.

**Batch number / Barcode:** 17262531 - 17264210 (Handy 2in1 25.2V LI-ION G EU); 17264211 - 17265890 (Handy 2in1 25.2V LI-ION MW EU); 17265891 - 17266740 (Handy 2in1 25.2V LI-ION MW EU);, 17273001 - 17273850 (Handy 2in1 25.2V LI-ION MW EU); 17276001 - 17276850 (Handy 2in1 25.2V LI-ION B EU); 17395061 - 17396740 (Handy 2in1 25.2V LI-ION B EU);, 17394211 - 17395060 (Handy 2in1 25.2V LI-ION G EU); 17395061 - 17396740 (Handy 2in1 25.2V LI-ION MW EU); 18140001 - 18140850 (Handy 2in1 25.2V LI-ION B EU);, 18150001 - 18150850 (Handy 2in1 25.2V LI-ION G EU); 18150851 - 18151700 (Handy 25.2V LI-ION MW EU); 18170551 - 18171400 (Handy 2in1 25.2V LI-ION B EU);, 18171401 - 18172450 (Handy 25.2V LI-ION MW EU); 18190001 - 18190850 (Handy 2in1 25.2V LI-ION B EU); 18221951 - 18222800 (Handy 2in1 25.2V LI-ION B EU);, 18260001 - 18260850 (Handy 2in1 25.2V LI-ION B EU); 18280001 - 18280850 (Handy 2in1 25.2V LI-ION B EU)

**Country of origin:** China

**Alert submitted by:** Denmark



**Alert number:** A12/1768/18

**Product:** Travel plug adaptor

**Name:** UNIVERSAL TRAVEL ADAPTOR

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** astrum

**Type / number of model:** A92539-B; CH390 (on the packaging)

**Type of alert:** Products with serious risks

The dimension of the openable EUROPE plug is significantly smaller than required. Single-pole insertion of a plug is possible.

The user may touch a live pin of the plug when the adaptor is plugged into a socket outlet.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950 and EN 60884. Recall of the product from end users, Withdrawal of the product from the market

**Description:** Universal travel adaptor with 2 USB socket and without a protective earth connection. Packaging: transparent plastic box

**Batch number / Barcode:** 4 897033 647212

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A11/0089/18

**Product:** Angle grinder

**Name:** Unknown

**Risk type:** Injuries

**Category:** Machinery

**Brand:** VERTO

**Type / number of model:** 51G053

**Type of alert:** Products with other risk levels

In the event that the cutting disc breaks, the disc guard intended to protect the user rotates too much.

As a consequence, the user could be hit by flying particles.

The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 60745.

Recall of the product from end users

**Description:** Angle grinder.

**Batch number / Barcode:** 5902062013576, Year of production 2017

**Country of origin:** China

**Alert submitted by:** Slovenia

**Products were found and measures were taken also in:** Hungary



**Alert number:** A11/0088/18

**Product:** Wallpaper stripper

**Name:** KX3300-QS

**Risk type:** Burns

**Category:** Electrical appliances and equipment

**Brand:** Black & Decker

**Type / number of model:** TYPE 02, 2400W

**Type of alert:** Products with other risk levels

The filler cap overheats when steam is emitted from the device.

The user has to use the cap to refill the device with water and can suffer burns.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Making the marketing of the product subject to prior conditions, Marking the product with appropriate warnings on the risks

**Description:** Electric wallpaper stripper in a cardboard box.

**Batch number / Barcode:** 5011402171712

**Country of origin:** China

**Alert submitted by:** France

