



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

📄 [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

## The Rapid Alert System for Non-Food Products (RAPEX)

### *RAPEX - Weekly overview report of notifications*

Week 6 - 2019

**Alert number:** A12/0218/19

**Product:** Earrings

**Name:** Poetic Küpe

**Risk type:** Chemical

**Category:** Jewellery

**Brand:** Unknown

**Type / number of model:** 70210

**Type of alert:** Products with serious risks

The earrings contain lead (measured value: 61% by weight ) and release an excessive amount of nickel (measured value: 25 µg/cm<sup>2</sup>/week). Lead is harmful to human health as it accumulates in the body and may damage the unborn child. Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin.

The product does not comply with the REACH Regulation.

Import rejected at border

**Description:** Set of round-shaped earrings, made of gold-coloured metal. Packed in a red cardboard box.

**Batch number / Barcode:** 8 690973 718723

**Country of origin:** Turkey

**Alert submitted by:** Slovakia



**Alert number:** A12/0223/19

**Product:** Necklace with pendant

**Name:** FASHIONIST DROP KOLYE

**Risk type:** Chemical

**Category:** Jewellery

**Brand:** Unknown

**Type / number of model:** 70152

**Type of alert:** Products with serious risks

The necklace contains lead (measured value: 69% by weight).

Lead is harmful to human health as it accumulates in the body and may damage the unborn child.

The product does not comply with the REACH Regulation.


Import rejected at border

**Description:** Thin gold, metal necklace with a pendant with a large oval black rhinestone surrounded with silver metal links. Packed in a red cardboard box.

**Batch number / Barcode:** 8 690973 717733

**Country of origin:** Turkey

**Alert submitted by:** Slovakia

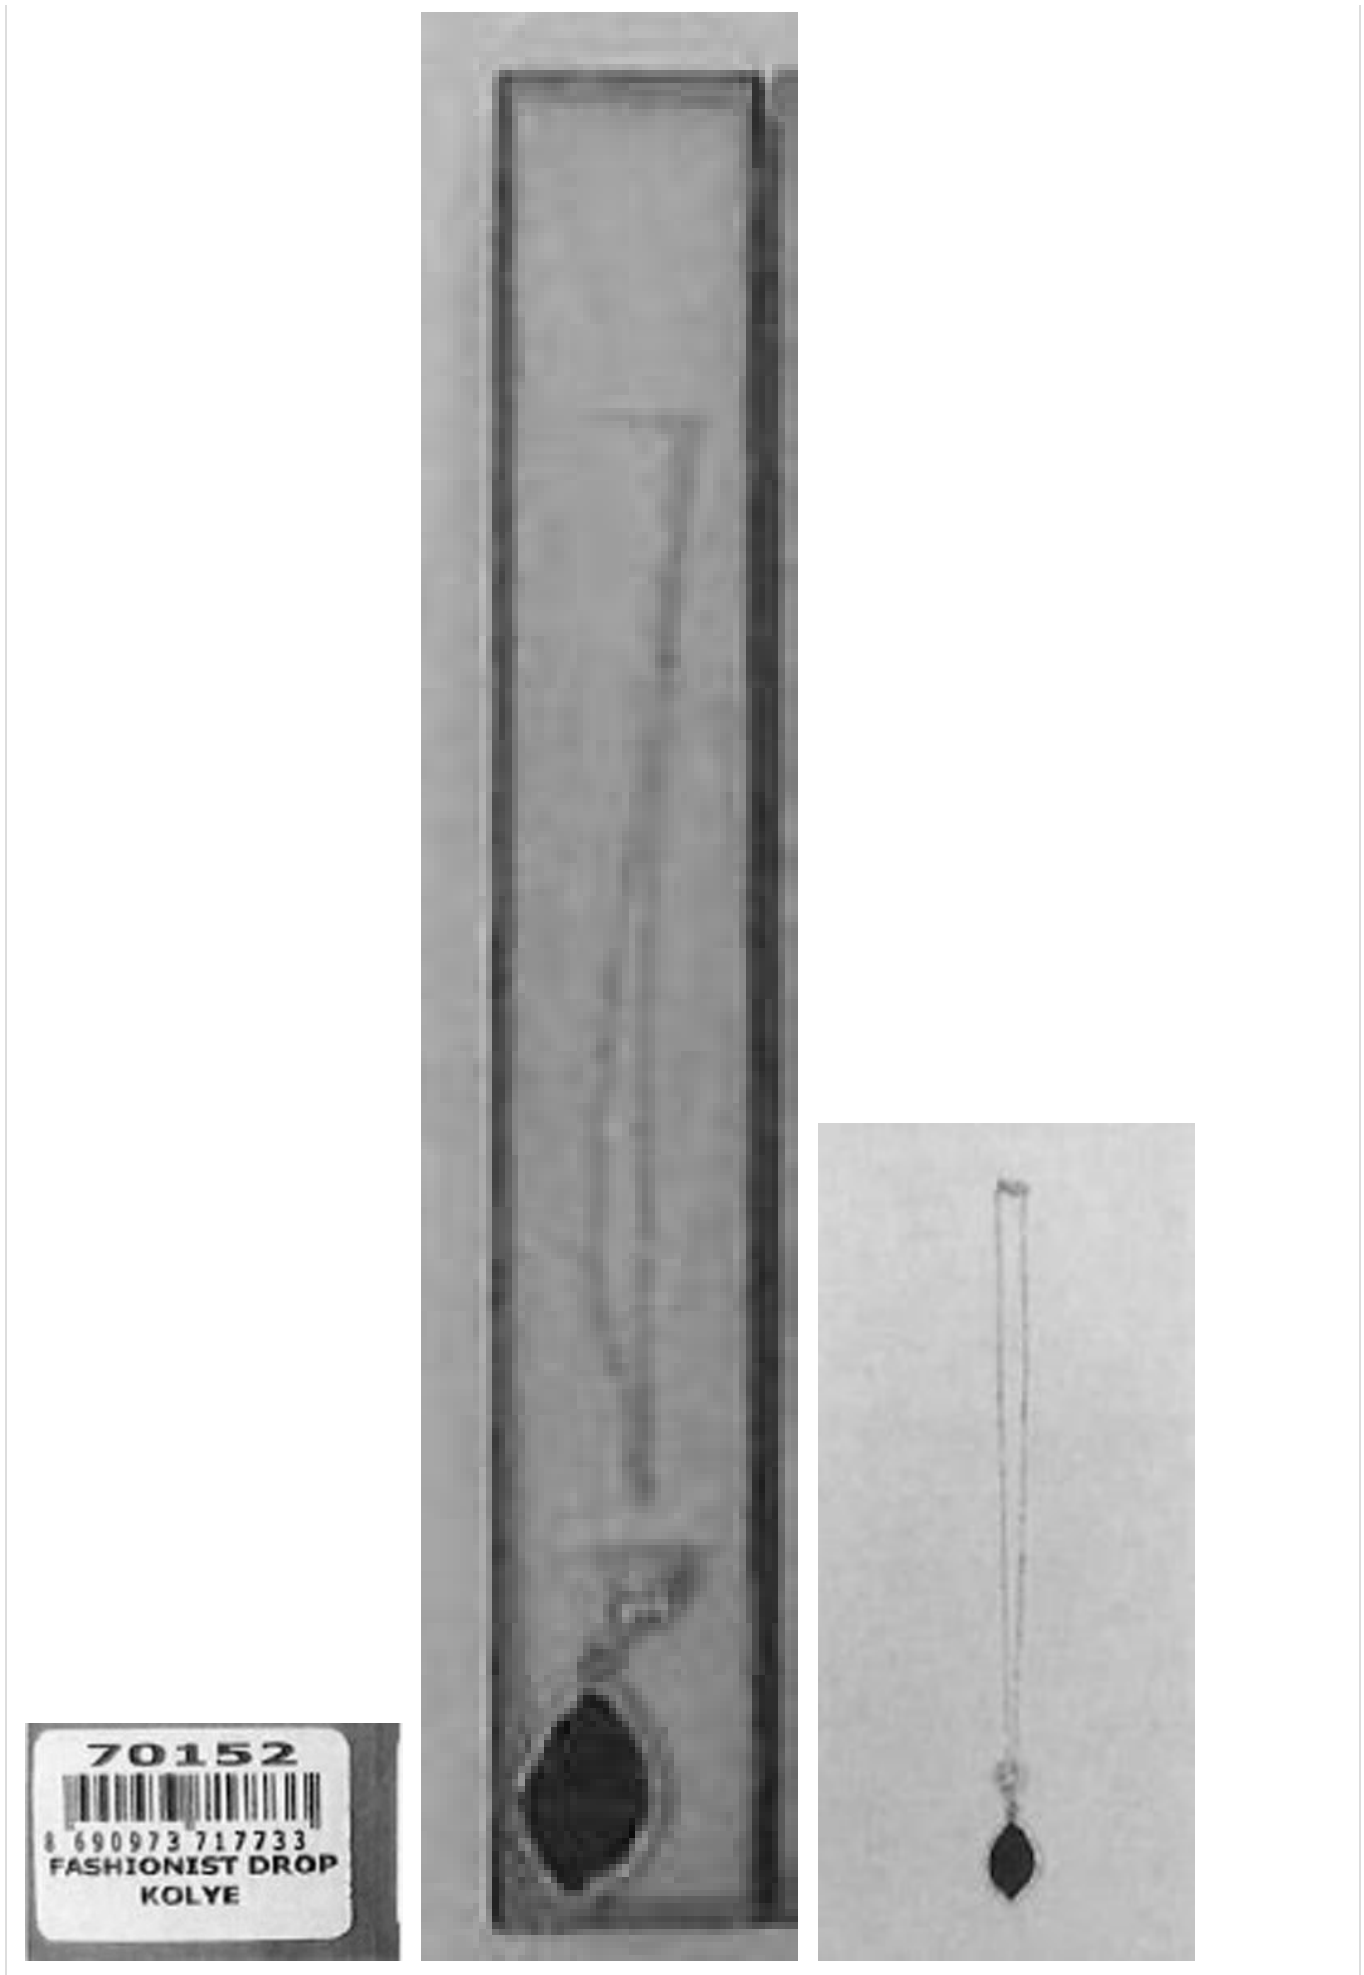

**Alert number:** A12/0224/19

**Product:** Necklace with pendant

**Name:** Magnificence Kolye

**Risk type:** Chemical

**Category:** Jewellery

**Brand:** Unknown

**Type / number of model:** 70218

**Type of alert:** Products with serious risks

The necklace contains lead (measured value: 67% by weight).

Lead is harmful to human health as it accumulates in the body and may damage the unborn child.

The product does not comply with the REACH Regulation.


Import rejected at border

**Description:** A thin golden necklace with a silver-coloured pendant containing a black oval rhinestone. It is packed in a red cardboard box.

**Batch number / Barcode:** 8 690973 718792

**Country of origin:** Turkey

**Alert submitted by:** Slovakia

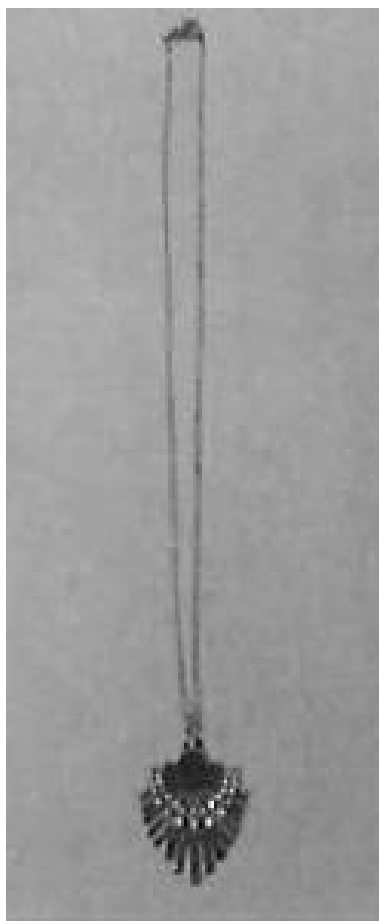

**Alert number:** A12/0214/19  
**Product:** Pressure cooker  
**Name:** Stainless Steel One-Touch Pressure Cooker  
**Risk type:** Burns, Injuries  
**Category:** Kitchen/cooking accessories  
**Brand:** TOWER

**Type / number of model:** T90103; Type DSS 22-6  
**Type of alert:** Products with serious risks

The working pressure of the safety device and the mechanical resistance of the opening systems are inadequate.

If the lid is opened abruptly, the lid's gasket may be ejected from the lid causing hot liquid to shoot out of the pressure cooker. It is also possible that the upper part of the manometric rod may become partially detached and therefore the safe opening system no longer works properly.

The product does not comply with the requirements of the Pressure Equipment Directive and the relevant European standard EN 12778.

Recall of the product from end users

**Description:** 6-litre pressure cooker with a clamp-type closure mechanism. The product was sold online.

**Batch number / Barcode:** 5055195872791

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0234/19

**Product:** Baking dish  
**Name:** Florina Natura  
**Risk type:** Burns  
**Category:** Kitchen/cooking accessories  
**Brand:** Florentyna

**Type / number of model:** B2024-12

**Type of alert:** Products with serious risks

Differences in temperature can cause the dish to break.

As a consequence, hot food could spill onto the user causing burns.

The product does not comply with the relevant European Standard EN 13834.

Withdrawal of the product from the market

**Description:** Oval ceramic dish, size: 30.5 x 21 cm. A card label is attached.

**Batch number / Barcode:** 5907530074615, WD130322

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0231/19  
**Product:** Laser pointer  
**Name:** Unknown  
**Risk type:** Damage to sight  
**Category:** Laser pointers  
**Brand:** Briday  
**Type / number of model:** 301  
**Type of alert:** Products with serious risks  
 The laser beam is too powerful.  
 Direct viewing of the laser beam could cause damage to sight.  
 Import rejected at border  
**Description:** Laser pointer. The product was sold online.  
**Batch number / Barcode:** Unknown  
**Country of origin:** China  
**Alert submitted by:** Malta



**Alert number:** A12/0210/19  
**Product:** Passenger car  
**Name:** RAM  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Dodge  
**Type / number of model:** Type-approval: individual approval.  
**Type of alert:** Products with serious risks  
 The locking mechanism of the tailgate can easily break.  
 This may result in sudden opening of the tailgate and pieces of luggage falling onto the road, increasing the risk of an accident.  
 Recall of the product from end users  
**Description:** Passenger car. Company recall code: U74  
**Batch number / Barcode:** The vehicles concerned were produced between 24 May 2014 and 18 December 2017.  
**Country of origin:** United States  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Denmark, Luxembourg

**Alert number:** A12/0213/19  
**Product:** Passenger car  
**Name:** Scion  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Toyota  
**Type / number of model:** Type: AZE151, AGT20  
**Type of alert:** Products with serious risks  
 The brake hose may rupture causing a loss of brake fluid and reduced braking power.  
 As a result, there is an increased risk of accidents.  
 Recall of the product from end users  
**Description:** Passenger car. Company recall code: 18SMD-069  
**Batch number / Barcode:** The vehicles affected were produced between 17.1.2007 and 5.7.2016.  
**Country of origin:** Japan  
**Alert submitted by:** Germany

**Alert number:** A12/0217/19  
**Product:** Passenger car  
**Name:** A6 / A7  
**Risk type:** Fire  
**Category:** Motor vehicles  
**Brand:** Audi  
**Type / number of model:** Type-approval number: e1 \* 2007/46 \* 0436 \* .. Type: 4G - Diesel-powered vehicles without factory-installed parking heaters, are affected.  
**Type of alert:** Products with serious risks  
The electrical connector for the auxiliary heating element may not have been fully secured during the assembly process. This could lead to increased contact resistances in the connector area. In such cases, thermal overload could arise, which can lead to a fire.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 82C1.  
**Batch number / Barcode:** Vehicles produced between July 2014 and October 2014 are affected.  
**Country of origin:** Germany  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Croatia, Denmark, Estonia, Finland, Hungary, Iceland, Luxembourg, Romania, Slovenia, Sweden

**Alert number:** A12/0220/19  
**Product:** Passenger car  
**Name:** C-class, E-class, GLC  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Mercedes-Benz  
**Type / number of model:** EC type-approvals: e1\*2001/116\*0431, e1\*2001/116\*0457, e1\*2001/116\*0501, e1\*2007/46\*1560, e1\*2007/46\*1666, e1\*2001/116\*0480, e1\*2007/46\*1884 Types: 204, 204 K, 212, R1ES, R1EC, 204 X, 204 X AMG  
**Type of alert:** Products with serious risks  
A defective sensor installed within the electrical power steering system may lead to deactivation of the power steering assistance. As a consequence, there is an increased risk of accidents.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 4693002.  
**Batch number / Barcode:** The vehicles affected were produced between 9 July 2018 and 13 August 2018.  
**Country of origin:** Germany  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Denmark, Finland, Hungary, Luxembourg, Poland, Romania, Slovakia, The Netherlands

**Alert number:** A12/0226/19  
**Product:** Passenger car  
**Name:** A4, A5  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Audi  
**Type / number of model:** Type-approval number: e1 \* 2001/116 \* 0430 \* .. Type: B8  
**Type of alert:** Products with serious risks  
The screw fitting the passenger airbag module to the instrument panel may not have been correctly tightened. This could have an impact on the inflation of the airbag and thus the protection of the occupant.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 69Y4  
**Batch number / Barcode:** The vehicles affected were produced between January 2017 and July 2018.  
**Country of origin:** Germany  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Ireland, Sweden, The Netherlands

**Alert number:** A12/0227/19  
**Product:** Passenger car  
**Name:** C3-IV  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Citroën  
**Type / number of model:** e2\*2007/46\*0003\*50, e2\*2007/46\*0003\*53, e2\*2007/46\*0060\*18, e2\*2007/46\*0060\*19, e2\*2007/46\*0060\*20, e2\*2007/46\*0060\*21  
**Type of alert:** Products with serious risks  
 The steering column was incorrectly assembled on the shaft of the steering system.  
 Consequently the steering column and the steering system could separate, leading to sudden loss of steering control.  
 Recall of the product from end users  
**Description:** Passenger car. Citroën recall code GRE.  
**Batch number / Barcode:** The affected vehicles were manufactured between 6 July 2018 and 12 July 2018 - VIN: VF7SWBHW6JT609707 to VF7SXNFPDKT501948  
**Country of origin:** France  
**Alert submitted by:** France  
**Products were found and measures were taken also in:** Bulgaria, Croatia, Finland, Malta, Poland, Slovakia, Slovenia

**Alert number:** A12/0228/19  
**Product:** Passenger car  
**Name:** S90, V60, V60CC, V90, V90CC, XC40, XC60, XC90  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Volvo  
**Type / number of model:** Type approvals: e9\*2007/46\*0023\*00 to \*03, e9\*2007/46\*03146\*00, e4\*2007/46\*0929\*00 to \*03, e4\*2007/46\*1067\*00 to \*05, e4\*2007/46\*1220\*01 Types: F, X, L, P, U  
**Type of alert:** Products with serious risks  
 A software problem has been detected in the communication module of the emergency call system.  
 As a consequence, incorrect location information might be sent to the emergency services in the event of an accident.  
 Recall of the product from end users  
**Description:** Passenger car. Company recall code: R39917  
**Batch number / Barcode:** The vehicles in question were manufactured between 24/03/2016 and 26/09/2018.  
**Country of origin:** Sweden  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Croatia, Denmark, Finland, Hungary, Iceland, Luxembourg, Malta, Poland, Portugal, Slovenia, Sweden, The Netherlands

**Alert number:** A12/0236/19  
**Product:** Passenger car  
**Name:** 208  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Peugeot  
**Type / number of model:** e2\*2007/46\*0070\*39, e2\*2007/46\*0070\*40, e2\*2007\*46\*0070\*41, e2\*2007/46\*0070\*42, e2\*2007/46\*0071\*13  
**Type of alert:** Products with serious risks  
 The steering column may have been incorrectly fixed to the shaft of the vehicle's steering system.  
 The steering column might consequently detach from the steering system, leading to a loss of steering control.  
 Recall of the product from end users  
**Description:** Passenger car. Recall code Peugeot JJJ  
**Batch number / Barcode:** Vehicles manufactured between 06/07/2018 and 12/07/2018 — VIN: VF3CCYHYSJT054705 to VF3CCBHY6KT001518 -  
**Country of origin:** France  
**Alert submitted by:** France  
**Products were found and measures were taken also in:** Croatia, Denmark, Germany, Poland, Slovenia, The Netherlands



**Alert number:** A12/0237/19  
**Product:** Passenger car  
**Name:** Stelvio  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Alfa Romeo  
**Type / number of model:** Type-approval number: e3\*2007/46\*0435\*05; Type: 949  
**Type of alert:** Products with serious risks  
An engine cooling line may become detached.  
This could impair driving safety.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: 8229.  
**Batch number / Barcode:** The vehicles in question were manufactured between 10.10.2016 and 7.9.2018.  
**Country of origin:** Italy  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Croatia, Denmark, Finland, Hungary, Luxembourg, Poland, Slovenia, Sweden, The Netherlands

**Alert number:** A12/0238/19  
**Product:** Passenger car  
**Name:** C3  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Citroen  
**Type / number of model:** Type-approval numbers: e2\*2007/46\*0003\*50 and 53, e2\*2007/46\*0060\*18-21 Type: S  
**Type of alert:** Products with serious risks  
The steering column may have been incorrectly fixed to the shaft of the vehicle's steering system.  
The steering column might consequently detach from the steering system, leading to a loss of steering control.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: GRE.  
**Batch number / Barcode:** The vehicles affected were produced between 06/07/2018 and 12/07/2018.  
**Country of origin:** France  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Finland, Malta, Slovakia, Slovenia

**Alert number:** A12/0240/19  
**Product:** Motorcycle  
**Name:** ZR900  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Kawasaki  
**Type / number of model:** Type-approval numbers: e1\*168/2013\*00043\*01, e1\*168/2013\*00060\*00, e1\*168/2013\*00057\*00 types: ZR900B, ZR900D, ZR900C sales name: ZR900  
**Type of alert:** Products with serious risks  
Owing to incorrect installation, the rear wheel brake line and/or the ABS sensor cable can be damaged through contact with the rear wheel.  
This can lead to failure of the rear wheel brake and the ABS, which could lead to an accident.  
Recall of the product from end users  
**Description:** Motorcycle. Company recall code: DAJ04  
**Batch number / Barcode:** The vehicles concerned were manufactured in 2018.  
**Country of origin:** Japan  
**Alert submitted by:** Germany  
**Products were found and measures were taken also in:** Croatia, Denmark, Estonia, Finland, Hungary, Luxembourg, Slovenia, Sweden, The Netherlands

**Alert number:** A12/0203/19

**Product:** Warning triangle

**Name:** Výstražný trojúhelník

**Risk type:** Injuries

**Category:** Other

**Brand:** Compass

**Type / number of model:** Homologation number: E27 27R031004 Item: 01 520

**Type of alert:** Products with serious risks

The stability of the triangle in the presence of wind is inadequate.

Consequently the triangle could easily overturn and oncoming vehicles would not be warned of the presence of an obstacle, increasing the risk of accidents.

The product does not comply with the relevant European Standard ECE27.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Foldable warning triangle for motor vehicles, packed in a red plastic case.

**Batch number / Barcode:** 8 591686 015201

**Country of origin:** China

**Alert submitted by:** Slovakia



**Alert number:** A12/0205/19

**Product:** Warning triangle

**Name:** Warndreieck / Warning Triangle

**Risk type:** Injuries

**Category:** Other

**Brand:** K Classic / DYNAMIC

**Type / number of model:** Homologation number: E11 27R-043557 Art. 154929-1318

**Type of alert:** Products with serious risks

The stability of the triangle in the presence of wind is inadequate.

Consequently the triangle could easily overturn and oncoming vehicles would not be warned of the presence of an obstacle, increasing the risk of accidents.

The product does not comply with the relevant European Standard ECE27.


Recall of the product from end users, Withdrawal of the product from the market

**Description:** Foldable warning triangle for motor vehicles, packed in a red plastic case.

**Batch number / Barcode:** 4 337185 372261

**Country of origin:** China

**Alert submitted by:** Slovakia

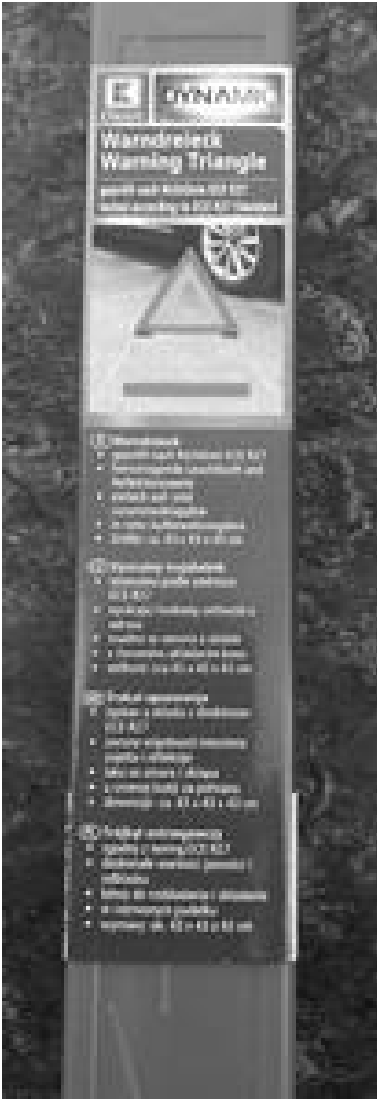

**Alert number:** A12/0207/19

**Product:** Warning triangle

**Name:** Výstražný trojúhelník

**Risk type:** Injuries

**Category:** Other

**Brand:** FILSON

**Type / number of model:** Homologation number: E27 27R031004 Art. NO.- 48.215

**Type of alert:** Products with serious risks

The stability of the triangle in the presence of wind is inadequate.

Consequently the triangle could easily overturn and oncoming vehicles would not be warned of the presence of an obstacle, increasing the risk of accidents.

The product does not comply with the relevant European Standard ECE27.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Foldable warning triangle for motor vehicles, packed in a red plastic case.

**Batch number / Barcode:** 8 591522 482150

**Country of origin:** China

**Alert submitted by:** Slovakia



**Alert number:** A12/0242/19

**Product:** Trolley suitcase

**Name:** Star by Cavalier

**Risk type:** Chemical

**Category:** Other

**Brand:** Cavalier

**Type / number of model:** 659ABS

**Type of alert:** Products with serious risks

The handles of the suitcase contain polycyclic aromatic hydrocarbons (PAHs), including : benz[a]anthracene (measured value up to 160 mg/kg), benzo[b]fluoranthene + benzo[j]fluoranthene + benzo[k]fluoranthene (measured value up to 45 mg/kg), benzo[a]pyrene (measured value up to 110 mg/kg), and dibenz[a,h]anthracene (measured value up to 4.6 mg/kg).

PAHs are absorbed through skin contact and respiration. These PAHs are carcinogenic.

The product does not comply with the REACH Regulation.

Import rejected at border

**Description:** A trolley suitcase with a hard plastic exterior, four double wheels, a lock, two handles: one for carrying and one to pull the case along. Exists in three sizes (20", 24", 28") and three different colours (black, light blue, rosegold).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0201/19

**Product:** Toy pushchair

**Name:** Passeggio

**Risk type:** Injuries

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Production no.: NO:170730-12N/13

**Type of alert:** Products with serious risks

The pushchair has only one locking device.

The toy pushchair could consequently collapse during use and the child's fingers may become trapped between moving parts, causing injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Pink, folding pushchair for dolls, with metal structure and decorated fabric. The product is sold packed in a transparent plastic bag.

**Batch number / Barcode:** 8 010380 151003 Date of production: Dec.2017

**Country of origin:** China

**Alert submitted by:** Slovakia



**Alert number:** A12/0202/19

**Product:** Toy slime

**Name:** CRYSTAL PUTTY

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** TG 412465

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high (measured value up to 1508 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Withdrawal of the product from the market

**Description:** Toy slime in a transparent plastic container.

**Batch number / Barcode:** 5902553818031

**Country of origin:** China

**Alert submitted by:** Latvia



**Alert number:** A12/0208/19

**Product:** Plastic doll

**Name:** Beautifull Ana

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** YT08779

**Type of alert:** Products with serious risks

The plastic doll's head contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 28% by weight).

This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Recall of the product from end users

**Description:** Plastic doll with blue hair and a yellow and red coloured dress, accompanied by a small plastic bag containing sweets. The product is supplied in a transparent plastic box.

**Batch number / Barcode:** 6933893304136 (on label), 6933893328460

**Country of origin:** China

**Alert submitted by:** Latvia



**Alert number:** A12/0211/19

**Product:** High-chair for dolls

**Name:** Love Bebe boutique

**Risk type:** Entrapment, Injuries

**Category:** Toys

**Brand:** Dimian

**Type / number of model:** Reference RDF 1617

**Type of alert:** Products with serious risks

The space between the moving elements of the feet of the high-chair is insufficient. A child could insert his fingers, leading to a risk of entrapment and injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users

**Description:** High-chair for dolls with a metal tubing frame and fabric seat

**Batch number / Barcode:** EAN 8001478016175, lot TMD7129

**Country of origin:** China

**Alert submitted by:** France





**Alert number:** A12/0215/19  
**Product:** Puffer Yoyo toy  
**Name:** I Pufferosi  
**Risk type:** Chemical, Choking  
**Category:** Toys  
**Brand:** MOOD

**Type / number of model:** Code ST3193  
**Type of alert:** Products with serious risks

The battery compartment can easily be opened without the use of any tools, leaving button cell batteries accessible. A child may put these in the mouth, which could cause damage to the child's gastrointestinal tract. They may also cause choking if swallowed by a small child.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1 and EN 62115. Withdrawal of the product from the market

**Description:** Battery-operated, soft silicone toys in various colours representing animals or balls.

**Batch number / Barcode:** 8054187031939

**Country of origin:** China

**Alert submitted by:** Italy



**Alert number:** A12/0216/19

**Product:** Ride-on toy

**Name:** Unknown

**Risk type:** Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

Small parts can be easily detached from the toy.

A small child could put these in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Ride-on, plastic horse on two wheels.

**Batch number / Barcode:** Batch 1/17 ; 8031051002264

**Country of origin:** China

**Alert submitted by:** Italy



**Alert number:** A12/0219/19

**Product:** Soft toy

**Name:** Masha and the bear

**Risk type:** Choking

**Category:** Toys

**Brand:** Simba

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

The nose of the bear can easily be detached.

A child may put it in the mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Soft toy bear (brown/beige) with face (sewn on) and nose (inserted, black).

**Batch number / Barcode:** 160810415

**Country of origin:** China

**Alert submitted by:** Austria



**Alert number:** A12/0221/19

**Product:** Electric toy

**Name:** Telefonchik

**Risk type:** Environment

**Category:** Toys

**Brand:** Azbukvarik

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

Four solders of the toy contain cadmium (measured value up to 0.24% by weight) and lead (measured value up to 55% by weight) in concentrations above limit values.

Cadmium and lead pose a risk to the environment.

The product does not comply with the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Withdrawal of the product from the market

**Description:** Plastic telephone in various colours

**Batch number / Barcode:** EAN 4680019281834

**Country of origin:** China

**Alert submitted by:** Latvia



**Alert number:** A12/0225/19

**Product:** Plastic toy

**Name:** 6 Ratten

**Risk type:** Chemical

**Category:** Toys

**Brand:** TEDI

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

The plastic toy contains diisobutyl phthalate (DIBP) (measured value 17.4% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive.

Recall of the product from end users

**Description:** Black plastic toy rats. Packaging: a black plastic net bag, with cardboard label.

**Batch number / Barcode:** 39202003081000000150

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0232/19

**Product:** Magnetic putty

**Name:** Crazy Geezer's Putty World

**Risk type:** Injuries

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Magnetic

**Type of alert:** Products with serious risks

The putty contains a magnet which is a small part and has a high magnetic flux.

If a child swallows the small magnet and other metallic objects, they could attract one another causing intestinal blockage or perforation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

This product listing was removed by Amazon., Withdrawal of the product from the market

**Description:** Magnetic putty with small plastic accessories (eyes and a nose). The product was sold online (in particular via Amazon).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** United Kingdom



**Alert number:** A12/0239/19

**Product:** Plastic doll

**Name:** Mermaid

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** BLAL1275 (on attached label) NO. XH 28C (on packaging)

**Type of alert:** Products with serious risks

The product contains dibutyl phthalate (DBP) (measured value up to 2.6% by weight) and di-isononyl phthalate (DINP) (measured value up to 27% by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll packaged in a cardboard box with transparent window.

**Batch number / Barcode:** 5902719711275

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0241/19

**Product:** Toy pushchair

**Name:** Baby Carrier

**Risk type:** Injuries

**Category:** Toys

**Brand:** MalPlay

**Type / number of model:** No.61

**Type of alert:** Products with serious risks

The locking device on the pushchair does not work properly.

It could consequently collapse during use causing the fingers of the child to be crushed.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** A pink folding pushchair for dolls with metal frame and textile seat. It is equipped with one locking device. Packed in a plastic bag.

**Batch number / Barcode:** 5901924212621

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0243/19

**Product:** Plastic doll

**Name:** Pretty

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** NO.DY807

**Type of alert:** Products with serious risks

The plastic material of the doll contains bis(2-ethylhexyl) phthalate (DEHP) (measured value: 25.7% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll (5 different models) with long blonde hair.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Germany





**Alert number:** A12/0204/19

**Product:** Two-way portable radio (walkie-talkie)

**Name:** Professional hunting radio

**Risk type:** Electric shock

**Category:** Communication and media equipment

**Brand:** Zodiac NEO

**Type / number of model:** Power supply unit: KA050120U. Radio: Neo 68.

**Type of alert:** Products with serious risks

The electrical insulation and the creepage distances between the primary and accessible secondary circuits of the charger are not sufficient. Accessible parts could become live, leading to an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60950.


Recall of the product from end users

**Description:** A yellow walkie-talkie with a power supply, sold in a black cardboard box. AC Charger Input: 100-240V Output: 12V 500mA.

**Batch number / Barcode:** 7036093103406

**Country of origin:** Sweden

**Alert submitted by:** Finland

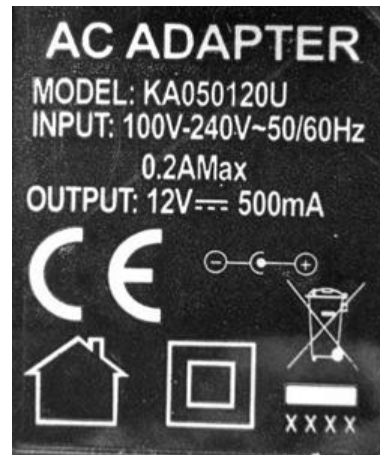

**Alert number:** A12/0222/19

**Product:** Battery pack for notebooks

**Name:** Rechargeable Battery

**Risk type:** Burns, Fire

**Category:** Communication and media equipment

**Brand:** HP

**Type / number of model:** 6ETGL, 6EVXH, 6EZZE, 6EZZF, 6FDWN, 6FSNF, 6FWBH, 6GAUL

**Type of alert:** Products with serious risks

Production errors may lead to short circuits in individual cells in the battery pack.

Consequently the battery cell can overheat, leading to burns or even fire if close to flammable products.

Recall of the product from end users


**Company recall page:** <https://batteryprogram687.ext.hp.com/en-GB/Home/ProgramSummary> (<https://batteryprogram687.ext.hp.com/en-GB/Home/ProgramSummary>)

**Description:** Built-in, replaceable, lithium-ion battery packs which may be contained in the following HP notebook and workstation computers: HP ProBook (4xx G4 series, 64x G2 series, 65x G2 series (x = placeholder for numbers); HP x360; HP 11 and HP ZBook (17 G3, and Studio G3) Mobile Workstations.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Germany

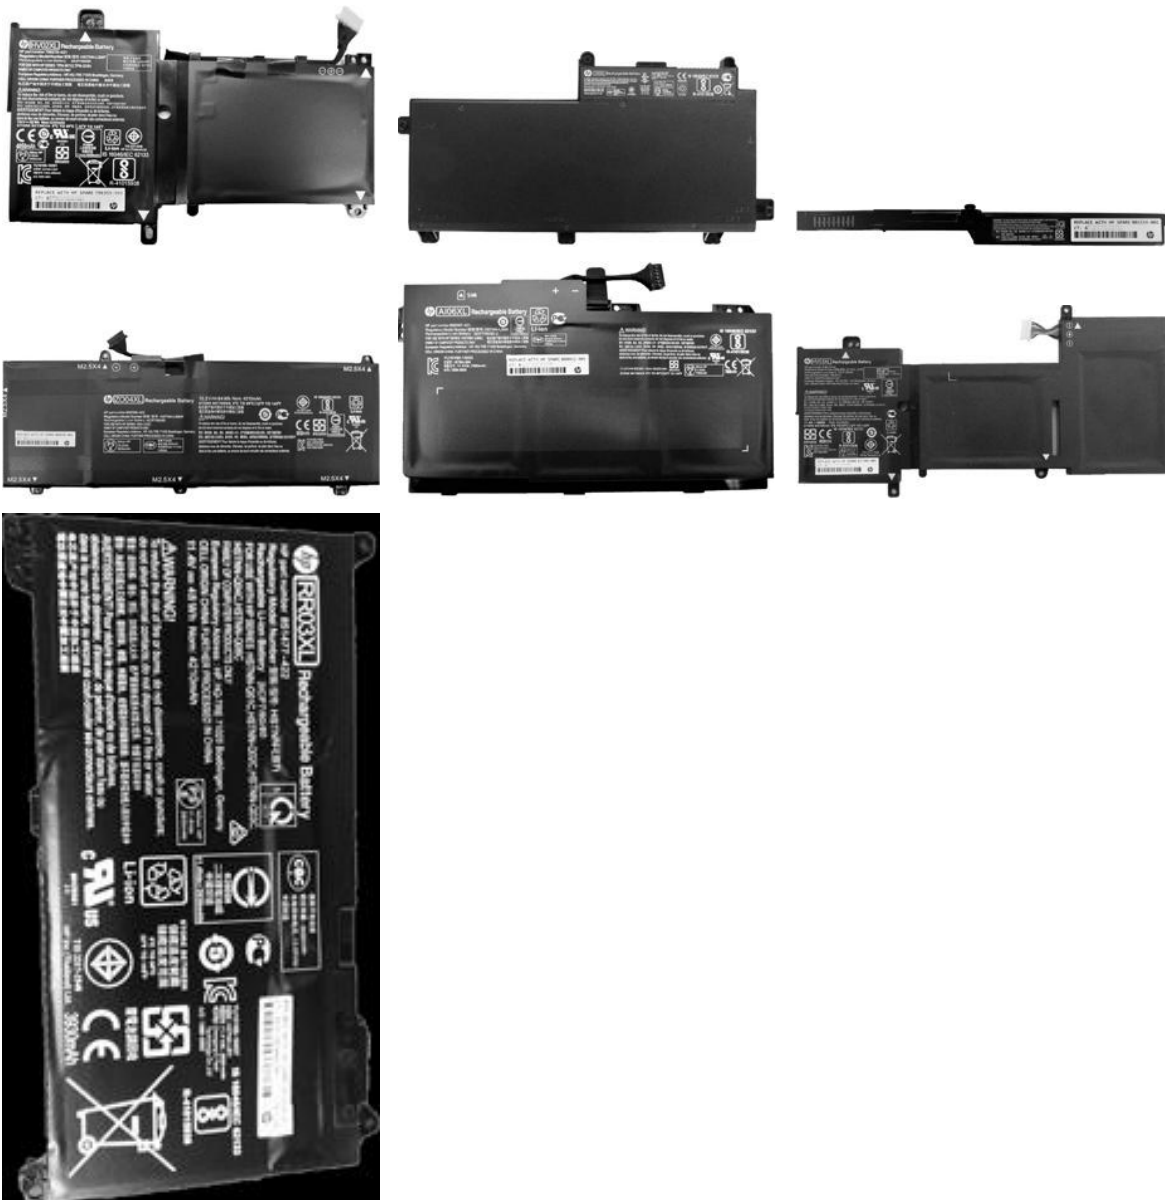

**Alert number:** A12/0212/19

**Product:** Bath product

**Name:** Creamers Muffinka Do kapieli

**Risk type:** Choking

**Category:** Cosmetics

**Brand:** Unknown

**Type / number of model:** Chocolate Dream, Confetty Muffin, Fresh Morning, Happy Flower, Pink Hearts, Strawberry Kiss, Sunny Butterfly, Sunny Cream

**Type of alert:** Products with serious risks

Due to its characteristic form, appearance, colour and size, this product may be mistaken for a foodstuff and small parts can be easily detached from it.

This may lead consumers, and specially children, to put them in the mouth and ingest them, which could entail the risk of choking.

The product does not comply with the Cosmetic Products Regulation and the requirements of the Food imitating Products Directive.

Ban on the marketing of the product and any accompanying measures

**Description:** A bath product in the shape of a cupcake, decorated with imitation whipped cream, with colourful sprinkles and flowers. Packed in a paper cake-case wrapped in plastic film.

**Batch number / Barcode:** Chocolate Dream:07-2019 8-0130; 5901638416575, Confetty Muffin: 01-2019 8-0115; 5901638413963, Fresh Morning: 08-2019 8-0202;5901638413123, Happy Flower: 08-2019 8-0202; 5901638414045, Pink Hearts: 8-0122 07-2019; 5901638412850, Strawberry Kiss: 07-2019 8-0131, 5901638412836, Sunny Butterfly: 08-2019 8-0202; 5901638414038, Sunny Cream: 07-2019 8-0130; 5901638413956

**Country of origin:** Poland

**Alert submitted by:** Latvia



**Alert number:** A12/0233/19

**Product:** Haircare product

**Name:** Hair Oil Moisturiser

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** MPL

**Type / number of model:** Model with olive, arnica and rosemary oils; Size 100 g

**Type of alert:** Products with serious risks

The product contains a mixture of the preservatives methylchloroisothiazolinone (MCI) and methylisothiazolinone (MI). MI and MCI are sensitising agents and can provoke allergic contact dermatitis to sensitised persons.

The product does not comply with the Cosmetic Products Regulation.

Recall of the product from end users

**Description:** Hair solution for conditioning and strengthening hair as well as soothing the scalp. Presented in a green plastic bottle, containing 100 grams, with a screw cap.

**Batch number / Barcode:** 6 001374 016080 Batch Number: 693787 Manufactured: 07/2016 Expiry date: 07/2020

**Country of origin:** South Africa

**Alert submitted by:** France



**Alert number:** A12/0235/19

**Product:** Candle

**Name:** Let it snow

**Risk type:** Burns, Fire

**Category:** Decorative articles

**Brand:** H&S Collection

**Type / number of model:** Xmas Tree 16 cm pillar candle

**Type of alert:** Products with serious risks

Due to its shape, the candle is not sufficiently stable and falls over too easily.

As a consequence, it could ignite flammable material and cause a fire.

The product does not comply with the relevant European Standard EN 15493.

Withdrawal of the product from the marketBan on the marketing of the product and any accompanying measures, Recall of the product from end users

**Description:** Pillar candle in the shape of a Christmas tree, sold individually in a cellophane wrapper. The product was sold online.

**Batch number / Barcode:** 8719202753615

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0206/19

**Product:** Travel adaptor/USB-charger

**Name:** World charger

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Walther

**Type / number of model:** Model with 4 USB ports

**Type of alert:** Products with serious risks

Single-pole insertion of a plug into the adaptor is possible.

The user could touch the free remaining pin of the plug and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950 and IEC 60884.

Recall of the product from end users

**Description:** International travel adaptor with different output ports for AC plugs and four USB connections. It is sold in a black transparent package.

**Batch number / Barcode:** 6438340002622

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/0229/19

**Product:** Shower speaker with USB charger

**Name:** Floating/ shower speaker

**Risk type:** Burns, Fire

**Category:** Electrical appliances and equipment

**Brand:** Lynx / Axe

**Type / number of model:** Models: Lynx - "Black and The Golden Year"; 15800 E11115/ 1804 Axe - "Dark Temptation"

**Type of alert:** Products with serious risks

The charging cable of the speaker could overheat.

The overheated cable could cause burns if touched or lead to a fire if left close to flammable products.

Recall of the product from end users


**Description:** Gift-packs, consisting of bodyspray (150 ml), bodywash (250 ml), anti-perspirant (150 ml) and a shower speaker with a USB cable. Sold in a cardboard box.

**Batch number / Barcode:** 8710447348123 (Lynx "The Golden Year"); 8710522349168 (Lynx "Black"), CE 8710447348550; HE 8710522355725 (Axe "Dark Temptation")

**Country of origin:** China

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Austria, Estonia, Ireland, Luxembourg, Slovakia

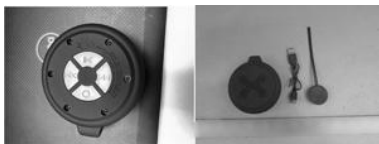

**Alert number:** A11/0007/19

**Product:** Luminous toy

**Name:** Ice Age Night - Cave Bear skeleton

**Risk type:** Injuries

**Category:** Toys

**Brand:** GEOWORLD

**Type / number of model:** CL599K

**Type of alert:** Products with other risk levels

The parts to be assembled can have sharp points.

As a result, the child assembling the toy could be injured.

The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.



Withdrawal of the product from the market

**Description:** Phosphorescent, "cave bear" skeleton toy.

**Batch number / Barcode:** 8033576217086

**Country of origin:** China

**Alert submitted by:** Italy

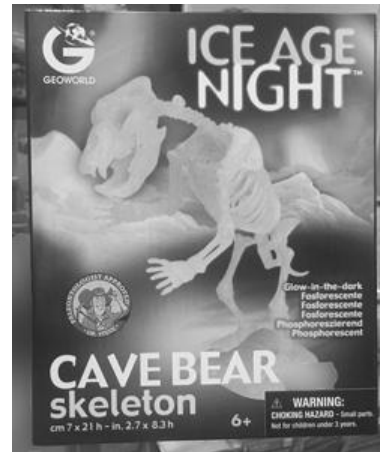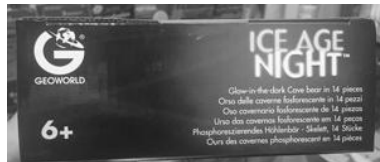



**Alert number:** A11/0057/19

**Product:** Slime toy

**Name:** COLOR OIL SLIME

**Risk type:** Chemical

**Category:** Toys

**Brand:** TOYS

**Type / number of model:** Item: GSC-11 (printed on the barrel) / 62.0458.080 (printed on the label)

**Type of alert:** Products with other risk levels

The migration of boron from the toy slime is too high (measured value up to 480 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Ban on the marketing of the product and any accompanying measures, Recall of the product from end users, Recall of the product from end users

**Description:** Black liquid slime sold in a small, transparent, plastic container in the shape of a barrel.

**Batch number / Barcode:** Batch 035877 / EAN 8 713219 267196

**Country of origin:** China

**Alert submitted by:** Luxembourg

**Products were found and measures were taken also in:** Austria, The Netherlands



**Alert number:** A11/0058/19

**Product:** Toy slime

**Name:** BARREL-O-SLIME (Schleim im Ölfass 100g)

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Art. 60871

**Type of alert:** Products with other risk levels

The migration of boron from the toy slime is too high (measured value: up to 380 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Ban on the marketing of the product and any accompanying measures, Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market

**Description:** Black liquid slime sold in a small, transparent, plastic jar in the shape of a barrel with a lid.

**Batch number / Barcode:** 4 032037 555211

**Country of origin:** China

**Alert submitted by:** Luxembourg

**Products were found and measures were taken also in:** Italy

