



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

## The Rapid Alert System for Non-Food Products (RAPEX)

### *RAPEX - Weekly overview report of notifications*

Week 15 - 2019

**Alert number:** A12/0579/19

**Product:** Pressure cooker

**Name:** Autocuiseur Gusto

**Risk type:** Injuries

**Category:** Kitchen/cooking accessories

**Brand:** OGO LIVING

**Type / number of model:** 7.5L; DSD 22-7.5

**Type of alert:** Products with serious risks

The working pressure of the safety device and the mechanical resistance of the pressure cooker and the lid are inadequate.

If the lid is opened abruptly, hot liquid might shoot out of the pressure cooker and the product may deform under the pressure.

The product does not comply with the requirements of the Pressure Equipment Directive and the relevant European standard EN 12778.

Withdrawal of the product from the market

**Description:** 7.5-litre pressure cooker with a clamp-type closure mechanism.

**Batch number / Barcode:** 3 256390166643

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0605/19

**Product:** Tattoo ink

**Name:** Green Beret

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** World Famous Tattoo Ink

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

The product contains the aromatic amine o-anisidine (measured value: 9 mg/kg).

This aromatic amine can cause cancer, cell mutations and affect reproduction.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that aromatic amines with carcinogenic mutagenic, reprotoxic or sensitising properties should neither be present in tattoos and permanent make-up products nor released from azo-colourants.

Ban on the marketing of the product and any accompanying measures

**Description:** Transparent plastic bottle containing 30 ml of green tattoo ink with black dispensing cap.

**Batch number / Barcode:** Batch: WFGB161801

**Country of origin:** United States

**Alert submitted by:** Italy



**Alert number:** A12/0606/19

**Product:** Tattoo ink

**Name:** Sailor Jerry Red

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** World Famous Tattoo Ink

**Type / number of model:** REF WFSJR1

**Type of alert:** Products with serious risks

The product contains the aromatic amine o-anisidine (measured value: 18 mg/kg).

This aromatic amine can cause cancer, cell mutations and affect reproduction.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that aromatic amines with carcinogenic mutagenic, reprotoxic or sensitising properties should neither be present in tattoos and permanent make-up products nor released from azo-colourants.

Ban on the marketing of the product and any accompanying measures

**Description:** Transparent plastic bottle containing red tattoo ink with black dispensing cap.

**Batch number / Barcode:** Lot: WFSJR1720011 Batch: B20205 BEST BY 11/21/20

**Country of origin:** United States

**Alert submitted by:** Italy



**Alert number:** A12/0581/19

**Product:** Portable lamp

**Name:** Fragrance lamp

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** Unknown

**Type / number of model:** 887-0B5698

**Type of alert:** Products with serious risks

The wire opening on the product has sharp edges and the power supply cable could detach or be damaged giving access to live parts.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598-1.


Withdrawal of the product from the market

**Description:** Portable lamp with lamp shade, height approx. 24 cm. Packaged in cardboard box.

**Batch number / Barcode:** EAN 2566297856983

**Country of origin:** China

**Alert submitted by:** Poland

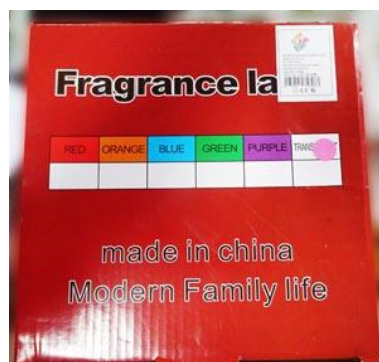

**Alert number:** A12/0614/19

**Product:** LED night-light

**Name:** LED Night Lamp

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** HOROZ

**Type / number of model:** 085 001 0004

**Type of alert:** Products with serious risks

The flower-shaped cover can easily be removed from the base of the night-light when the lamp is plugged into a socket-outlet. As a result, live parts are accessible and this could lead to an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60598.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** LED night-light in the shape of a flower. The product can be plugged directly into a socket. Packaging: blister on cardboard.

**Batch number / Barcode:** 8 680985 522630

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/0585/19

**Product:** Mains socket tester

**Name:** Unknown

**Risk type:** Electric shock

**Category:** Measuring instruments

**Brand:** Laserliner

**Type / number of model:** Article n° 083.026A

**Type of alert:** Products with serious risks

The electrical insulation, creepage and clearance distances and electric strength are inadequate. Consequently accessible parts may become live and lead the user to receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61010.

Recall of the product from end users

**Description:** Mains socket tester in a blister pack

**Batch number / Barcode:** 4021563694488

**Country of origin:** Germany

**Alert submitted by:** Finland



**Alert number:** A12/0586/19

**Product:** Mains socket tester

**Name:** Live Tester Plus

**Risk type:** Electric shock

**Category:** Measuring instruments

**Brand:** Laserliner

**Type / number of model:** Article N° 083.027A

**Type of alert:** Products with serious risks

The electrical insulation, creepage and clearance distances and electric strength are inadequate. Consequently accessible parts may become live and lead the user to receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61010.

Recall of the product from end users

**Description:** Phase indicator/socket tester sold in a cardboard box.

**Batch number / Barcode:** 4021563694495

**Country of origin:** Germany

**Alert submitted by:** Finland



**Alert number:** A12/0580/19

**Product:** Passenger Car

**Name:** Focus

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Ford

**Type / number of model:** Type approval number e13\*2007/46\*1911\*02

**Type of alert:** Products with serious risks

In the vehicles affected, the bolts fixing the front suspension to the vehicle may not have been tightened to the correct torque. If the bolts are lost, the suspension could become detached from the vehicle causing a loss of vehicle control.

Recall of the product from end users

**Description:** Passenger car under recall code 19S08

**Batch number / Barcode:** Specific vehicles built between 22/09/2018 and 10/11/2018

**Country of origin:** Germany

**Alert submitted by:** United Kingdom

**Alert number:** A12/0582/19  
**Product:** Passenger van / Light commercial vehicle  
**Name:** Expert, Traveller  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Peugeot  
**Type / number of model:** Type-approval numbers: e2\*2007/46\*0532\*00 to 06, e2\*2007/46\*0533\*00 to 04; Type: V  
**Type of alert:** Products with serious risks  
Excessive loading of the front suspension could result in loosening and eventual separation of the front wishbone lower ball joints. This can impair the vehicle's directional stability, increasing the risk of an accident.  
Recall of the product from end users  
**Description:** Passenger van / Light commercial vehicle under Peugeot recall code: JHK.  
**Batch number / Barcode:** The affected vehicles were manufactured between 27 August 2015 and 5 December 2018.  
**Country of origin:** France  
**Alert submitted by:** Germany

**Alert number:** A12/0584/19  
**Product:** Passenger car  
**Name:** C3 Aircross II  
**Risk type:** Fire  
**Category:** Motor vehicles  
**Brand:** Citroen  
**Type / number of model:** Type-approval numbers: e4\*2007/46\*1241\*00 to \*01, e4\*2007/46\*1241\*03 to \*04; type: 2  
**Type of alert:** Products with serious risks  
A protruding weld stud may damage the bodywork wire harness and lead to a short-circuit.  
This may consequently cause a fire.  
Recall of the product from end users  
**Description:** Passenger car. Company recall code: GHZ  
**Batch number / Barcode:** The vehicles affected were produced between 6 September 2016 and 15 January 2019.  
**Country of origin:** France  
**Alert submitted by:** Germany

**Alert number:** A12/0588/19  
**Product:** Passenger car  
**Name:** Arona, Ibiza  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Seat  
**Type / number of model:** Type-approval number: e9\*2007/46\*3134  
**Type of alert:** Products with serious risks  
Due to incorrect setting, the handbrake may have to travel further to ensure immobilisation.  
As a result, the vehicle could roll, possibly leading to an accident.  
Recall of the product from end users  
**Description:** Passenger car under Seat recall code: 4611.  
**Batch number / Barcode:** The affected vehicles were manufactured between 31 October 2016 and 6 November 2018.  
**Country of origin:** Spain  
**Alert submitted by:** Germany

**Alert number:** A12/0590/19  
**Product:** Passenger car  
**Name:** Caddy  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** VW commercial vehicles  
**Type / number of model:** Type-approval numbers: e1\*2001/116\*0252\*; type: 2K  
**Type of alert:** Products with serious risks  
The predetermined break point in the cushion for the side airbags is on the wrong side.  
In the event of a crash, the side airbag may not inflate properly, thus not provide protection and increase the risk of an injury.  
Recall of the product from end users  
**Description:** Passenger car under VW recall code: 74D6.  
**Batch number / Barcode:** The affected vehicles were manufactured between 10 July 2018 and 29 November 2018.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/0592/19  
**Product:** Passenger car  
**Name:** Touareg  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** VW  
**Type / number of model:** Type-approval numbers: e1\*2007/46\*1827\*03; type: CR  
**Type of alert:** Products with serious risks  
The suspension damper forks are defective and could break.  
As a result, the tyre could be pressed against the wheel arch, potentially causing an accident.  
Recall of the product from end users  
**Description:** Passenger car under VW recall code: 4003.  
**Batch number / Barcode:** The affected vehicles were manufactured between 27 November 2018 and 15 December 2018.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/0593/19  
**Product:** Motorcycle  
**Name:** Speed Twin  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Triumph  
**Type / number of model:** Type-approval number: e5\*168/2013\*00013\*00  
**Type of alert:** Products with serious risks  
The coolant hose between the radiator and expansion tank may have been misrouted and consequently come into contact with the exhaust header pipe, potentially causing damage to the hose.  
A leak from the radiator hose may allow coolant to escape and get onto the rear tyre. This could cause the rider to lose control over the vehicle, leading to an accident.  
Recall of the product from end users  
**Description:** Motorcycle under Triumph recall code: SRAN563.  
**Batch number / Barcode:** The affected vehicles were manufactured between 21 September 2018 and 04 February 2019.  
**Country of origin:** United Kingdom  
**Alert submitted by:** United Kingdom

**Alert number:** A12/0594/19  
**Product:** Passenger car  
**Name:** Evoque  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Jaguar Land Rover  
**Type / number of model:** Type-approval number: E5\*2007/46\*0076  
**Type of alert:** Products with serious risks  
The indicated fuel level may be inaccurate. This could cause the vehicle to run out of fuel without any low fuel warning.  
This may cause the engine to cut out while in motion, leading to an accident.  
Recall of the product from end users  
**Description:** Passenger car under Jaguar Land Rover recall code: N316.  
**Batch number / Barcode:** The affected vehicles were manufactured between 05 October 2018 and 05 March 2019.  
**Country of origin:** United Kingdom  
**Alert submitted by:** United Kingdom  
**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/0595/19  
**Product:** Motorcycles  
**Name:** TMAX XP530A  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Yamaha  
**Type / number of model:** Type-approval number: e13\*168/2013\*00047; type: SJ14  
**Type of alert:** Products with serious risks  
Faulty programming of the engine control unit may cause the engine to stall suddenly at idle or at low RPM.  
This may increase the risk of an accident.  
Recall of the product from end users  
**Description:** Motorcycles under Yamaha recall code: TMAX XP530A.  
**Batch number / Barcode:** The affected vehicles were manufactured in 2017 and 2018.  
**Country of origin:** Japan  
**Alert submitted by:** Germany



**Alert number:** A12/0601/19  
**Product:** Motorcycle  
**Name:** C 600 Sport, C 650 Sport, C 650 GT  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** BMW  
**Type / number of model:** Type-approval numbers: e1\*2002/24\*0552, e1\*168/2013\*00004, e1\*168/2013\*00005; Types: K18/11, K19/11  
**Type of alert:** Products with serious risks  
The front brake hose may get damaged over time, which may lead to a loss of brake fluid.  
This can reduce brake performance, increasing the risk of an accident.  
Recall of the product from end users  
**Description:** Motorcycles under BMW recall code: 00 00 34 81 00.  
**Batch number / Barcode:** The affected vehicles were manufactured between 09 February 2011 and 23 August 2018.  
**Country of origin:** Germany  
**Alert submitted by:** Portugal

**Alert number:** A12/0607/19  
**Product:** Passenger car  
**Name:** Aventador Coupe and Roadster  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Lamborghini  
**Type / number of model:** Aventador Coupè + Roadster, 50 Anniversario + Roadster, Pirelli Edition + Roadster, Aventador Super Veloce + Roadster, Miura Homage, Veneno Coupè + Roadster, Aventador J, , Aventador S Coupè + S Roadster, Centenario Coupe + Roadster  
**Type of alert:** Products with serious risks  
Under certain driving conditions, the engine software fails to correctly determine the flow of fuel from the discharge valves.  
This may cause the engine to stall without warning, increasing the risk of an accident.  
Recall of the product from end users  
**Description:** Passenger car  
**Batch number / Barcode:** The affected vehicles were manufactured between March 2011 and October 2017; VIN range: ZHWEC1476CLA00091 to ZHWEG4ZD2JLA06939.  
**Country of origin:** Italy  
**Alert submitted by:** Italy

**Alert number:** A12/0608/19  
**Product:** Motorhome  
**Name:** T6601, 6671, 7057, MET 002  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Dethleffs  
**Type / number of model:** Type-approval number: e1\*2001/116\*0416; types: EG/DF 003  
**Type of alert:** Products with serious risks  
The connection of the seatbelt clip may not be sufficiently strong.  
This will increase the risk of injury in the event of an accident.  
Recall of the product from end users  
**Description:** Motorhome.  
**Batch number / Barcode:** The affected vehicles were manufactured between July 2014 and January 2019.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/0609/19  
**Product:** Camper van  
**Name:** V-Class, Vito  
**Risk type:** Injuries  
**Category:** Motor vehicles  
**Brand:** Mercedes-Benz  
**Type / number of model:** Type-approval numbers: e1\*2007/46\*0457\*17 to 19; Types: 639/2  
**Type of alert:** Products with serious risks  
There is a possibility of red rust corrosion on metallic components of the roof frame reinforcement and the connecting elements in the rear part of the roof bed.  
This could lead to weakening of the roof structure and thus of the overall stability of the body.  
Recall of the product from end users  
**Description:** Camper van under Mercedes-Benz recall code: VS2DAPLANK (6595353).  
**Batch number / Barcode:** The affected vehicles were manufactured between 16 January 2017 and 21 September 2018.  
**Country of origin:** Germany  
**Alert submitted by:** Germany

**Alert number:** A12/0610/19

**Product:** Passenger car

**Name:** C4 Cactus

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroen

**Type / number of model:** Type-approval number: e2\*2007/46\*0440\*10; Type: 0

**Type of alert:** Products with serious risks

The weight distribution of the vehicle may, under certain conditions, be inadequate.

This may impair driving stability, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Citroen recall code: GNF.

**Batch number / Barcode:** The affected vehicles were manufactured between 23 February 2018 and 25 April 2018.

**Country of origin:** France

**Alert submitted by:** Germany

**Alert number:** A12/0617/19

**Product:** Passenger car

**Name:** XC60

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Volvo

**Type / number of model:** Type-approval numbers: e4\*2007/46\*1220\*00 – e4\*2007/46\*1220\*04; Type: U

**Type of alert:** Products with serious risks

Due to cold temperatures the tailgate lifting arms could freeze and consequently become loose, bend or completely separate.

This may cause the expanding springs to be released and potentially cause injury.

Recall of the product from end users

**Description:** Passenger car under Volvo recall code: R89910.

**Batch number / Barcode:** The affected vehicles were manufactured between 12 January 2017 and 26 October 2018.

**Country of origin:** Sweden

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/0618/19

**Product:** Passenger car

**Name:** A8, Q7, Q8

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Audi

**Type / number of model:** Type-approval numbers: e1\*2007/46\*1751\*; type: F8; Type-approval number: e1\*2001/116\*0350\*; type: 4L;

**Type of alert:** Products with serious risks

A component of the wheel suspension may not be strong enough and could break over time.

As a consequence, the tyre may press against the wheel arch which poses a risk of accidents.

Recall of the product from end users

**Description:** Passenger car. Company recall code: 40O4

**Batch number / Barcode:** Vehicles produced between November and December 2018 are affected.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0591/19

**Product:** Children's fancy-dress costume

**Name:** Ninja (red)

**Risk type:** Injuries, Strangulation

**Category:** Toys

**Brand:** Fun fashion

**Type / number of model:** 753

**Type of alert:** Products with serious risks

The cords in the neck area and hemline have free ends which can become trapped during various activities of the child, leading to injuries and strangulation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 14682.

Withdrawal of the product from the market

**Description:** A fancy-dress costume consisting of two parts. The costume is red and has black cords with free ends at the neck, sleeves and in the hemline area. This product is designed for 6-year old children.

**Batch number / Barcode:** 5204745753060

**Country of origin:** Greece

**Alert submitted by:** Cyprus



**Alert number:** A12/0596/19

**Product:** Toy Slime

**Name:** ΠΙΤΣΑ - Slime

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** XXB-614HP

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high (measured value up to 1649.4 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Withdrawal of the product from the market

**Description:** Toy slime in fuchsia colour in a transparent plastic pot.

**Batch number / Barcode:** 20171130 / 0465544000037

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/0597/19

**Product:** Toy guitar

**Name:** Guitar Butterfly Music

**Risk type:** Strangulation

**Category:** Toys

**Brand:** Nafeng

**Type / number of model:** N°. 663B (on packaging) N°. 663 (on product)

**Type of alert:** Products with serious risks

The strap of the toy guitar has no quick release mechanism.

If worn around the neck, it could form a loop and become trapped, leading to strangulation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Battery-operated toy guitar made of coloured plastic material, with a strap attached. It is sold packed in a cardboard box.

**Batch number / Barcode:** 5901271223974 Lot n°: 9340

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0599/19

**Product:** Musical toy

**Name:** Animals music mobile

**Risk type:** Damage to hearing

**Category:** Toys

**Brand:** Hao Xue Tong / ABABABY

**Type / number of model:** 1005-A

**Type of alert:** Products with serious risks

The sound pressure level of the toy is too high.

It could cause damage to hearing.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Cow-shaped, battery-operated plastic toy. The toy emits a variety of sound and music effects by pressing the buttons and a red light during operation. Packaging: cardboard box.

**Batch number / Barcode:** 2017010011160

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/0600/19

**Product:** Toy gun set

**Name:** Super Gun Shooting Game

**Risk type:** Choking, Injuries

**Category:** Toys

**Brand:** XH

**Type / number of model:** XH088

**Type of alert:** Products with serious risks

The water bullets expand in size by more than 50% when placed in water. If the small bullets are put into the mouth and swallowed by children, they could expand causing fatal occlusion of the respiratory tract or intestinal blockage.

Moreover, the foam projectiles can break easily, creating small parts with suction cups.

A child playing with the toy may put the projectile in the mouth in order to wet it before shooting. If it breaks, the suction cup could obstruct the airways.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Toy gun set including a plastic toy gun, foam projectiles and water bullets (bullets need to be soaked in water before shooting).

Packaged in cardboard box with plastic window.

**Batch number / Barcode:** 6920176814048

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/0602/19

**Product:** Electrical ride-on toy

**Name:** Unknown

**Risk type:** Burns

**Category:** Toys

**Brand:** KIDCARS

**Type / number of model:** Item No.: 1188-R

**Type of alert:** Products with serious risks

The metal surface of the motor enclosure can overheat.

This may cause burns to the user.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115.

Ban on the marketing of the product and any accompanying measures, Withdrawal of the product from the market

**Description:** Electrical ride-on toy motorcycle with charger, packed in a brown cardboard box (dimensions: 830 mm x 420 mm x 510 mm).

**Batch number / Barcode:** 5204258068774

**Country of origin:** China

**Alert submitted by:** Greece



**Alert number:** A12/0603/19

**Product:** Toy slime

**Name:** Slime Unicorn

**Risk type:** Chemical

**Category:** Toys

**Brand:** LG-IMPORTS

**Type / number of model:** Reference LG 9444

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high (measured value: up to 885 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Recall of the product from end users

**Description:** Toy slime in the shape of a unicorn's head.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0611/19

**Product:** Magnetic puzzle

**Name:** Puzzle magnetyczne "zwierzatka"

**Risk type:** Chemical

**Category:** Toys

**Brand:** PEPCO

**Type / number of model:** 284451 SKU28445101

**Type of alert:** Products with serious risks

The product contains a high amount of formaldehyde.

Formaldehyde can cause skin irritation when in contact with the skin and is carcinogenic.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-9.

Recall of the product from end users, Withdrawal of the product from the market

**Company recall page:** <https://pepco.pl/sklepy/informacje-dla-klientow/info/komunikat-firmy-pepco-1/> (<https://pepco.pl/sklepy/informacje-dla-klientow/info/komunikat-firmy-pepco-1/>)

**Description:** Magnetic puzzle with pictures of animals.

**Batch number / Barcode:** EAN: 2200128445167, EAN: 2200128445174, ORD00106679\_01, ORD00106683\_01, ORD00127029\_01, ORD00127033\_01, ORD00127036\_01

**Country of origin:** China

**Alert submitted by:** Poland

**Products were found and measures were taken also in:** Slovenia





**Alert number:** A12/0612/19

**Product:** Plastic toy set

**Name:** JUMBO BRICK Game

**Risk type:** Chemical, Choking, Damage to hearing

**Category:** Toys

**Brand:** Bai Bian

**Type / number of model:** 1989/1400868

**Type of alert:** Products with serious risks

The sound pressure level of the brick game is too high and it could cause damage to hearing.

Furthermore, the battery compartment of the torch can easily be opened without the use of any tools, leaving button cell batteries accessible.

A child may put these in the mouth, which could cause damage to the child's gastrointestinal tract or a risk of choking.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1 and EN 62115.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** The set includes a light-green coloured brick game, a pink mobile phone, red binoculars and a white torch. Packaging: blister pack

**Batch number / Barcode:** 8000014008681

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/0613/19

**Product:** Wooden puzzle

**Name:** Układanka drewniana z pinezkami

**Risk type:** Chemical

**Category:** Toys

**Brand:** PEPCO

**Type / number of model:** 276731 SKU27673101

**Type of alert:** Products with serious risks

The product contains a high amount of formaldehyde.

Formaldehyde can cause skin irritation when in contact with the skin and is carcinogenic.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-9.

Recall of the product from end users, Withdrawal of the product from the market


**Company recall page:** <https://pepco.pl/sklepy/informacje-dla-klientow/info/komunikat-firmy-pepco-1/> (<https://pepco.pl/sklepy/informacje-dla-klientow/info/komunikat-firmy-pepco-1/>)

**Description:** Wooden puzzles with thumbtacks

**Batch number / Barcode:** EAN: 2200127673165, ORD00127170\_01, ORD00127171\_01, ORD00127173\_01, ORD00127174\_01, ORD00127175\_01

**Country of origin:** China

**Alert submitted by:** Poland

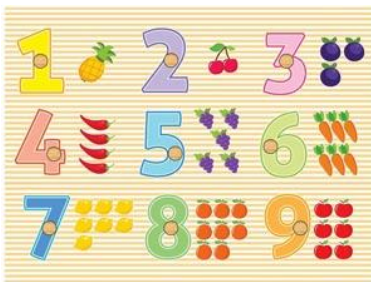

**Alert number:** A12/0615/19

**Product:** Plastic doll

**Name:** Modern Girl

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Index 340426

**Type of alert:** Products with serious risks

The plastic material of the doll contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured values: 35 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll with blonde hair wearing a pink dress. The product is supplied in a cardboard box with a transparent front part.

**Batch number / Barcode:** 5902012753705

**Country of origin:** China

**Alert submitted by:** Latvia



**Alert number:** A12/0619/19

**Product:** Toy dog

**Name:** Unknown

**Risk type:** Environment

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Art. No. 40087

**Type of alert:** Products with serious risks

Four solders in the toy contain an excessive amount of lead (measured values up to 64% by weight).

Lead poses a risk to the environment.

The product does not comply with the requirements of the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Withdrawal of the product from the market

**Description:** Battery-operated brown plush puppy with red plastic glasses

**Batch number / Barcode:** 435491

**Country of origin:** China

**Alert submitted by:** Lithuania



**Alert number:** A12/0620/19

**Product:** Musical toy

**Name:** Animal world

**Risk type:** Chemical, Environment

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** PS 668-16 / 4954178

**Type of alert:** Products with serious risks

The battery compartment can easily be opened without the use of any tools, leaving batteries accessible.

A child may take a damaged or leaking battery and suffer burns due to the leaking chemical products.

Four solders in the toy contain an excessive amount of lead and cadmium (measured values up to: 54 % and 0.34% by weight respectively). Lead and cadmium pose a risk to the environment.

The product does not comply with the requirements of the Toy Safety Directive, the relevant European Standard EN 62115 and the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Withdrawal of the product from the market

**Description:** Plastic electric organ with coloured buttons that emit or play melodies when pressed. The toy is powered by three 1.5V AA batteries. Sold in a cardboard box.

**Batch number / Barcode:** 8713149541786

**Country of origin:** China

**Alert submitted by:** Czech Republic



**Alert number:** A12/0589/19

**Product:** Scarf

**Name:** Unknown

**Risk type:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** Stockmann 1862

**Type / number of model:** 1904 Colin, D449 14100842

**Type of alert:** Products with serious risks

The scarf contains azo dyes releasing the aromatic amine benzidine (measured value: 210 mg/kg).

When in direct and prolonged contact with the skin, the aromatic amines may be absorbed by the skin. Aromatic amines can cause cancer, cell mutations and affect reproduction.

The product does not comply with the REACH Regulation.

Import rejected at border

**Description:** White and dark blue, checked cotton scarf (Size: 70 x 180 cm).

**Batch number / Barcode:** 1234567931586

**Country of origin:** India

**Alert submitted by:** Finland



**Alert number:** A12/0598/19

**Product:** Girls' dress

**Name:** Babyrose alkalmi ruha

**Risk type:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** Babyrose Missrose

**Type / number of model:** 9246

**Type of alert:** Products with serious risks

The small decorative elements of the product may be easily detached.

A small child may put them in the mouth and choke.

The product does not comply with the relevant European standard EN 14682.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** White, long-sleeved dress with zip at the back. The product is decorated with beads and textile flowers. Size: 80cm -1 year.

**Batch number / Barcode:** 4983201192469

**Country of origin:** Turkey

**Alert submitted by:** Hungary



**Alert number:** A12/0587/19

**Product:** Bath product

**Name:** Duft Schaum Bad

**Risk type:** Microbiological

**Category:** Cosmetics

**Brand:** Frucht

**Type / number of model:** Exoticfrucht hautfreundlich

**Type of alert:** Products with serious risks

The product contains an excessive amount of pseudomonas putida (measured value: 23000 cfu/g).

If used on damaged skin or by immunocompromised users, the product may cause a severe infection.

The product does not comply with the Cosmetic Products Regulation and the relevant European standard EN ISO 17516.

Ban on the marketing of the product and any accompanying measures Temporary ban on the supply, offer to supply and display of the product

**Description:** Transparent plastic bottle containing 1 litre of foam bath gel.

**Batch number / Barcode:** 4010937100045 08/11/2020

**Country of origin:** Poland

**Alert submitted by:** Germany



**Alert number:** A12/0583/19  
**Product:** Electrical socket adaptor  
**Name:** Unknown  
**Risk type:** Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** Bohemian, L.H

**Type / number of model:** L165-L166, SP02

**Type of alert:** Products with serious risks

The product does not have shutters on live parts, nor a fuse.

A user could consequently touch live parts of the socket and receive an electric shock.

The product does not comply with the relevant national standards.

Withdrawal of the product from the market

**Description:** Flat white plastic socket adaptors packed in a transparent plastic bag containing 6 units.

**Batch number / Barcode:** 5290728008999

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/0604/19  
**Product:** Hair straightener  
**Name:** Multifunctional hair iron  
**Risk type:** Electric shock  
**Category:** Electrical appliances and equipment  
**Brand:** SURKER

**Type / number of model:** HD915

**Type of alert:** Products with serious risks

The electrical insulation and the creepage/clearance distances are inadequate.

The user may receive an electric shock from live parts.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Recall of the product from end users

**Description:** Hair straighteners.

**Batch number / Barcode:** 6948187139158

**Country of origin:** China

**Alert submitted by:** France





**Alert number:** A12/0616/19

**Product:** Aquarium air pump

**Name:** Aquarium air pump

**Risk type:** Burns, Fire

**Category:** Electrical appliances and equipment

**Brand:** XiLONG

**Type / number of model:** AP-001

**Type of alert:** Products with serious risks

The product does not have a thermal cut-off device and the plastic material of its casing has a low melting point and is flammable. During continuous use, the product could overheat causing the casing to melt or catch fire.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Withdrawal of the product from the market

**Description:** Black plastic air pump for aquariums, sold in a cardboard box.

**Batch number / Barcode:** 5 999090 400843

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A11/0018/19

**Product:** Electric Knapsack Sprayer

**Name:** Intelligent Sprayer

**Risk type:** Burns, Electric shock, Fire

**Category:** Machinery

**Brand:** Kobold

**Type / number of model:** KB-16ER-6

**Type of alert:** Products with other risk levels

The 12 Volt output from the adapter has the standard 230 Volt IEC connection. The charging 12 Volt port is also the standard 230 Volt IEC type. A user could inadvertently plug a 230 Volt mains cable into the 12 volt charging port. This could lead to a short-circuit and overheating of the battery, causing burns, fire or electric shock.

The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 60335-1.

Ban on the marketing of the product and any accompanying measures, Import rejected at border

**Description:** Knapsack sprayer with built-in, rechargeable battery and a deposit of 16 litres. The product includes a charger with power adaptor. The product was sold online (in particular via Alibaba/Aliexpress).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Ireland



**Alert number:** A11/0020/19

**Product:** Electric bicycle

**Name:** Unknown

**Risk type:** Injuries

**Category:** Machinery

**Brand:** Enik

**Type / number of model:** Easy

**Type of alert:** Products with other risk levels

The stem and handlebar can detach progressively.

The user may consequently fall off the bike.

The product does not comply with the requirements of the Machinery Directive.

Withdrawal and recall with corrective measures &#x28;Exchange of the stem&#x29;

**Description:** Electric bicycle (electrically assisted until 25km/h). Models where the handlebar has not been replaced are affected.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Luxembourg



**Alert number:** INFO/0045/19

**Product:** Pencil with top eraser

**Name:** Unknown

**Risk type:** Chemical

**Category:** Stationery

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with other risk levels

The plastic coating of the pencils contains di-(2-ethylhexyl) phthalate (DEHP). (measured value: 1.9% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Ban on the marketing of the product and any accompanying measures, Withdrawal of the product from the market

**Description:** Pencil with floral pattern and little bears and a top eraser. No packaging.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Greece





**Alert number:** A11/0019/19

**Product:** Toy bow and arrow set

**Name:** Set Arciere Junior

**Risk type:** Injuries

**Category:** Toys

**Brand:** Sport1

**Type / number of model:** Unknown

**Type of alert:** Products with other risk levels

The kinetic energy of the arrows fired from the bow is too high.

This could lead to injuries if a person is hit in the eye by the shot arrows.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Toy set consisting of a bow and 3 arrows with suction cups. It is sold in open cardboard packaging.

**Batch number / Barcode:** 8003029602301

**Country of origin:** China

**Alert submitted by:** Denmark

