



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

📄 [Back to report listings \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

Week 28 - 2019

Alert number: A12/1044/19

Product: LED lighting chain

Name: Lampki choinkowe

Risk type: Electric shock

Category: Lighting chains

Brand: Volteno

Type / number of model: V00491, V00492, V00805

Type of alert: Products with serious risks

Single-pole insertion of the plug is possible. One plug pin can be inserted into the socket of the lighting chain leaving the other live plug pin accessible.

The user may touch live parts and get electric shock

The product does not comply with the requirements of the Low Voltage Directive, the relevant European standards EN 60598, EN 62368-1.

Withdrawal of the product from the market

Description: LED lighting chains that can be connected with each other. Available in various colours. Packaging: cardboard box.

Batch number / Barcode: 5901508164919, 5901508192165, 5901508192172

Country of origin: China

Alert submitted by: Poland



Alert number: A12/1009/19

Product: Lava lamp

Name: Unknown

Risk type: Electric shock

Category: Lighting equipment

Brand: RL

Type / number of model: Article N° R50071110 / TFM40-40W (control gear)

Type of alert: Products with serious risks

The electrical insulation and the clearance/creepage distances between the primary and secondary circuit of the controller are not sufficient. The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Recall of the product from end users

Description: Lava lamp in a printed cardboard box. According to the manufacturer, the defect concerns production batch 11-2017-13, which was marketed only in Finland.

Batch number / Barcode: 4017807235289

Country of origin: Germany

Alert submitted by: Finland



Alert number: A12/1029/19

Product: Table lamp

Name: SWEET LN Czarny

Risk type: Electric shock

Category: Lighting equipment

Brand: TK Lighting

Type / number of model: 2884

Type of alert: Products with serious risks

The mounting of the bulb cap is not sufficiently protected.

Consequently the cap could be twisted, damaging the cables and leaving live parts accessible. The user could touch them and receive an electric shock.

The product does not comply with the requirements of Low Voltage Directive and the relevant European standard EN 60598.

Withdrawal of the product from the market

Description: Table portable lamp with a dark lamp shade, sold in a cardboard box.

Batch number / Barcode: 5901780528843

Country of origin: Poland

Alert submitted by: Poland



Alert number: A12/1011/19

Product: Passenger van / Light commercial vehicle

Name: Crafter

Risk type: Injuries

Category: Motor vehicles

Brand: VW

Type / number of model: Type-approval numbers: e1*2007/46*1613*, e1*2007/46*1615*, e1*2007/46*1619*, e1*2007/46*1616*, e1*2007/46*1622*; types: SYN1E, SYN1Z, SYN2Z, SZN1E, SZN2Z

Type of alert: Products with serious risks

In vehicles with dual tyres and a short wheelbase, resonance vibrations at high speeds can cause damage to the driveshaft.

As a result, the driveshaft can break, increasing the risk of an accident.

Recall of the product from end users

Description: Passenger van / Light commercial vehicle under VW recall code: 23AF.

Batch number / Barcode: The affected vehicles were manufactured between 20 June 2017 and 11 February 2019.

Country of origin: Poland

Alert submitted by: Germany

Alert number: A12/1012/19
Product: Passenger car
Name: X7
Risk type: Injuries
Category: Motor vehicles
Brand: BMW
Type / number of model: Type-approval number: e1*2007/46*1952; type: G7X
Type of alert: Products with serious risks
The head airbags may be incorrectly installed.
This may result in insufficient deployment of the airbags in the event of an accident, increasing the risk of injuries.
Recall of the product from end users
Description: Passenger car under BMW recall code: 0072080200.
Batch number / Barcode: The affected vehicles were manufactured between November 2018 and April 2019.
Country of origin: United States
Alert submitted by: Germany
Products were found and measures were taken also in: Denmark, Ireland

Alert number: A12/1013/19
Product: Passenger van / Light commercial vehicle
Name: Vito
Risk type: Injuries
Category: Motor vehicles
Brand: Mercedes-Benz
Type / number of model: Type approval number: e1*2007/46*0458*14; type: 639/4
Type of alert: Products with serious risks
The springs on the rear axle are inadequate for the vehicle type.
This could lead to loss of control over the vehicle when it is fully loaded, increasing the risk of an accident.
Recall of the product from end users
Description: Passenger van / Light commercial vehicle under Mercedes-Benz recall code: VS2HAFEDER.
Batch number / Barcode: The affected vehicles were manufactured on 4 January 2019.
Country of origin: Germany
Alert submitted by: Germany

Alert number: A12/1014/19
Product: Motorcycle
Name: Superlight 125
Risk type: Injuries
Category: Motor vehicles
Brand: Keeway
Type / number of model: Type-approval number: e13*168/2013*00116*01; type: J28
Type of alert: Products with serious risks
When the front brake pads are worn out above certain level, they could fall out of the brake caliper.
This can impair the braking efficiency, increasing the risk of an accident.
Recall of the product from end users
Description: Light motorcycles.
Batch number / Barcode: The affected vehicles were manufactured in 2017 and 2018.
Country of origin: China
Alert submitted by: Germany
Products were found and measures were taken also in: Ireland, Poland

Alert number: A12/1015/19
Product: Passenger van / Light commercial vehicle
Name: Sprinter
Risk type: Injuries
Category: Motor vehicles
Brand: Mercedes-Benz
Type / number of model: Type-approval numbers: e1*2007/46*0301*18, e1*2001/116*0354*22-23; types: 906BB35, 906A
Type of alert: Products with serious risks
A missing torsion rod on the front axle can result in a significant change in the road performance and restricted control performance of the Electronic Stability Program (ESP).
This may increase the risk of the driver losing control over the vehicle, possibly leading to an accident.
Recall of the product from end users
Description: Passenger van / Light commercial vehicle under Mercedes-Benz recall code: VS3DREHSTA (3390095).
Batch number / Barcode: The affected vehicles were manufactured between 1 September 2018 and 25 March 2019.
Country of origin: Germany
Alert submitted by: Germany

Alert number: A12/1016/19

Product: Passenger car

Name: Tivoli, XLV

Risk type: Fire

Category: Motor vehicles

Brand: Ssangyong

Type / number of model: Type-approval number: e9*2007/46*6294*02

Type of alert: Products with serious risks

Possible interference between the wiring and the fuel supply line may result in damage of the fuel supply hose and subsequent fuel leaks.

Fuel leakage close to a source of ignition may increase the risk of the vehicle catching fire.

Recall of the product from end users

Description: Passenger car.

Batch number / Barcode: The affected vehicles were manufactured between July 2015 and August 2018.

Country of origin: Republic of Korea

Alert submitted by: Belgium

Products were found and measures were taken also in: Luxembourg

Alert number: A12/1017/19

Product: Passenger car

Name: A110

Risk type: Injuries

Category: Motor vehicles

Brand: Alpine

Type / number of model: Type-approval numbers: e2*2007/46*0612*00, e2*2007/46*0612*01, e2*2007/46*0612*02, e2*2007/46*0612*03, e2*2007/46*0612*04

Type of alert: Products with serious risks

The wiring route may be inappropriate and without adequate fixation.

In the event of contact with the exhaust, the wiring can melt, leading to short circuit and engaging of the limp-home mode.

Recall of the product from end users

Description: Alpine sport vehicles equipped with a sports exhaust system (LIECH1 criterion) under Renault recall code 0D17.

Batch number / Barcode: The affected vehicles were manufactured in Dieppe from the start of production until 9 November 2018.

Country of origin: France

Alert submitted by: France

Products were found and measures were taken also in: Germany

Alert number: A12/1018/19

Product: Passenger car

Name: A110

Risk type: Injuries

Category: Motor vehicles

Brand: Alpine

Type / number of model: Type-approval numbers: e2*2007/46*0612*00, e2*2007/46*0612*01, e2*2047/46*0612*02, e2*2007/46*0612*03, e2*2007/46*0612*04, e2*2007/46*0612*05

Type of alert: Products with serious risks

The lock of the front hood may not be sufficiently torqued.

This may result in the front hood opening in motion, increasing the risk of an accident.

Recall of the product from end users

Description: Passenger car under Renault recall code: 0D3Q.

Batch number / Barcode: The affected vehicles were manufactured in Dieppe from the start of production until 27 February 2019.

Country of origin: France

Alert submitted by: France

Alert number: A12/1020/19

Product: Passenger car

Name: Citan

Risk type: Environment

Category: Motor vehicles

Brand: Mercedes Benz

Type / number of model: M1: e2*2007/46*0129*12, e2*2007/46*0129*13, e2*2007/46*0129*14-18, N1 : e2*2007/46*0130*12, e2*2007/46*0130*13, e2*2007/46*0130*14, e2*2007/46*0130*15-17

Type of alert: Products with serious risks

An emission control component, used under certain conditions, could deteriorate more rapidly than expected and might cause the exhaust emissions' level of nitrogen oxides (NOx) to exceed regulated limits.

Nitrogen oxides are harmful to human health and the environment.

Recall of the product from end users

Description: Passenger car

Batch number / Barcode: M1: Citan 108 - 109 CDI manufactured June 2015 -December 2016; M1: Citan 111 CDI June 2015 - February 2017; N1: Citan 108 - 109 CDI June 2016 - December 2016; N1: Citan 111 CDI June 2015-February 2017

Country of origin: Germany

Alert submitted by: France

Products were found and measures were taken also in: Denmark, Romania

Alert number: A12/1034/19

Product: Scooter

Name: ZIP

Risk type: Injuries

Category: Motor vehicles

Brand: Piaggio

Type / number of model: ZIP 50cc 4T 3V E4 injection; VIN range: LBMCA210000000007 - LBMCA220000004511

Type of alert: Products with serious risks

The accelerator cable could snap or become trapped in the carburettor control system.

As a result, the vehicle decelerates rapidly or keeps accelerating until the brake is activated, increasing the risk of an accident.

Recall of the product from end users

Company recall page: <http://static.piaggio.com/recall/form-piaggio.html> (<http://static.piaggio.com/recall/form-piaggio.html>)

Description: Scooter under Piaggio recall code: PPJZZQ1901.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Italy

Products were found and measures were taken also in: Luxembourg, Slovenia

Alert number: A12/1035/19

Product: Passenger car

Name: E-Class

Risk type: Fire

Category: Motor vehicles

Brand: Mercedes-Benz

Type / number of model: Type-approval numbers: e1*2007/46*1666*06, 08; type: R1EC; model series 238

Type of alert: Products with serious risks

Certain screw connections attaching the wiring harness to the fuse box may not have been fitted correctly.

As a result, there could be excessive contact resistance at these connection points, increasing the risk of fire.

Recall of the product from end users

Description: E-Class coupé/cabriolet vehicles with 48V onboard electrical systems under Mercedes-Benz recall code: 5491802.

Batch number / Barcode: The affected vehicles were manufactured between 15 March and 28 May 2018.

Country of origin: Germany

Alert submitted by: Germany

Products were found and measures were taken also in: Denmark, Finland

Alert number: A12/1036/19
Product: Passenger car
Name: 500
Risk type: Injuries
Category: Motor vehicles
Brand: Fiat
Type / number of model: Type-approval number: e3*2007/46*0064*47; type: 312
Type of alert: Products with serious risks
The front-right driveshaft is defective.
As a result, the driveshaft could break in motion, increasing the risk of an accident.
Recall of the product from end users
Description: Passenger car under Fiat recall code: 6228.
Batch number / Barcode: The affected vehicles were manufactured between 13 November and 19 December 2018.
Country of origin: Italy
Alert submitted by: Germany
Products were found and measures were taken also in: Denmark, Poland, Slovenia

Alert number: A12/1037/19
Product: Pickup truck
Name: RAM
Risk type: Fire
Category: Motor vehicles
Brand: Dodge
Type / number of model: Type-approval number: individual approval
Type of alert: Products with serious risks
Fatigue failure of the heating wires in the seat cushion may result in overheating.
Overheating increases the risk of the vehicle catching fire.
Recall of the product from end users
Description: Pickup truck under Dodge recall code: T80.
Batch number / Barcode: The affected vehicles were manufactured between 17 May 2004 and 24 June 2005.
Country of origin: United States
Alert submitted by: Germany

Alert number: A12/1038/19
Product: Passenger car
Name: Spider
Risk type: Injuries
Category: Motor vehicles
Brand: Abarth
Type / number of model: Type-approval number: e11*2007/46*3320*03; type: NF
Type of alert: Products with serious risks
Defective software may result in the automated transmission shifting down unintentionally.
This may cause the rear wheels to lock, increasing the risk of an accident.
Recall of the product from end users
Description: Passenger car under Abarth recall code: 6222.
Batch number / Barcode: The affected vehicles were manufactured between 1 September 2016 and 3 July 2018.
Country of origin: Italy
Alert submitted by: Germany
Products were found and measures were taken also in: Slovenia

Alert number: A12/1039/19
Product: Motorcycle
Name: GSX250R
Risk type: Injuries
Category: Motor vehicles
Brand: Suzuki
Type / number of model: Type-approval number: e4*168/2013*00059*00; model code: GSX250RAL8
Type of alert: Products with serious risks
Water may get into the rear brake light switch and corrode the metal parts.
This could cause the rear brake light to fail to illuminate, increasing the risk of an accident.
Recall of the product from end users
Description: Motorcycle under Suzuki recall code: 97ER.
Batch number / Barcode: The affected vehicles were manufactured between 10 December 2015 and 6 March 2019.
Country of origin: China
Alert submitted by: Poland
Products were found and measures were taken also in: Denmark, Luxembourg

Alert number: A12/1040/19

Product: Passenger car

Name: Yaris

Risk type: Injuries

Category: Motor vehicles

Brand: Toyota

Type / number of model: Type-approval number: e11*2007/46*0152; model code NHP130; VIN range: VDS-KD3D3#/VIS - 0A426766 - 0A586475

Type of alert: Products with serious risks

Defective soldering may cause a transistor to separate from the circuit board of the DC-DC converter.

As a result, the auxiliary battery may no longer receive power from the DC-DC converter. If the auxiliary battery is discharged to a certain level, the hybrid system could shut down, resulting in loss of motive power. Loss of motive power while driving could increase the risk of an accident.

Recall of the product from end users

Description: Passenger car under Toyota recall code: DIR_TME 19SMD062.

Batch number / Barcode: The affected vehicles were manufactured between 06 February 2018 - 02 April 2019;

Country of origin: France

Alert submitted by: Portugal

Products were found and measures were taken also in: Iceland, Poland, Slovakia, Slovenia

Alert number: A12/1041/19

Product: Passenger car

Name: A8, S8

Risk type: Injuries

Category: Motor vehicles

Brand: Audi

Type / number of model: Type-approval number: e1*2007/46*1751*; type: F8

Type of alert: Products with serious risks

The rivets which fix the seat tracks on the passenger side of the vehicle have an unsuitable head diameter.

This can cause the rivet connection to fail in the event of an accident, impairing the restraining effect of the seat and belt system and increasing the risk of injuries.

Recall of the product from end users

Description: Passenger car with the 'relaxation seat' optional extra under Audi recall code: 72J3.

Batch number / Barcode: The affected vehicles were manufactured between September 2018 and March 2019.

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/1042/19

Product: Light commercial vehicle

Name: NV300

Risk type: Injuries

Category: Motor vehicles

Brand: Nissan

Type / number of model: Type-approval number: e2*2007/46*0154; model code: X82; VIN ranges: VNVF4000 (161326224-761477049), VNVJ4000 (761131156-861129951)

Type of alert: Products with serious risks

The hand brake cable stopper may be incorrectly installed.

As a result, the holding force of the hand brake may not be sufficient to hold the vehicle in position, increasing the risk of an accident.

Recall of the product from end users

Description: Light commercial vehicle under Nissan recall code: PN9B3.

Batch number / Barcode: The affected vehicles were manufactured in Sandouville between 18 May 2018 and 13 September 2018.

Country of origin: France

Alert submitted by: Portugal

Alert number: A12/1006/19

Product: Mug and sock gift set

Name: Mug and Socks Gift Set

Risk type: Burns

Category: Other

Brand: Jack Wills

Type / number of model: Boots item code UK / ROI 80-85-447 (Mens) 80-85-560 (Ladies) Norway Ladies 81-10-468

Type of alert: Products with serious risks

The base of the mug may crack and break away when boiling water is added.

The user may suffer burns.

The product does not comply with the relevant national standard.

Recall of the product from end users

Description: A gift box containing ceramic mug and socks (for men) or a ceramic mug, marshmallows, hot chocolate sachets and socks (for ladies). The ceramic mugs within the gift sets are subject to the recall.

Batch number / Barcode: Unknown

Country of origin: United Kingdom

Alert submitted by: United Kingdom



Alert number: A12/1007/19

Product: Baby carrier

Name: isa

Risk type: Choking, Injuries

Category: Childcare articles and children's equipment

Brand: Lionelo

Type / number of model: LO-ISA PLUS® Z

Type of alert: Products with serious risks

The carrier has too large openings for the child's legs and a small part (plastic sticker) can be detached easily.

If a child is carried in an almost horizontal position, s/he may fall out of the carrier. The child may put the small part in the mouth which could block the airways.

The product does not comply with the relevant European standard EN 13209-2.

Withdrawal of the product from the market

Description: Red textile soft carrier for a child without frame but with leg openings. Packed in a cardboard box.

Batch number / Barcode: 5902581654502

Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/1025/19

Product: Baby bouncer

Name: Steps Bouncer, Steps Newborn Set

Risk type: Injuries

Category: Childcare articles and children's equipment

Brand: Stokke

Type / number of model: Unknown

Type of alert: Products with serious risks

The locking indicator of the product turns green even if the bouncer is not properly attached to the chair.

Consequently the bouncer might inadvertently remain loose while on the chair. If touched or pushed by bystanders it may detach, causing it to fall while the baby is still attached to it.

The product does not comply with the relevant European standard EN 14988.

Recall of the product from end users

Company recall page: <https://reclamations.stokke.com/stepsbouncer> (<https://reclamations.stokke.com/stepsbouncer>)

Description: Two models of baby bouncer to be attached to the Steps high chair. Suitable for children between 0 to 6 months. The Steps Bouncer model has its own support and can be used as stand alone.

Batch number / Barcode: 7040353501017, 7040353501024, 7040353501031, 7040353501048, 7040353501055, 7040353501062, 7040353501079, 7040353545011, 7040353545028, 7040353545035, 7040353545042, 7040353545059, 7040353545066, 7040353545073, 7040355403012, 7040355403029, 7040355404019, 7040355410003

Country of origin: Norway

Alert submitted by: Norway

Products were found and measures were taken also in: Austria



Alert number: A12/1026/19

Product: Reclined cradle

Name: Tripp Trapp Newborn Set

Risk type: Injuries

Category: Childcare articles and children's equipment

Brand: Stokke

Type / number of model: Unknown

Type of alert: Products with serious risks

The harnesses could be re-assembled incorrectly after washing, leading to one or more harness attachment points to detach. If a small child is left unattended on the product, the harness could detach and the child could slip out of the seat and fall down.

The product does not comply with the relevant European standard EN 14988.

Recall of the product from end users

Company recall page: <https://reclamations.stokke.com/newbornupgrade> (<https://reclamations.stokke.com/newbornupgrade>)

Description: Infant reclined seat to be attached to the Tripp Trapp chair. Suitable for children between 0-6 months, up to 9 kg or not able to sit up unaided. It is sold with the fabric in different colours.

Batch number / Barcode: 7040355261018, 7040355261025, 7040355261032, 7040355262015, 7040355262022, 7040355262039

Country of origin: Norway

Alert submitted by: Norway

Products were found and measures were taken also in: Austria



Alert number: A12/1002/19

Product: Plastic toy dinosaur

Name: Dinosaur Century Tyrannosaurus Rex

Risk type: Chemical

Category: Toys

Brand: Rong Kai Toys

Type / number of model: 6623

Type of alert: Products with serious risks

The plastic of the toy contains an excessive amount of lead (measured value: 80mg/kg).

Exposure to lead is harmful for human health and can cause developmental neurotoxicity.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Destruction of the product

Description: Plastic battery-operated toy dinosaur in a printed cardboard box.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: United Kingdom



Alert number: A12/1004/19

Product: Soft toy

Name: Owca

Risk type: Choking

Category: Toys

Brand: A.S. Academy of Plush Sun-Day

Type / number of model: O0547

Type of alert: Products with serious risks

Small parts (plastic eyes) may be easily detached from the toy.

A child may put the small parts in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

Description: A sheep-shaped soft toy. No packaging, label attached to the toy.

Batch number / Barcode: 5904073146403

Country of origin: China

Alert submitted by: Poland



Alert number: A12/1005/19

Product: Plastic doll

Name: Beautiful Baby, Happy

Risk type: Chemical

Category: Toys

Brand: BABY LOVE

Type / number of model: NO.QT607

Type of alert: Products with serious risks

The plastic material of the doll contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 17.2% by weight).

This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

Description: Plastic baby doll, dressed in differently coloured overalls or cap.

Batch number / Barcode: 6915871247154

Country of origin: China

Alert submitted by: Czech Republic



Alert number: A12/1010/19

Product: Plastic doll

Name: Barbara Sposa

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: GvC4369, A4596

Type of alert: Products with serious risks

The product contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 0.1% by weight) and dibutyl phthalate (DBP) (measured value: 0.1% by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Import rejected at border

Description: Plastic doll with synthetic blonde and fuchsia-coloured hair, a long white dress with rhinestones, a pink ribbon, a veil, fuchsia shoes and a necklace. Packed in a cardboard box with a transparent front.

Batch number / Barcode: GVC LK01, 8056448043699

Country of origin: China

Alert submitted by: Italy



Alert number: A12/1021/19

Product: Toy flute

Name: Unknown

Risk type: Choking

Category: Toys

Brand: LG

Type / number of model: LG9161

Type of alert: Products with serious risks

The mouthpiece of the flute detaches easily, generating a small part.

A child may put the small part in the mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

Description: Plastic toy flute in a transparent plastic packaging.

Batch number / Barcode: 5413247091611, LOT NUMBER 205AO1770

Country of origin: China

Alert submitted by: Poland



Alert number: A12/1023/19

Product: Plastic toy tractor

Name: Speedy truck

Risk type: Choking

Category: Toys

Brand: FARM MACHINE YT08276

Type / number of model: 612

Type of alert: Products with serious risks

The driver, steering wheel and the plastic cord can detach, generating small parts.

A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

Description: Plastic toy tractor with sweets in a transparent plastic bag.

Batch number / Barcode: 6933893325315

Country of origin: China

Alert submitted by: Lithuania



Alert number: A12/1024/19

Product: Squeezable toy

Name: Baby Cheeki

Risk type: Chemical

Category: Toys

Brand: Puni maru

Type / number of model: Unknown

Type of alert: Products with serious risks

The product contains the substance cyclohexanone.

There is a risk of eye and mucous membrane irritation.

The product does not comply with the requirements of the Toy Safety Directive.

Withdrawal of the product from the market

Description: Squeezable toy ('squishy') in the shape of a crying monkey.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: Sweden



Alert number: A12/1031/19

Product: Squeezable toy

Name: I Love Squishy

Risk type: Chemical

Category: Toys

Brand: Unknown

Type / number of model: 10-pack

Type of alert: Products with serious risks

The product contains the substances N,N-dimethylformamide, dimethylaminoethanol, cyclohexanone, bis (2-(dimethylamino) ethyl) ether) and triethylenediamine.

There is a risk of eye and mucous membrane irritation.

The product does not comply with the requirements of the Toy Safety Directive.

This product listing was removed by the online shop. Ban on the marketing of the product and any accompanying measures

Description: Ten different types of squishy toys sold together in a bag. The product was sold online.

Batch number / Barcode: 106762S33604

Country of origin: Hong Kong

Alert submitted by: Sweden



Alert number: A12/1032/19

Product: Squeezable toy

Name: Squish-Dee-Lish

Risk type: Chemical

Category: Toys

Brand: Disney, jakks

Type / number of model: FAC-069362-18131

Type of alert: Products with serious risks

The product contains the substances cyclohexanone, bis(2-(dimethylamino)ethyl)ether) and triethylenediamine. There is a risk of eye and mucous membrane irritation.

The product does not comply with the requirements of the Toy Safety Directive.

Withdrawal of the product from the market

Description: A white squeezable toy (squishy) in a plastic bag.

Batch number / Barcode: 461088806326

Country of origin: China

Alert submitted by: Sweden



Alert number: A12/1033/19

Product: Squeezable toy

Name: Squishy Cake

Risk type: Chemical

Category: Toys

Brand: Coolstuff

Type / number of model: 16086

Type of alert: Products with serious risks

The product contains the substances N,Ndimethylformamide, dimethylaminoethanol, cyclohexanone, bis (2-(dimethylamino) ethyl) ether) and triethylenediamine.

There is a risk of eye and mucous membrane irritation.

The product does not comply with the requirements of the Toy Safety Directive.

Withdrawal of the product from the market

Description: Jumbo squeezable toy ('squishy') in the shape of a piece of cake. The product was sold online.

Batch number / Barcode: 7350074028244

Country of origin: China

Alert submitted by: Sweden



Alert number: A12/1043/19

Product: Magnetic toy

Name: Magnastix

Risk type: Injuries

Category: Toys

Brand: SGS

Type / number of model: Unknown

Type of alert: Products with serious risks

The product contains magnets with a high magnetic flux.

If a child swallows the small magnet and other metallic objects, they could attract one another causing intestinal blockage or perforation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Import rejected at border

Description: Set of magnetic balls and coloured sticks packed in a cardboard box.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: United Kingdom



Alert number: A12/1003/19

Product: Children's dress

Name: Unknown

Risk type: Choking

Category: Clothing, textiles and fashion items

Brand: ESILA

Type / number of model: 902, 1-2-3-4 YAS

Type of alert: Products with serious risks

The small beads can be easily detached, generating small parts.

A small child can put the small part in the mouth and choke.

Withdrawal of the product from the market

Description: Dress with a headband for children aged 2 years and 3 years. In the waist area, at the front of the dress there is a brooch with two flowers and small beads.

Batch number / Barcode: 5356309649026

Country of origin: Turkey

Alert submitted by: Bulgaria



Alert number: A12/1027/19

Product: Eyelash enhancing serum

Name: Bimatoprost ophthalmic solution

Risk type: Chemical

Category: Cosmetics

Brand: Careprost

Type / number of model: 0,03% w/v Sterile Eye drops, 3 ml

Type of alert: Products with serious risks

According to the label the product contains the active substance bimatoprost, which should be used under supervision of an ophthalmologist. Bimatoprost can cause eye and ophthalmic defects in the user and should not be used by pregnant and breastfeeding women, as it may affect the child.

The product does not comply with the Cosmetic Products Regulation.


Withdrawal of the product from the market

Description: White plastic bottle with dispenser cap containing ophthalmic solution.

Batch number / Barcode: WBSOOI 1

Country of origin: India

Alert submitted by: Lithuania

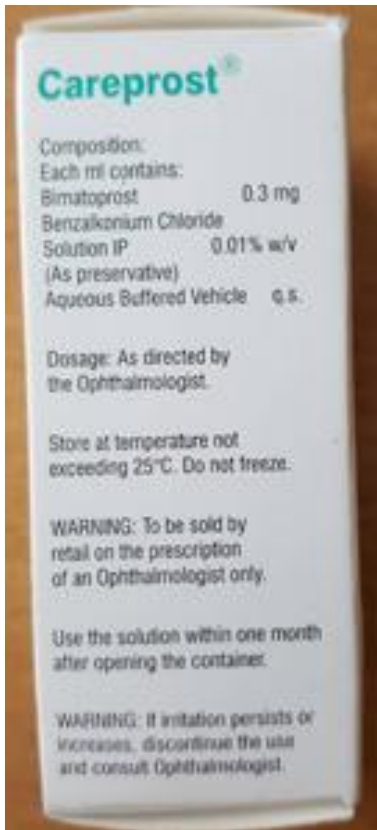

Alert number: A12/1008/19

Product: Laptop power supply

Name: Replacement AC Adapter

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Unknown

Type / number of model: ST-C-070-19000342CT (Product code: MBA1026)

Type of alert: Products with serious risks

The electrical insulation and the clearance and creepage distances between the primary and secondary circuit are not sufficient. Accessible parts of the product could become live, leading to an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Recall of the product from end users

Description: Laptop power supply in a brown cardboard box.

Batch number / Barcode: 5705965702215

Country of origin: China

Alert submitted by: Finland



Alert number: A12/1022/19

Product: Adaptor

Name: Unknown

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Electraline

Type / number of model: 70026

Type of alert: Products with serious risks

The different plugs are all connected electrically. If one of the pins is inserted in a socket, the user could touch the pins of the other plug and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard CEI 23-50.

Withdrawal of the product from the market

Description: Universal travel adaptor, comprising three plugs (European, American and UK) and two sockets.

Batch number / Barcode: 8011439700265

Country of origin: China

Alert submitted by: Italy



Alert number: A12/1028/19
Product: Micro-USB charger
Name: Travel Charger
Risk type: Electric shock
Category: Electrical appliances and equipment
Brand: Unknown
Type / number of model: QL-268 10035
Type of alert: Products with serious risks
 The electrical insulation is insufficient.
 The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.
 Withdrawal of the product from the market

Description: Travel charger with micro-USB connexion with and output of 2.1A.

Batch number / Barcode: 6934476163218

Country of origin: China

Alert submitted by: Lithuania



Alert number: A12/1030/19

Product: Torch

Name: Rechargeable Tactical X800 Flashlight

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Shadowhawk

Type / number of model: X800

Type of alert: Products with serious risks

The clearance and creepage distances between the primary and accessible secondary circuit are not sufficient. The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

This product listing was removed by Amazon, Withdrawal of the product from the market

Description: A battery powered handheld torch supplied with a charging base and power adaptor. The product was sold online, in particular via Amazon.

Batch number / Barcode: Unknown

Country of origin: China

Alert submitted by: United Kingdom



Alert number: INFO/0076/19

Product: Baby carrier

Name: Baby Carrier

Risk type: Strangulation, Suffocation

Category: Childcare articles and children's equipment

Brand: Storchenwiege

Type / number of model: BC15-CAFE-6082

Type of alert: Products with other risk levels

The carrier contains long cords/straps.

The child may become entangled in the long cords/straps and may be strangled or s/he may put the cover over the head, pull the cord and suffocate.

Withdrawal of the product from the market, Withdrawal of the product from the market

Description: Brown textile soft carrier for a child without frame and integral leg openings. Packed in a cardboard box. Inside the box, there is a textile bag for the carrier and a plastic chest clip.

Batch number / Barcode: 4260200156082; The product subject to the measure was manufactured before August 2018.

Country of origin: Germany

Alert submitted by: Czech Republic



Alert number: A11/0040/19

Product: Mains extension lead

Name: Tischsteckdose / Asztali elosztó

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: AOBEOER

Type / number of model: GNBKU03; 24554

Type of alert: Products with other risk levels

The electrical insulation between the primary and secondary circuit of the voltage-reducing converter are not sufficient.

The power socket of the cable connected to the USB ports may become live.

The user could touch accessible live part and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Withdrawal of the product from the market

Description: White extension lead with three socket outlets, two USB ports and a switch. Packaging: transparent plastic bag.

Batch number / Barcode: 4 006341 912473

Country of origin: China

Alert submitted by: Hungary

