



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

Week 39 - 2019

Alert A12/1410/19 has been modified on request of the notifying authority to include additional countries of destination (Austria, Croatia, Hungary, Ireland, Liechtenstein, Malta and Portugal).

**Alert number:** A12/1406/19

**Product:** Garden hose

**Name:** Trädgårdsslang

**Risk type:** Chemical

**Category:** Hand tools

**Brand:** Nyby Sweden

**Type / number of model:** 5-10-001

**Type of alert:** Products with serious risks

The material of the hose contains an excessive amount of lead (measured value: 0.06% by weight ).

Lead is harmful for human health as it accumulates in the body and may damage the unborn child.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** A 20 m long garden hose with 1/2" diameter, made of dark green PVC plastic. The hose is made of recycled plastic.

**Batch number / Barcode:** 7391535850028

**Country of origin:** Poland

**Alert submitted by:** Sweden



**Alert number:** A12/1397/19

**Product:** Laser pointer

**Name:** Unknown

**Risk type:** Damage to sight

**Category:** Laser pointers

**Brand:** XIONGWEI

**Type / number of model:** XHA 200XXY 200XXY

**Type of alert:** Products with serious risks

The product lacks the required labelling, including appropriate warning texts related to the use of the product and the classification. Direct viewing of the laser beam or its mirror reflection can cause damage to sight.

The product does not comply with the relevant European standard EN 60825-1.

Withdrawal of the product from the market

**Description:** Battery-powered, metallic grey laser pointer (7 cm long) with a carabiner, on/off slider and light outputs.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Bulgaria



**Alert number:** A12/1399/19

**Product:** Laser pointer

**Name:** GOLD BARS KEY CHAIN, 3 IN 1 • LED LIGHT • LASER

**Risk type:** Damage to sight

**Category:** Laser pointers

**Brand:** The World Over / SHOCK

**Type / number of model:** B-VE-18722-ML301; ITEM No. 40235

**Type of alert:** Products with serious risks

The laser beam is too powerful.

Direct viewing of the laser beam could cause damage to sight.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Gold bar shaped laser pointer with LED torch and key chain. It can be used as a mobile phone stand too. Packaging: sold individually from a display box.

**Batch number / Barcode:** 8484067402359

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1405/19

**Product:** Naphthalene

**Name:** a) Pearl Balls ; b) Unknown

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** b) Shayu, a) Happy Deer

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

According to the ingredients list, the product consists of pure naphthalene, which is not authorised in biocides and lacks the appropriate labelling and warnings.

Naphthalene is irritant, if inhaled or in contact with skin, and might cause cancer.

The product does not comply with the Biocidal Products and CLP Regulations.

Withdrawal of the product from the market

**Description:** Transparent polyethylene bag with blue printing containing between 12 and 20 disks of white naphthalene.

**Batch number / Barcode:** a) 6956570300016, b) 6931767563531

**Country of origin:** China

**Alert submitted by:** Romania



**Alert number:** A12/1393/19

**Product:** LED floodlight

**Name:** POWERPLUSLIGHT POWLI233 Portable LED Floodlight

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** VARO

**Type / number of model:** POWLI233 concerned batch: Prod.Y.-S.N.: 15-01-2014/131237/xxxx

**Type of alert:** Products with serious risks

Water penetration is possible and water may therefore come into contact with live parts. Moreover, the earth connection is inadequate and there is no strain relief for the mains connection lead.

The housing of the product could consequently become live and lead to an electric shock if touched by a user.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60598.

Recall of the product from end users, Recall of the product from end users

**Description:** The LED floodlight (dimensions: 145 x 180 x 120 mm) has a flat LED protected by a glass panel. The floodlight and the protective framework for the front panel consists of an aluminium housing with protective cover that can be removed from behind. The product was (also) sold online.

**Batch number / Barcode:** 5400338061097

**Country of origin:** Unknown

**Alert submitted by:** Germany



**Alert number:** A12/1410/19

**Product:** Awning for recreational vehicle (RV)

**Name:** Omnistor

**Risk type:** Injuries

**Category:** Machinery

**Brand:** Thule

**Type / number of model:** TO 8000 and TO 9200 and motor-set Nice 230 V

**Type of alert:** Products with serious risks

The drive wheel of the tubular motor may spontaneously detach from it.

Consequently, the awning could open inadvertently while driving, leading to an increased risk of accident.

The product does not comply with the requirements of the Machinery Directive.

Recall of the product from end users

**Description:** Awning for recreational vehicle and/or its corresponding motorset.

**Batch number / Barcode:** The affected products were sold from June 2016 until August 2019.

**Country of origin:** Belgium

**Alert submitted by:** Belgium

**Products were found and measures were taken also in:** Poland



**Alert number:** A12/1396/19

**Product:** Bus

**Name:** Citaro, Conecto

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** EvoBus

**Type / number of model:** Type-approval numbers: e1\*2007/46\*0087\*, e1\*2007/46\*0090\*, e1\*2007/46\*0036\*, e1\*2007/46\*0037\* Types: 628 02, 628 03, 628B01, 628B02

**Type of alert:** Products with serious risks

There are leakage currents in electronic components.

This may increase the risk of fire and consequent injuries.

Recall of the product from end users

**Description:** Bus

**Batch number / Barcode:** The vehicles in question were manufactured between October 2015 and July 2019. Recall code: 54.00M19057A

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Denmark, Finland, Sweden

**Alert number:** A12/1429/19

**Product:** Passenger car

**Name:** 308II

**Risk type:** Environment

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** e2\*2007/46\*0405\*16, e2\*2007/46\*0405\*18

**Type of alert:** Products with serious risks

As a result of an incorrectly calibrated engine, the diesel particulate filter (DPF) could be damaged.

Depending on the amount of damage, the particulate emission level could exceed regulatory limits.

Recall of the product from end users

**Description:** Passenger car

**Batch number / Barcode:** Vehicles manufactured between 12/01/2017 and 30/03/2018 - VIN: VF3LHEZRHS028975 to VF3LJEHZRJ5174718

Peugeot code : JDF

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Slovakia, The Netherlands

**Alert number:** A12/1430/19

**Product:** Passenger car

**Name:** 911, Boxster, Cayman, Panamera

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Porsche

**Type / number of model:** Type-approval number: e13\*2007/46\*1187\*, e13\*2007/46\*1188\*, e13\*2007/46\*1187\*, e13\*KS07/46\*0991\*, e13\*2007/46\*1607\*, e13\*2007/46\*0970\*, e13\*2007/46\*1143\*, e13\*2007/46\*1160\*, e13\*2007/46\*1161\* , Types: 991, 991 Turbo, 991H, 982, 970, 970N, 970HN, 970H

**Type of alert:** Products with serious risks

A defective capacitor may cause voltage fluctuations in the power supply of the airbag control unit.

As a result, the airbags and the seatbelt pre-tensioners may deploy unexpectedly or fail to deploy in the event of an accident, increasing the risk of injury to the occupants.

Recall of the product from end users

**Description:** Passenger car.

**Batch number / Barcode:** The affected vehicles were manufactured between 23 June 2015 and 16 June 2016.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Bulgaria, Denmark, Estonia, Finland, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1431/19

**Product:** Passenger car

**Name:** Carrera, Boxster, Cayman

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Porsche

**Type / number of model:** Type-approval numbers: e13\*2007/46\*1607, e13\*2007/46\*1187\* Types: 982, 991

**Type of alert:** Products with serious risks

Possible faulty construction of the door moulding causes the sensors of the vehicle occupant protection system to be activated incorrectly.

This may result in unnecessary and unexpected deployment of the occupant protection system, increasing the risk of injury.

Recall of the product from end users

**Description:** Passenger car under Porsche code: AKB3.

**Batch number / Barcode:** The affected vehicles were manufactured between 12 January 2018 and 17 June 2019.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Sweden

**Alert number:** A12/1432/19

**Product:** Passenger car

**Name:** Ateca, Tarraco

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Seat

**Type / number of model:** Type-approval numbers: e9\*2007/46\*6394\*, e9\*2007/46\*6666\*; types: 5FP, KN

**Type of alert:** Products with serious risks

Possible development of cracks in the mounting of the left-hand front seat.

This can reduce its protective function in case of an accident, increasing the risk of injury.

Recall of the product from end users

**Description:** Passenger car under Seat recall code: 72J4.

**Batch number / Barcode:** The affected vehicles were manufactured in 2019.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Croatia, Denmark, Estonia, Finland, Hungary, Ireland, Portugal, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1433/19

**Product:** Pickup truck

**Name:** RAM

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Dodge

**Type / number of model:** Type-approval: individual approval

**Type of alert:** Products with serious risks

Possible defect in the airbags and seatbelt pre-tensioners control unit.

As a result their functioning can be impaired, increasing the risk of injury in the event of an accident.

Recall of the product from end users

**Description:** Pickup truck under Dodge recall code: V61.

**Batch number / Barcode:** The affected vehicles were manufactured between 27 November 2017 and 31 December 2018.

**Country of origin:** United States

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Estonia, Luxembourg, The Netherlands

**Alert number:** A12/1434/19

**Product:** Motorcycle

**Name:** G 310 GS, G 310 R, C 400 GT, C 400 X

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** BMW

**Type / number of model:** Type-approval numbers: e1\*168/2013\*00017, e1\*168/2013\*00052, e1\*168/2013\*00062;; model codes: G 310 GS (K02) - 0G02, 0G12, 0G22, G 310 R (K03) - 0G01, 0G11, 0G21, C 400 GT (K08) - 0C06, 0C16, C 400 X (K09) - 0C09, 0C19

**Type of alert:** Products with serious risks

Surface corrosion could occur within the non-anodised calliper piston bore.

Corrosion on the surface of the calliper could impair the piston's clearance within the bore, affect brake performance and increase the risk of an accident.

Recall of the product from end users

**Description:** Motorcycle under BMW recall code: 00 00 34 82 00.

**Batch number / Barcode:** The affected vehicles were manufactured between 21 April 2016 and 08 August 2019.

**Country of origin:** Brazil, India, Republic of Korea

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Bulgaria, Denmark, Estonia, Finland, Luxembourg, Slovenia, Sweden, The Netherlands



**Alert number:** A12/1435/19

**Product:** Passenger car / Light commercial vehicle

**Name:** Jumpy III

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroën

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0045\*10, e2\*2007/46\*0045\*12, e2\*2007/46\*0045\*15; VIN range: VF7XS9HM0EZ011527 to VF7XT9HM0GZ034460

**Type of alert:** Products with serious risks

The support for the counterweight located beneath the rear floor may crack over time and break.

As a result, the counterweight may become detached from the vehicle and fall off, posing a risk to the following traffic.

Recall of the product from end users

**Description:** Passenger car / Light commercial vehicle under Citroën recall code: GQY.

**Batch number / Barcode:** The affected vehicles were manufactured between 25 February 2014 and 27 June 2016.

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Finland, Poland, Slovakia, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1436/19

**Product:** Passenger car

**Name:** C3 IV

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Citroën

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0003\*56, e2\*2007/46\*0003\*57, e2\*2007/46\*0060\*23; VIN range: VF7SXHMRVKT635888 and VFSXHNPYKT639941

**Type of alert:** Products with serious risks

The airbag control unit may be defective.

As a result, the airbags could fail to inflate in the event of an accident, increasing the risk of an injury to the occupants.

Recall of the product from end users

**Description:** Passenger car under Citroën recall code: GXR.

**Batch number / Barcode:** The affected vehicles were manufactured between 27 June 2019 and 29 June 2019.

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, The Netherlands

**Alert number:** A12/1437/19

**Product:** Passenger car / Light commercial vehicle

**Name:** eXPERT 3

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type / number of model:** E2\*2007/46\*0046\*10, E2\*2007/46\*0046\*12, E2\*2007/46\*0046\*15; VIN range: VF3XS9HM0EZ010829 to VF3XS9HHCHZ000876

**Type of alert:** Products with serious risks

The support for the counterweight located beneath the rear floor may crack over time and break.

As a result, the counterweight may become detached from the vehicle and fall off, posing a risk to the following traffic.

Recall of the product from end users

**Description:** Passenger car / Light commercial vehicle under Peugeot code: JJB.

**Batch number / Barcode:** The affected vehicles were manufactured between 25 February 2014 and 29 June 2016.

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Croatia, Finland, Poland, Slovakia, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1438/19

**Product:** Passenger car

**Name:** Mégane RS

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type / number of model:** Type-approval number: e2\*2007/46\*0546\*08 to \*14

**Type of alert:** Products with serious risks

The oil-pressure solenoid valve may be defective and could malfunction.

This may result in engine failure, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger cars with M5P engine, manufactured at the Palencia plant under Renault recall code: 0D4W.

**Batch number / Barcode:** The affected vehicles were manufactured from the beginning of production until 6 May 2019.

**Country of origin:** Spain

**Alert submitted by:** France

**Products were found and measures were taken also in:** Bulgaria, Croatia, Denmark, Ireland, Poland, Portugal, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1439/19

**Product:** Passenger car

**Name:** Tiguan

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** VW

**Type / number of model:** Type-approval number: e1\*2001/116\*0450\*##; type: 5N

**Type of alert:** Products with serious risks

The locking nut on the park lock bolt in the gearbox may not have been tightened with the necessary torque.

As a result, it could become detached, possibly damaging the gearbox or causing failure of the parking lock, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger cars with 7-speed DSG automatic transmission under VW recall code: 34J3.

**Batch number / Barcode:** The affected vehicles were manufactured between 2 and 5 April 2019.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/1440/19

**Product:** Passenger car

**Name:** GLE

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Type-approval number: e1\*2007/46\*1885\*00; type: H1GLE

**Type of alert:** Products with serious risks

The functioning of the front passenger airbag may be impaired by extreme vehicle interior temperatures (above 85°C).

As a result, there might be a delay in the deployment of the front passenger airbag and/or it might not deploy completely, increasing the risk of injury in the event of an accident.

Recall of the product from end users

**Description:** Passenger car under Mercedes-Benz recall code: 9193001.

**Batch number / Barcode:** The affected vehicles were manufactured between 26 June 2018 and 3 December 2018.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/1441/19

**Product:** Motorcycle tyre

**Name:** Trailmax Meridian

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Dunlop

**Type / number of model:** 170/60 ZR17 M/C 72W, 150/70 ZR18 M/C 70W, 150/70 R17 M/C 69V

**Type of alert:** Products with serious risks

The tyres may be affected by an open tread splice that can lead to a tread bulge or tread detachment affecting the operation of the motorcycle. In case the tread detaches during high-speed operation, the motorcycle could be subject to vibration and the driver may lose control, increasing the risk of an accident.

Recall of the product from end users

**Description:** Dunlop Trailmax Meridian motorcycle tyres.

**Batch number / Barcode:** DOT: DK8C 4K1M, DOT: DK2H 4E1M, DOT: DKLL 4P1M; includes all weeks from 2319 to 3519.

**Country of origin:** France

**Alert submitted by:** Luxembourg



**Alert number:** A12/1392/19

**Product:** Toy slime

**Name:** Magical Unicorn Poop Pink Purple Blue Swirl Slime

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** X001PF8VUB, 083176106844

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high (measured value up to 4030 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Removal of this product listing by AmazonSales ban, Withdrawal of the product from the market

**Description:** Toy slime in a swirled plastic container with a happy face on it, 2 Pack. The product was sold online, in particular via Amazon.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Denmark



**Alert number:** A12/1394/19

**Product:** Toy gun set

**Name:** Micro Punch

**Risk type:** Choking

**Category:** Toys

**Brand:** Yang Kai

**Type / number of model:** N° M05+; BBRO1344

**Type of alert:** Products with serious risks

The suction cups of the projectiles can easily detach.

If a child puts the projectile in the mouth, the suction cup could detach and obstruct the airways.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Plastic water bullet gun supplied with foam projectiles with suction cups. Packaged in plastic blister with cardboard back.

**Batch number / Barcode:** 5902719701344

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/1395/19

**Product:** Toy robot

**Name:** Naughty / Tanczacy robot

**Risk type:** Environment

**Category:** Toys

**Brand:** ARTYK

**Type / number of model:** ART-99444-2

**Type of alert:** Products with serious risks

Four solders in the toy contain an excessive amount of lead and cadmium (measured values up to 68.9% and 0.29% by weight respectively).

Lead and cadmium pose a risk to the environment.

The product does not comply with the requirements of the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Withdrawal of the product from the market

**Description:** Plastic, battery-powered toy robot. Packaging: cardboard box

**Batch number / Barcode:** 5901811103810

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/1400/19

**Product:** Toy car

**Name:** Samochod

**Risk type:** Choking, Cuts, Suffocation

**Category:** Toys

**Brand:** Happy Star

**Type / number of model:** NO. MPB25529

**Type of alert:** Products with serious risks

Small parts (wheel, cord holder) may be easily detached from the toy. Sharp element (metal axle) is easily accessible. The cross-section of cord attached to the toy is inadequate and the plastic bag of the packaging is too thin.

As a consequence, a child may put the small part in the mouth and choke on it and the sharp elements may cause cuts. If a child plays with the packaging, the plastic can cover the mouth and nose, causing the child to suffocate.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Withdrawal of the product from the market

**Description:** Plastic toy car, packaging: foil bag.

**Batch number / Barcode:** 5900368255294

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/1402/19

**Product:** Soft toy

**Name:** Unknown

**Risk type:** Choking

**Category:** Toys

**Brand:** SUN-DAY A.S. Academy of Plush

**Type / number of model:** M3449

**Type of alert:** Products with serious risks

Small parts (plastic eyes) may be easily detached from the toy.

A child may put the small part in the mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Plush teddy bear. No packaging, label attached to the toy.

**Batch number / Barcode:** 5904073149862

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/1403/19

**Product:** Squeezable toy

**Name:** Zabawka gniotek

**Risk type:** Choking

**Category:** Toys

**Brand:** GAZELO Toys

**Type / number of model:** Z1676-Z1676-2362

**Type of alert:** Products with serious risks

Small parts (knots) may be easily detached from the toy.

A child may put the small part in the mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Squeezable toy packaged in foil bag.

**Batch number / Barcode:** 5907773940609

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/1404/19

**Product:** Push-along toy

**Name:** Rekin

**Risk type:** Damage to hearing, Suffocation

**Category:** Toys

**Brand:** Tasso

**Type / number of model:** 986-39

**Type of alert:** Products with serious risks

The sound level produced by the toy is too high. The plastic bag of the packaging is too thin.

The sound level could lead to permanent or partial hearing loss. If a child plays with the packaging, the plastic can cover the mouth and nose, causing the child to suffocate.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Plastic shark-shaped push-along toy, packed in a transparent plastic bag.

**Batch number / Barcode:** 5901002004957

**Country of origin:** China

**Alert submitted by:** Poland





**Alert number:** A12/1411/19

**Product:** Plastic doll with accessories

**Name:** Shine Fashion Girl

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** BLAL8273 (on attached label) N0.ZR-563 (on packaging)

**Type of alert:** Products with serious risks

The plastic material of the vacuum cleaner contains an excessive amount of bis (2-ethylhexyl) phthalate (DEHP) and di-butyl phthalate (DBP) (measured values: 13 and 11 % by weight, respectively).

These phthalates may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll in a green fabric dress with household accessories, packed in a cardboard box with plastic window.

**Batch number / Barcode:** 5902719728273

**Country of origin:** China

**Alert submitted by:** Poland



**Alert number:** A12/1414/19

**Product:** Plastic doll

**Name:** Happy day

**Risk type:** Chemical

**Category:** Toys

**Brand:** HENGFA

**Type / number of model:** N0:798

**Type of alert:** Products with serious risks

The doll's head contains an excessive amount of di-(2-ethylhexyl) phthalate (DEHP) (measured value: 24 % by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Destruction of the product, Import rejected at border

**Description:** Mermaid doll in different colours. Packaging: foil bag.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1415/19

**Product:** Soft-filled toys with sequins.

**Name:** Shimmeez

**Risk type:** Choking

**Category:** Toys

**Brand:** Sambro International / Van Cranenbroek

**Type / number of model:** Shimmeez

**Type of alert:** Products with serious risks

Small parts (sequins) can easily be detached from the soft toy.

A small child could put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Ban on the marketing of the product and any accompanying measures, Withdrawal of the product from the market

**Description:** Soft-filled toys covered with sequins.

**Batch number / Barcode:** 603154010002 / 5166-052018

**Country of origin:** China

**Alert submitted by:** The Netherlands

**Products were found and measures were taken also in:** Slovenia



**Alert number:** A12/1416/19

**Product:** Toy gun set

**Name:** Shoot gun

**Risk type:** Choking, Damage to sight

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** N0.771

**Type of alert:** Products with serious risks

The suction cups can easily detach from the projectiles.

If a child puts the projectile in the mouth, the suction cups may detach and obstruct the airways. The kinetic energy of the projectiles fired from the toy gun is too high and can lead to eye injuries.

The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.

Import rejected at border

**Description:** Plastic toy gun set including two 2 black and brown rifles, 2 police badges and 5 projectiles with suction cups. Packaging: blister.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1417/19

**Product:** Plastic doll

**Name:** Unknown

**Risk type:** Chemical

**Category:** Toys

**Brand:** Amiable girls

**Type / number of model:** N0.G232

**Type of alert:** Products with serious risks

The doll contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 3.4% by weight) and dibutyl phthalate (DBP) (measured value: 0.36% by weight).

These phthalates may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Destruction of the product, Import rejected at border

**Description:** Plastic dolls, 10 cm tall, in different colours. Packaging: box with butterfly wings.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1418/19

**Product:** Plastic doll

**Name:** WORLD HAPPY

**Risk type:** Chemical

**Category:** Toys

**Brand:** Cute Beaut

**Type / number of model:** N0.7123

**Type of alert:** Products with serious risks

The doll's head contains an excessive amount of di-(2-ethylhexyl) phthalate (DEHP)(measured value: 36% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Destruction of the product, Import rejected at border

**Description:** Plastic dolls, 15 cm tall, in different colours. Packaging: individually cardboard boxes with transparent window. It is offered for sale from collective cardboard box containing 12 dolls.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1419/19

**Product:** Wooden train

**Name:** Unknown

**Risk type:** Choking

**Category:** Toys

**Brand:** LEGLER

**Type / number of model:** 7460 to 7487

**Type of alert:** Products with serious risks

Small parts (the red wheels and the metal links between the carriages) can easily become detached from the toy.

A child may put a small part into the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Wooden train made up of letters with red wheels and metal hooks between the carriages. Sold loose without packaging.

**Batch number / Barcode:** 4020972074799

**Country of origin:** Germany

**Alert submitted by:** France



**Alert number:** A12/1420/19

**Product:** Drawing kit

**Name:** Animals Prints collection Angels Navarro

**Risk type:** Chemical

**Category:** Toys

**Brand:** APLI kids

**Type / number of model:** 14835

**Type of alert:** Products with serious risks

There is an excessive migration of copper from the blue ink pad (measured value: 2372 mg/kg).

Exposure to excessive levels of copper can induce nausea, vomiting and/or abdominal pain and kidney and liver damage.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Kit containing 4 ink pads (red, orange, blue and green) and 6 coloured pencils for drawing finger print animals. The product was (also) sold online.

**Batch number / Barcode:** 8410782148357

**Country of origin:** Spain

**Alert submitted by:** France



**Alert number:** A12/1421/19

**Product:** Toy car

**Name:** 4x4 CRAZE

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Item n°: DY082439

**Type of alert:** Products with serious risks

The battery compartment can be easily opened without the use of any tools leaving button cell batteries accessible.

A child may put these in the mouth, which could cause damage to the child's gastrointestinal tract.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115.

Withdrawal of the product from the market/Recall of the product from end users

**Description:** Toy car in a cardboard box having a transparent plastic window.

**Batch number / Barcode:** Batch n°: 08/2018

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/1422/19

**Product:** Plastic doll with accessories

**Name:** Bath Tub

**Risk type:** Chemical

**Category:** Toys

**Brand:** 669TOYS

**Type / number of model:** Sweet Home, SWEET BABIES Item numbers without check mark: N. 669-552 A,A1,A2; N. 669-522D

**Type of alert:** Products with serious risks

The plastic material of the body of the dolls contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 16.1% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.


Withdrawal of the product from the market

**Description:** Doll in bathtub with shower, hair dryer, baby bottle, comb and toy; 3+, packed in a transparent plastic bag.

**Batch number / Barcode:** 8596361800004, Q636T2H84K76

**Country of origin:** China

**Alert submitted by:** Czech Republic

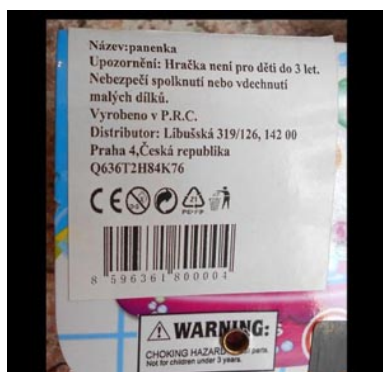

**Alert number:** A12/1423/19

**Product:** Plastic doll

**Name:** Сказочный патруль (Fairytale Patrol)

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** NO.XL009

**Type of alert:** Products with serious risks

The plastic material of the head of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 14% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll - name only in Russian language "Сказочный патруль" - high 24cm - different colored hair and dress, CE, 3+, without a label.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Czech Republic





**Alert number:** A12/1424/19

**Product:** Plastic doll

**Name:** L.O.L. SUPRISE! FASHION STYLE

**Risk type:** Chemical

**Category:** Toys

**Brand:** L.O.L. SUPRISE!

**Type / number of model:** No.1833

**Type of alert:** Products with serious risks

The plastic material of the head of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 14.6% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

**Description:** Plastic doll, high 11cm - different colored hair and dress, CE, 3+.

**Batch number / Barcode:** 5421880684138

**THE PRODUCT IS OR MAY BE COUNTERFEIT**

**Country of origin:** China

**Alert submitted by:** Czech Republic

**Products were found and measures were taken also in:** Romania



**Alert number:** A12/1425/19

**Product:** Plastic doll

**Name:** Lovely

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** No.1892 (HC176328 on the label)

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains 2-ethylhexyl phthalate (DEHP) (measured value: 34% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.


Recall of the product from end users, Withdrawal of the product from the market

**Description:** Blue-haired plastic doll wearing a blue and gold dress with a pink flower-shaped hair brush. Packaging: blister.

**Batch number / Barcode:** 5999057760324

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1426/19

**Product:** Plastic doll

**Name:** Beautiful; Fashion Girl

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** No.5834

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains 2-ethylhexyl phthalate (DEHP) (measured value: 34% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Destruction of the product, Import rejected at border

**Description:** Plastic dolls in different colours. Inscription on the packaging: Beautiful This is my fashion. Packaging: cardboard box with transparent window.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1427/19

**Product:** Plastic doll

**Name:** Fashion

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** No.8122

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains 2-ethylhexyl phthalate (DEHP) (measured value: 36% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Destruction of the product, Import rejected at border

**Description:** Plastic dolls in different dresses. Packaging: cardboard box with transparent window.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1428/19

**Product:** Plastic doll with accessories

**Name:** Beautiful princess

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

The plastic material of the doll's head contains 2-ethylhexyl phthalate (DEHP) (measured value: 13% by weight).

This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Destruction of the product, Import rejected at border

**Description:** Plastic mermaids in different colours with a brush. Inscription on the packaging: Let's Play Together. Packaging: cardboard box with transparent window.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1401/19

**Product:** Children's clothing set

**Name:** Unknown

**Risk type:** Injuries

**Category:** Clothing, textiles and fashion items

**Brand:** Supergirl

**Type / number of model:** HGLJT 8747

**Type of alert:** Products with serious risks

The product has drawstrings with free ends in the neck area.

The drawstrings can become trapped during activities of the child and cause injuries.

The product does not comply with the applicable European Standard EN 14682.

Withdrawal of the product from the market

**Description:** Girls suit, size 92-122, made from two pieces: yellow sleeveless blouse, printed with flowers and butterflies, bearing shoulder straps and white pants with flowers.

**Batch number / Barcode:** 5999032787476

**Country of origin:** Unknown

**Alert submitted by:** Romania



**Alert number:** A12/1407/19

**Product:** Primer Spray

**Name:** Primer Water

**Risk type:** Microbiological

**Category:** Cosmetics

**Brand:** PS... Prep & Perfect

**Type / number of model:** Coconut

**Type of alert:** Products with serious risks

The product contains an excessive amount of aerobic mesophilic bacteria (measured value: 310 000 cfu/g) among which presumably Pseudomonas.

If used on damaged skin or by immunocompromised users, or if it comes into contact with the eyes or mucous membrane, the product may cause infection or irritation.

The product does not comply with the Cosmetic Products Regulation.

Recall of the product from end users

**Description:** Plastic spray bottle containing 150 ml of PS... Prep & Perfect Coconut Primer Water

**Batch number / Barcode:** Batch number: UR0010119; UR0020119; UR0030619; UR0040619; UR0050719; UR0060719; UR0070719

**Country of origin:** Turkey

**Alert submitted by:** Ireland

**Products were found and measures were taken also in:** France



**Alert number:** A12/1408/19

**Product:** Primer spray

**Name:** Primer Spray

**Risk type:** Microbiological

**Category:** Cosmetics

**Brand:** PS... Prep & Perfect

**Type / number of model:** Watermelon

**Type of alert:** Products with serious risks

The product contains an excessive amount of aerobic mesophilic bacteria (measured values up to: 380 000 cfu/g) among which presumably Pseudomonas.

If used on damaged skin or by immunocompromised users, or if it comes into contact with the eyes or mucous membrane, the product may cause infection or irritation.

The product does not comply with the Cosmetic Products Regulation.

Recall of the product from end users

**Description:** Plastic spray bottle containing 150 ml of PS... Prep & Perfect Watermelon Primer Water.

**Batch number / Barcode:** Batch number: UR0010119, UR0030419, UR0040519, UR0050619

**Country of origin:** Turkey

**Alert submitted by:** Ireland

**Products were found and measures were taken also in:** France, Portugal





**Alert number:** A12/1409/19

**Product:** Primer Spray

**Name:** Primer Water

**Risk type:** Microbiological

**Category:** Cosmetics

**Brand:** PS... Prep & Perfect

**Type / number of model:** Charcoal

**Type of alert:** Products with serious risks

The product contains an excessive amount of aerobic mesophilic bacteria (measured values up to: 160 000 cfu/g) among which presumably Enterobacteriaceae and Pseudomonas.

If used on damaged skin or by immunocompromised users, or if it comes into contact with the eyes or mucous membrane, the product may cause infection or irritation.

The product does not comply with the Cosmetic Products Regulation.

Recall of the product from end users

**Description:** Plastic spray bottle containing 150 ml of PS... Prep & Perfect Charcoal Primer Water.

**Batch number / Barcode:** Batch number: UR0010119; UR0020119; UR0030119; UR0040219

**Country of origin:** Turkey

**Alert submitted by:** Ireland

**Products were found and measures were taken also in:** France, Portugal



**Alert number:** A12/1398/19

**Product:** Hand mixer

**Name:** ručni mikser

**Risk type:** Burns, Fire

**Category:** Electrical appliances and equipment

**Brand:** home

**Type / number of model:** KMX-3605-KH

**Type of alert:** Products with serious risks

Thermoplastic insulating parts of the product are not sufficiently resistant to heat.

The product could consequently catch fire.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Hand mixer packed in a white cardboard box. the products were (also) sold online.

**Batch number / Barcode:** 3850334308344

**Country of origin:** China

**Alert submitted by:** Croatia



**Alert number:** A12/1412/19

**Product:** Electrical oven

**Name:** Electrical round oven

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** elit

**Type / number of model:** elit 1100

**Type of alert:** Products with serious risks

Internal wirings can become damaged due to sharp edges.

As result, metal parts of the product can become live and user may receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60335.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Electrical oven packed in cardboard box. The product was (also) sold online.

**Batch number / Barcode:** 3871250007609

**Country of origin:** Turkey

**Alert submitted by:** Croatia

**Products were found and measures were taken also in:** Slovenia



**Alert number:** A12/1413/19

**Product:** LED Rechargeable spotlight

**Name:** Rechargeable 150mm Luminator Lamp

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Gowen and Bradshaw

**Type / number of model:** NFC140LI-15W 150mm 229YL 1200 Lumens

**Type of alert:** Products with serious risks

The accessible assembly screw of the mains charger is in direct contact with a live wire from the mains.

Consequently the user could touch the accessible screw and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 62368-1.

Recall of the product from end users

**Company recall page:** <http://gowbrad.ie/> (<http://gowbrad.ie/>)

**Description:** Rechargeable spotlight with mains and car chargers. The product was also sold online.

**Batch number / Barcode:** 2100000027859

**Country of origin:** China

**Alert submitted by:** Ireland

**Products were found and measures were taken also in:** United Kingdom



**Alert number:** INFO/0102/19

**Product:** Laser pointer

**Name:** Unknown

**Risk type:** Damage to sight

**Category:** Laser pointers

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with other risk levels

The product lacks the required labelling, including appropriate warning texts related to the use of the product and the classification.

Direct viewing of the laser beam or its mirror reflection may cause damage to the sight.

The product does not comply with the relevant European standard EN 60825-1.

Withdrawal of the product from the market

**Description:** A black pen-shaped laser pointer, 16,5 cm long with 4 and 12 tips emitting light with various figures, 2 batteries.

**Batch number / Barcode:** 892018730509

**Country of origin:** China

**Alert submitted by:** Bulgaria



**Alert number:** INFO/0106/19

**Product:** Step ladder

**Name:** ALUMIXTE 4504

**Risk type:** Injuries

**Category:** Other

**Brand:** ESCALUX

**Type / number of model:** ESCALUX ALUMIXTE 4504

**Type of alert:** Products with other risk levels

The plastic ladder feet can detached.

As a consequence, the user can lose balance and fall.

The product does not comply with the relevant European Standard EN 131.

Recall of the product from end users

**Description:** Step ladder wrapped in plastic.

**Batch number / Barcode:** 3524480281409, Year of production 2018

**Country of origin:** France

**Alert submitted by:** Slovenia



**Alert number:** INFO/0103/19

**Product:** Toy slime

**Name:** AbbyRose 12 Pack Slime Putty Party Favors AbbyRos

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with other risk levels

The migration of boron from the toy slime is too high (measured value up to 4370 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Removal of the product listing by AmazonSales ban, Withdrawal of the product from the market

**Description:** Fluorescent toy slime. The product was sold online, in particular via Amazon.

**Batch number / Barcode:** 97138611116

**Country of origin:** Unknown

**Alert submitted by:** Denmark



**Alert number:** INFO/0104/19

**Product:** Toy slime

**Name:** Fluffy Floam Slime

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with other risk levels

The migration of boron from the toy slime is too high (measured value up to 856 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Removal of the product listing by eBaySales ban, Withdrawal of the product from the market

**Description:** Slime toy in five different colours, scented. the product was sold online, in particular via eBay.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Denmark



**Alert number:** INFO/0105/19

**Product:** Toy slime

**Name:** Colorful Exquisite Fishbowl

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with other risk levels

The migration of boron from the toy slime is too high (measured value up to 1180 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Removal of the products from the Aliexpress platform Sales ban, Withdrawal of the product from the market

**Description:** 60ml Colourful Exquisite fishbowl beads mermaid Slime crystal mud cotton clay Plasticene DIY decompression Modeling toys. The product was sold online.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Denmark

