



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

Week 47 - 2019

Notification A12/1696/19 published on weekly report 2019-46 on 15/11/2019 has been modified following national authority request to indicate that the product is counterfeit.

**Alert number:** A12/1739/19

**Product:** Lighter

**Name:** Colour lighters

**Risk type:** Burns

**Category:** Lighters

**Brand:** Ktwo

**Type / number of model:** CB5022441140065

**Type of alert:** Products with serious risks

The flame extinction time is too long.

The user could suffer burns.

The product does not comply with the relevant European standard EN 9994.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Lighter sold individually without packaging, with label and glued-on bar code.

**Batch number / Barcode:** 5022441140065

**Country of origin:** Unknown

**Alert submitted by:** France



**Alert number:** A12/1735/19

**Product:** Ceiling light

**Name:** Crystal Ceiling Light

**Risk type:** Electric shock

**Category:** Lighting equipment

**Brand:** Paths

**Type / number of model:** B27/2 LED Driver model number 4-7W

**Type of alert:** Products with serious risks

The internal build and the fuse are inadequate, causing the product to break down.

The product may consequently become live, leading to an electric shock if touched by user.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standards EN 60598-1 and EN 61347-1.

Destruction of the product

**Description:** LED ceiling light with metal plate fitting and hanging crystal decorations.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** United Kingdom



**Alert number:** A12/1720/19

**Product:** Pickup truck

**Name:** RAM

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Dodge

**Type / number of model:** Type-approval number: individual approval

**Type of alert:** Products with serious risks

Possible defect in the airbag control software.

As a result, the side airbags may not deploy in the event of an accident, increasing the risk of injury.

Recall of the product from end users

**Description:** Pickup truck under Dodge recall code: U53.

**Batch number / Barcode:** The affected vehicles were manufactured between 8 June 2012 and 12 May 2018.

**Country of origin:** United States

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/1721/19

**Product:** Passenger car

**Name:** 3, CX-30

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mazda

**Type / number of model:** Model codes: BP; DM

**Type of alert:** Products with serious risks

On certain subject vehicles, it is possible that the powertrain control module (PCM) provides an inappropriate air/fuel ratio causing a lean condition.

This may cause the engine to stall in motion, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger car under Mazda recall code: AK055A.

**Batch number / Barcode:** The affected vehicles were manufactured between 14 June and 1 October 2019 (Mazda 3 BP) and between 9 July and 1 October 2019 (Mazda CX-30 DM).

**Country of origin:** Japan

**Alert submitted by:** Romania

**Products were found and measures were taken also in:** Estonia, Germany, Iceland, Poland, Portugal, Slovenia, Sweden

**Alert number:** A12/1723/19

**Product:** Truck/livestock transporter

**Name:** KA-BA

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Fiege

**Type / number of model:** Individual approval

**Type of alert:** Products with serious risks

The roof panel may become detached from the vehicle because of cracks in the roof-panel supports.

It may then fall into the vehicle interior and could endanger those inside.

Recall of the product from end users

**Description:** Truck/livestock transporter

**Batch number / Barcode:** The vehicles affected were produced between January 2007 and December 2014. Recall code: Hubdachstützen [roof-panel supports]

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/1725/19

**Product:** All-Terrain vehicle

**Name:** Ranger XP 1000

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Polaris

**Type / number of model:** Model 2018-2020

**Type of alert:** Products with serious risks

The fuel line is not sufficiently protected.

If the drive belt breaks or fails during operation, the fuel line could become damaged. Consequently, fuel may leak, increasing the risk of fire.

Recall of the product from end users

**Description:** All-terrain vehicle.

**Batch number / Barcode:** The affected vehicles were manufactured between 7 September 2017 and 10 September 2019.

**Country of origin:** Poland

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Finland, Sweden

**Alert number:** A12/1727/19

**Product:** Three-wheel motorcycle

**Name:** Slingshot S / SL / SLR / GT

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Polaris

**Type / number of model:** Model year 2015 and 2019

**Type of alert:** Products with serious risks

Under certain conditions, the capability of the battery fuse block terminals might be exceeded by the actual electrical current requirements.

Consequently, the terminal could be damaged leading to a loss of forward and rear lighting, instrument cluster or power steering assist, increasing the risk of accident.

Recall of the product from end users

**Description:** Three-wheel motorcycle.

**Batch number / Barcode:** The affected vehicles were manufactured between 15/05/2014 and 25/04/2016.

**Country of origin:** United States

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Sweden

**Alert number:** A12/1729/19

**Product:** Passenger car

**Name:** Kangoo

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** RENAULT

**Type / number of model:** e2\*2007/46\*0006\*41 Stop & Start versions equipped with K9K628/648 H5Ft408 engines

**Type of alert:** Products with serious risks

The "Stop & Start" function might not properly work.

Consequently, the engine might inadvertently remain running while the vehicle is stationary, increasing the risk of accidents.

Recall of the product from end users

**Description:** Passenger car under Renault recall code: 0D3M.

**Batch number / Barcode:** The affected vehicles were manufactured at the Maubeuge plant between 5 December 2018 and 19 February 2019.

**Country of origin:** France

**Alert submitted by:** France

**Products were found and measures were taken also in:** Croatia, Finland, Germany, Iceland, Poland, Portugal, Slovenia, Sweden, The Netherlands

**Alert number:** A12/1749/19

**Product:** Lorry

**Name:** Actros, Antos, Arocs, Atego, Econic

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Models: 963-0-A, 963-4-A, 963-2-A, 963-0-B, 963-2-B, 963-0-C, 963-0-D, 963-7-E, 963-2-E, 963-8-H, 967PKX2, 967PKX3, 967KMU3, 967FWU2, 967FWU3, NGE-L62N, NGE-L42, NGE-L62V, 967PKX4-T, 967PKX4, 967PKX3-T, 967PKX2-T, Type-approval numbers: : e1\*2007/46\*0726, \*0727, \*0728, \*0729, \*0731, \*0732, \*0735, \*0736, \*0738, \*0743, \*1170, \*1171, \*1174, \*1175, \*1176, \*1222, \*1223, \*1234, \*1553, \*1641, \*1650, \*1651

**Type of alert:** Products with serious risks

The high pressure line is possibly fitted defectively.

Fuel could leak leading to the risk of fire.

Recall of the product from end users

**Description:** Lorry

**Batch number / Barcode:** The vehicles in question were manufactured between 31/07/2019 and 11/09/2019. Recall code: HUELSE-LTG

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/1750/19

**Product:** Passenger car

**Name:** Fabia, Karoq, Kodiaq, Octavia, Rapid, Superb

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Skoda

**Type / number of model:** Type-approval numbers: e11\*2001/116\*0291, \*0326 e8\*2007/46\*0319, \*0320, \*0249, e11\*2007/46\*0250, \*0243, \*0317, \*0318; types: 5J, NH, 5E, 3T, 2CM, NS, NH

**Type of alert:** Products with serious risks

Possible defect in the driver's airbag housing.

As a result, the airbag may not deploy properly in the event of an accident, increasing the risk of an injury.

Recall of the product from end users

**Description:** Passenger car under Skoda recall code: 69Y9.

**Batch number / Barcode:** The vehicles affected were manufactured between January and August 2018.

**Country of origin:** Czech Republic

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Estonia, Finland, Iceland, Ireland, Slovenia, Sweden

**Alert number:** A12/1751/19

**Product:** Passenger car

**Name:** Cherokee

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Jeep

**Type / number of model:** Type-approval number: e4\*2007/46\*0783\*11; type: KL

**Type of alert:** Products with serious risks

The airbag control device may lose its connection to the connected accelerometers.

This could reduce the effectiveness of the airbag system, leading to delayed airbag deployment or airbag failure.

Recall of the product from end users

**Description:** Passenger car under Jeep recall code: V63.

**Batch number / Barcode:** The affected vehicles were manufactured between 28 July 2018 and 20 September 2018.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Croatia, Poland, Slovenia

**Alert number:** A12/1752/19

**Product:** Passenger van / Light commercial vehicle

**Name:** Vito

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Type-approval numbers: e1\*2007/46\*0458\*08-17, e1\*2007/46\*0459\*06-11, e1\*2007/46\*0457\*09-22; types: 639/4, 639/5, 639/2

**Type of alert:** Products with serious risks

The coverings on the seat boxes with an integrated back-up battery may be missing.

This will increase the risk of a short circuit or fire in case objects made of electroconductive (e.g. metal) materials are placed in the seat boxes.

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle under Mercedes-Benz recall code: VS2SITZAB (9190165).

**Batch number / Barcode:** The affected vehicles were manufactured between June 2014 and 2 September 2019.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/1753/19

**Product:** Passenger car

**Name:** E-class

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Type-approval number: e1\*2007/46\*1560\*02-09; type: R1ES; T-model; model series BR 213

**Type of alert:** Products with serious risks

The rear spoiler might not have been attached in accordance with requirements.

As a result, the rear spoiler could become completely detached from the vehicle at high speeds, posing a risk to the following traffic.

Recall of the product from end users

**Description:** Passenger car under Mercedes-Benz recall code: 7792001.

**Batch number / Barcode:** The affected vehicles were manufactured between 29 September 2016 and 23 May 2019.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Finland, Iceland, Ireland, Poland

**Alert number:** A12/1754/19

**Product:** Passenger van / Light commercial vehicle

**Name:** Sprinter

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** Type-approval numbers: e1\*2007/46\*1761\*00 - \*01, e1\*2007/46\*1763\*00 - \*01; types: FL3A4, FL3A5

**Type of alert:** Products with serious risks

The leaf springs on the rear axle may have not been fitted in accordance with the specifications.

This will impair the driving stability, increasing the risk of an accident.

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle under Mercedes-Benz recall code: VS3ZUGFED (3291092).

**Batch number / Barcode:** The affected vehicles were manufactured between 19 September 2018 and 20 August 2019.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/1737/19

**Product:** Work gloves

**Name:** Unknown

**Risk type:** Chemical

**Category:** Protective equipment

**Brand:** DEXTER

**Type / number of model:** 930528- taille 10

**Type of alert:** Products with serious risks

The leather of the gloves contains an excessive amount of chromium VI (measured value: 38.9 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions.

The product does not comply with the Personal Protective Equipment Regulation and the REACH Regulation.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Waterproof grain yellow bovine-leather gloves for DIY – the pair of gloves is attached to a cardboard backing.

**Batch number / Barcode:** 3276009965115

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/1728/19

**Product:** Travel cot

**Name:** LÓZECZKO TURYSTYCZNE

**Risk type:** Suffocation

**Category:** Childcare articles and children's equipment

**Brand:** CARETERO

**Type / number of model:** Simple

**Type of alert:** Products with serious risks

The foldable mattress of the bed folds too easily and a small child could pull the mattress up and get its head trapped between the mattress and the base of the cot, leading to suffocation.

Moreover a small child may introduce its head in the outside pocket of the cot, that poses a risk of suffocation.

The product does not comply with the relevant European standard EN 716.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Folding cot with metal frame, dark blue fabric and mesh, this can open with a semicircle zipper at one end. There is a pocket on the other end of the cot. Packaging: blue textile carrying bag and cardboard box.

**Batch number / Barcode:** 5902021521609

**Country of origin:** China

**Alert submitted by:** Hungary

**Products were found and measures were taken also in:** Estonia



**Alert number:** A12/1738/19

**Product:** Eraser shaped like a pink macaroon

**Name:** Unknown

**Risk type:** Choking

**Category:** Stationery

**Brand:** IWAKO

**Type / number of model:** Unknown

**Type of alert:** Products with serious risks

Due to its characteristic form, colour, appearance and size, the product may be mistaken for foodstuff.

This may lead children to put it in the mouth. Small parts may be bitten off or detach, which could lead to choking.

The product does not comply with the requirements of the Food Imitating Products Directive nor with the relevant European Standard EN 71-1 .

Recall of the product from end users, Withdrawal of the product from the market

**Description:** IWAKO puzzle eraser looking like foodstuff

**Batch number / Barcode:** 0096455440001, 0096455440002, 0096455440003

**Country of origin:** United Kingdom

**Alert submitted by:** France



**Alert number:** A12/1719/19

**Product:** Soft-filled toys

**Name:** Unknown

**Risk type:** Choking

**Category:** Toys

**Brand:** ALL NEW MATERIALS

**Type / number of model:** WCH6829-8

**Type of alert:** Products with serious risks

A small part (the nose) can easily be detached from the toy.

A small child may put it in the mouth and choke on it.

The toy does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

Withdrawal of the product from the market

**Description:** Soft-filled toy in the shape of a bear wearing a blue shirt.

**Batch number / Barcode:** 6906510856707

**Country of origin:** China

**Alert submitted by:** Cyprus





**Alert number:** A12/1722/19

**Product:** Toy slime

**Name:** Red slime big can

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** ZRJ81120104D

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high (measured value up to 1021 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Withdrawal of the product from the market

**Description:** Red slime decorated with black dots in a see-through plastic container with a fishing bear on the label. The product was sold online (in particular via Aliexpress).

**Batch number / Barcode:** 190427190042465000

**Country of origin:** China

**Alert submitted by:** Sweden



**Alert number:** A12/1724/19

**Product:** Plastic doll with accessories

**Name:** 8Pcs LoL Surprise

**Risk type:** Chemical, Environment

**Category:** Toys

**Brand:** LOL Surprise

**Type / number of model:** 1100715 (1266308)

**Type of alert:** Products with serious risks

The plastic material of the dolls contains 2-ethylhexyl phthalate (DEHP) (measured value up to 12.42% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The plastic dolls contain short chain chlorinated paraffins (SCCPs) (measured value up to 2.01%).

SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment.

The product does not comply with the REACH Regulation and with the Regulation on persistent organic pollutants (POP Regulation).

Withdrawal of the product from the market

**Description:** 8 small plastic collector dolls with various accessories. The product was sold online.

**Batch number / Barcode:** PU62454

**THE PRODUCT IS COUNTERFEIT**

**Country of origin:** China

**Alert submitted by:** Sweden



**Alert number:** A12/1731/19

**Product:** Toy scooter

**Name:** SCOOTER

**Risk type:** Injuries

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** WX-T9513

**Type of alert:** Products with serious risks

The front wheel is too small and could get stuck in holes in the ground and the steering tube is not sufficiently stable.

This could cause the child to lose balance and fall off, leading to injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Foldable, three-wheeled, metal framed scooter. The transparent wheels are equipped with LED lights which emit red-green light, when rotating rapidly. The product is available in blue and pink colour. Packaging: cardboard box

**Batch number / Barcode:** 5998083593685

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1733/19

**Product:** Soft-filled toy

**Name:** FLIPPABLES

**Risk type:** Choking, Health risk / other

**Category:** Toys

**Brand:** TY

**Type / number of model:** TY36263 (0918/17179)

**Type of alert:** Products with serious risks

The sequins can easily detach from the toy, generating small parts.

A child may put small part into the mouth, where it may block the airways, or may inhale it, leading to infection in the lungs.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market


**Description:** Soft toy dinosaur covered with sequins. No packaging.

**Batch number / Barcode:** 008421362639

**Country of origin:** United States

**Alert submitted by:** Lithuania

**Products were found and measures were taken also in:** Slovenia

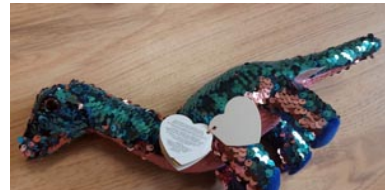

**Alert number:** A12/1734/19

**Product:** Baby teether set

**Name:** Baby Teethers

**Risk type:** Choking

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** N° BM3340-2

**Type of alert:** Products with serious risks

Small parts can easily detach from the teethers.

A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Set of baby teethers/rattles in different shapes in a cardboard box.

**Batch number / Barcode:** 5995858137440

**Country of origin:** China

**Alert submitted by:** Lithuania



**Alert number:** A12/1740/19

**Product:** Plastic doll with accessories

**Name:** Il Castello Di Martina

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Art. N°: 40210, No 2116-13

**Type of alert:** Products with serious risks

The plastic material of the doll and the shoes contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), di-'isononyl' phthalate (DINP) and dibutyl phthalate (DBP) (measured values: 21.4%, 1.2% and 1.2 % by weight, respectively).

This phthalate may harm the health of children, causing possible damage to the reproductive system and the liver.

The product does not comply with the REACH Regulation.

Recall of the product from end users

**Description:** Plastic doll with accessories, packaging: blister with cardboard back.

**Batch number / Barcode:** GTF00915112017, EAN 8022645402102

**Country of origin:** China

**Alert submitted by:** Slovenia



**Alert number:** A12/1743/19

**Product:** Rattle toy

**Name:** Játék csörgő

**Risk type:** Choking, Injuries

**Category:** Toys

**Brand:** BF

**Type / number of model:** Item NO: 1401087

**Type of alert:** Products with serious risks

The product can easily break, releasing small parts.

A child may put the small parts in the mouth and choke. The sharp endings of the broken toy may cause injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Plastic blue and white rattle toy. The two ends of the toy are enclosed by pink plastic lattices with 1-1 green rattle ball in them. The product is sold without packaging.

**Batch number / Barcode:** 8000014010875

**Country of origin:** China

**Alert submitted by:** Hungary

**Products were found and measures were taken also in:** Romania



**Alert number:** A12/1744/19

**Product:** Rattle toy

**Name:** Rattle

**Risk type:** Choking

**Category:** Toys

**Brand:** babyono

**Type / number of model:** Cat. N0 673

**Type of alert:** Products with serious risks

The product can easily break, releasing small parts.

A child may put the small parts in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Two flower-shaped rattles containing coloured balls. The two flowers are connected by a coloured, rotatable plastic element. Packaging in a blister.

**Batch number / Barcode:** 5904341205382

**Country of origin:** Poland

**Alert submitted by:** Hungary



**Alert number:** A12/1745/19

**Product:** Rattle toy set

**Name:** BABY Rattle

**Risk type:** Choking

**Category:** Toys

**Brand:** Weixingda

**Type / number of model:** N0.999

**Type of alert:** Products with serious risks

The product can easily break, releasing small parts.

A child may put the small parts in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Set of six plastic rattles, three teething and a horn. Packaging in a plastic bag with cardboard closing.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1746/19

**Product:** Mobile phone toy

**Name:** KidPhone projection

**Risk type:** Damage to hearing

**Category:** Toys

**Brand:** CYD

**Type / number of model:** NO.134B

**Type of alert:** Products with serious risks

The sound level of the toy is too high.

It could cause damage to hearing.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** White and blue plastic toy in the shape of a mobile phone with sound and light effects and with projector function, powered by 3xAAA batteries. Packaging in a cardboard box with transparent front.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/1747/19  
**Product:** Mobile phone toy  
**Name:** MUSIC PHONE  
**Risk type:** Damage to hearing  
**Category:** Toys  
**Brand:** Abababy  
**Type / number of model:** NO.CY103-4  
**Type of alert:** Products with serious risks  
 The sound level of the toy is too high.  
 It could cause damage to hearing.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.  
 Withdrawal of the product from the market

**Description:** White plastic toy in the shape of a mobile phone with sound and light effects, powered by 3xAG13 button batteries. Packaging in a cardboard box with transparent front.

**Batch number / Barcode:** 8335669171344  
**Country of origin:** China  
**Alert submitted by:** Hungary



**Alert number:** A12/1732/19  
**Product:** Children's shoes  
**Name:** Unknown  
**Risk type:** Choking  
**Category:** Clothing, textiles and fashion items  
**Brand:** Aily  
**Type / number of model:** 2650-7, 21 size  
**Type of alert:** Products with serious risks  
 The decorative flowers on the shoes can easily be detached, generating small parts.  
 A small child may put them in the mouth and choke.  
 Withdrawal of the product from the market  
**Description:** Children's shoes with decorative rhinestones and flowers, sold in a cardboard box.  
**Batch number / Barcode:** 6907302206014  
**Country of origin:** China  
**Alert submitted by:** Lithuania  
**Products were found and measures were taken also in:** Estonia



**Alert number:** A12/1726/19

**Product:** Wireless headset

**Name:** Wireless headset

**Risk type:** Chemical, Environment

**Category:** Electrical appliances and equipment

**Brand:** Unknown

**Type / number of model:** Stereo sound & ultra compact

**Type of alert:** Products with serious risks

The metal solder contains an excessive amount of lead (measured value up to 36.25% by weight).

The black cord and the artificial leather contain short chain chlorinated paraffins (SCCPs) (measured value up to 3.55% by weight).

Lead poses a risk to the environment.

SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment.

The article does not comply the requirements of the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) and with the Regulation on persistent organic pollutants (POP Regulation).

Withdrawal of the product from the market

**Description:** Black and orange foldable headphones in a black cardboard packaging. The product was sold online (in particular via Aliexpress).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Sweden



**Alert number:** A12/1730/19

**Product:** Electric kettle

**Name:** Unknown

**Risk type:** Environment

**Category:** Electrical appliances and equipment

**Brand:** Rusta

**Type / number of model:** Batch no 657827, Batch no 657828

**Type of alert:** Products with serious risks

The plastic cord of the kettle contains short chain chlorinated paraffins (SCCPs) (measured value up to 0.47% by weight).

The placing on the market and use of articles containing SCCPs is banned. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment.

The product does not comply with the Regulation on persistent organic pollutants (POP Regulation).

Withdrawal of the product from the market

**Description:** Water kettle stainless with black power base and a black cord.

**Batch number / Barcode:** 7331121394154

**Country of origin:** China

**Alert submitted by:** Sweden





**Alert number:** A12/1736/19

**Product:** Vacuum packing machine

**Name:** FreshpackPro-QH

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Xin Boa long

**Type / number of model:** QH-01

**Type of alert:** Products with serious risks

The poor quality of the internal build can easily lead to breakdown at low voltage.

User may touch the product and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-1 and EN 60335-2-45.

Destruction of the product

**Description:** White vacuum packing machine supplied in a printed cardboard box.

**Batch number / Barcode:** 6931863200013

**Country of origin:** China

**Alert submitted by:** United Kingdom



**Alert number:** A12/1742/19

**Product:** USB Charger Adapter

**Name:** OKCS

**Risk type:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** OKCS

**Type / number of model:** YJ-085

**Type of alert:** Products with serious risks

The clearance/creepage distances between the primary and accessible secondary circuits are not sufficient.

Consequently, the accessible USB ports could become live, leading to an electric shock if touched by the user.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.


Removal of the products from the Amazon platform

**Description:** 2 black USB power supplies in a transparent plastic bag. The product was sold online, in particular via Amazon.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Denmark

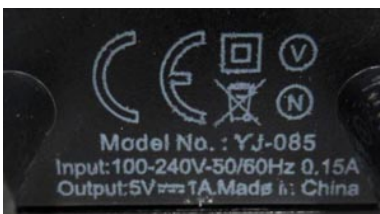

**Alert number:** A11/0067/19

**Product:** Travel cot

**Name:** Hordozható babaágy pozicionáló

**Risk type:** Suffocation

**Category:** Childcare articles and children's equipment

**Brand:** Zopa

**Type / number of model:** Yoga B-2824

**Type of alert:** Products with other risk levels

The foldable mattress of the bed folds too easily when the cot is used in an elevated condition.

As a result, a child could be trapped underneath the mattress, increasing the risk of suffocation.

The product does not comply with the requirements of the relevant European standard EN 716.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Folding cot with metal frame, grey fabric and mesh, that opens with a zipper. The foldable mattress of the cot is height adjustable with a zippered insert. Packaging: grey textile carrying bag.

**Batch number / Barcode:** 8595114431700

**Country of origin:** Czech Republic

**Alert submitted by:** Hungary



**Alert number:** INFO/0128/19

**Product:** Amber necklace

**Name:** Unknown

**Risk type:** Choking

**Category:** Childcare articles and children's equipment

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with other risk levels

The beads can easily break, generating small parts.

A small child may put them in the mouth and choke on it.

Withdrawal of the product from the market

**Description:** Amber Jewellery for use for children only

**Batch number / Barcode:** Unknown

**Country of origin:** Latvia

**Alert submitted by:** United Kingdom



**Alert number:** INFO/0127/19

**Product:** Toy slime

**Name:** Two coloured slime

**Risk type:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type / number of model:** Unknown

**Type of alert:** Products with other risk levels

The migration of boron from the toy slime is too high (measured value up to 1078 mg/kg).

Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Withdrawal of the product from the market

**Description:** Two plastic bags of blue and purple slime in a see-through plastic container. The product was sold online (in particular via Aliexpress).

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Sweden

