



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2019&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

Week 51 - 2019

Country of origin changed on request of the notifying MSA from japan to France., Notification A12/1451/19 has been republished on report 2019-40 of 04/10/2019. The decision was taken based on findings from new documentation submitted to the authority Notifications A12/0244/16 and A12/0245/16 wre withdrawn and unpublished from report 2016-08 of 26/02/2016 at the request of the notifying authority following to a judgement of the German court. Notification A12/1451/19 was withdrawn and unpublished from report 2019-47 of 22/11/2019 at the request of the notifying authority following modification of the product that removed risk linked to the product.

Alert number: A12/00035/19

Product: Laser pointer with shock function

Name: Shock LASER flashlight; Vicces játék

Risk type: Damage to sight, Electric shock

Category: Laser pointers

Brand:

Type / number of model: CD288-082 (on the label of the packaging)

Type of alert: Products with serious risks

The laser beam is too powerful. As a result, direct viewing of the laser beam could cause damage to sight. Also, the electric discharge, when triggering the laser light control button, is too strong. Consequently, it may cause an electric shock.

The product does not comply with the relevant European standard EN 60825 and EN 60335-1.

Recall of the product from end users, Withdrawal of the product from the market

Description: Laser pointer with key ring and electric shock function.

Batch number / Barcode: 6952856654453

Country of origin: People's Republic of China

Alert submitted by: Hungary



Alert number: A12/00004/19

Product: Passenger car

Name: EQC

Risk type: Injuries

Category: Motor vehicles

Brand: Mercedes- Benz

Type / number of model: Model Series (BR): 293, Type-approval number: e1*2001/116*0480*31-35, Type: 204X

Type of alert: Products with serious risks

The bolt of the front-axle differential gear may not meet the durability specification and could break. As a result, fragments of the bolt could block the differential gear and hence the front wheels. This could affect the control over the vehicle and increase the risk of an accident. In addition, the gear casing could be damaged and oil could leak onto the road, posing a risk to the following traffic.

Recall of the product from end users

Description: Passenger car under Mercedes-Benz recall code: 0894001.

Batch number / Barcode: 0894001

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/00007/19

Product: Passenger van / Light commercial vehicle

Name: Expert, Traveller

Risk type: Injuries

Category: Motor vehicles

Brand: Peugeot

Type / number of model: Type-approval numbers: e2*2007/46*0069*06, e2*2007/46*0532*00 to *09, e2*2007/46*0533*00 to *07, Types: 1, V

Type of alert: Products with serious risks

The seatbelt buckle of the front outer passenger seat can open inadvertently. This can impair the seatbelt's protective function in the event of an accident, increasing the risk of an injury. Additionally, the ball joint of the wishbone may loosen up. This can impair the vehicle's directional stability, increasing the risk of an accident.

Recall of the product from end users

Description: Passenger van / Light commercial vehicle under Peugeot's recall code JNA.

Batch number / Barcode: JNA

Country of origin: France

Alert submitted by: Germany

Products were found and measures were taken also in: Poland

Alert number: A12/00008/19

Product: Passenger Car

Name: DB11, DBS SUPERLEGGERA, VANTAGE

Risk type: Injuries

Category: Motor vehicles

Brand: Aston Martin

Type / number of model: Type approval numbers: e11*2007/46*3421*01 r02, e11*2007/46*3421*02 r03, e11*2007/46*3421*03 r04, e9*2007/46*6619*00 r00, e9*KS07/46*6655*00 r01

Type of alert: Products with serious risks

An incorrect torque might have been applied to the front passenger airbag fixings. Consequently, in the event of an accident the airbag might not properly deploy, increasing the risk of injuries.

Recall of the product from end users

Description: Passenger car under Aston martin Recall code RA-01-1327.

Batch number / Barcode: RA-01-1327

Country of origin: United Kingdom

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Germany

Alert number: A12/00010/19

Product: Passenger van / Light commercial vehicle

Name: Proace

Risk type: Fire, Injuries

Category: Motor vehicles

Brand: Toyota

Type / number of model: - Model year: 2016 ~ 2019, e2*2007/46*0537*, e2*2007/46*0538*

Type of alert: Products with serious risks

The rear brake tube is not tightly connected to the holding clip on the lower suspension arm. As a result, it may become damaged and leak brake fluid, reducing the braking performance of the vehicle and increasing the risk of accident. The shaft of the parking brake might have been incorrectly manufactured. As a result, the parking brake might not properly function and the vehicle might unintentionally move, increasing the risk of accident. The fuel tube can move against the ribs of the urea tank. As a result, it may become damaged and leak fuel, which might get ignited, increasing the risk of fire. An insufficient torque might have been applied to the seat belt fixation, seat belt anchor and ground cable bolts. As a result, the seat belt fixation and anchor might become loose, increasing the risk of injuries in the event of an accident or the ground cable might overheat, increasing the risk of fire. The mastic in the front left and right wheel arch panels might be applied incorrectly. As a result, water could filter and reach the airbag module, increasing the risk of accident or injuries in the event of an accident.

Recall of the product from end users

Description: Passenger van / Light commercial vehicle under Toyota Recall Code: 19SMD-122.

Batch number / Barcode: 19SMD-122

Country of origin: France

Alert submitted by: Portugal

Products were found and measures were taken also in: Poland

Alert number: A12/00013/19

Product: Passenger van / Light commercial vehicle

Name: V-Class, Vito

Risk type: Injuries

Category: Motor vehicles

Brand: Mercedes-Benz

Type / number of model: Type approval number: e1*2007/46*0457*18, e1*2007/46*0458*13, e1*2007/46*0459*10, Type: 639/2, 639/4, 639/5

Type of alert: Products with serious risks

A solenoid valve in the brake fluid circuit could jam. Consequently, brake fluid would outflow to the ABS storage chamber. This might impair the braking capacity of the vehicle, as well as the functioning of the ABS and ESP, increasing the risk of accident.

Recall of the product from end users

Description: Passenger van / Light commercial vehicle under Mercedes-Benz Recall code: VS2BREPE (4294058).

Batch number / Barcode: VS2BREPE (4294058)

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/00014/19

Product: Motorcycle

Name: Hypermotard 950

Risk type: Injuries

Category: Motor vehicles

Brand: Ducati

Type / number of model: Type approval number: e9*168/2013*11287, Type: BB

Type of alert: Products with serious risks

The negative terminal of the battery might be defective. Consequently, the electricity provision to the vehicle's electrics and engine might fail, increasing the risk of accident.

Recall of the product from end users

Description: Motorcycle under Ducati Recall code: CR183.

Batch number / Barcode: CR183

Country of origin: Italy

Alert submitted by: Germany

Products were found and measures were taken also in: Poland

Alert number: A12/00015/19

Product: Passenger car

Name: 301

Risk type: Injuries

Category: Motor vehicles

Brand: Peugeot

Type / number of model: e2*2007/46/CE

Type of alert: Products with serious risks

The brake pedal cover may suddenly detach. This can lead to loss of grip of the driver's foot on the pedal and a momentary loss of braking performance due to the surprise effect, increasing the risk of an accident.

No information

Recall of the product from end users

Description: Passenger car under Peugeot recall code: JQK.

Batch number / Barcode: JQK

Country of origin: France

Alert submitted by: France

Alert number: A12/00016/19

Product: Passenger car

Name: 208 I 2008 I

Risk type: Injuries

Category: Motor vehicles

Brand: Peugeot

Type / number of model: e2*2007/46*0070*44, e2*2007/46*0070*46

Type of alert: Products with serious risks

The rear-axle fixing screws may be defective and could break. This may result in loss of the rear axle while driving, increasing the risk of an accident.

Recall of the product from end users

Description: Passenger car under Peugeot recall code: JLU.

Batch number / Barcode: JLU

Country of origin: France

Alert submitted by: France

Products were found and measures were taken also in: Germany

Alert number: A12/00017/19

Product: Passenger car

Name: 3er, 5er

Risk type: Injuries

Category: Motor vehicles

Brand: BMW

Type / number of model: Type-approval numbers: e1*98/14*0097*, e1*98/14*+ 2001/116*0144, 0167*, 0112*, 0146*, e1*98/14*0028*, 0022*, Types: 346L, 346X, 346K, 346C, 346R, 5/D, 5/DS

Type of alert: Products with serious risks

The gas generator on the driver side airbag could burst in the event of airbag activation if it had been exposed to high air humidity, high temperatures and considerable temperature fluctuations over several years. This could result in metal parts being discharged, increasing the risk of injury of the vehicle occupants.

No information

Recall of the product from end users

Description: Passenger car under BMW recall code: 0032930200

Batch number / Barcode: 0032930200

Country of origin: Germany

Alert submitted by: Germany

Products were found and measures were taken also in: Portugal

Alert number: A12/00018/19

Product: Passenger car

Name: C4 Cactus

Risk type: Injuries

Category: Motor vehicles

Brand: Citroën

Type / number of model: e2*2007/46*0440*13, e2*2007/46*0440*14

Type of alert: Products with serious risks

The left rear brake hose may be in contact with the suspension spring. As a result, the hose will be damaged and brake fluid will leak, reducing the braking performance and increasing the risk of an accident.

Recall of the product from end users

Description: Passenger car under Citroën recall code: GZC.

Batch number / Barcode: GZC

Country of origin: France

Alert submitted by: France

Alert number: A12/00019/19

Product: Passenger car

Name: C Elysee

Risk type: Injuries

Category: Motor vehicles

Brand: Citroen

Type / number of model: e2*2007/46*0225*11, e2*2007/46*0225*12

Type of alert: Products with serious risks

The brake pedal cover may suddenly detach. This can lead to loss of grip of the driver's foot on the pedal and a momentary loss of braking performance due to the surprise effect, increasing the risk of an accident.

No information

Recall of the product from end users

Description: Passenger car under Citroen recall code: GXL.

Batch number / Barcode: GXL

Country of origin: France

Alert submitted by: France

Products were found and measures were taken also in: Poland

Alert number: A12/00028/19

Product: Passenger car

Name: S80, V70, XC70, S60, S60CC, V60, V60CC, XC60, V40 and V40CC

Risk type: Fire

Category: Motor vehicles

Brand: Volvo

Type / number of model:

Type of alert: Products with serious risks

Excessive carbon deposits could build up in the intake system of the engine. Additionally, the intake valve could leak. Consequently, the temperature of the intake air could rise, causing the engine intake manifold to melt and deform. This could lead to the engine to stop increasing the risk of accidents or even the engine bay to catch fire.

Recall of the product from end users

Description: Passenger car equipped with four-cylinder diesel engine D4204T5 (engine code 73) D4204T4 (AR) and D4204T14 (A8) under Volvo recall code: R29948

Batch number / Barcode: R29948

Country of origin: Sweden

Alert submitted by: Portugal

Products were found and measures were taken also in: Poland

Alert number: A12/00029/19

Product: Motor vehicle part

Name: Accessory Quickshifter Kit

Risk type: Injuries

Category: Motor vehicles

Brand: Triumph Motorcycles

Type / number of model: A9930469

Type of alert: Products with serious risks

The body of the Triumph shift assist (TSA) assembly may come in contact with the linkage clamp assembly. Consequently, the assisted gear change might fail, resulting in an unexpected missed gear or false neutral, increasing the risk of an accident.

Recall of the product from end users

Description: Triumph shift assist (TSA) accessory kit to allow full and partial throttle up-shifts without the use of the clutch. The product was sold for aftermarket installation on Triumph Speed Triple S & Speed Triple RS motorcycles only. Product under Triumph Recall code: SRAN568.

Batch number / Barcode: SRAN568

Country of origin: United Kingdom

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Germany, Poland

Alert number: A12/00032/19

Product: Passenger car

Name: S80, V70, XC70, S60, S60CC, V60, V60CC, XC60, V40 and V40CC

Risk type: Fire, Injuries

Category: Motor vehicles

Brand: Volvo

Type / number of model: - Model year: 2014 - 2017, - Vehicles equipped with four-cylinder diesel engines: D4204T14 (engine code A8), D4204T5 (73) and D4204T4 (AR)

Type of alert: Products with serious risks

Excessive carbon deposits could build up in the intake system of the engine. Consequently, the temperature of the intake air could rise, causing the engine's intake manifold to melt and deform. This could lead to the engine to stop, increasing the risk of accidents or even the engine bay to catch fire.

Recall of the product from end users

Description: Passenger car under Volvo recall code : R29947.

Batch number / Barcode: R29947

Country of origin: Sweden

Alert submitted by: Portugal

Products were found and measures were taken also in: Poland

Alert number: A12/00033/19

Product: Passenger car

Name: Leon, Ateca

Risk type: Injuries

Category: Motor vehicles

Brand: Seat

Type / number of model: - Model year: 2018, - Type: Leon (5F) and Ateca (KH7)

Type of alert: Products with serious risks

Due to an inadequate sensitivity in the LED turn signal operating control, a failure of the LED turn signals is not always detected.

As a result, the mandatory warning (acoustic/optical) does not occur in these cases and the driver will not be notified of possible failure of the direction indicators, increasing the risk of an accident.

Recall of the product from end users

Description: Passenger car under SEAT Recall code: 94M1.

Batch number / Barcode: 94M1

Country of origin: Spain

Alert submitted by: Portugal

Alert number: A12/00023/19

Product: Carbon monoxide detector

Name: Carbon monoxide detector

Risk type: Asphyxiation

Category: Other

Brand: Zamel

Type / number of model: CTW-01

Type of alert: Products with serious risks

The product is not sufficiently sensitive with respect to detection of carbon monoxide and poses a risk of CO poisoning.

The product does not comply with the relevant European standard EN 50291.

Withdrawal of the product from the market

Description: Carbon monoxide detector, battery powered.

Batch number / Barcode: 5903669074151

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: A12/00009/19

Product: USB Nightlight

Name: Dream Rotating Projection Lamp

Risk type: Fire

Category: Childcare articles and children's equipment

Brand: Star Master

Type / number of model:

Type of alert: Products with serious risks

The product lacks a charging cut-off circuit, protecting the battery of unsuitable charging voltage or overcharging. Consequently, the battery could overcharge, leading it to overheat and increasing the risk of fire.

The product does not comply with the relevant national standard.

Removal of this product listing by the online marketplace

Description: USB Nightlight in dome form with shapes cut into upper half-sphere for projection.

Batch number / Barcode:

Country of origin: People's Republic of China

Alert submitted by: United Kingdom



Alert number: A12/00002/19

Product: Soft toy with keychain

Name:

Risk type: Chemical, Injuries

Category: Toys

Brand:

Type / number of model: Item N°. MO8253

Type of alert: Products with serious risks

The key ring has sharp edges and its metal releases an excessive amount of nickel (measured value up to: 3.95 µg/cm²/week . Nickel is a strong sensitizer and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. A child may become exposed to it by playing with the ring or injured with the sharp edges.

The product does not comply with the REACH Regulation, the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

Description: Plush toy in the shape of a brown teddy bear with a keychain at its head.

Batch number / Barcode:

Country of origin: People's Republic of China

Alert submitted by: Slovenia



Alert number: A12/00005/19

Product: Plastic toy

Name: Cartoon Pet Car / Bajkowy pojazd

Risk type: Choking

Category: Toys

Brand:

Type / number of model: 3699B/L2218

Type of alert: Products with serious risks

The product has a small part (plastic exhaust pipe) that can be easily detached. A child may put it in the mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


Withdrawal of the product from the market

Description: Plastic toy tractor with a dog seated on it, sold in bulk in a collective cardboard exhibitor.

Batch number / Barcode: 5104732159854

Country of origin: People's Republic of China

Alert submitted by: Poland

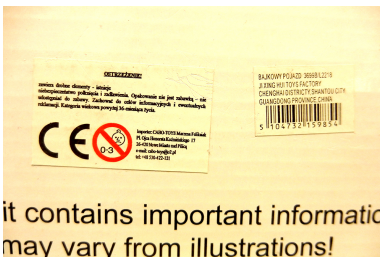

it contains important information
may vary from illustrations!

Alert number: A12/00011/19

Product: Soft toy

Name: Plüss elemes játék

Risk type: Choking

Category: Toys

Brand:

Type / number of model: HY520

Type of alert: Products with serious risks

The product has small parts (eyes and nose) that can be easily detached. A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Destruction of the product, Import rejected at border

Description: Battery-powered toy dog with artificial fur, plastic eyes and nose. The dogs wears a dotted ribbon around their neck with a flower-shaped metal buckle. The dog emits a barking sound and moves independently. The product is available in different colours.

Batch number / Barcode:

Country of origin: People's Republic of China

Alert submitted by: Hungary



Alert number: A12/00020/19

Product: Remote-controlled dog

Name: Remote dog and Floss pet

Risk type: Choking

Category: Toys

Brand: An Yuan

Type / number of model: NO. 9697B4

Type of alert: Products with serious risks

The eyes and the nose can easily detach from the soft toy, generating small parts. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Ban on the marketing of the product and any accompanying measures, Import rejected at border

Description: A dog-shaped, remote-controlled toy covered with artificial fur. The dog has plastic eyes and nose. The remote control is bone shaped. The dog emits a barking sound and moves independently. The product is available in two types.

Batch number / Barcode:

Country of origin: People's Republic of China

Alert submitted by: Hungary



Alert number: A12/00021/19

Product: Soft toy

Name: Plüss játék

Risk type: Choking

Category: Toys

Brand: King toy's

Type / number of model: king toy's

Type of alert: Products with serious risks

The eyes can easily detach from the soft toy, generating small parts. The fibrous stuffing material of the toy is easily accessible due to the zipper. The small parts and the stuffing material may cause choking when put in the mouth by children.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Ban on the marketing of the product and any accompanying measures, Import rejected at border

Description: Pink / white soft teddy bear, containing multi-coloured flashing LED lightening chain which is powered by 2 AA batteries. The teddy bear has a zipper on the back.

Batch number / Barcode:

Country of origin: People's Republic of China

Alert submitted by: Hungary



Alert number: A12/00022/19

Product: Soft toy

Name: ALEX III / ANOS

Risk type: Choking

Category: Toys

Brand:

Type / number of model: MY-LCB-010

Type of alert: Products with serious risks

The eyes and the nose can easily detach from the soft toy, generating small parts. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Destruction of the product, Import rejected at border

Description: Battery-powered toy dog with artificial fur, plastic eyes and nose. The dog emits a barking sound and moves independently. The product is available in different colours. The battery compartment cover is snap-on, and has a screw slot on it, but it is not secured with a screw.

Batch number / Barcode:

Country of origin: People's Republic of China

Alert submitted by: Hungary



Alert number: A12/00026/19

Product: Soft toy

Name: Elemes játék

Risk type: Choking

Category: Toys

Brand: Honey Toys

Type / number of model:

Type of alert: Products with serious risks

The eyes can easily detach from the soft toy, generating small parts. The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. The small parts and the stuffing material may lead to choking when put in the mouth by children.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


Ban on the marketing of the product and any accompanying measures, Import rejected at border

Description: Brown soft teddy bear, containing red LED light and emitting sounds. The product is powered by 3 AA batteries. The teddy bear has a velcro on the back. Size: 45 cm tall

Batch number / Barcode: unknown

Country of origin: People's Republic of China

Alert submitted by: Hungary

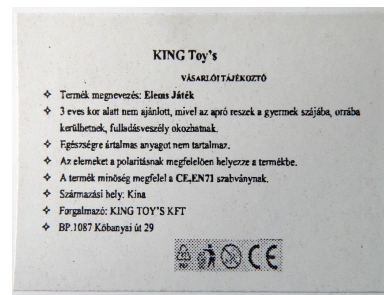

Alert number: A12/00027/19

Product: Rattle toy set

Name: Baby

Risk type: Choking

Category: Toys

Brand: Fansheng / ABABABY

Type / number of model: N°733A-71

Type of alert: Products with serious risks

Small parts can easily detach from the toy. They can be put in the mouth by small children, causing them to choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users, Withdrawal of the product from the market

Description: The set consists of five colourful plastic rattles in the shape of musical instruments.

Batch number / Barcode: 2018121733712

Country of origin: People's Republic of China

Alert submitted by: Hungary



Alert number: A12/00030/19

Product: Squeezable toy

Name: Squeezy crystal ball

Risk type: Chemical, Choking

Category: Toys

Brand:

Type / number of model: 24301

Type of alert: Products with serious risks

The external rubber of the toy can break during use, releasing the internal flashing capsule with button batteries. This capsule can easily break, leaving the button batteries accessible. A child could put the button batteries in the mouth, which could cause damage to the child's gastrointestinal tract or choking.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 62115.

Recall of the product from end users

Company recall page: <https://www.zps.si/index.php/otrok-topmenu-258/odpoklici-2019/10004-odpoklic-squeezy-kristalna-zoga-z-lucko>
(<https://www.zps.si/index.php/otrok-topmenu-258/odpoklici-2019/10004-odpoklic-squeezy-kristalna-zoga-z-lucko>)

Description: Soft plastic squeezable ball containing led lights and button batteries.

Batch number / Barcode: 8711866243013

Country of origin: People's Republic of China

Alert submitted by: Slovenia



Alert number: A12/00031/19

Product: Balloons

Name: WILD BIRTHDAY PASTEL BALLOONS

Risk type: Chemical

Category: Toys

Brand: belbal

Type / number of model: Art. 5000374, BRN BALON LATEKS D11 WILD, BRN 50000374

Type of alert: Products with serious risks

The rubber of the balloons releases an excessive amount of nitrosatable substances generating n-nitrosodimethylamine (NDMA)(measured value: 1.2 mg/ kg). NDMA is a nitrosamine, which may cause cancer through ingestion or dermal exposure. A child could be exposed to it when touching or putting the product in the mouth.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

Recall of the product from end users

Company recall page: <https://www.zps.si/index.php/otrok-topmenu-258/odpoklici-2019/10024-odpoklic-baloni-latex-wild-birthday>
(<https://www.zps.si/index.php/otrok-topmenu-258/odpoklici-2019/10024-odpoklic-baloni-latex-wild-birthday>)

Description: 6 white balloons with words HAPPY BIRTHDAY MY DEER and a sketch of a deer, sold in a plastic bag with a cardboard label inside.

Batch number / Barcode: 5414391004458

Country of origin: Belgium

Alert submitted by: Slovenia



Alert number: A12/00036/19

Product: Soft toy

Name:

Risk type: Choking

Category: Toys

Brand:

Type / number of model: KING Toy's

Type of alert: Products with serious risks

The eyes and the nose can easily detach from the soft toy, generating small parts. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Ban on the marketing of the product and any accompanying measures, Import rejected at border

Description: A dog-shaped, battery-powered toy covered with artificial fur in different colours artificial fur. The dog has plastic eyes and nose and emits a barking sound and moves independently. The battery compartment cover is snap-on, and has a screw slot on it, but it is not secured with a screw.

Batch number / Barcode:

Country of origin: People's Republic of China

Alert submitted by: Hungary



Alert number: A12/00012/19

Product: Children's shoes

Name:

Risk type: Choking

Category: Clothing, textiles and fashion items

Brand: Nice Wear

Type / number of model: DR1214

Type of alert: Products with serious risks

The product has small parts (decorative rubber pieces) that can be easily detached. A small child may put them in the mouth and choke on them.

Withdrawal of the product from the market

Description: A pair of rubber children clogs, with a decorative plastic plane on them.

Batch number / Barcode: 0000011570240

Country of origin: People's Republic of China

Alert submitted by: Lithuania



Alert number: A12/00025/19

Product: Children's dress

Name:

Risk type: Injuries

Category: Clothing, textiles and fashion items

Brand: Yellowsub

Type / number of model: 41040240032

Type of alert: Products with serious risks

The dress has long functional cords with free ends to be tied at the back area. The cords can become trapped during various activities of the child, leading to injuries.

The product does not comply with the relevant European standard EN 14682.

Withdrawal of the product from the market

Description: Young girls sleeveless dress bearing functional cords with free ends to be tied at the back. This dress is intended for 18-24 months girls.

Batch number / Barcode: 5210019977728

Country of origin: Greece

Alert submitted by: Cyprus



Alert number: A12/00037/19

Product: Children's dress

Name:

Risk type: Injuries, Strangulation

Category: Clothing, textiles and fashion items

Brand: Two in a castle

Type / number of model: T04230304

Type of alert: Products with serious risks

The product bears long functional cords close to the neck to be tied at the upper back area. The cords may become trapped during various activities of a child, leading to injuries and/or strangulation.

The product does not comply with the relevant European Standard EN 14682.

Withdrawal of the product from the market

Description: Young girls sleeveless dress intended for 4 years old girls. This dress is in white color and at the front side has additional tulle layer with small stitched daisies. The dress bears black functional cords at the upper chest area and decorative cords and at the point under the armpits.

Batch number / Barcode:

Country of origin: Greece

Alert submitted by: Cyprus



Alert number: A12/00038/19

Product: Children's dress

Name:

Risk type: Injuries, Strangulation

Category: Clothing, textiles and fashion items

Brand: Yellowsub

Type / number of model: 41040440045

Type of alert: Products with serious risks

The product bears long functional cords close to the neck to be tied at the upper front area. The cords may become trapped during various activities of a child, leading to injuries and/or strangulation.

The product does not comply with the relevant European Standard EN 14682.

Withdrawal of the product from the market

Description: Young girls short sleeve dress. This dress is designed for 6-9 months old girls, is in blue color with white stripes and bears functional cords with 3D embellishment at free ends.

Batch number / Barcode: 5210019979999

Country of origin: Greece

Alert submitted by: Cyprus



Alert number: A12/00003/19

Product: Inverter welder

Name: Spawarka Inwertorowa IGBT

Risk type: Burns, Electric shock, Fire

Category: Electrical appliances and equipment

Brand: Bestcraft, Kraft Dele

Type / number of model: IGBT-250 EC1845

Type of alert: Products with serious risks

The creepage distances and insulation are insufficient. The product can consequently become live and lead to an electric shock. The protective circuit and attachment plug are inadequate. The product can overheat and lead to burns or fire.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60974-1.

Withdrawal of the product from the market


Description: Portable inverter welder.

Batch number / Barcode: 5901638118684

Country of origin: People's Republic of China

Alert submitted by: Poland

Products were found and measures were taken also in: Croatia

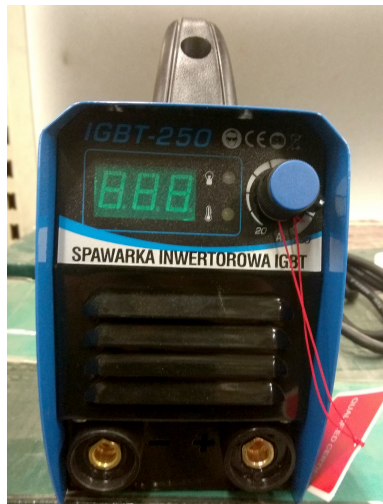

Alert number: A12/00006/19

Product: Electric shaver

Name: Rechargeable Shaver

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Kemei

Type / number of model: KM-2801

Type of alert: Products with serious risks

The mains plug does not properly fit in the socket and its casing can be easily detached. While plugging or unplugging the charger, the casing might open, leaving live parts accessible and increasing the risk of the user receiving an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Recall of the product from end users, Withdrawal of the product from the market

Description: Rechargeable battery powered hand-held shaver fitted with a C2 appliance inlet and supplied with a separate mains to C1 charging cable. The product is packed in a black cardboard box and was also sold online (in particular via eBay).

Batch number / Barcode:

Country of origin: People's Republic of China

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Germany



Alert number: A12/00024/19

Product: Hair dryer

Name: Elgetec Professional Salon Style Hairdryer 2200W

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Elgetec

Type / number of model:

Type of alert: Products with serious risks

The live pins of the mains supply plug are too close to the outer edge. As the hairdryer does not have an earth wire, a consumer may receive an electric shock when (un)plugging the hair dryer.

The product does not comply with the requirements of the Low Voltage Directive.

Recall of the product from end users, Withdrawal of the product from the market

Description: Red hand held hairdryer.

Batch number / Barcode:

Country of origin: Unknown

Alert submitted by: United Kingdom



Alert number: A12/00034/19

Product: USB Charger

Name: Ladowarka sieciowa plaska USB czarna 1A

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand:

Type / number of model: GSM0601 (AR-1000)

Type of alert: Products with serious risks

The electrical insulation and the creepage/clearance distances of the product are insufficient. Consequently, the user might touch live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

Withdrawal of the product from the market

Description: Black plastic USB charger, delivering 1A, sold in a plastic packaging.

Batch number / Barcode: 5901890010429

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: INFO/00001/19

Product: Children's tracksuit

Name:

Risk type: Strangulation

Category: Clothing, textiles and fashion items

Brand: Mertoğlu Baby

Type / number of model:

Type of alert: Products with other risk levels

The product has long drawstrings with free ends in the neck area. The drawstrings may become trapped during various activities of a child, leading to strangulation.

The product does not comply with the relevant European standard 14682.

Withdrawal of the product from the market

Description: Children's tracksuit for 3-4 year old child. It consists of a pink hooded sweatshirt, with drawstrings, and a pair of blue sweatpants. On the front of the sweatshirt there is a picture of a clock and the inscription "Love".

Batch number / Barcode:

Country of origin: Turkey

Alert submitted by: Czechia

