



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

# The Rapid Alert System for Non-Food Products (RAPEX)

## RAPEX - Weekly overview report of notifications

Week 7 - 2020

**Alert number:** A12/00196/20

**Product:** Pressure cooker

**Name:** EMMA 7 litres

**Risk type:** Burns, Injuries

**Category:** Kitchen/cooking accessories

**Brand:** HO ME

**Type / number of model:** 8003512661624

**Type of alert:** Products with serious risks

The safety valve does not release pressure. When handling the pressure cooker, the user may sustain burns from the jet of steam on release of the second safety valve or suffer injuries from the lid being expelled. / The product does not comply with the relevant European standard EN 12778.

Recall of the product from end users

**Description:** Pressure cooker. the product was also sold online, in particular via Amazon.

**Batch number / Barcode:** 8003512661624

**Country of origin:** Italy

**Alert submitted by:** France



**Alert number:** A12/00183/20

**Product:** Lighting chains

**Name:** ENERGY SAVING LED

**Risk type:** Electric shock, Fire

**Category:** Lighting chains

**Brand:**

**Type / number of model:** 1718681, 1718682, 1718683, 1718684, 1718687, 1718691, 1718692, 1718693

**Type of alert:** Products with serious risks

The mechanical strength of the control device is not sufficient, the conductors in the wires are too thin, and the protection against water is not sufficient, which could result in electric shock or fire. / The product does not comply with the requirements of the Low Voltage Directive, the relevant European standards EN 60598, EN 62368-1.


Recall of the product from end users, Withdrawal of the product from the market

**Description:** Lighting chains with 20, 500, 100 and 200 LED bulbs.

**Batch number / Barcode:** 5901780540517, 5901780540524, 5901780540586, 5901780540593, 5901780540609, 5901780540616, 5901780540463, 5901780540500

**Country of origin:** People's Republic of China

**Alert submitted by:** Slovakia

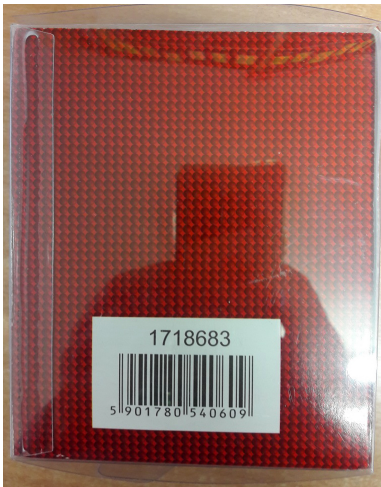

**Alert number:** A12/00184/20

**Product:** Lighting chain

**Name:** LUCI DI NATALE 100 LED 10M

**Risk type:** Burns, Electric shock, Fire

**Category:** Lighting chains

**Brand:** DRF

**Type / number of model:** 62527 (on the packaging), 62528 (on the packaging label)

**Type of alert:** Products with serious risks

The cable is not properly anchored and is too thin. The accessible wires have inadequate insulation. The structure of cord extension socket allows single-pole insertion of plugs. The product is not protected against moisture but is recommended for outdoor use. The cable could overheat, burning the user or leading to a fire. The water could penetrate the product or the user could touch accessible live parts, which may cause an electric shock. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598. Import rejected at border

**Description:** Lighting chain with 100 non-replaceable colourful LED lamps. The product includes a socket outlet that allows the connection of another lighting chain.

**Batch number / Barcode:** 8 068911 625271 (on the packaging), 8 068911 625288 (on the packaging label)

**Country of origin:** People's Republic of China

**Alert submitted by:** Hungary



**Alert number:** A12/00185/20

**Product:** Lighting chain

**Name:** LUCI DI NATALE 100 LED 10M

**Risk type:** Burns, Electric shock, Fire

**Category:** Lighting chains

**Brand:** DRF

**Type / number of model:** REF: 56567 (on the packaging), REF: 59216 (on a label)

**Type of alert:** Products with serious risks

The cable is not properly anchored and is too thin. The accessible wires have inadequate insulation. The product is not protected against moisture but is recommended for outdoor use. The cable could overheat, burning the user or leading to a fire. The water could penetrate the product or the user could touch accessible live parts, which may cause an electric shock. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Import rejected at border

**Description:** Lighting chain with 100 non-replaceable white LED lamps.

**Batch number / Barcode:** 8 068911 565676 (on the packaging), 8 068911 592160 (on the packaging label)

**Country of origin:** People's Republic of China

**Alert submitted by:** Hungary





**Alert number:** A12/00189/20

**Product:** Lighting chains

**Name:** adristar

**Risk type:** Electric shock, Fire

**Category:** Lighting chains

**Brand:**

**Type / number of model:** 1781686, 1781689, 1781694, 1781692, AP4M-26LED-RGB-B2, AP4M-26LED-RGB-S2, AP4M-26LED-RGB-XT, AP4M-26LED-RGB-CD

**Type of alert:** Products with serious risks

The mechanical strength of the control device is not sufficient and the conductors in the wires are too thin. This can lead to increased risk of electric shock or fire. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598-1 and EN 60598-2-20.

Recall of the product from end users, Withdrawal of the product from the market

**Description:** Lighting chains with 26 LED bulbs in various shapes.

**Batch number / Barcode:** 6911909504589, 6911909504619, 6911909504657, 6911909504633

**Country of origin:** People's Republic of China

**Alert submitted by:** Slovakia





**Alert number:** A12/00207/20

**Product:** DIAMOND WIRE SAWING MACHINE

**Name:** MACCHINA TAGLIATRICE A FILO DIAMANTATO

**Risk type:** Injuries

**Category:** Machinery

**Brand:** BENETI

**Type / number of model:** VIP 915/A-75/8

**Type of alert:** Products with serious risks

The disc guard does not provide sufficient protection against flying particles in the event of a breakage of the device. As a result, uncontrolled flying parts may cause injuries to the user. The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 15163. / EN 15163:2008 and Directive 2006/42/EC

Making the marketing of the product subject to prior conditions

**Description:** Electrical equipment on rails for stone cutting. The machine withdraws on rails to allow the continuous tensioning of the diamond-studded sawing wire and the rotation of the driving pulley which drags the wire to cut the stone.

**Batch number / Barcode:**

**Country of origin:** Italy

**Alert submitted by:** Italy



**Alert number:** A12/00191/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Vivaro, Zafira

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Opel

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0532\*10, e2\*2007/46\*0533\*08 - \*09, Type: V

**Type of alert:** Products with serious risks

Water may leak into the vehicle interior. This can impair the proper functioning of the airbags, increasing the risk of injury in the event of an accident. /

Recall of the product from end users

**Description:** Passenger car/van under Opel recall code: E19-190463.

**Batch number / Barcode:** E19-190463

**Country of origin:** France

**Alert submitted by:** Germany

**Alert number:** A12/00194/20

**Product:** Passenger car

**Name:** Yaris GRMN

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Toyota

**Type / number of model:** Model code: NSP131, Model year: 2017~2018, Vehicles equipped with supercharged 2ZR engines , e11\*KS07/46\*4079

**Type of alert:** Products with serious risks

The fuel-delivery resin spacer between the fuel injector and the engine's cylinder head does not have the appropriate thermal resistance. / Consequently, it could deform, reducing the injector's head sealing, resulting in fuel leakage and increasing the risk of fire.

Recall of the product from end users

**Description:** Passenger car.

**Batch number / Barcode:** 20SMD-003

**Country of origin:** France

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Germany

**Alert number:** A12/00195/20

**Product:** Passenger Car

**Name:** Discovery

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Land Rover

**Type / number of model:** E11\*2007/46\*3784, Model 2020

**Type of alert:** Products with serious risks

The fixings of the second row seat frame assembly may be missing. / Consequently the seat might not have sufficient structural integrity and strength, and might move in the event of an accident or under the weight of the luggage, increasing the risk of injuries.

Recall of the product from end users

**Description:** Passenger Car.

**Batch number / Barcode:** N422

**Country of origin:** Slovakia

**Alert submitted by:** United Kingdom

**Alert number:** A12/00208/20

**Product:** Passenger van / Light commercial vehicle

**Name:** Proace

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Toyota

**Type / number of model:** Type-approval number: e2\*2007/46\*0388\*, Type: X

**Type of alert:** Products with serious risks

An attachment holding a counterweight could break during driving. Consequently, the counterweight could become detached from the vehicle and fall onto the road, posing a risk to the following traffic. /

Recall of the product from end users

**Description:** Passenger van / Light commercial vehicle under Toyota recall code: 19SMD-080.

**Batch number / Barcode:** 19SMD-080

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/00209/20

**Product:** Passenger car

**Name:** Grandland

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Opel

**Type / number of model:** Type-approval numbers: e2\*2007/46\*0597\*09, e2\*2007/46\*0597\*11 - \*13 , Type: Z

**Type of alert:** Products with serious risks

The screw connection of the trailer coupling module may be defective. This can cause the screws between the base plate and the trailer coupling to break away, increasing the risk of an accident. /

Recall of the product from end users

**Description:** Passenger car under Opel recall code: E19-190469.

**Batch number / Barcode:** E19-190469

**Country of origin:** France

**Alert submitted by:** Germany

**Alert number:** A12/00210/20

**Product:** Pickup truck

**Name:** F-150

**Risk type:** Fire, Injuries

**Category:** Motor vehicles

**Brand:** Ford

**Type / number of model:** Type-approval number: Individual approval , Type: Pick-up

**Type of alert:** Products with serious risks

The attachment of the positive battery cable can be defective. This can result in failure of the vehicle's electrical system and engine increasing the risk of an accident. Furthermore, this can lead to increased risk of fire in the engine compartment. /

Recall of the product from end users

**Description:** Passenger car under Ford recall code: 19S40.

**Batch number / Barcode:** 19S40

**Country of origin:** United States

**Alert submitted by:** Germany



**Alert number:** A12/00211/20

**Product:** Passenger car

**Name:** Corolla

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Toyota

**Type / number of model:** Type-approval number: e6\*2007/46\*0318\*, Type: ZE1HE (EU,M)

**Type of alert:** Products with serious risks

The wind deflector on the panorama roof may be insufficiently attached. As a result, it may break off and fall onto the road, posing a risk to the following traffic. /

Recall of the product from end users

**Description:** Passenger car under Toyota recall code: 19SMD-039.

**Batch number / Barcode:** 19SMD-039

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/00190/20

**Product:** Motorcycle helmet

**Name:**

**Risk type:** Injuries

**Category:** Protective equipment

**Brand:** Ozone

**Type / number of model:** A951, Approval No.: E1-05300136/P

**Type of alert:** Products with serious risks

The impact absorption capacity of the helmet is insufficient. As a result, users may suffer head injuries In the event of an impact. / The product does not comply with the requirements of the Regulation ECE 22-05.


Recall of the product from end users, Withdrawal of the product from the market

**Description:** Motorcycle helmet with a visor. Suitable for drivers and passengers on motorcycles and mopeds. Technical parameters: weight 1,650g +/- 10%, size XL 61-62 cm, color black matt.

**Batch number / Barcode:** 2000000245539

**Country of origin:** People's Republic of China

**Alert submitted by:** Slovakia

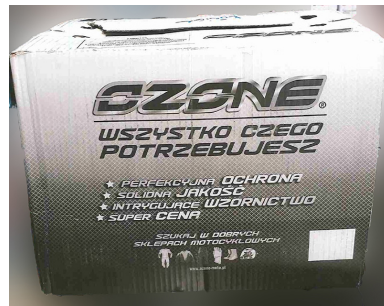

**Alert number:** A12/00188/20

**Product:** Drinking bottle for children

**Name:** Glass & Straw Bottle

**Risk type:** Injuries

**Category:** Childcare articles and children's equipment

**Brand:** Everyday baby

**Type / number of model:**

**Type of alert:** Products with serious risks

The silicone coating is opaque and the glass easily breaks, releasing small fragments. / If the glass of the bottle breaks or cracks, the child caretaker might not notice this and the child might keep on drinking, potentially swallowing small fragments of glass that could cause internal injuries.

Stop of sales/Recall of the product from end users


**Company recall page:** <https://www.ipanainen.fi> (<https://www.ipanainen.fi>)

**Description:** Rose pink glass bottle coated with silicon, with cap and depending on the model either a built in straw or a silicone teat. The product was also sold online.

**Batch number / Barcode:** 7350077263840

**Country of origin:** Unknown

**Alert submitted by:** Finland

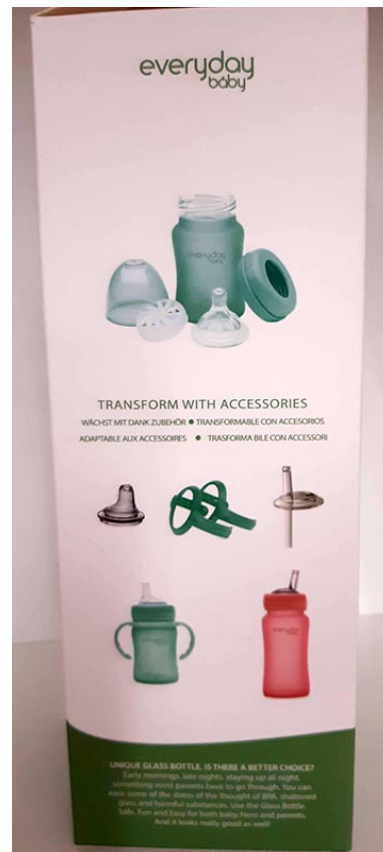



**Alert number:** A12/00187/20

**Product:** Toy slime

**Name:** Whoopee Putty

**Risk type:** Chemical

**Category:** Toys

**Brand:**

**Type / number of model:** index: 405721

**Type of alert:** Products with serious risks

The migration of boron from the toy slimes is too high ((measured value up to 1220 mg/kg). Ingestion of boron or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system. / The product does not comply with the Toy Safety Directive and the relevant European standard EN 71-3.

Recall of the product from end users

**Company recall page:** [http://www.euro-trade.pl/pl/tresc\\_aktualnosci/1013](http://www.euro-trade.pl/pl/tresc_aktualnosci/1013) ([http://www.euro-trade.pl/pl/tresc\\_aktualnosci/1013](http://www.euro-trade.pl/pl/tresc_aktualnosci/1013))

**Description:** Toy slime, available in different colours

**Batch number / Barcode:** 5902643685178

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland





**Alert number:** A12/00192/20

**Product:** Toy slime

**Name:** Oil Slime

**Risk type:** Chemical

**Category:** Toys

**Brand:**

**Type / number of model:** index: 413975

**Type of alert:** Products with serious risks

The migration of boron from the toy slime is too high ( measured value up to 714 mg/kg). Ingestion of boron or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system. / The product does not comply with the Toy Safety Directive and the relevant European standard EN 71-3.

Recall of the product from end users

**Company recall page:** [http://www.euro-trade.pl/pl/tresc\\_aktualnosci/1012](http://www.euro-trade.pl/pl/tresc_aktualnosci/1012) ([http://www.euro-trade.pl/pl/tresc\\_aktualnosci/1012](http://www.euro-trade.pl/pl/tresc_aktualnosci/1012))

**Description:** Toy slime, available in different colours.

**Batch number / Barcode:** 5902643627291

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland



**Alert number:** A12/00198/20

**Product:** Fancy-dress costume

**Name:**

**Risk type:** Strangulation

**Category:** Toys

**Brand:**

**Type / number of model:** AE 146-A-5 B18065 S

**Type of alert:** Products with serious risks

There are cords with free ends in the neck area of the costume. The cords can become trapped during various activities of a child, leading to strangulation. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 14682.

Withdrawal of the product from the market

**Description:** Black and red ninja costume for children, consisting of an outfit with cords at the neck, a belt, a hood and a head band.

**Batch number / Barcode:**

**Country of origin:** Unknown

**Alert submitted by:** France



**Alert number:** A12/00199/20

**Product:** Fancy-dress costume

**Name:** Naughty clown

**Risk type:** Strangulation

**Category:** Toys

**Brand:** TAOS

**Type / number of model:** AF 2242 TP10

**Type of alert:** Products with serious risks

There are cords with free ends in the neck area of the fancy-dress costume. They can become trapped during various activities of a child, leading to strangulation. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 14682. Withdrawal of the product from the market

**Description:** Red and yellow clown costume (outfit + hat) for children.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** France





**Alert number:** A12/00200/20

**Product:** Fancy-dress costume

**Name:** 2-7 Garçons Enfants Robin 3pc Muscle Costume Set Halloween Party Dress Outfit

**Risk type:** Strangulation, Suffocation

**Category:** Toys

**Brand:** COSPLAY

**Type / number of model:** KK16806

**Type of alert:** Products with serious risks

There are cords with free ends in the neck area of the fancy-dress costume. They can become trapped during various activities of a child, leading to strangulation. Moreover, the plastic bag of the packaging is too thin. If a child plays with the packaging, the plastic can cover the mouth and nose, causing the child to suffocate. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standards EN 14682 and EN 71-1.

Withdrawal of the product from the market

**Description:** Child's fancy dress costume consisting of green, yellow and black trousers, a yellow and green padded muscle-effect top and a black cape with drawstrings at the neck. The product was sold online, in particular via eBay.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** France



**Alert number:** A12/00201/20

**Product:** Rattle

**Name:**

**Risk type:** Choking

**Category:** Toys

**Brand:**

**Type / number of model:** 446892/2019-07-18/C05-03-068-1, Outil pratique En bois Bell Baby Toys Children's Wooden Cartoon Smiley Childhood Teaching Aids Rattle

**Type of alert:** Products with serious risks

Small parts can easily be detached from the rattles and the handle is too long. A small child could put either the handle or the small parts in the mouth and choke on them. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** Multi-coloured wooden rattle with metal bells on top.

**Batch number / Barcode:**

**Country of origin:** Unknown

**Alert submitted by:** France



**Alert number:** A12/00203/20

**Product:** Soft toy

**Name:**

**Risk type:** Chemical, Choking, Strangulation

**Category:** Toys

**Brand:**

**Type / number of model:** G97903 0999//1/NO

**Type of alert:** Products with serious risks

The product has small pieces (handle of zipper and nose) that can be easily detached. A small child might put them in the mouth and choke on them. The battery compartment and inside of the toy can be opened without the need of a tool, leaving easily detachable small pieces of cables, electronic components and stuffing accessible. A small child may put them in the mouth and choke or suffer injuries. The accessible inner cable of the product is too long. The cable may become trapped around the neck area of the child and lead to strangulation. The accessible inner cables of the toy contain an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and di-'isononyl' phthalate (DINP) (measured values up to: 7 % and 0.22 % by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system and liver. / The product does not comply with the REACH Regulation, the requirements of the Toy Safety Directive and the relevant European standards EN 71-1 and EN 62115.

Removal of this product listing by the online marketplace

**Description:** Soft-filled toy in the shape of a teddy bear with LED lights, available with the fur in different colours. The product was sold online, in particular via eBay.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** Luxembourg



**Alert number:** A12/00205/20

**Product:** Toy scooter

**Name:** Scooter

**Risk type:** Injuries

**Category:** Toys

**Brand:**

**Type / number of model:** 563

**Type of alert:** Products with serious risks

The front wheels are too small and could get stuck in holes in the ground. This could cause the child to lose balance and fall off, leading to injuries. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Withdrawal of the product from the market

**Description:** A scooter with two adjacent wheels at the back and two at the front connected via a 'mechanism' that turns the wheels when the scooter is tilted left or right.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** United Kingdom





**Alert number:** A12/00206/20

**Product:** Soft toy

**Name:** Cute baby

**Risk type:** Choking

**Category:** Toys

**Brand:** Toi Toys

**Type / number of model:** 02090

**Type of alert:** Products with serious risks

Small parts (the Velcro, inner circles of the forearms) can easily be detached from the toy. A small child may put them in the mouth and choke on them. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Recall of the product from end users

**Description:** Soft toy doll with plastic hands and feet and face in a light blue suit with bunny ears.

**Batch number / Barcode:** 8714627020908

**Country of origin:** The Netherlands

**Alert submitted by:** Iceland



**Alert number:** A12/00212/20

**Product:** Soft-filled toy

**Name:**

**Risk type:** Choking

**Category:** Toys

**Brand:** Lorelli Toys

**Type / number of model:** 1019112

**Type of alert:** Products with serious risks

The zip puller can easily be detached, generating a small parts. A small child may put it in the mouth and choke. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Making the marketing of the product subject to prior conditions

**Description:** Soft-filled toy in the shape of an octopus in pink colour containing plastic, with zipper.

**Batch number / Barcode:** 3800151952244

**Country of origin:** Bulgaria

**Alert submitted by:** Bulgaria



**Alert number:** A12/00186/20

**Product:** Henna product

**Name:** Henna Cone Mehndy

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Malki Mumtaz

**Type / number of model:**

**Type of alert:** Products with serious risks

The product contains phenol (measured value: 3.4 %). Phenol is corrosive, can cause eye and skin irritation or damage, and might be mutagenic. / The product does not comply with the Cosmetic Products Regulation.

Withdrawal of the product from the market

**Description:** Powder brown henna dye to be used for body painting and temporary tattoos. To be given as gifts in weddings. The product was also sold online.

**Batch number / Barcode:** 4011643677258

**Country of origin:** Pakistan

**Alert submitted by:** Austria



**Alert number:** A12/00204/20

**Product:** Hand cream

**Name:** Hand Cream

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Caicui

**Type / number of model:** Raspberry

**Type of alert:** Products with serious risks

The product contains methylisothiazolinone (MI)(measured value: 0.0006 %), which use is forbidden in leave-on cosmetic products. MI is a strong sensitizer and can provoke allergic contact dermatitis to sensitised persons. / The product does not comply with the Cosmetic Products Regulation.


Removal of this product listing by the online marketplace

**Description:** 30 g of hand cream. The product was also sold online, in particular via eBay.

**Batch number / Barcode:** 6959192810666

**Country of origin:** People's Republic of China

**Alert submitted by:** United Kingdom

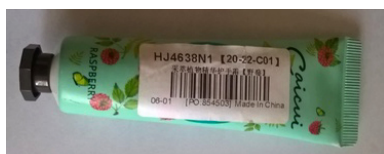

**Alert number:** A12/00213/20

**Product:** Perfume

**Name:** Limon eau de Cologne

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Kartopu

**Type / number of model:** 80° Kolonya, S.N:003

**Type of alert:** Products with serious risks

The product contains an excessive amount of methanol (measured value: 20 %). Due to its appearance, the product may be mistaken for foodstuff, leading the user to ingest it. Methanol is acutely toxic to the central nervous system and the eye. Ingestion of methanol leads to blindness and death. / The product does not comply with the Cosmetic Products Regulation.


Ban on the marketing of the product and any accompanying measures, Recall of the product from end users, Withdrawal of the product from the market

**Description:** 320 ml of slightly yellow eau de cologne.

**Batch number / Barcode:** 8 691238 987670

**Country of origin:** Turkey

**Alert submitted by:** Finland

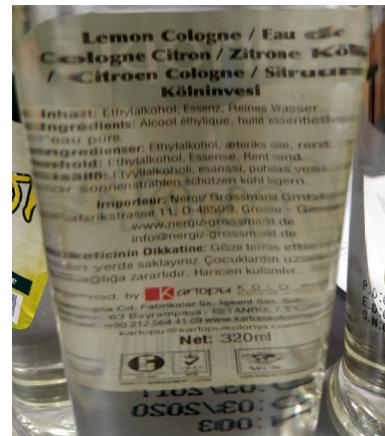



**Alert number:** A12/00193/20

**Product:** Meat grinder

**Name:** Maszynka do mielenia miesa / Elektrischer Fleischwolf

**Risk type:** Electric shock, Fire

**Category:** Electrical appliances and equipment

**Brand:** Germin

**Type / number of model:** AMG-31B-120

**Type of alert:** Products with serious risks

The product's electrical insulation, thermal protection and internal capacitor are inappropriate. Consequently, the product could overheat during use, leading to a fire or the user could touch accessible live parts, increasing the risk of receiving an electric shock. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-2-14.

Withdrawal of the product from the market

**Description:** Electric meat grinder with several food processing accessories and a maximal power of 1300 W.

**Batch number / Barcode:**

**Country of origin:** People's Republic of China

**Alert submitted by:** Poland





**Alert number:** A12/00202/20

**Product:** LED lamp

**Name:** Proiettore LED Easy

**Risk type:** Electric shock, Fire

**Category:** Electrical appliances and equipment

**Brand:** valex

**Type / number of model:** Easy/1153096

**Type of alert:** Products with serious risks

The dielectric strength test and the test on the insulation between primary and secondary produced negative results with a possible risk of fire and electric shock. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standards EN 60598.

Withdrawal of the product from the market

**Description:** LED lamp with warm light

**Batch number / Barcode:** 8004878688263

**Country of origin:** People's Republic of China

**Alert submitted by:** Italy



**Alert number:** A11/00019/20

**Product:** Trampoline

**Name:** Trampoline hexagonal 240

**Risk type:** Entrapment, Injuries

**Category:** Toys

**Brand:** DOMYOS Décathlon

**Type / number of model:** 8501780

**Type of alert:** Products with other risk levels

The gap between two accessible spiral springs is too big and a gap is created between the jumping area and the suspension system when the trampoline is used at maximum weight. A child could get its fingers stuck in the suspension springs underneath the jumping area or slip through the gap and hit the ground or get trapped. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-14.

Withdrawal of the product from the market

**Description:** Trampoline for home use with a safety net fixed between the mat and the suspension area.

**Batch number / Barcode:**

**Country of origin:** France

**Alert submitted by:** France

