



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2020&lng=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&lng=en)

👍 [IPSW 2018 \(https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

Week 36 - 2020

Alert number: A12/01193/20

Product: Passenger car

Name: 2008, 3008, 308, 5008

Risk type: Injuries

Category: Motor vehicles

Brand: Peugeot

Type / number of model: Type-approval number: e2*2007/46*0405*04 to *07, e2*2007/46*0070*21-*22 and *24, e2*2001/116*0377*19 and *21, e2*2007/46*0004*16-*17, e2*2007/46*0058*14, Type: L, C, 0U, 0

Type of alert: Products with serious risks

The sub-frame may corrode and fracture due to defective anti-rust treatment. This can lead to loss of control over the vehicle, increasing the risk of an accident.

Recall of the product from end users

Description: Passenger car

Batch number / Barcode: JSB

NO

Country of origin: France

Alert submitted by: Germany

Alert number: A12/01194/20

Product: Passenger car

Name: CR-V

Risk type: Injuries

Category: Motor vehicles

Brand: Honda

Type / number of model: Type-approval number: NATO vehicle, Type: RW1, RW2

Type of alert: Products with serious risks

The description of the front-seat passenger airbag warning light given in the manual is incorrect. This could lead to a misinterpretation by an occupant of the vehicle, increasing the risk of injury. /

Recall of the product from end users

Description:

Batch number / Barcode: 6GK

NO

Country of origin: United States

Alert submitted by: Germany

Alert number: A12/01195/20

Product: Passenger car

Name: Puma MHEV

Risk type: Fire, Injuries

Category: Motor vehicles

Brand: Ford

Type / number of model: e9*2007/46*3165*00

Type of alert: Products with serious risks

The hybrid battery connections may not have been torqued according to the Ford specification, which can result in a poor electrical connection. This can lead to the loss of the hybrid drive (MHEV) function, increasing the risk of an accident. Furthermore, localized overheating and possible melting of surrounding components can occur, increasing the risk of fire. /

Recall of the product from end users

Description:

Batch number / Barcode: 20S46

NO

Country of origin: Romania

Alert submitted by: United Kingdom

Products were found and measures were taken also in: Ireland

Alert number: A12/01198/20

Product: Passenger car

Name: DS7

Risk type: Injuries

Category: Motor vehicles

Brand: DS

Type / number of model: Type-approval number: e2*2007/46*0601*07 to *09, Type: J

Type of alert: Products with serious risks

The bolts of the rear axle may not have been tightened to the necessary torque. This could lead to breakage of the rear axle and to loss of control over the vehicle, increasing the risk of an accident. /

Recall of the product from end users

Description: Passenger car

Batch number / Barcode:

NO

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/01200/20

Product: Roof rack

Name: Rapid Fixpoint XT

Risk type: Injuries

Category: Motor vehicles

Brand: Thule

Type / number of model: Model numbers: 3049, 3073, 3123, 3130, 3136, 3144

Type of alert: Products with serious risks

As the batch of screws in the mounting kit does not meet the specification, the roof rack system may not be properly secured to the vehicle. As a result, the roof rack system might become detached from the vehicle and the luggage on it (bicycle carriers and bicycles, roof boxes, etc.) could fall onto the road, endangering the following traffic.

Recall of the product from end users

Description: Roof rack for attaching loads to the roof of a vehicle.

Batch number / Barcode:

NO

Country of origin: Sweden

Alert submitted by: Germany

Products were found and measures were taken also in: Austria, Slovenia



Alert number: A12/01201/20

Product: Lorry/bus

Name: TGS

Risk type: Injuries

Category: Motor vehicles

Brand: MAN

Type / number of model: Type approval numbers: e4*2007/46*0234*37, e4*2007/46*0234*38

Type of alert: Products with serious risks

Due to incorrect parameterisation of the wheelbase, a sensing error could occur in the braking system. There is therefore a risk of delayed braking effect and thus an increased braking distance. /

Recall of the product from end users

Description: Lorries/buses

Batch number / Barcode: TI 7181

NO

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/01204/20

Product: Vehicle part/coupling ball

Name: Bosal, Oris

Risk type: Injuries

Category: Motor vehicles

Brand: ACPS

Type / number of model: Type-approval numbers: E1 55R – 011512, e1*94/20*1512, e1*94/20*0019, Types: D140, D 125/1

Type of alert: Products with serious risks

The affected batch was cast incorrectly and therefore cracking can occur during use. If further used, the ball of the trailer coupling breaks off and the trailer becomes detached from the vehicle, increasing the risk of an accident. /

Recall of the product from end users

Description: Vehicle part/coupling ball

Batch number / Barcode: 512-771/10007/20

NO

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/01205/20

Product: Passenger van / Light commercial vehicle

Name: Transit, Transit Custom

Risk type: Injuries

Category: Motor vehicles

Brand: Ford

Type / number of model: e1*2007/46*1100*16

Type of alert: Products with serious risks

The lower control arms fitted to vehicles may have missing or partial welds. As a result, the control arms could break, increasing the risk of an accident. /

Recall of the product from end users

Description: Passenger van / Light commercial vehicle

Batch number / Barcode: 20S47

NO

Country of origin: Turkey

Alert submitted by: United Kingdom

Alert number: A12/01206/20

Product: Passenger car

Name: A-Class

Risk type: Injuries

Category: Motor vehicles

Brand: Mercedes-Benz

Type / number of model: Type-approval number: e1*2007/46*1829*01-03, Type: F2A

Type of alert: Products with serious risks

The condensed water drainage hose of the air-conditioning system may not be properly fitted. In such a case condensed water from the air conditioning system could enter the passenger compartment of the vehicle, ending up in the footwells of the driver and passenger side and in the central tunnel. As a result, any electrical components installed there could be corroded and/or subjected to short circuits or leakage currents. As a consequence, the SRS control unit could stop working, the vehicle may fail to start, the engine emergency run could be activated while driving, and the functioning of other components (e.g. the fuel pump, automatic/manual emergency call) could be adversely affected. /

Recall of the product from end users

Description: Model series: BR 177

Batch number / Barcode: 8391001

NO

Country of origin: Germany

Alert submitted by: Germany

Products were found and measures were taken also in: Greece

Alert number: A12/01207/20

Product: Passenger car

Name: Juke, Navara, Note, Pulsar, Qashqai

Risk type: Injuries

Category: Motor vehicles

Brand: Nissan

Type / number of model: Type-approval number: Individual approval, Types: Pulsar (C13), Navara NP300 (D23), Note (E12), Juke (F15), Qashqai (J11)

Type of alert: Products with serious risks

The child lock on the rear doors could be defective. As a result, it might be possible to open the door even when the child lock is activated, increasing the risk of an accident. /

Recall of the product from end users

Description: Vehicles with right-hand drive.

Batch number / Barcode: PS0C1

NO

Country of origin: Spain

Alert submitted by: Germany

Alert number: A12/01192/20

Product: Plush toy

Name: Plush animals

Risk type: Chemical

Category: Toys

Brand:

Type / number of model: Item. S-2019014

Type of alert: Products with serious risks

The plastic material of the product's suction cup contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and (measured values: up to 37 % by weight). DEHP may harm the health of children, causing possible damage to their reproductive system. / The product does not comply with the REACH Regulation.

Import rejected at border

Description: Plush toy (in different shapes, including sheep, zebra, crocodile) with tab and suction cup.

Batch number / Barcode: 6420190140142

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Finland



Alert number: A12/01197/20

Product: Plastic doll

Name: my first Fashion Perfect

Risk type: Chemical

Category: Toys

Brand:

Type / number of model: Item: S7080, NO. 958 (on packaging)

Type of alert: Products with serious risks

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 9% by weight) and di-isononyl phthalate (DINP) (measured value up to 7.8% by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system. / The product does not comply with the REACH Regulation.

Withdrawal of the product from the market

Description: Plastic doll, available with different styles and hair.

Batch number / Barcode: 5907714497469

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: A12/01202/20

Product: Plastic doll

Name: Sweet Princess the First

Risk type: Chemical

Category: Toys

Brand:

Type / number of model: Item N0: TC55530, N0.DY810

Type of alert: Products with serious risks

The plastic material of the toy contains an excessive amount of bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 20.1% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. / The product does not comply with the REACH Regulation.

Destruction of the product, Withdrawal of the product from the market


Description: Plastic doll.

Batch number / Barcode: 5907714492372

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland

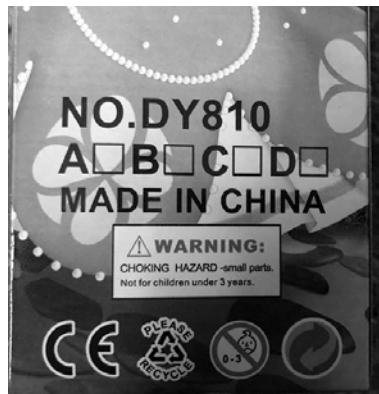

Alert number: A12/01203/20

Product: Set of rubber ducks

Name: Zabawka

Risk type: Chemical

Category: Toys

Brand:

Type / number of model: N0: TC35904

Type of alert: Products with serious risks

The plastic material of the toy contains an excessive amount of bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 14.6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. / The product does not comply with the REACH Regulation.

Destruction of the product, Withdrawal of the product from the market

Description: Set of rubber ducks consisting of one big duck and three small ducks.

Batch number / Barcode: 5902135839874

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: A12/01209/20

Product: Toy gun

Name: Dekoracja

Risk type: Choking

Category: Toys

Brand:

Type / number of model: N0:2018 , Q180901043

Type of alert: Products with serious risks

The suction cups of the projectiles can easily detach. If a child puts the projectile in the mouth, the suction cup could detach and obstruct the airways. / The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.

Withdrawal of the product from the market

Description: Plastic toy gun supplied with two projectiles with suction cups.

Batch number / Barcode: 5907221694481

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: A12/01210/20

Product: Toy slime

Name: Brokatowy Slime z Jednorozcem

Risk type: Chemical

Category: Toys

Brand:

Type / number of model:

Type of alert: Products with serious risks

The migration of boron from the toy is too high (measured value: 1592 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.

Destruction of the product

Description: Toy slime with glitter including a plastic figurine of a unicorn.

Batch number / Barcode:

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: A12/01199/20

Product: Skin lightening cream

Name: Aneeza Gold Beauty cream

Risk type: Chemical

Category: Cosmetics

Brand:

Type / number of model:

Type of alert: Products with serious risks

The product contains mercury (measured value: 21.3 g/kg). Mercury accumulates in the body and can damage the kidneys, brain and nervous system. Additionally, it may affect reproduction and the unborn child. / The product does not comply with the Cosmetic Products Regulation.

Ban on the marketing of the product and any accompanying measures

Description: 20g of skin lightening cream in a plastic jar.

Batch number / Barcode: 1143723500026

UNKNOWN

Country of origin: Pakistan

Alert submitted by: Sweden



Alert number: A12/01191/20

Product: Mobile USB charger

Name: MOBILE CHARGER HD 3.4A - 2 USB

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Tecnoware

Type / number of model: FAM17197

Type of alert: Products with serious risks

The electrical insulation is inadequate and the clearance/creepage distances between the primary and accessible secondary circuits are not sufficient. The user could receive an electric shock from accessible (live) parts. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950-1 and the relevant standards SFS 5610 and IEC 60884-1.

Recall of the product from end users

Description: Mobile USB charger with the following electrical specifications: Input: 110 - 240 V~, 50 / 60 Hz, 0,2 A. Suojausluokka II / Class II USB Outputs: 5 VDC, 3,4 A Max

Batch number / Barcode: 8026475171979

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Finland



Alert number: A12/01196/20

Product: Electric kettle

Name: Czajnik elektryczny

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Lucznik

Type / number of model: WK 1800 S

Type of alert: Products with serious risks

The insulation of the supply cable may easily get damaged, leaving live parts accessible to the user. The user may consequently receive an electric shock. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-2-15.

Withdrawal of the product from the market



Description: Electric kettle.

Batch number / Barcode: 5902022181758

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland

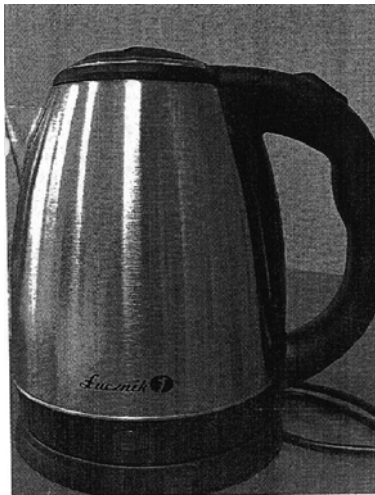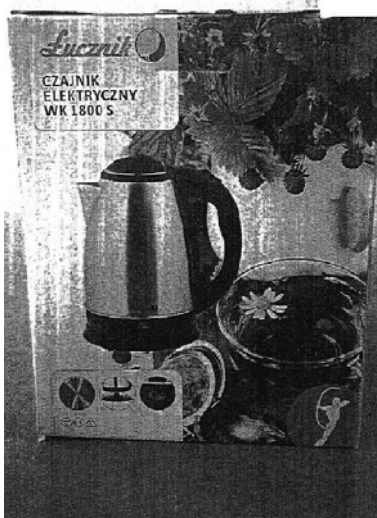

Alert number: A12/01208/20

Product: Ceiling fan and LED light unit

Name: Ceiling fan and LED light unit

Risk type: Electric shock

Category: Electrical appliances and equipment

Brand: Fcmila

Type / number of model: DZ0152-1

Type of alert: Products with serious risks

The electric strength of the product is not sufficient. Consequently, accessible parts may become live and the user can receive an electric shock. / The product does not comply with the requirements of the Low Voltage Directive.

Destruction of the product

Description: 500mm ceiling fan and LED light unit.

Batch number / Barcode:

NO

Country of origin: People's Republic of China

Alert submitted by: United Kingdom



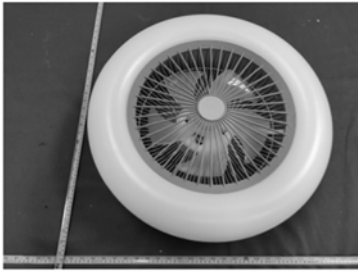


Figure 1

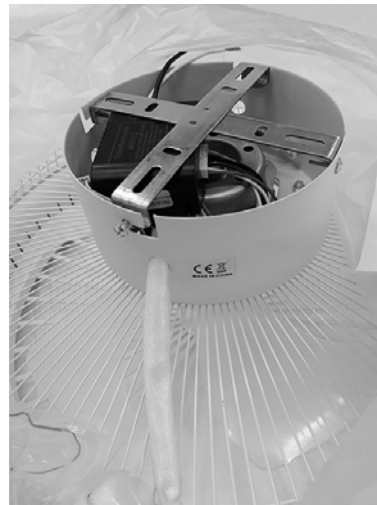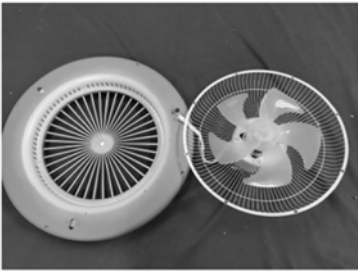

Alert number: INFO/00122/20

Product: Garden table

Name:

Risk type: Injuries

Category: Furniture

Brand:

Type / number of model:

Type of alert: Products with other risk levels

There are sharp edges, cracks and accessible dents and holes in the table. A user might consequently suffer injuries or cuts during use. / The product does not comply with the relevant European standard EN 581.

Ban on the marketing of the product and any accompanying measures

Description: Wooden garden table, oval shape and rustic colour. Dimensions 100 cm x 50 cm.

Batch number / Barcode:

NO

Country of origin: Indonesia

Alert submitted by: Bulgaria



Alert number: A11/00076/20

Product: Toy water gun

Name: Super Soaker Water Blaster

Risk type: Chemical

Category: Toys

Brand: Nerf

Type / number of model: XP20, XP30

Type of alert: Products with other risk levels

The ink on the sticker of some water tanks on the product contains an excessive amount of lead (measured value up to 13889 mg/kg). Lead is harmful to human health, accumulates in the body and can cause developmental neurotoxicity. / The product does not comply with the REACH Regulation.

Recall of the product from end users

Company recall page: <http://www.supersoakerrecall.com> (<http://www.supersoakerrecall.com>)

Description: Two models of super soaker water blasters. XP20 model is a green and orange water blaster, XP30 is a blue and orange water blaster.

Batch number / Barcode: 5 010993629916, 5010993629893

NO

Country of origin: India

Alert submitted by: United Kingdom



Alert number: A11/00077/20

Product: Activity play mat

Name: Big Owl

Risk type: Choking

Category: Toys

Brand: Britton

Type / number of model: B2301

Type of alert: Products with other risk levels

The fibrous stuffing material of half ball shaped hanging toy is easily accessible due to the weakness of certain seams. A small child may put the stuffing material in the mouth and choke on it. / The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standards EN 71-1.

Withdrawal of the product from the market

Description: Colourful baby play mat with arches from which several toys are hanging.

Batch number / Barcode: 473171023015

NO

Country of origin: People's Republic of China

Alert submitted by: Finland

