



🏠 [Safety Gate home \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/repository/content/pages/rapex/index\\_en.htm\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/repository/content/pages/rapex/index_en.htm)

☰ [Back to report listings \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.listNotifications&year=2021&Ing=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.listNotifications&year=2021&Ing=en)

🔍 [Search alerts \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=main.search&Ing=en\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=main.search&Ing=en)

👍 [IPSW \(https://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/alerts/?event=ipsw:home\)](https://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/alerts/?event=ipsw:home)

## The Rapid Alert System for Non-Food Products (RAPEX)

# RAPEX - Weekly overview report of notifications

Week 3 - 2021

The alerts published on this weekly report notified by the United Kingdom were submitted in 2020, although the reference number indicates 2021.

Alert number: A12/00073/21

Product: Hand disinfectant

Name: Pilot Dezinfekcijas līdzeklis

Risk type: Chemical

Category: Chemical products

Brand: Pilot

Type / number of model:

Type of alert: Products with serious risks

The product contains methanol (measured value: 7 % by weight), which is acutely toxic to the central nervous system and to the eyes.

Furthermore, the required hazard pictograms are missing. Users have therefore no information on the toxicity and flammability of the product. The packaging is not fitted with child-resistant fastening. Ingestion or contact with methanol may lead to blindness and death. / The product does not comply with the Biocidal Products and the Classification, Labelling and Packaging (CLP) Regulations.

Withdrawal of the product from the market

Description: Transparent liquid in a plastic bottle.

Batch number / Barcode: 4752215002831

NO

Country of origin: Latvia

Alert submitted by: Sweden



Alert number: A12/00074/21

Product: Hand disinfectant

Name: Solenal To Go

Risk type: Health risk / other

Category: Chemical products

Brand: Solenal

Type / number of model: To Go

Type of alert: Products with serious risks

The product contains too little active chlorine to be effective as disinfectant (measured value: less than 0.016 mg/g). Therefore, it will not provide any disinfectant effect and thus not properly protect if not combined with additional measures. / The product does not comply with the Biocidal Products Regulation.

Ban on the marketing of the product and any accompanying measures, Recall of the product from end users, Warning consumers of the risks



Description: White plastic bottle with spray mechanism and black lettering, containing 50 ml of hand disinfectant.

Batch number / Barcode: 4260636050015

NO

Country of origin: Germany

Alert submitted by: Germany

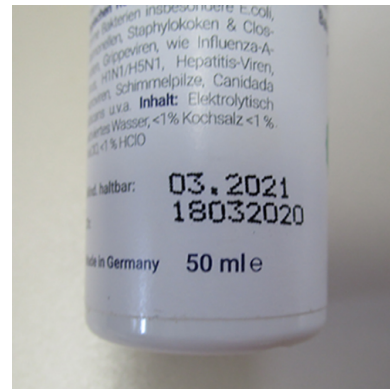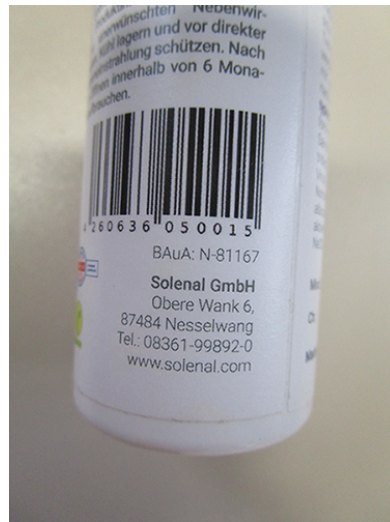

Alert number: A12/00055/21

Product: Light Bulb

Name: LED Bulb Lamp

Risk type: Electric shock

Category: Lighting equipment

Brand: Yuan Bo Lighting

Type / number of model: AC220-240V 6500K 2020.M

Type of alert: Products with serious risks

The lens cap of the bulb can be removed without any tool which provides access to live parts. A user or a child could touch them and receive an electric shock. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 62560.

Recall of the product from end users, Removal of this product listing by the online marketplace

Description: Smart LED E27 5W 7W 9W 12W Emergency Light Bulb Rechargeable Intelligent Lamps H. The product is sold online, in particular via Wish.com.

Batch number / Barcode: 6918719614125

NO

Country of origin: People's Republic of China

Alert submitted by: United Kingdom



Alert number: A12/00057/21

Product: Circular saw blade

Name: Drillpro-4-Inch-14-Teeth-Grinder-Chain-Disc-16mm-Arbor-Wood-Carving-Disc-For-100115-Angle-Grinder

Risk type: Cuts, Injuries

Category: Machinery

Brand: Drillpro

Type / number of model: Banggood ID number 1385981

Type of alert: Products with serious risks

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries. / The product does not comply with the requirements of the Machinery Directive and with the relevant European standards EN 62841 and EN 60745.

Recall of the product from end users

Description: Wood Carving Chain Disc for Angle Grinder. The product was advertised as suitable for use on commercial angle grinders and was sold online.

Batch number / Barcode:

UNKNOWN

Country of origin: Unknown

Alert submitted by: Denmark



Alert number: A12/00058/21

Product: Circular saw blade

Name: Drillpro-4-Inch-Grinder-Chain-Disc-22mm-Arbor-22-Tooth-Wood-Carving-Disc-For-115125mm-Angle-Grinder

Risk type: Cuts, Injuries

Category: Machinery

Brand: Drillpro

Type / number of model: Banggood ID number 1441967

Type of alert: Products with serious risks

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries. / The product does not comply with the requirements of the Machinery Directive and with the relevant European standards EN 62841 and EN 60745.

Recall of the product from end users

Description: Wood Carving chain Disc for Angle Grinders. The product was advertised as suitable for use on commercial angle grinders and was sold online.

Batch number / Barcode:

UNKNOWN

Country of origin: Unknown

Alert submitted by: Denmark



Alert number: A12/00069/21

Product: Circular saw blade

Name: Drillpro-4-Inch-16mm-Grinder-Chain-Disc-22-Tooth-Wood-Carving-Disc-For-100-or-115-Angle-Grinder

Risk type: Cuts, Injuries

Category: Machinery

Brand: Drillpro

Type / number of model: Banggood id number 1311538

Type of alert: Products with serious risks

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries. / The product does not comply with the requirements of the Machinery Directive and with the relevant European standards EN 62841 and EN 60745.

Recall of the product from end users

Description: Wood Carving chain Disc for Angle Grinders. The product was advertised as suitable for use on commercial angle grinders and was sold online.

Batch number / Barcode:

UNKNOWN

Country of origin: Unknown

Alert submitted by: Denmark



Alert number: A12/00070/21

Product: Circular saw blade

Name: 4 Inch Grinder Chain Disc with 2pcs Chain 5/8 Inch Arbor 22 Tooth Wood Carving Disc for 100/115

Risk type: Cuts, Injuries

Category: Machinery

Brand:

Type / number of model: Banggood ID 1442964

Type of alert: Products with serious risks

The circular saw blade may be mounted on an angle grinder and may therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries. / The product does not comply with the requirements of the Machinery Directive and the relevant European standards EN 62841 and EN 60745.

Recall of the product from end users

Description: Wood Carving Chain Disc for Angle Grinders. It was advertised as suitable for use on standard commercial angle grinders and sold online.

Batch number / Barcode:

NO

Country of origin: Unknown

Alert submitted by: Denmark



Alert number: A12/00062/21

Product: Passenger car

Name: e-UP!

Risk type: Fire

Category: Motor vehicles

Brand: VW

Type / number of model: e13\*2007/46\*1167\*, Type: AA

Type of alert: Products with serious risks

An insulation malfunction can lead to a short circuit in the battery system. In the event of a double malfunction (i.e. two affected cell modules in one battery), this could potentially lead to a fire. /

Recall of the product from end users

Description: Passenger car

Batch number / Barcode: 93i9

NO

Country of origin: Slovakia

Alert submitted by: Germany

Products were found and measures were taken also in: Denmark, Slovenia, Sweden

Alert number: A12/00063/21

Product: Passenger car

Name: Crafter

Risk type: Injuries

Category: Motor vehicles

Brand: VW

Type / number of model: Types: 2EKE2, 2EKZ, 2FJE1, 2FJE2, 2FJZ, 2EC1, 2EC2, 2EKE1, SYN1E, SYN1Z, SZN1E, SZN1Z, SYN2E, SYN2Z, SZN2E, SZN2Z, e1\*2001/116\*0355\*, e1\*2001/116\*0356\*, e1\*2007/46\*0513\*, e1\*2007/46\*0516\*, e1\*2007/46\*0514\*, e1\*2007/46\*0515\*, e1\*2007/46\*0520\*, e1\*2007/46\*0518\*, e1\*2007/46\*0519\*, e1\*2007/46\*0521\*, e1\*2007/46\*0522\*, e1\*2007/46\*0523\*, e1\*2007/46\*0524\*, e1\*2007/46\*0525\*, e1\*2007/46\*1613\*, e1\*2007/46\*1615\*, e1\*2007/46\*1619\*, e1\*2007/46\*1621\*, e1\*2007/46\*1614\*, e1\*2007/46\*1616\*, e1\*2007/46\*1620\*, e1\*2007/46\*1622\*, L769\* L770\*, L847\*, L767\*, L768\*, L846\*

Type of alert: Products with serious risks

The propellant used in the airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants. /

Recall of the product from end users

Description: Vehicles with a passenger airbag manufactured by Takata.

Batch number / Barcode: 69V5

NO

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/00064/21

Product: Passenger car

Name: UP

Risk type: Injuries

Category: Motor vehicles

Brand: VW

Type / number of model: Type-approval number: e13\*2007/46\*1167\*, Type: AA

Type of alert: Products with serious risks

The propellant used in the airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants. /

Recall of the product from end users

Description: Vehicles with a passenger airbag manufactured by Takata.

Batch number / Barcode: 69BF

NO

Country of origin: Slovakia

Alert submitted by: Germany

Alert number: A12/00065/21

Product: Vehicle part / wheel spacer

Name: NAB-0955-IL

Risk type: Injuries

Category: Motor vehicles

Brand: I.L. Motorsport

Type / number of model: 132XT0243-02; Type: NAB-0955

Type of alert: Products with serious risks

The spacer rings on the part may be defective. As a result, they may break, increasing the risk of an accident. /

Withdrawal of the product from the market

Description: Wheel spacer.

Batch number / Barcode: 512-771/10406/20

NO

Country of origin: Germany

Alert submitted by: Germany



Alert number: A12/00066/21

Product: Passenger car

Name: ION

Risk type: Injuries

Category: Motor vehicles

Brand: PEUGEOT

Type / number of model: Type-approval numbers: e2\*2007/46\*0068\*06, e2\*2007/46\*0069\*00 - \*07, e2\*2007/46\*0158\*00, Type: 1

Type of alert: Products with serious risks

An internal component of the vacuum pump in the braking power assistance system could be defective. Over time this could lead to a loss of braking assistance, increasing the risk of an accident. /

Recall of the product from end users

Company recall page: <https://www.peugeot.de/teile-und-zubehor/prufung-ihres-fahrzeugs-auf-ruckrufaktionen.html> (<https://www.peugeot.de/teile-und-zubehor/prufung-ihres-fahrzeugs-auf-ruckrufaktionen.html>)

Description: Passenger car

Batch number / Barcode: JVA

NO

Country of origin: Japan

Alert submitted by: Germany

Products were found and measures were taken also in: Poland, Slovenia, Sweden



Alert number: A12/00067/21  
Product: Passenger car  
Name: C-Zero  
Risk type: Injuries  
Category: Motor vehicles  
Brand: CITROEN  
Type / number of model: Type-approval numbers: e2\*2007/46\*0068\*00 - \*07, e2\*2007/46\*0157\*00, Type: 1  
Type of alert: Products with serious risks  
An internal component of the vacuum pump in the braking power assistance system could be defective. Over time, this could lead to a loss of braking assistance, increasing the risk of an accident. /  
Recall of the product from end users  
Company recall page: <https://www.citroen.de/zubehoer-service/instandhaltung-und-reparatur/pruefen-ihres-fahrzeuges-auf-rueckrufaktion.html>  
(<https://www.citroen.de/zubehoer-service/instandhaltung-und-reparatur/pruefen-ihres-fahrzeuges-auf-rueckrufaktion.html>)  
Description: Passenger car  
Batch number / Barcode: HBS  
NO  
Country of origin: Japan  
Alert submitted by: Germany  
Products were found and measures were taken also in: Poland, Sweden

Alert number: A12/00068/21  
Product: Passenger car  
Name: V60, V60CC, V90, V90CC, XC60 and XC90  
Risk type: Injuries  
Category: Motor vehicles  
Brand: Volvo  
Type / number of model: Types: 225, 227, 235, 236, 246, 256; Chassis: 0421125 - 0422417 // 0067970 - 0068306 // 0161949 - 0162075 // 0132890 - 0133072 // 0722021 - 0728723 // 0688074 - 0692218. , e4\*2007/46\*1315\*09, e4\*2007/46\*1315\*09, e4\*2007/46\*1067\*10, e4\*2007/46\*1067\*09, e4\*2007/46\*1067\*10, e4\*2007/46\*1220\*10, e4\*2007/46\*0929\*15  
Type of alert: Products with serious risks  
The control unit on the SRS (Supplementary Restraint System) may not be attached to the car body according to the specifications. As a result, the occupant protection function of the SRS could be impaired, increasing the risk of injury in the event of an accident. /  
Recall of the product from end users  
Description: Volvo V60, V60CC, V90, V90CC, XC60 and XC90 vehicles (model year 2021).  
Batch number / Barcode: R10068  
NO  
Country of origin: Sweden  
Alert submitted by: Portugal  
Products were found and measures were taken also in: Belgium, Denmark, Germany, Greece, Slovakia, Sweden

Alert number: A12/00080/21  
Product: Passenger car  
Name: Q5, A5  
Risk type: Injuries  
Category: Motor vehicles  
Brand: Audi  
Type / number of model: Type-approval numbers: e13\*2007/46\*1084\*, e1\*2001/116\*0430\*, e13\*2007/46\*1083\*, e1\*2001/116\*0473\*, e13\*2007/46\*1179\*, Types: B8, B81, 8R, 8R1, 8R2  
Type of alert: Products with serious risks  
The propellant used in the airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants. /  
Recall of the product from end users  
Description: Vehicles with a driver airbag manufactured by Takata.  
Batch number / Barcode: 69R7  
NO  
Country of origin: Germany  
Alert submitted by: Germany

Alert number: A12/00081/21  
Product: Passenger van / Light commercial vehicle  
Name: eSprinter, eVito  
Risk type: Fire, Injuries  
Category: Motor vehicles  
Brand: Mercedes-Benz  
Type / number of model: e1\*2007/46\*0457\*20 - \*22, e1\*2007/46\*0458\*14 - \*17, e1\*2007/46\*1760\*02 Typ lt.Typgen.: 639/2, 639/4, KL3A4  
Type of alert: Products with serious risks  
Water may ingress into the high voltage battery due to insufficient sealing of the battery casing and possible corrosion. As a result the vehicle may not be able to start and furthermore, this could lead to increased risk of fire. /  
Recall of the product from end users  
Description: Passenger van / Light commercial vehicle  
Batch number / Barcode: VXEKOSCHU  
NO  
Country of origin: Germany  
Alert submitted by: Germany

Alert number: A12/00082/21  
Product: Passenger car  
Name: AYGO  
Risk type: Injuries  
Category: Motor vehicles  
Brand: TOYOTA  
Type / number of model: e6\*2007/46\*0348\*03  
Type of alert: Products with serious risks  
The seam of the rear seat inner safety belt may break. As a result, the proper functioning of the occupant restraint systems cannot be guaranteed in the event of an accident, increasing the risk of injury. /  
Recall of the product from end users  
Description: AYGO – frame code KGB40, WMI: JTD, Range by frame number: VDS – VIS: JGNEC# - 0N569824-0N577423, KGNEC# - 0N569303-0N577522  
Batch number / Barcode: 20SMD-114  
NO  
Country of origin: Belgium  
Alert submitted by: Bulgaria  
Products were found and measures were taken also in: Croatia, Greece, Poland, Slovenia, Sweden

Alert number: A12/00083/21  
Product: Passenger van / Light commercial vehicle  
Name: EQV, eVito  
Risk type: Injuries  
Category: Motor vehicles  
Brand: MERCEDES-BENZ  
Type / number of model: Type-approval number: e1\*2007/46\*0457\*25, Type: 639/2  
Type of alert: Products with serious risks  
The vehicles are equipped with non-reinforced suspension struts. This may impair the wheel control, increasing the risk of an accident. /  
Recall of the product from end users  
Description:  
Batch number / Barcode: V2EFEDBEI  
NO  
Country of origin: Germany  
Alert submitted by: Germany  
Products were found and measures were taken also in: Greece, Poland

Alert number: A12/00084/21  
Product: Passenger car  
Name: Corsa  
Risk type: Injuries  
Category: Motor vehicles  
Brand: Opel  
Type / number of model: Type-approval numbers: e2\*2007/46\*0639\*05 and \*06, Type: U  
Type of alert: Products with serious risks  
The bolting of the lower transverse arm may be improper. This can impair the driving stability, increasing the risk of an accident. /  
Recall of the product from end users  
Description: Passenger car  
Batch number / Barcode: E202007480 (20-C-149)  
NO  
Country of origin: Spain  
Alert submitted by: Germany

Alert number: A12/00085/21  
Product: Passenger car  
Name: Stinger  
Risk type: Fire, Injuries  
Category: Motor vehicles  
Brand: KIA  
Type / number of model: e11\*2007/46\*4002\*03  
Type of alert: Products with serious risks  
The electrical circuit within the HECU (hydraulic electronic control unit) may experience a short circuit condition. The resulting excessive current can cause fire in the engine compartment, and consequently, increase the risk of an accident. /  
Recall of the product from end users  
Description: KIA Stinger (CK), Model years: 2018, 2019.  
Batch number / Barcode:  
NO  
Country of origin: Republic of Korea  
Alert submitted by: Poland  
Products were found and measures were taken also in: Sweden

Alert number: A12/00079/21  
Product: Fireworks  
Name: Traca 25MTR  
Risk type: Injuries  
Category: Pyrotechnic articles  
Brand: Salon Roger Fireworks  
Type / number of model: 1395-F2-0168/2019, SFA25M  
Type of alert: Products with serious risks  
The product could not explode or not explode fully when trying to ignite or it could explode at unexpected time. The user could go back to the firework and maybe even manipulate it and receive multiple injuries from the unexpected explosion. / The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.  
Withdrawal of the product from the market  
Description: Battery of bangers cat. F2, 1 piece per box.  
Batch number / Barcode:  
NO  
Country of origin: People's Republic of China  
Alert submitted by: Belgium



Alert number: A12/00059/21

Product: Plastic toy

Name: Yellow Duck

Risk type: Chemical

Category: Toys

Brand:

Type / number of model:

Type of alert: Products with serious risks

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 24,7% by weight) and dibutyl phthalate (DBP) (measured value up to 8,6% by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system. / The product does not comply with the REACH Regulation.

Destruction of the product

Description: Plastic yellow ducks.

Batch number / Barcode: 8576778036333

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: A12/00060/21

Product: Plastic doll

Name: Fish Doll

Risk type: Chemical

Category: Toys

Brand:

Type / number of model: W158A

Type of alert: Products with serious risks

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 33,6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. / The product does not comply with the REACH Regulation.

Destruction of the product

Description: Mermaid - plastic doll.

Batch number / Barcode: 5920190103105

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: A12/00061/21

Product: Plastic doll

Name: Beauty Endless Hair Kingdom

Risk type: Chemical

Category: Toys

Brand:

Type / number of model: 2001B

Type of alert: Products with serious risks

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 35,8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. / The product does not comply with the REACH Regulation.

Destruction of the product

Description: Plastic doll.

Batch number / Barcode: 2018012120010

NO

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: A12/00071/21

Product: Toy slime

Name:

Risk type: Chemical

Category: Toys

Brand:

Type / number of model: NO. 8236, intet batchnummer

Type of alert: Products with serious risks

The toy contains an excessive amount of 5-Chloro-2-methyl-isothiazolin-3(2H)-one (CMI), (measured value up to 4.7 mg/kg). This substance can cause eye and skin irritation, burns and are toxic. / The product does not comply with the requirements of the Toy Safety Directive.

Recall of the product from end users Warning consumers of the risks

Description: Large container with pink-colored slime.

Batch number / Barcode:

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Denmark



Alert number: A12/00072/21

Product: Toy slime

Name:

Risk type: Chemical

Category: Toys

Brand:

Type / number of model: BDD: 12/2019; Lot# 0151843

Type of alert: Products with serious risks

The toy contains an excessive amount of 2-methylisothiazolin-3(2H)-one (MI), (measured value up to 7.9 mg/kg). This substance can cause eye and skin irritation, burns and are toxic. / The product does not comply with the requirements of the Toy Safety Directive.

Withdrawal of the product from the marketBan on the marketing of the product and any accompanying measures

Description: Toy slime in tiny package shaped like a ghost.

Batch number / Barcode:

NO

Country of origin: Germany

Alert submitted by: Denmark



Alert number: A12/00086/21

Product: Balloons

Name: 8 Balloons

Risk type: Chemical

Category: Toys

Brand: Keleidoscope party

Type / number of model:

Type of alert: Products with serious risks

The amount of N-nitrosatable substances released by the balloons is too high (measured value up to 2,33 mg/kg). Nitrosatable compounds can be converted into nitrosamines, which are genotoxic carcinogens via inhalation, ingestion or dermal exposure. A child can get exposed to them by putting the balloon in the mouth. / The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

Withdrawal of the product from the market

Description: There are eight balloons (yellow, green, blue and red) in each bag.

Batch number / Barcode: 5055977063720

UNKNOWN

Country of origin: Vietnam

Alert submitted by: Malta





Alert number: A12/00056/21

Product: Children's shorts

Name:

Risk type: Injuries

Category: Clothing, textiles and fashion items

Brand: O'Neill

Type / number of model: 0A7574 LG Chilling Color 4084 Pink Lemonade

Type of alert: Products with serious risks

The shorts have long drawstrings with free ends to be tied at the front of the waist area. They can become trapped during various activities of a child, leading to injuries. / The product does not comply with the relevant European Standard EN 14682.

Recall of the product from end users

Company recall page: <https://support.oneill.com/hc/nl/articles/360018249160-Veiligheidswaarschuwing-voor-O-Neill-Girls-Sweat-Short>  
(<https://support.oneill.com/hc/nl/articles/360018249160-Veiligheidswaarschuwing-voor-O-Neill-Girls-Sweat-Short>)

Description: Sport shorts in pink.

Batch number / Barcode: 8719403667223

NO

Country of origin: India

Alert submitted by: Belgium



Alert number: A12/00075/21  
Product: Children's sweatshirt  
Name:  
Risk type: Strangulation  
Category: Clothing, textiles and fashion items  
Brand: BODY MOVE  
Type / number of model: K. SW. SHIRT 1745  
Type of alert: Products with serious risks

There are long functional cords with free ends in the hood of the product. They can become trapped during various activities of a child, leading to strangulation. / The product does not comply with the relevant European Standard EN 14682.

Withdrawal of the product from the market

Description: Young children hooded sweatshirt. Designed for 4 years old children and bears long drawstrings with free ends at the hood.

Batch number / Barcode:

NO

Country of origin: Greece

Alert submitted by: Cyprus



Alert number: A12/00076/21  
Product: Leather bra  
Name: Leder BH mit Bügel 75 Bsw  
Risk type: Chemical  
Category: Clothing, textiles and fashion items  
Brand: ZADO  
Type / number of model: Supplier Nummer 881 Art. Nr. 020.20009111231  
Type of alert: Products with serious risks

The product contains chromium (VI) (measured value up to: 4.9 mg/kg) that may come into contact with the skin. Chromium (VI) is sensitising and can trigger allergic reactions and can cause cancer. / The product does not comply with the REACH Regulation.

Stop of sales, Withdrawal of the product from the market

Description: Black leather bra; Back of the bra and adjustable strap made of black textile; Outside of the cup and material below the cup made of black leather; Middle layer of cup made of foam.

Batch number / Barcode:

NO

Country of origin: Turkey

Alert submitted by: Germany



Alert number: A12/00077/21

Product: Extension lead

Name: Listwa ochronna 5-gniazdowa

Risk type: Electric shock, Fire

Category: Electrical appliances and equipment

Brand: dpm

Type / number of model: Model: KD-1115FM, Type: FMP5130

Type of alert: Products with serious risks

The product is missing the overcurrent protector. Thus, in overvoltage conditions, the circuits may overheat and cause fire. The cable is inadequately soldered and may detach leaving live parts accessible. The user may get electrocuted. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950-1.

Withdrawal of the product from the market



Description: White extension lead with five socket outlets and a switch. Advertised as having an overcurrent protector (varistor).



Batch number / Barcode: EAN 5906881190753

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland

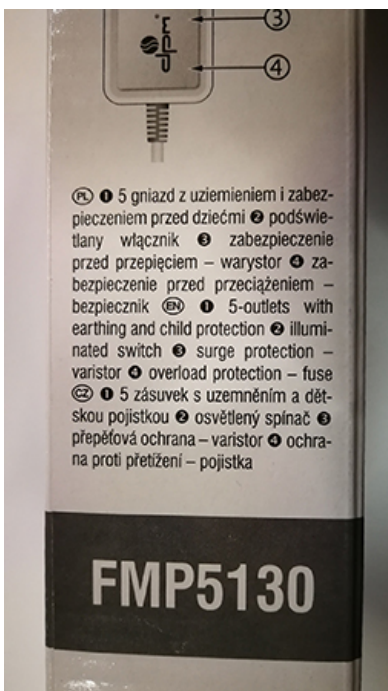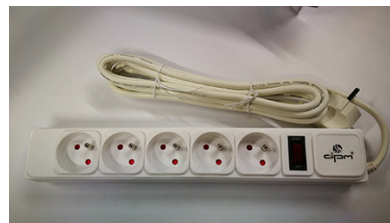

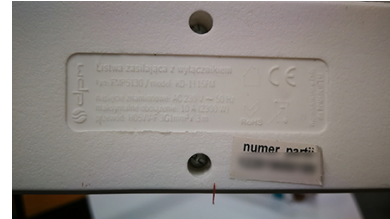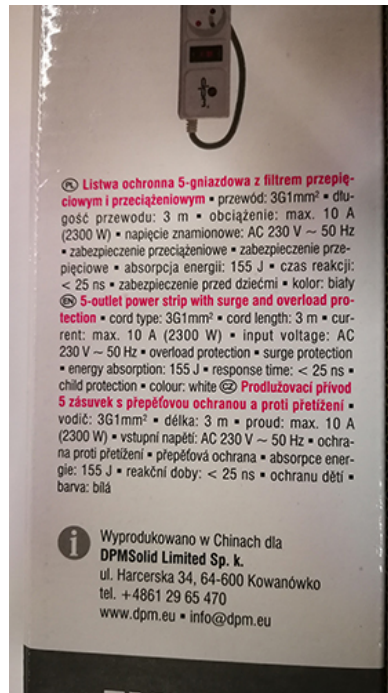

Alert number: A12/00078/21

Product: USB Charger

Name: Travel Adapter

Risk type: Electric shock, Fire

Category: Electrical appliances and equipment

Brand:

Type / number of model: ETA-U90EWE

Type of alert: Products with serious risks

The electrical insulation and the creepage/clearance distances are inadequate. The user may receive an electric shock from live parts. The device may overheat and cause fire. / The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950-1

Withdrawal of the product from the market

Description: Charger with two USB ports.

Batch number / Barcode:

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Poland



Alert number: INFO/00005/21  
 Product: Light Bulb  
 Name: CARPOINT halogen super white H4  
 Risk type: Injuries  
 Category: Motor vehicles  
 Brand: CARPOINT  
 Type / number of model: E13 271  
 Type of alert: Products with other risk levels

As the approval certificate is counterfeit, the conformity of the product could not be approved by the competent authority. As a consequence, the light emitted might be too strong and dazzle the eyes of other drivers or too weak and the driver may not see the road well, increasing the risk of an accident. There is a valid UNECE-R37 type approval from the Luxembourgish authority for a H4 light bulb from another manufacturer in China. The certificate provided by the importer (of the described product) was counterfeit and mentioned a manufacturer in Taiwan. /

Withdrawal of the product from the market

Description: Pack of 2 replacement H4 halogen light bulbs with marking MICHIBA H4 12V60/55W E13 271 1810. The product is sold online, in particular via Amazon.

Batch number / Barcode:

YES

Country of origin: Unknown

Alert submitted by: Luxembourg



Alert number: INFO/00004/21  
 Product: Particle filter mask  
 Name: Disposable face mask  
 Risk type: Health risk / other  
 Category: Protective equipment  
 Brand: DMC

Type / number of model: DM-100

Type of alert: Products with other risk levels

The product bears a CE marking but is not certified as protective equipment by a relevant body. Consequently, the product might not fulfil the health and safety requirements and thus not properly protect if not combined with additional measures. / The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.

Removal of this product listing by the online marketplace, Withdrawal of the product from the market

Description: Black or pink three-layer masks, with the indication "PPE category 1/type IIR".

Batch number / Barcode:

UNKNOWN

Country of origin: Unknown

Alert submitted by: Estonia



Alert number: INFO/00006/21

Product: Particle filter mask

Name: KN95

Risk type: Health risk / other

Category: Protective equipment

Brand:

Type / number of model: BH1083X-010

Type of alert: Products with other risk levels

The product advertises a protective potential against (viral) particles but its filtering capacity has not been certified by a relevant (European) body. Consequently, the product might not fulfil the health and safety requirements and thus not properly protect if not combined with additional measures. / The product does not comply with the Personal Protective Equipment Regulation.

Withdrawal of the product from the market

Description: White respiratory protective half-face mask.

Description: White respiratory protective half-face mask.

Batch number / Barcode: 5902628219800

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Latvia



Alert number: INFO/00007/21

Product: Particle filter mask

Name:

Risk type: Health risk / other

Category: Protective equipment

Brand:

Type / number of model: SYM-001

Type of alert: Products with other risk levels

The product bears a CE marking but is not certified as protective equipment by the relevant body. Consequently, the product might not fulfill the health and safety requirements and properly protect when combined with additional measures. / The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.

Import rejected at border

Description: White respiratory protective half-face mask.

Batch number / Barcode:

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Luxembourg



Alert number: INFO/00008/21  
Product: Particle filter mask  
Name: Disposable medical mask FFP2 NR  
Risk type: Health risk / other  
Category: Protective equipment  
Brand:

Type / number of model: DN-68

Type of alert: Products with other risk levels

The product bears a CE marking but is not certified as protective equipment by the relevant body. Consequently, the product might not fulfill the health and safety requirements and properly protect when combined with additional measures. / The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.

Import rejected at border

Description: Disposable medical face mask.

Batch number / Barcode:

UNKNOWN

Country of origin: People's Republic of China

Alert submitted by: Luxembourg



Alert number: INFO/00009/21  
Product: Particle filter mask  
Name: KN95 Particulate Respirator  
Risk type: Health risk / other  
Category: Protective equipment  
Brand:

Type / number of model: KN95 FFP2

Type of alert: Products with other risk levels

The product bears a CE marking but is not certified as protective equipment by the relevant body. Consequently, the product might not fulfill the health and safety requirements and properly protect when combined with additional measures. / The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.

Import rejected at border

Description: White respiratory protective half-face mask.

Batch number / Barcode:

UNKNOWN

Country of origin: Hong Kong

Alert submitted by: Luxembourg



