


Alert number

[A12/00339/21](#)

Product

Wooden toy car

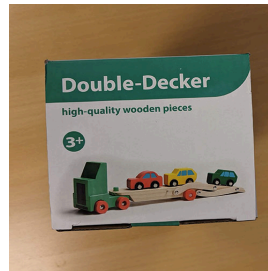

Risk type

Choking

Small parts (the wheels of the cars) could easily detach from the toy. A child could put them in the mouth and choke. Furthermore, the product does not have a CE marking.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category

Toys

Type

Consumer

Description

Wooden toy transporter car (green) with 3 small cars (Yellow, red, and green).

Packaging description

Cardboard box.

Brand

Unknown

Alert number **[A12/00312/21](#)**

Product **Plastic hammers**



Risk type **Choking**

Small parts may easily detach from the toy. A small child may put them in the mouth and choke on them. Furthermore, the product does not have a CE marking.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Four golden plastic hammers from the Avengers concept.**

Packaging description **Packed in a plastic blister with cardboard back.**

Brand **Unknown**

Name **Super Hero**

Weekly report number **Report-2021-10**

Alert submitted by **Iceland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic **Recall of the product from end users**

Alert number

[**A12/00314/21**](#)

Product

4 Marvel characters sold together

Risk type

Choking

Small parts may easily detach from the toy. A small child may put them in the mouth and choke on them. Furthermore, the product does not have a CE marking.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

Category

Toys

Type

Consumer

Description

Four small plastic figures from the Marvel universe.

Packaging description

Packaging is plastic front and cardboard back. Size is 33x40 cm.

Brand

Unknown

Name

Launching Missile

Weekly report number

Report-2021-10

Alert submitted by

Iceland

Is the product counterfeit?

Unknown

Country of origin

Unknown

Alert number **[A12/00315/21](#)**

Product **USB charger**



Risk type **Electric shock**

The electrical insulation and the creepage/clearance distances are inadequate. The user may receive an electric shock from live parts. The device may overheat and cause fire.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950-1.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **High-speed LED charger adapter, compatible with USB-powered device. The product was sold online, in particular via Wish.**

Packaging description **Transparent plastic bag.**

Brand **Unknown**

Name **Adaptive Fast Charging**

Type / number of model **EP-TA 300**

Weekly report number **Report-2021-10**

Alert submitted by **France**

Alert number **[A12/00333/21](#)**

Product **Skin-lightening product**

Corrigendum **null**

Risk type **Chemical**

The product poses a chemical risk because it contains mercury (measured value: 8061 mg/kg). Mercury accumulates in the body and can damage the kidneys, brain and nervous system. Additionally, it may affect reproduction and the unborn child.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Cosmetic product, cream with skin-lightening and skin-conditioning effect**

Packaging description **White, printed and laminated plastic pot with pink screw top in grey-blue printed cardboard box, with instruction leaflet; quantity: 30 gr.; best-before date: 11/2022**

Brand **Crème Diana**

Name **Crème C.T.R. Diana Améliore l'aspect des traces de taches de Rousseur et d'acné**

Batch number **191102**

Barcode **5 280080 004166**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Lebanon**

Alert number **[A12/00329/21](#)**

Product **Skin-lightening product**

Corrigendum **null**

Risk type **Chemical**

The product poses a chemical risk because it contains mercury (measured value: 7502 mg/kg). Mercury accumulates in the body and can damage the kidneys, brain and nervous system. Additionally, it may affect reproduction and the unborn child.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Cosmetic product, cream with skin-lightening and skin-conditioning effect.**

Packaging description **White, printed plastic pot with pink screw top in grey-blue printed cardboard box, with instruction leaflet; quantity: 30 gr.; best-before date: 11/2021**

Brand **Crème Diana**

Name **Crème C.T.R. Diana Contre Les Taches De Rousseur**

Batch number **181121**

Barcode **5 280080 004005**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Lebanon**

Measures ordered by public **Warning consumers of the risks**

Alert number **[A12/00330/21](#)**

Product **Skin-lightening product**

Corrigendum **null**

Risk type **Chemical**

The product poses a chemical risk because it contains mercury (measured value: 15590 mg/kg). Mercury accumulates in the body and can damage the kidneys, brain and nervous system. Additionally, it may affect reproduction and the unborn child.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Cosmetic product, cream with skin-lightening and skin-conditioning effect**

Packaging description **White plastic jar with transparent, printed plastic seal, in grey, printed cardboard box with accompanying product leaflet; quantity: 20 ml.; best-before date: 02/2022**

Brand **Roop Rang
SJ ENTERPRISES PAKISTAN**

Name **Chandni Whitening Cream, Removes Acne, Wrinkles
Pimples, Dark Spots & Dark Circles**

Batch number **Manufacturing date 02/2020; expiry 02/2022**

Barcode **0 639072 227208**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Pakistan**

Alert number **[A12/00331/21](#)**

Product **Skin-lightening product**

Risk type **Chemical**

The product contains clobetasol propionate (measured value: 0,0062 % by weight). Clobetasol propionate is a corticosteroid that should be applied only if medically prescribed. Exposure to it could cause skin irritation and may lead to endocrine problems.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Cosmetic product, cream with skin-lightening and skin-conditioning effect**

Packaging description **Brown, laminated plastic pot with screw top; quantity: 275 ml; best-before date: 12/21**

Brand **Bronz Tone Maxi Tone**

Name **Vanishing Cream, Cocoa Butter & Honey extracts**

Batch number **1010219 'L'**

Barcode **6 181100 248302**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Ivory Coast**

Measures ordered by public authorities **Stop of sales
Retailer**

Measures ordered by public **Recall of the product from end users**

Alert number **[A12/00332/21](#)**

Product **Skin-lightening product**

Risk type **Chemical**

The product contains clobetasol propionate (measured value: 0,044 % by weight). Clobetasol propionate is a corticosteroid that should be applied only if medically prescribed. Exposure to it could cause skin irritation and may lead to endocrine problems.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Cosmetic product, cream with skin-lightening and skin-conditioning effect**

Packaging description **White, printed plastic tube orange-coloured screw cap, in white and orange-coloured, printed cardboard box; quantity: 30 ml; best-before date: 03/2021**

Brand **Caro light**

Name **Intensive Care Lightening Beauty Cream with carrot oil**

Batch number **L92243**

Barcode **9 501101 371033**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Congo**

Measures taken by economic operators **Recall of the product from end users
Retailer**

Alert number **[A12/00334/21](#)**

Product **Skin-lightening product**

Risk type **Chemical**

The product contains clobetasol propionate (measured value: 0,021 % by weight). Clobetasol propionate is a corticosteroid that should be applied only if medically prescribed. Exposure to it could cause skin irritation and may lead to endocrine problems.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Cosmetic product, cream with skin-lightening and skin-conditioning effect**

Packaging description **white plastic bottle with flip-top, hinged cap and dosage spout, completely enclosed in mint-coloured, printed plastic foil, in a white, printed cardboard box; quantity: 250 ml; best-before date: 11/20**

Brand **Gold Skin**

Name **Lait Clarifiant À La Bave D'Escargot**

Batch number **L1022**

Barcode **61811003215**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Ivory Coast**

Measures ordered by public authorities **Recall of the product from end users
Retailer**

Alert number **[A12/00335/21](#)**

Product **Skin-lightening product**

Risk type **Chemical**

The product contains clobetasol propionate (measured value: 0,0044 % by weight). Clobetasol is a corticosteroid that should be applied only if medically prescribed. Exposure to it could cause skin irritation and may lead to endocrine problems. Furthermore, the product contains hydroquinone (measured value: 3,64% by weight). Hydroquinone can cause skin irritation and dermatitis.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Cosmetic product, cream with skin-lightening and skin-conditioning effect**

Packaging description **White and orange/yellow-coloured, printed plastic tube with orange-coloured screw cap, in orange and yellow-coloured, printed cardboard box with accompanying leaflet; quantity: 30 ml; best-before date: 03/2021**

Brand **Light & Natural CAROTONE™**

Name **Brightening Cream**

Batch number **1000046 'L'**

Barcode **6 182000 101667**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Ivory Coast**


Measures taken by economic **Stop of sales**

Alert number

[A12/00328/21](#)

Product

Particle filter mask

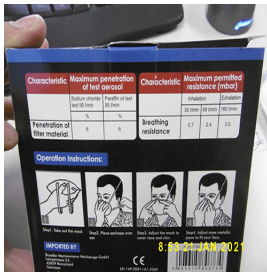

Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured value as low as 83%). Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. As a result of the labelling, the mask may be worn in areas where hazardous substances are in use or during activities involving asbestos; since the mask fails to offer sufficient protection, this could lead to asbestosis with fatal consequences.

The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description



Masks labelled as KN95 and FFP2, 10 masks per pack

Alert number

A12/00327/21

Product

Particle filter mask

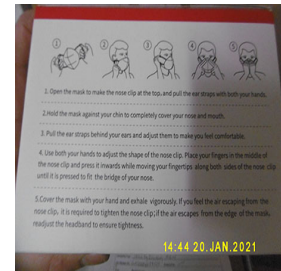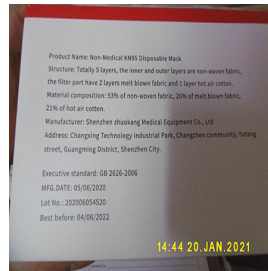

Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values as low as 90%). Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. As a result of the labelling, the mask may be worn in areas where hazardous substances are in use or during activities involving asbestos; since the mask fails to offer sufficient protection, this could lead to asbestosis with fatal consequences.

The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type


Consumer

Description

70 masks in a cardboard box, as a 10-pack in plastic packaging.

Alert number **[A12/00326/21](#)**

Product **Plastic doll**

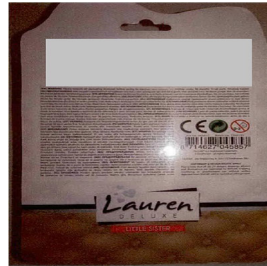

Risk type **Chemical**

The arms and legs of the doll contain bis-(2-ethylhexyl) Phthalate (DEHP) and dibutyl Phthalate (DBP) (measured value up to 2.5% and 3.8% respectively). These phthalates may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Two dolls, one with brown hair and the other with blonde hair.**

Packaging description **Cardboard back with transparent plastic blister.**

Brand **NUGAR
Toi-Toys**

Name **Lauren Deluxe - Little Sister**

Type / number of model **Art no. 04585Z**

Batch number **1900155**

Barcode **8 714627 045857**

Weekly report number **Report-2021-10**

Alert number **[A12/00325/21](#)**

Product **Fireworks**



Risk type **Damage to sight
Injuries**

The product may explode at too low altitude and can burst too close to the ground. Bystanders can be hit by parts of the firework, causing injuries and damage to eye if hit in the eye region.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

Category **Pyrotechnic articles**

Type **Consumer**

Description **The product is a fountain.**

Packaging description **Packed as a brown cone with the logo 'Afac'.**

Brand **Aalborg Fyrværkerifabrik A/S**

Name **AFAC Keglefontæne**

Type / number of model **CE registration number: 1008-F3-69256801
Item number: FO-UP-01-17-01**

Batch number **2018-01**

Weekly report number **Report-2021-10**

Alert submitted by **Denmark**

Alert number **[A12/00341/21](#)**

Product **Fireworks**



Risk type **Damage to hearing**

The product explodes at too low altitude and can burst too close to the ground. The sound pressure level is too high and may cause damage to hearing.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947-5.

Category **Pyrotechnic articles**

Type **Consumer**

Description **Compound battery with 108 special effects.**

Packaging description **Green and black colours with a firework image. 'JAPAN KANDA' is written in yellow capital letters.**

Brand **Aalborg Fyrværkerifabrik A/S**

Name **Japan Kanda**

Type / number of model **CE registration number: 1008-F2-69259899
Item number: BA-GU-108-18-45**

Batch number **2018-01**

Weekly report number **Report-2021-10**

Alert submitted by **Denmark**

Alert number **[A12/00321/21](#)**

Product **Passenger car**

Risk type **Injuries**

The adjustable second seat row might not be correctly latched onto the seat rail on one side. As a result, the fastening of the second seat row might not be ensured in the event of a crash, increasing the risk of injury.

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 247.**

Brand **Mercedes-Benz**

Name **GLB**

EC-type approval/model **Type-approval number: e1*2007/46*1909*03, Type: F2B**

Production dates **The affected vehicles were manufactured between 26 July 2019 and 25 January 2020.**

Company recall code **9190167**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**


Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <http://www.Mercedes-Benz.de>**

Alert number **[A12/00340/21](#)**

Product **Fireworks**

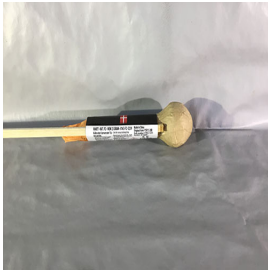

Risk type **Damage to hearing
Damage to sight
Injuries**

The product may explode at too low altitude and can burst too close to the ground. Bystanders can be hit by parts of the firework, causing injuries or damage to the eye region. The sound pressure level is too high and may cause damage to hearing.

The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.

Category **Pyrotechnic articles**

Type **Consumer**

Description **Rocket with stick.**

Packaging description **Black paper with a small image of Denmark and a red flag.**

Brand **Fyrværkerieksperten**

Alert number **[A12/00338/21](#)**

Product **Passenger car**

Risk type **Fire
Injuries**

Due to defective screw connection, the positive 12V battery cable may come into contact with the starter and be damaged by its movement. Consequently, the damaged positive cable might be in contact with the starter housing, which could lead to a short circuit. As a result, the battery may become discharged in a short period of time, and an intermediary electrical component might be overloaded, leading to immobilisation of the vehicle and to increased the risk of fire.

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 253. Vehicles equipped with an AMG petrol engine and 4MATIC.**

Brand **Mercedes-Benz**

Name **GLC**

EC-type approval/model **Type-approval numbers: e1*2001/116*0480*24 to *36, Type: 204X**

Production dates **The affected vehicles were manufactured between 12 January 2018 and 21 January 2020.**

Company recall code **5491301**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic **Recall of the product from end users**

Alert number **[A12/00323/21](#)**

Product **Passenger car**

Risk type **Fire**

The maximum permissible operating temperature of individual diodes on the alternator rectifier bridge could be exceeded and the diodes could subsequently fail. Consequently, an improper flow of current from the on-board electrical system battery through the alternator to the vehicle earth could occur. As a result, the windings in the alternator stator could be heated to such an extent that an outbreak of fire cannot be ruled out.

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles equipped with a four-cylinder petrol engine. Model series: BR 205.**

Brand **Mercedes-Benz**

Name **C-Class**

EC-type approval/model **Type-approval numbers: e1*2001/116*0431*31 to 46, e1*2001/116*0457*25 to 37, Types: 204, 204 K**

Production dates **The affected vehicles were manufactured between 1 March 2014 and 28 February 2018.**

Company recall code **5499723**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00336/21](#)**

Product **Bus**

Risk type **Injuries**

Due to some faulty components, the inward-swinging door may inadvertently open if someone leans against it. This will increase the risk of injuries.

Category **Motor vehicles**

Type **Professional**

Description **Bus**

Brand **EvoBus**

Name **Capacity, Citaro**

EC-type approval/model **Models: 628 02, 628 09
Type-approval numbers: e1*2007/46*0087, e1*NKS*0050**

Production dates **September 2020**

Company recall code **72.00M20136A**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Sweden**

Alert number **[A12/00322/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to a manufacturing error, not all of the four bolts on the driver's seat have been bolted onto the seat rail. As a result, the seat may fail to provide the necessary restraint in the event of an accident, increasing the risk of injury.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car.**

Brand **VW**

Name **Tiguan Allspace**

EC-type approval/model **Type-approval number: e1*2001/116*0450*
Type: 5N**

Production dates **The affected vehicles were manufactured between
20 October and 2 December 2020.**

Company recall code **72L8**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Mexico**


Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number

A12/00337/21

Product

Particle filter mask

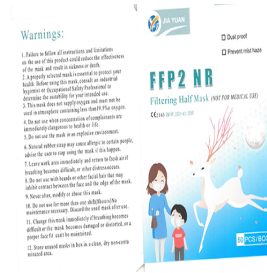

Risk type

Health risk / other

The product advertises a protective potential against particles but its filtering capacity has not been tested by a relevant competent European conformity assessment body, and it misuses the CE marking and the model name of a different product from the same manufacturer, which is certified. The packaging of the two being identical, there is no possibility for the consumer to see that it is not the certified product. In addition, the product has a complete different shape and size than the certified product, and due to its small size, it does not cover the mouth and nose entirely. Consequently, it is not proven that the product fulfils the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Alert number **[INFO/00059/21](#)**

Product **Children's bib**



Risk type **Choking**

The small decorative elements on the product (the stone and pebbles glued) can be easily detached. A small child may put them in the mouth and choke.

The product does not comply with the relevant European standard EN 71-1.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **A white baby bib (23 cm x 17 cm) on which a pink bow is applied. There is a shiny white stone glued to this bow. The pink bow is framed in a pink crown on which small shiny white pebbles are glued.**

Brand **Unknown**

Weekly report number **Report-2021-10**

Alert submitted by **Romania**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Retailer**

Alert number **[A12/00313/21](#)**

Product **Baby T-shirt**



Risk type **Choking**

The product contains small decorative elements (silver pebbles) that can easily be detached. A child may put them in the mouth and choke on it.

The product does not comply with the relevant European standard EN 71-1.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Disney baby t-shirt, size 6M. The shirt has drawings on the front an orange bear and a pink piglet. Beneath the two animals is written Hello Little Friend. Above the slogan is a pink heart framed by small, silver pebbles, glued to the shirt.**

Brand **Disney Baby**

Type / number of model **6 M**

Weekly report number **Report-2021-10**

Alert submitted by **Romania**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Alert number **[A12/00344/21](#)**

Product **Snowmobile**



Risk type **Burns
Fire**

The fuel hose may rub on the air inlet tube due to an incorrect assembly, which can lead to fuel leaks. Fuel leakage close to a source of ignition increases the risk of the vehicle catching fire.

Category **Motor vehicles**

Type **Consumer**

Description **Snowmobile**

Brand **SKI-DOO**

Name **Freeride 850 E-Tec Turbo, Summit Expert 850 E-Tec Turbo**

Production dates **The affected vehicles were manufactured between July and December 2020.**

Company recall code **2021-012**

Weekly report number **Report-2021-10**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Alert number **[A12/00316/21](#)**

Product **Plush toy**



Risk type **Choking**

Small parts (the nose and the suction cup with the ribbon) can easily detach from the toy, generating small part. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **The toy made of plush in the shape of a dog with glasses and a scarf. The scarf is made of plush, the glasses, the eyes, the nose and the suction cup are made of plastic.**

Brand **Toys series**

Type / number of model **4920386**

Barcode **2881149203860**

Weekly report number **Report-2021-10**

Alert submitted by **Slovakia**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Alert number **[A12/00320/21](#)**

Product **Passenger car**

Risk type **Injuries**

The high voltage system, may get inadvertently disconnected during driving. This could lead to loss of propulsion, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **VOLVO**

Name **XC40**

EC-type approval/model **e9*2007/46*3146*08 - e9*2007/46*3146*10**

Production dates **2021**

Company recall code **R10078**

Weekly report number **Report-2021-10**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **Sweden**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Products were found and measures were taken also in **Sweden**

Alert number **[A12/00324/21](#)**

Product **Passenger car**

Risk type **Injuries**

The vehicle may, under certain circumstances, experience loss of propulsion while driving. This will increase the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Polestar**

Name **Polestar 2**

EC-type approval/model **e9*2007/46*6834*00 - e9*2007/46*6834*03**

Production dates **The affected vehicles were manufactured in 2021.**

Company recall code **R10079**

Weekly report number **Report-2021-10**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **Sweden**


Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **01/03/2021**

Products were found and measures were taken also in **Poland
Sweden**

Alert number **[A12/00319/21](#)**

Product **Children's dress**

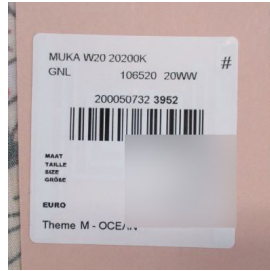

Risk type **Injuries**

The product has long functional cords in the waist area. These cords can become trapped during various activities of a child, leading to strangulation.

The product does not comply with the relevant European standard EN 14682.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Black dress with colored flower print. The product was sold online.**

Brand **Ella Italia**

Type / number of model **20200K M-Ocean**

Barcode **2000507323952**

Weekly report number **Report-2021-10**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic **Recall of the product from end users**

Alert number **[A12/00343/21](#)**

Product **Bus**

Risk type **Injuries**

The brake-circuit protection, designed to ensure that the brake pressure is maintained over the intact circuit if one brake circuit fails, is not functioning. If one of the two brake circuits fails, the pressure in the other brake circuit also decreases. In such a case, the service brake may fail completely, increasing the risk of injuries.

Category **Motor vehicles**

Type **Professional**

Description **Bus**

Brand **MAN**

Name **Lion`s City**

EC-type approval/model **Model: B.2007.46.017
Type-approval number: e1*2007/46*1955*05 + *06**

Production dates **August 2020 to December 2020**

Company recall code **7356TR**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**


Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00317/21](#)**

Product **Bath toy**

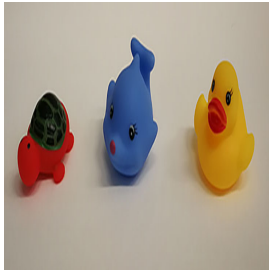

Corrigendum **Alerts A12/00078/19, A12/00079/19, A12/00086/19 and A12/00088/19 have been withdrawn at the request of the notifying authority following a new evaluation of the products concerned.**

Risk type **Chemical**

The plastic material of the product contains an excessive amount of bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 17,3% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation

Category **Toys**

Type **Consumer**

Description **Plastic tray containing three whistling toys made of soft plastic (yellow duck, red turtle with green armor and blue whale), four plastic molds in the shape of a crab, starfish, fish, frogs and a yellow perforated strainer with a hard plastic mallet.**

Packaging description **Transparent plastic bag.**

Brand **Bathing Paradise**

Type / number of model **ITEM NO: ZY-17322**

Barcode **6912080173229**

Alert number **[A12/00318/21](#)**

Product **Plastic toy**



Risk type **Choking**

Small part (plastic screw cap) may easily detach from the toy. A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Plastic toy mobile phone, battery powered.**

Packaging description **Cardboard box.**

Brand **Unknown**

Name **Smily play**

Type / number of model **0618/000618**

Barcode **EAN 5905375804619**

Weekly report number **Report-2021-10**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Alert number **[A11/00018/21](#)**

Product **Climbing triangle**



Risk type **Entrapment Injuries**

The toy is not sufficiently stable and could easily tip over, causing injuries to the child. Moreover there is a risk of entrapment because a child can get its head stuck between the sticks of the toy..

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-8.

Category **Toys**

Type **Consumer**

Description **Wooden triangle for children to climb and play with. The product is made of two wooden triangles with wooden sticks that connect them together.**

Brand **Unknown**

Barcode **; EAN code: 5200109520088**

Weekly report number **Report-2021-10**

Alert submitted by **Iceland**

Is the product counterfeit? **Unknown**

Country of origin **Iceland**

Alert number **[A12/00342/21](#)**

Product **Children's sweatshirt**



Risk type **Strangulation**

The product contains long drawstrings with free ends and toggles in the hood area. These drawstrings can become trapped during various activities of a child, leading to strangulation.

The product does not comply with the relevant European standard EN 14682.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Pink sweatshirt with long sleeves and hood, intended for children aged 6 years, with functional cord with free ends and toggles for tightening the hood.**

Brand **SETTY KOOP**

Type / number of model **zj9005**

Weekly report number **Report-2021-10**

Alert submitted by **Romania**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public **Withdrawal of the product from the market**

Alert number **[A12/00345/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to a manufacturing error, a weld joint between the brake pedal and the brake-pedal plate could break when the brake pedal is suddenly applied. This can result in complete detachment of the brake-pedal plate, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles with automatic gearbox.**

Brand **AUDI**

Name **Q2, Q3**

EC-type approval/model **e1*2007/46*1552*, Type: GA, - Audi Q2
e1*2007/46*1900*, Type: F3 - Audi Q3**

Production dates **Q3: Production period from calendar week 29/2020 to calendar week 35/2020
Q2: Production period from calendar week 28/2020 to calendar week 35/2020**

Company recall code **46I7**

Weekly report number **Report-2021-10**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and **Greece**

Alert number **[A11/00017/21](#)**

Product **Computer Case**



Risk type **Fire**

The two screws that attach the PCIe Riser assembly to the chassis may cause an electrical short circuit in the printed circuit board that may overheat and lead to a fire.

The product does not comply with the requirements of the Low Voltage Directive.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Personal computer case, colors black (model: CA-H16WR-B1-EU) or white (model: CA-H16WR-W1-EU).**

Brand **NZXT**

Name **H1**

Type / number of model **CA-H16WR-B1-EU
CA-H16WR-W1-EU**

Batch number **The affected products were sold till December 2020.**

Barcode **EAN 5060301695355
EAN 5060301695942**

Weekly report number **Report-2021-10**

Alert submitted by **Poland**