

---

Alert number **[A12/00368/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The brake pipes can be damaged through mechanical contact with other components, resulting in the leakage of brake fluid. This can consequently lead to restricted braking action, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles with right-hand drive.**

Brand **Fiat**

Name **Ducato**

EC-type approval/model **Type-approval number: e3\*2007/46\*0049\*16\*01  
Type: 250**

Production dates **The affected vehicles were manufactured between 31 October 2014 and 16 July 2019.**

Company recall code **6255**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Slovenia**

---

Alert number **[A12/00369/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The software of the communication module for the emergency call system (eCall) does not meet the specifications. As a result, the eCall button may not work.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Skoda**

Name **Kamiq, Scala**

EC-type approval/model **Type-approval number: e8\*2007/46\*0349\*00-04  
Type: NW**

Production dates **The affected vehicles were manufactured between August and September 2019.**

Company recall code **91W7**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Slovenia**

---

Alert number	<b><u><a href="#">A12/00354/21</a></u></b>
Product	<b>Electric lighting chain</b>

---



Risk type	<b>Electric shock</b>  <b>The insulation is inadequate and the creepage distance between the primary and secondary circuits is not sufficient. As a result of these defects, the product poses a risk of electric shock.</b>  <b>The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.</b>
Category	<b>Electrical appliances and equipment</b>
Type	<b>Consumer</b>
Description	<b>Electric lighting chain with 6 light bulbs. The product is sold online, in particular via Wish.</b>
Brand	<b>Beauty World</b>
Name	<b>Lampes à cordes G40 UL Listed Patio Lights for Indoor Outdoor Commercial Decor 25pi with 25 Clear</b>
Type / number of model	<b>BW-E12-1(25~625)</b>
Weekly report number	<b>Report-2021-11</b>
Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>Unknown</b>

Alert number

**[A12/00381/21](#)**

Product

**Henna powder for colouring the skin**



Risk type

**Chemical**

**The product contains 2-hydroxy-1,4-naphthoquinone (measured values: up to 0,14% by weight). 2-hydroxy-1,4-naphthoquinone causes serious eye and skin irritation, is harmful if swallowed, and may cause respiratory irritation.**

**The product does not comply with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Appearance: fine, olive-green powder; smell: intense plant fragrance, characteristic odour;**

Packaging description

**Outer packaging: printed, sewn, light-green fabric bag; packaging: colourless sealed plastic bag without any labelling; nominal quantity: 500 g**

Brand

**Cimen**

Name

**HINDISTAN MALI KARTAL KINA**

Batch number

**Expiry date 03-2024, batch 04-19**

Barcode

**8 697461 670730**

Weekly report number

**Report-2021-11**

Alert number **[A12/00383/21](#)**

Product **Jewellery set**



Corrigendum **null**

Risk type **Chemical**

**The bracelet from the jewellery set contains excessive amounts of cadmium and of lead (measured values: up to 95% by weight and 2,8% by weight, respectively). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Jewellery set comprising a necklace, a ring, a bracelet and a pair of earrings. The product was also sold online, in particular via Wish.**

Packaging description **transparent plastic bag**

Brand **Unknown**

Name **jewelry set: necklace+earring+bracelet+ring :set gold plated rhinestone - crystal african beads**

Weekly report number **Report-2021-11**

Alert number **[A12/00346/21](#)**

Product **Jewellery set**



Risk type **Chemical**

**The product contains an excessive amount of cadmium (measure value: up to 87% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer. It also contains an excessive amount of lead (measured value: up to 13% by weight). Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children. Additionally, the product releases an excessive amount of nickel (measured values up to: 75 µg/cm<sup>2</sup>/week). Nickel is a strong sensitiser and causes allergic reactions if present in articles that come into direct and prolonged contact with the skin.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Gold-coloured metal jewellery set comprising: a pair of earrings, a ring, a bracelet and a necklace, all matching. The product was sold online, in particular via Wish.**

Packaging description **Transparent plastic bag.**

Brand **Unknown**

Name **Classiques Luxe Plaqué or Collier Boucles d'oreilles  
Bracelet Bague Ensemble de strass Personnalité**

Alert number **[A12/00355/21](#)**

Product **Bracelet**



Risk type **Chemical**

**The product contains excessive amounts of cadmium and of lead (measured values: up to 84% by weight and 1,6% by weight, respectively). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Gold-coloured metal bracelet, with a heart-shaped pendant. The product was sold online, in particular via Wish.com.**

Packaging description **Packaged in a transparent zipped bag.**

Brand **Unknown**

Name **Fashion Jewelry 925 Sterling Silver Heart-Shape Chain Bracelets for Women Gifts**

Weekly report number **Report-2021-11**

Alert submitted by **France**

Alert number **[A12/00382/21](#)**

Product **Bracelet**



Corrigendum **null**

Risk type **Chemical**

**The product releases an excessive amount of nickel (measured values: up to 1,3 µg/cm<sup>2</sup>/week). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Bracelet with a label bearing the message 'a gift from an owl' (FR: 'un hibou t'apporte un cadeau'). The product was also sold online, in particular via CDiscount.**

Packaging description **Packaged in an individual plastic bag and then in an outer bag.**

Brand **Unknown**

Name **Bracelet Harry Potter doré hiboux triangle RDLM**

Weekly report number **Report-2021-11**

Alert submitted by **France**



Alert number **[A12/00349/21](#)**

Product **Bracelet**



Risk type **Chemical**

**The product contains an excessive amount of cadmium (measure value: 52% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer. It also contains an excessive amount of lead (measured value: 0.24% by weight). Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Bracelet in brass-coloured metal in the shape of a snake, with the top of the head and tail set with diamante stones. The product was sold online, in particular via Wish.com**

Packaging description **Contained in plastic packaging.**

Brand **Unknown**

Name **Bracelet manchette extensible incurvé orné de strass créatifs et bracelets joncs rétro serpent**

Weekly report number **Report-2021-11**

Alert submitted by **France**

Alert number **[A12/00347/21](#)**

Product **Necklace**



Risk type **Chemical**

**The product contains an excessive amount of cadmium (measure value: up to 90% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Necklace made of metal with arrow-shaped pendant. The product was sold online, in particular via Wish.com**

Packaging description **Plastic packaging.**

Brand **Unknown**

Name **Bijoux Fantaisie Homme Or Argent Flèche Tête Pendentif Longue Chaîne Collier**

Weekly report number **Report-2021-11**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **United States**

Alert number **[A12/00375/21](#)**

Product **Bracelet**



Risk type **Chemical**

**The product contains an excessive amount of cadmium (measure value: up to 87% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Silver-coloured perforated metal bracelet with leaf decorations, set with a turquoise and brown stone. The product was sold online, in particular via Wish.com.**

Packaging description **Packaged in a transparent bag.**

Brand **Unknown**

Name **Bracelet large en argent tibétain avec bracelets turquoise mode bracelet turquoise bijoux bracelet B**

Weekly report number **Report-2021-11**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Alert number **[A12/00372/21](#)**

Product **Jewellery set**



Risk type **Chemical**

**The product contains an excessive amount of cadmium (measure value: up to 95% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Gold-coloured metal jewellery set comprising a pair of earrings with a turquoise pendant, and a matching necklace. The product was sold online, in particular via Wish.com**

Packaging description **Packaged in a transparent bag stapled to a white card bearing the brand name 'Fashion Jewelry' and the reference 'AA0332/61152107'.**

Brand **Fashion Jewelry**


Name **Collier ras du cou en chaîne avec strass pour femme de style chic, boucles d'oreilles, bijoux.**

Type / number of model **"AA0332/ 61152107".**

Weekly report number **Report-2021-11**

Alert number **[A12/00385/21](#)**

Product **Extension lead**

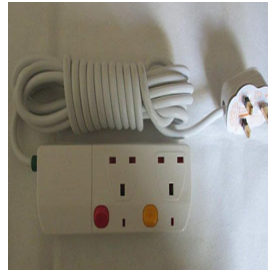

Risk type **Electric shock**

**The product may overheat and the socket outlet deform severely leaving live parts accessible. The user may get electrocuted.**

**The product does not comply with the requirements of the Low Voltage Directive.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **The product consists of a plug, 5 m cable and a 2 way socket outlet containing all the electric parts.**

Packaging description **Blue cardboard package.**

Brand **British Design BS**

Type / number of model **UK-02S (manufacturer)  
UK-202S 5M (importer)**

Barcode **3675543110287 (importer)**


Weekly report number **Report-2021-11**

Alert submitted by **Cyprus**

Is the product counterfeit? **Unknown**

Alert number **[A12/00359/21](#)**

Product **skin serum**

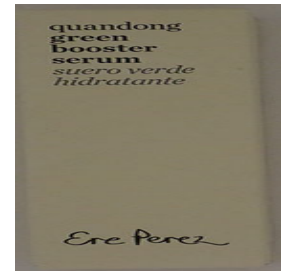

Risk type

**Microbiological**

**The product is microbiologically contaminated with mesophilic aerobic bacteria and yeast (measured values 1.200.000 cfu/g for mesophilic aerobic bacteria and 150 000 cfu/g for yeasts). If used on damaged skin, or if it comes into contact with the eyes, the product may cause infection or irritation.**

**The product does not comply with the Cosmetic Products Regulation and with the relevant standard EN ISO 17516.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Green serum for topical use.**

Packaging description

**Packed in a light beige cardboard package (height 10,5 cm). Contact information of a British distributor is printed on a sticker on the side of the package but the product has been delivered straight from Australia to Finland.**

Alert number **[A12/00373/21](#)**

Product **Balloons**



Risk type **Chemical**

**The rubber of the balloons releases an excessive amount of nitrosatable substances generating n-nitrosodimethylamine (NDMA)(measured value: 1.6 mg/kg). NDMA is a nitrosamine, which may cause cancer through ingestion or dermal exposure. A child could be exposed to it when touching or putting the product in the mouth.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.**

Category **Toys**

Type **Consumer**

Description **Multicolour balloon set packed into a nylon bag.**

Packaging description **Packed into a nylon bag.**

Brand **VIOSARP**

Type / number of model **VC949-15**

Barcode **5206753016571**

Weekly report number **Report-2021-11**

Alert submitted by **Cyprus**



Alert number **[A12/00357/21](#)**

Product **Soft toy**



Risk type **Choking**

**Small parts (nose and eye) may easily detach from the product. The seam allows access to the stuffing material. A small child may put them in the mouth and choke.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **White soft toy in the shape of a rabbit with a metallic keyring as jewel for bag. The product does not have a CE marking.**

Brand **Unknown**

Name **Bijou de sac**

Type / number of model **CXP505B0-8169583\4**

Weekly report number **Report-2021-11**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**



Alert number

**[INFO/00060/21](#)**

Product

**Particle filter mask**



Risk type

**Health risk / other**

**The product advertises a protective potential against particles but its filtering capacity has not been tested by a relevant competent European conformity assessment body. Consequently, it is not proven that the product fulfils the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with Personal Protective Equipment Regulation**

Category

**Protective equipment**

Type

**Consumer**

Description

**White respiratory protective half-face mask of category KN95**

Packaging description

**White box with green elements, 100 masks inside**

Brand

**Shield**

Name

**Hygienic disposable mask KN95**

Type / number of model

**7100**

Barcode

**4772013226307**

Weekly report number

**Report-2021-11**

Alert number **[A12/00350/21](#)**

Product **Plush toy**



Risk type **Choking**

**Small parts ( the eyes) can easily detach. A small child may put them in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Large plush stork toy.**

Brand **Unknown**

Type / number of model **56081**

Barcode **8712026560810**

Weekly report number **Report-2021-11**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Alert number

**[A12/00370/21](#)**

Product

**Hand disinfectant**



Risk type

**Chemical**

**The product contains methanol (measured value: 11,4 % by weight), which is acutely toxic to the central nervous system and to the eyes. Furthermore, the required hazard pictograms and warnings are missing. Users have therefore no information on the toxicity and flammability of the product. The packaging is not fitted with child-resistant fastening. Ingestion or contact with methanol may lead to blindness and death.**

**The product does not comply with the Biocidal Products Regulation and with the CLP Regulation.**

Category

**Chemical products**

Type

**Consumer**

Description

**250 ml colorless mild antiseptic hand gel in transparent plastic bottle with white cap.**

Packaging description

**The product is sold in a transparent plastic bottle with a white cap, and clear blue labels on it.**

Brand

**HUGGLO**

Name

**Mild antiseptic hand gel**

Type / number of model

**3296656**

Batch number

**Expiration date: 10.04.2023  
LOT: 206**

Alert number **[A12/00361/21](#)**

Product **Toy pushchair**



Risk type **Injuries**

**The pushchair has only one safety lock and is not sufficiently resistant to load. As a consequence, it can easily collapse and a child playing with it may fall to the ground.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Folding pushchair for dolls with grey frame and with textile seat. It is equipped with one locking device.**

Packaging description **Transparent bag with a cardboard label.**

Brand **Dominika**

Name **Doll Stroller**

Type / number of model **Item NO. 21000**


Barcode **2636546000013**

Weekly report number **Report-2021-11**

Alert submitted by **Hungary**

Alert number **[A12/00360/21](#)**

Product **plush stork**

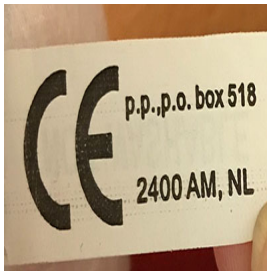

Risk type **Choking**

**Small parts (the eyes) can easily be detached from the toy. A small child may put them in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Plush stork (approx. 20 cm long) with suction cups and an attached label.**

Brand **Unknown**

Type / number of model **56080**

Barcode **8712026560803**

Weekly report number **Report-2021-11**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **Unknown**



Alert number

**A12/00387/21**

Product

**Children's skirt**



Risk type

**Injuries**

**The skirt has long drawstrings to be tied at the front of the waist area. They can become trapped during various activities of a child, leading to injuries.**

**The product does not comply with the relevant European Standard EN 14682.**

Category

**Clothing, textiles and fashion items**

Type

**Consumer**

Description

**Dark blue skirt with multicolored motifs.**

Brand

**Babyface**

Type / number of model

**style 0108822, dark grey, size 80**

Barcode

**8719517453200**

Alert number

**[A12/00371/21](#)**

Product

**Cooking stove for solid fuel**



Risk type

**Burns  
Fire**

**The fuel storage container may overheat and cause a fire and also burns.**

**The product does not comply with the requirements of the standard EN 12815.**

Category

**Construction products**

Type

**Consumer**

Description

**Stove for solid fuel designed for cooking and baking, with a declared rated output of 7.0 kW, black. Two variants are produced: left (with flue on the left) and right (with flue on the right).**

Brand

**Hosseven**

Type / number of model

**Model 4020, Ser. NO 19003173 (on the label), Comid Northern 40**

Weekly report number

**Report-2021-11**

Alert submitted by

**Slovakia**

Is the product counterfeit?

**No**

Country of origin


**Turkey**

Measures ordered by public

**Recall of the product from end users**

Alert number **[A12/00367/21](#)**

Product **Plactic toy**

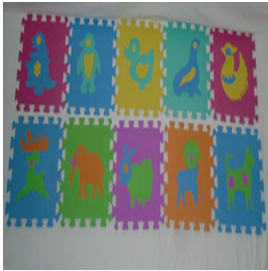

Risk type **Choking**

**Small parts may easily detach from the pieces of the puzzle. A small child may put them in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **The toy consists of 10 pieces of large foam with different colours and pictures of various animals (a dog, a dinosaur, a penguin, a duck, a seal, a hen, a deer, an elephant, a rabbit and a sheep).**

Brand **Unknown**

Name **EVA PUZZLE MATS - puzzle**

Type / number of model **00388**

Barcode **8585030000388**


Weekly report number **Report-2021-11**

Alert submitted by **Slovakia**



Alert number **[A12/00380/21](#)**

Product **Scissor lift jack**

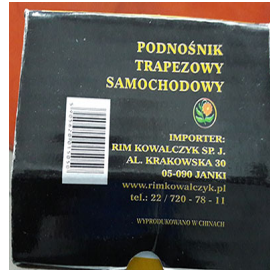

Risk type **Injuries**

**The device is not sufficiently resistant to load. It may break down and cause the user to fall increasing the risk of injuries.**

**The product does not comply with the requirements of the Machinery Directive.**

Category **Machinery**

Type **Consumer**

Description **Metal scissor lift jack with capacity to lift a maximum weight of 1,5 t.**

Packaging description **Cardboard box.**

Brand **Unknown**

Name **Podnosnik trapezowy samochodowy**

Barcode **EAN 5905620015050**

Weekly report number **Report-2021-11**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Alert number

**A12/00356/21**

Product

**Particle filter mask**



Risk type

**Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as to 43 %). Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures. As a result of the labelling, the mask may be worn in areas where hazardous substances are in use or during activities involving asbestos; since the mask fails to offer sufficient protection, this could lead to asbestosis with fatal consequences.**

**The product does not comply with the PPE Regulation and the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**'Duckbill mask' with a grey or white band, labelled NB 1437 or NB 2163. Sold in packs of 25. The product is also sold online.**

---

Alert number **[INFO/00061/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**There may be faulty communication between various electronic units; this includes windscreen wipers, reversing cameras, lighting devices (full headlights) and window lifters.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Honda**

Name **Accord**

EC-type approval/model **Individual approval**

Production dates **The affected vehicles were manufactured between 3 October 2017 and 17 September 2019.**

Company recall code **6BF**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<https://owners.honda.com/service-maintenance/recalls>**

---

Alert number **[A12/00362/21](#)**

Product **Pickup truck**

---

Risk type **Injuries**

**The gas generator of the front airbag may be defective. This can result in uncontrolled inflation and the release of metal fragments when the airbag is activated, causing injury to the occupants of the vehicle.**

Category **Motor vehicles**

Type **Consumer**

Description **Pickup truck**

Brand **Ford**

Name **Ranger**

EC-type approval/model **Individual approval**

Production dates **The affected vehicles were manufactured between 1 January 2004 and 31 December 2006.**

Company recall code **17S42**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<http://www.etis.ford.com>**

Alert number

**[A12/00376/21](#)**

Product

**Squeezy Cake (Knautsch Torte)**



Risk type

**Choking**

**The product has small parts that a small child may put in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category

**Toys**

Type

**Consumer**

Description

**Red-and-white toy cake with stylised strawberries and cream balls of a soft crushable plastic foam. Packed in a clear plastic bag with a dark-blue, light-blue band at the top, showing a picture of a hand squeezing a watermelon. The product was also sold online.**

Brand

**Squeezies**

Type / number of model

**Torte**

Barcode

**4032037649514**

Weekly report number

**Report-2021-11**

Alert submitted by

**Germany**

Is the product counterfeit?

**No**

Alert number **[A12/00363/21](#)**

Product **Passenger car**

Risk type **Injuries**

**Due to a manufacturing error, the belt pulley securing ring of the steering system may not be fully engaged. As a result, the securing ring may become detached and subsequently jam with surrounding components, leading to possible locking of the steering system.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Skoda**

Name **Kodiaq, Octavia**

EC-type approval/model **Octavia: e11\*2007/46\*0243\*, e8\*2007/46\*00318\*, Kodiaq: e8\*2007/46\*0249\*  
Types: 5E, NS**

Production dates **The affected vehicles were manufactured between 3 July 11 October 2019.**

Company recall code **48P5**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Romania**

Alert number

**[A12/00377/21](#)**

Product

**Squeezy Bread (Knautschiges Brot)**



Risk type

**Choking**

**Small plastic parts (squeaking element) may easily detach from the toy. A small child may put them in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.**

Category

**Toys**

Type

**Consumer**

Description

**Orange-and-white toy bread of soft crushable plastic foam. In addition to the product, the bag contains a label marked 'squeezies'. The labelling of the product is visible. Dimensions L x W x H [mm]: 110 x 60 x 45 mm.**

Brand

**Squeezies**

Type / number of model

**Brot**

Barcode

**4032037649484**

Weekly report number

**Report-2021-11**

Alert submitted by

**Germany**

Is the product counterfeit?

**No**



Alert number **[A12/00364/21](#)**

Product **Passenger car**

Risk type **Injuries**

**Due to a manufacturing error, the brake-pedal plate for may not have been adequately welded and may be deformed and completely detached when the brake pedal is suddenly applied. As a result, the application of the brakes will be impaired, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles with automatic gearbox.**

Brand **SKODA**

Name **Karoq, Kodiaq**

EC-type approval/model **Types: NU, NS  
e8\*2007/46\*0272, e8\*2007/46\*0249**

Production dates **The affected vehicles were manufactured between 29 June and 31 August 2020.**

Company recall code **46i5**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Greece  
Sweden  
Slovenia  
Slovakia**



Alert number

**[A12/00378/21](#)**

Product

**Squeezy camel**



Risk type

**Choking**

**Small plastic parts may easily detach from the toy. A small child may put them in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.**

Category

**Toys**

Type

**Consumer**

Description

**Light-blue toy camel with black dotted eyes. The material is a soft crushable plastic foam. Dimensions L x W x H [mm] 45 x 20 x 25.**

Packaging description

**Transparent plastic bag with a green band at the top showing a picture of other animals and the name 'squeezies'.**

Brand

**Squeezies**

Type / number of model

**Camel**

Barcode

**4032037651593**

Weekly report number

**Report-2021-11**

Alert submitted by

**Germany**

Alert number

**[A12/00379/21](#)**

Product

**Squeezy Dog (Knautschbarer Hund)**



Risk type

**Choking**

**Small parts can easily detach from the toy, generating small part. A small child may put them in the mouth and choke.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category

**Toys**

Type

**Consumer**

Description

**Pink crushable dog with three dots as black eyes and nose. Dimensions: length x width x height [mm]: 45 x 28 x 16. The product was also sold online.**

Packaging description

**Transparent plastic bag with a green band bearing the name 'squeezies'. The green band also shows a duck and another dog.**

Brand

**Squeezie**

Type / number of model

**Dog**

Barcode

**4032037651593**

Weekly report number

**Report-2021-11**

Alert submitted by

**Germany**

---

Alert number **[A12/00365/21](#)**

Product **Passenger car**

---

Risk type **Fire  
Injuries**

**The affected vehicles have a flange with an open circulation aperture, through which fuel may leak out during refuelling. This will increase the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Cadillac XT4 vehicles of the model years 2020 and 2021, equipped with a 2.0-litre 4-cylinder turbodiesel engine (RPO LSQ).**

Brand **Cadillac**

Name **XT4**

EC-type approval/model **Type: E2UL  
e13\*2007/46\*2376\*00 and e13\*2007/46\*2376\*01**

Production dates **The affected vehicles were manufactured between 2020 and 2021.**

Company recall code **N202322020**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/00374/21](#)**

Product **Fishing game**



Risk type **Choking**

**The small magnetic parts have a high magnetic flux and can easily become detached. If a small child puts it in the mouth, it could cause choking. If the magnets are swallowed together, they could attract each other, causing intestinal blockage or perforation.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Plastic fishing game with magnets.**

Packaging description **White cardboard box.**

Brand **Unknown**

Name **Fishing game**

Type / number of model **C54164 A68201 022000**

Batch number **191230**

Barcode **2099960682010**

Weekly report number **Report-2021-11**

Alert number **[A12/00366/21](#)**

Product **Mobile home/camper van**

Risk type **Fire  
Injuries**

**The installation of the battery cable harness in the area of the steering column/cardan shaft may be faulty. This can result in a short circuit, increasing the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Mobile home/camper van**

Brand **Dethleffs**

Name **Globetrotter XXLA, Grand Alpa Plus**

EC-type approval/model **Type.: EG/DI 001  
e1\*2001/116\*0250**

Production dates **The affected vehicles were manufactured between 15 April 2017 and 13 July 2020.**

Company recall code **53748**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Slovenia**

Alert number **[A12/00353/21](#)**

Product **Lorry**

Risk type **Injuries**

**The wheelbase is not recorded in the data set in the vehicle data memory leading to implausible steering or braking interventions by the ESP (Electronic Stability Programme). If, during an ESP intervention, the service brake is applied, the full effect may be delayed, which could initially be perceived by the driver as a brake failure. That would lead to a braking delay and thus to a longer braking distance.**

Category **Motor vehicles**

Type **Professional**

Description **Lorry**

Brand **MAN**

Name **TGX**

EC-type approval/model **Model: L.2007.46.002  
Type-approval number: e4\*2007/46\*0230\*38 - \*40**

Production dates **July 2020 to October 2020**

Company recall code **7313TR**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number

**[A12/00348/21](#)**

Product

**Toddlers sleeveless t-shirt**



Risk type

**Choking**

**The product has small parts (beads), which can easily come off. Children can put them in the mouth and choke on them.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 71-1.**

Category

**Clothing, textiles and fashion items**

Type

**Consumer**

Description

**Orange sleeveless baby t-shirt (35 cm long, 26 cm wide), with decorative silver beads glued on the front, intended for children aged 1-2 years. Minnie Mouse character is printed on the front of the shirt.**

Packaging description

**No packaging.**

Brand

**ATABAY KIDS**

Type / number of model

**Size: 1-2 years**

Weekly report number

**Report-2021-11**

Alert submitted by

**Romania**

Is the product counterfeit?

**Unknown**

Country of origin

**Turkey**



Alert number **[A12/00386/21](#)**

Product **Hair curler**



Risk type **Electric shock**

**The electrical insulation is inadequate and the clearance/creepage distances between the primary and accessible secondary circuits are insufficient. The user may touch live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and of the relevant European standard EN 60335.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Hair curler in black colour, sold online.**

Packaging description **Black box with orange and white writing. The name of the product is written in capital letters.**

Brand **FashionCurler**

Name **FashionCurler**

Type / number of model **HC191230-2**

Weekly report number **Report-2021-11**


Alert submitted by **Denmark**

Is the product counterfeit? **No**



Alert number **[A12/00351/21](#)**

Product **Table**

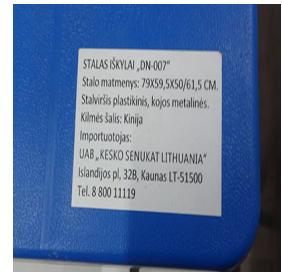

Risk type **Injuries**

**The product is not stable and may tilt and fall on the person, causing injuries.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 581.**

Category **Furniture**

Type **Consumer**

Description **Table top made of 2 - 3 mm thick plastic. Legs bent together with table top supports made of 19 mm diameter painted metal tube and connected with metal rivets. External dimensions of the table: length 790 mm, width 590 mm, height 500/615 mm.**

Packaging description **Product is packed in a cardboard box.**

Brand **Unknown**

Name **Table for camping**

Type / number of model **DN007**

Barcode **4770364012525**

Weekly report number **Report-2021-11**

Alert number **[A12/00352/21](#)**

Product **Plastic doll**



Risk type **Chemical**

**The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and diisobutyl phthalate (DIBP) (measured values up to 26% and 0,17% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Doll with a soft plastic face, painted eyes and lips, with light blue clothes, with yellowish and pink hair.**

Packaging description **Packed in a cardboard box with a transparent plastic cover, CE marking and the age limit marking.**

Brand **Unknown**

Name **Moxie Girl**

Type / number of model **N. 1210**

Weekly report number **Report-2021-11**


Alert submitted by **Lithuania**

Alert number

**[A12/00358/21](#)**

Product

**Children's scooter with a removable seat**

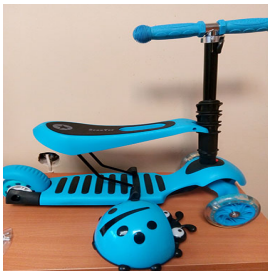

Risk type

**Cuts  
Injuries**

**The locking device does not work properly. The toy pushchair could consequently collapse during use causing the fingers of a child to be crushed. Sharp edges on the locking device could cause cuts as well.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category

**Toys**

Type

**Consumer**

Description

**Scooter in blue with three plastic wheels, height-adjustable metal steering tube, foot brake-mudguard, removable padded seat and bug-shaped basket, feature 'Lean to Teer' turning mechanism. The product was also sold online.**

Packaging description

**Packed in a cardboard box.**

Brand

**Unknown**

Name

**Scooter 3 in 1**

Type / number of model

**NO. 740**

Weekly report number

**Report-2021-11**

Alert number **[A12/00384/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as 20 %). Consequently, an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection if not combined with additional protective measures.**

**The product does not comply with the PPE Regulation and with the relevant European standard EN 149.**

Category **Protective equipment**

Type **Professional**

Description **Packed in cardboard box with 20 masks**

Brand **Unknown**

Name **KN95 Protective Mask 4 Layer Protection KN95**

Weekly report number **Report-2021-11**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users  
Other**