

Alert number **[INFO/00067/21](#)**

Product **Earrings**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 61.5% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Flower-shaped metal earrings with turquoise stones. The product is also sold online.**

Brand **Unknown**

Name **Earrings flower oval stone turquoise**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market
Distributor**

Alert number **[INFO/00068/21](#)**

Product **Earrings**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 96.1% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Metal earrings. The product was also sold online.**

Brand **Unknown**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures taken by economic operators **Withdrawal of the product from the market
Distributor**

Alert number **[INFO/00071/21](#)**

Product **Earrings**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 49.7% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Gold coloured metal earrings. The product is also sold online, with the numbers PU257157 (CX-55-35)**

Brand **Unknown**

Type / number of model **2021569
2029727**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic **Other : No measures taken**

Alert number **[INFO/00072/21](#)**

Product **Ring**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 89.2% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Silver-coloured ring with orange stone. The product is also sold online, with the number S458401600004.**

Brand **Unknown**

Barcode **2000531293283
2000537109120**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures taken by economic **Other : No measures taken**

Alert number **[INFO/00073/21](#)**

Product **Bracelet**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 45.3% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Gold coloured necklace with red stones. The product is also sold online, with the number W0602829TB012.**

Brand **Unknown**

Name **Occident Modeable Popular Round Plate Hot Sale Armband**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : No measures taken Distributor**

Alert number **[INFO/00074/21](#)**

Product **Leather bracelet**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 0.34% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Multilayer braided leather bracelet decorated with metal details. The product is also sold online, with the codes POA345133 and SKU185264-18766820.**

Brand **Unknown**

Name **Multilayer Braided Leather Triangle Owl Wings Cuff**

Type / number of model **1031--0--11476**

Batch number **L-I-03-11**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Alert number **[INFO/00075/21](#)**

Product **Earrings**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 97.2% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Drop earrings in metal with blue stone**

Packaging description **The earrings are attached to a small brown cardboard. The product is also sold online, with the codes POA4950299 and SKUC26844-19916283.**

Brand **Fashion Jewelry**

Name **Bohemian Cross Drop Earrings**

Type / number of model **0108--0--14308**

Batch number **R-Q1-05-26**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Alert number **[INFO/00076/21](#)**

Product **Necklace**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 87.2% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Metal necklace with metal charms and turquoise stones. The product is also sold online, with the codes C-E10-A04-105 and T0437641911140013**

Brand **Fvermecky**

Name **Bohemian Carved Turquoise Fringe Necklace**

Type / number of model **(12) Silver**

Batch number **461665601**


Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Alert number **[A12/00422/21](#)**

Product **Train set**

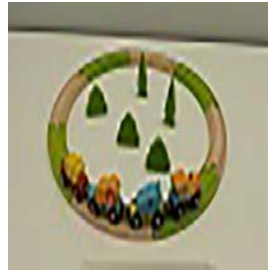

Risk type **Choking
Injuries**

The product has easily accessible small parts. A child may put them in the mouth and choke on them. The product also has magnets that can detach from the toy and possess a high magnetic flux. A small child may put them in the mouth and choke on them or, if swallowed, they could attract one another causing intestinal blockage or perforation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Wooden train with rails and accessories. 20 pieces**

Brand **Tooky Toy**

Name **Treinset 20 delig**

Type / number of model **Multifunctional cot Dreamy plus 2; Item#TKI025;**

Batch number **6970090048500**

Weekly report number **Report-2021-12**

Alert submitted by **The Netherlands**

Alert number	<u>A11/00020/21</u>
Product	Safety gate for children



Corrigendum	The notifications A12/1935/19 and A12/1937/19 were withdrawn from report 2019-50 and notifications A12/00077/19, A12/00080/19, A12/00084/19, 12/00089/19, A12/00091/19 and A12/00094/19 were withdrawn from weekly report 2020-02 at the request of the notifying authority following a reassessment of the corresponding risk reports.
Risk type	Choking The safety gate has small detachable small parts. The child can put those in the mouth and choke on them. The product does not comply with the relevant European standard EN 1930.
Category	Childcare articles and children's equipment
Type	Consumer
Description	White stair gate/safety barrier.
Packaging description	Cardboard box
Brand	Baby and Kids
Name	Metalen Traphek Oslo wit
Type / number of model	64633
Weekly report number	Report-2021-12

Alert number **[A12/00416/21](#)**

Product **Necklace**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 90% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Metal coin chain necklace. The product was sold online, in particular via Amazon.**

Brand **Unknown**

Name **Bellaven 1 X Personalized Gold Coin Drop Pendant Necklace Durable Turquoise Chain Jewelry**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures ordered by public **Other : Written advice**

Alert number **[A12/00417/21](#)**

Product **Earrings**



Risk type **Chemical**

The product releases an excessive amount of nickel (measured value up to 0.09 µg/cm²/week). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. The product contains an excessive amount of cadmium (measured value 24% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Round metal earrings. The product was sold online, in particular via Amazon.**

Brand **Unknown**

Name **Sticks Jewelry Charm Earrings Good quality New arrive 2017 Trend fashion women earrings**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Alert number **[INFO/00066/21](#)**

Product **Earrings**

Risk type **Chemical**

The product contains an excessive amount of cadmium (measured value 90% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidney and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Earrings with tree design**

Brand **Unknown**

Name **Örhängen med Yggdrasil**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **Sweden**

Measures taken by economic operators **Withdrawal of the product from the market
Distributor**

Alert number **[A12/00395/21](#)**

Product **Battery-operated toy**



Risk type	<p>Chemical Environment</p> <p>The soldered joints of the toy contain an excessive amount of lead (measured value: 150000 mg/kg). Lead is harmful to human health, accumulates in the body and can cause developmental neurotoxicity.</p> <p>The product does not comply with the requirements of the Directive 2011/65/EU on the restriction of hazardous substances (RoHS) and the relevant European standard EN 62321-5.</p>
Category	Toys
Type	Consumer
Description	A car toy with battery supply 3x1, 5V AA.
Packaging description	Cardboard box.
Brand	YI JUN
Name	ROBOT DEFORM
Type / number of model	LG9111F (on the label) NO:YJ388-22
Barcode	8661906060035
Weekly report number	Report-2021-12
Alert submitted by	Czechia

Alert number **[A12/00388/21](#)**

Product **Motorcycle**

Risk type **Injuries**

The gearbox may be defective. This can lead to propulsion failure, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Motorcycle**

Brand **Yamaha**

Name **FJR1300**

EC-type approval/model **Type-approval number: e13*168/2013*00001, Type: RP28**

Production dates **The affected vehicles were manufactured between 2015 and 2020.**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <http://www.yamaha-motor.de>**

Products were found and measures were taken also in **Greece
Croatia
Sweden**

Alert number **[A12/00397/21](#)**

Product **Table lamp**



Risk type **Electric shock**

The lamp is attractive to children but it is not equipped with a transformer or converter. The lamp bulb is easily accessible and touching it when is hot it may cause burns. The user can touch live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Panda-shaped table lamp, mains powered.**

Packaging description **Printed cardboard box.**

Brand **Milagro**

Name **Lampa: PANDA**

Type / number of model **NO. 210**

Batch number **VI-2017**

Barcode **EAN 5902693732105**

Weekly report number **Report-2021-12**

Alert number **[A11/00019/21](#)**

Product **Children's bikini**



Risk type	<p>Strangulation</p> <p>The product has long functional cords with free ends in the neck area. These cords can become trapped during various activities of a child, leading to strangulation.</p> <p>The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 14682.</p>
Category	Clothing, textiles and fashion items
Type	Consumer
Description	Children's bikini pink-orange-green-blue-white color, colored in stripes, which consist of an upper and lower part. The upper part of the bikini contains elastic cords that tie behind the neck. The elastic cords are terminated against fraying knots.
Packaging description	The product is without packaging.
Brand	Cygnus
Type / number of model	72-0403/2719613
Barcode	2051027196144
Weekly report number	Report-2021-12
Alert submitted by	Czechia

Alert number **[INFO/00062/21](#)**

Product **Passenger car**

Risk type **Injuries**

Defective software may impair the functioning of the brake booster.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **KIA**

Name **Soul**

EC-type approval/model **Type-approval number: e4*2007/46*1365*
Type: SK3**

Production dates **The affected vehicles were manufactured between 20 April 2018 and 25 November 2020.**

Company recall code **201128**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[INFO/00063/21](#)**

Product **Passenger car**

Risk type **Injuries**

Functional failure can occur in the left-rear light control unit due to vibrations. This could cause the left reversing light to be on all the time.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Mercedes-Benz**

Name **GLE (BR 167): GLE 300 d 4MATIC, GLE 350 4MATIC, GLE 450 4MATIC, GLE 350 D 4MATIC, GLE 400 d 4MATIC**

EC-type approval/model **Type-approval numbers: e1*2007/46*1885*02 - *09, Type: H1GLE**

Production dates **The affected vehicles were manufactured between 9 April 2019 and 8 May 2020.**

Company recall code **5495204**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code - **<https://www.Mercedes-benz.de>**

Alert number **[A12/00389/21](#)**

Product **Passenger car**

Risk type **Injuries**

The wiring harness of the electronic steering-column lock (ESL) may come into contact with the steering-column shaft during steering movements. This may result in cable abrasion and, over time, damage to the cables. As a consequence, propulsion power and/or the power steering may be lost, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Jeep**

Name **Wrangler**

EC-type approval/model **Type-approval number: e4*2001/116*0116*30, Type: ACE**

Production dates **The affected vehicles were manufactured between 1 February 2019 and 11 September 2020.**

Company recall code **W53**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Poland**

Alert number **[A12/00421/21](#)**

Product **Thermal paper**



Risk type **Chemical**

The product contains bisphenol A (measured value up to 1,02% by weight). Bisphenol A may harm the health of users, causing possible damage to the reproductive system

The product does not comply with the REACH Regulation

Category **Stationery**

Type **Consumer**

Description **Thermal paper for fax machines, print colour: black**

Packaging description **Paper packed in polymer packaging**

Brand **FORPUS**

Name **Thermal paper for fax machines**

Type / number of model **210mmx30m**

Batch number **F040902**

Barcode **4750650409024**

Weekly report number **Report-2021-12**

Alert submitted by **Latvia**

Alert number **[A12/00391/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to an error in the driver's airbag folding process, the heat shield may not move fully into position around the inflator when the airbag is activated. Consequently, hot gas can directly contact the front panel of the airbag, causing burn damage to the bag material. As a result, the airbag may tear during inflation reducing its protective function.

Category **Motor vehicles**

Type **Consumer**

Description **Model: Juke (F15), e-NV200 (ME0); Range affected VIN's in Portugal: - F15 (none); - ME0 (VSKYAAME0U0 (613337 - 616254), VSKTAAME0U0 (610621 - 616306), VSKYAAME0U0 (613080 - 616302)); Countries of production: - Juke (F15) - NMUK - UK; - e-NV200 (ME0) - NMISA - Spain.**

Brand **Nissan**

Name **Juke, e-NV200**

EC-type approval/model **Juke (e11*2007/46*0132), e-NV200 (e11*2007/46*1339).**

Production dates **Juke (04/04/2019 to 30/05/2019), e-NV200 (23/04/2019 to 19/11/2019).**

Company recall code **PFP PG1C5, PS1C0.**

Weekly report number **Report-2021-12**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic **Recall of the product from end users**

Alert number **[A12/00393/21](#)**

Product **Hybrid bicycle**



Risk type **Injuries**

The spokes of the front wheel might be insufficiently tightened. The user could lose balance and fall off leading to injuries and accidents.

The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN ISO 4210-2.

Category **Hobby/sports equipment**

Type **Consumer**

Description **Blue hybrid bicycle**

Brand **GITANE**

Name **Bicyclette**

Type / number of model **Cycleurope YPG3085101 Verso Sport OFR 2x9s**

Weekly report number **Report-2021-12**

Alert submitted by **France**


Is the product counterfeit? **No**

Country of origin **Bangladesh**

Measures taken by economic **Other : contact with buyers so that they return the bicycles**

Alert number **[INFO/00064/21](#)**

Product **Particle filter mask**

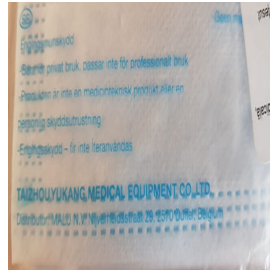

Risk type **Health risk / other**

The mask is presented as providing a protective function; however these claims are not backed by evidence. This could create a false sense of safety to the wearer of the mask and thus, even if combined with other recommended measures, not protect its user.

The product does not comply with the requirements of the General Product Safety Directive (GPSD).

Category **Protective equipment**

Type **Consumer**

Description **3 layers disposable mask with 3 folds. Product information is printed on the plastic bag, on a paper label inside the bag and a self-adhesive label applied on the bag.**

Packaging description **The product is sold in a package containing 10 units packed in a plastic bag closed by heat sealing.**

Brand **YK-MASK**

Name **Disposable mask**

Type / number of model **YK10001**

Barcode **YK00202005003
5411504164856**

Weekly report number **Report-2021-12**

Alert number **[A12/00390/21](#)**

Product **Passenger car**

Risk type **Fire
Injuries**

The vehicles may be affected by frictional corrosion on the connector from the wiring harness to the blower control unit. Over time, this may cause damage to the insulation of the wiring harness, which could trigger a short circuit. This could cause a vehicle fire, even when the engine is switched off.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **BMW**

Name **3**

EC-type approval/model **Type-approval number: e1*2007/46*0314*, *0315*, *0316*
Types: 3L, 3K, 3C**

Production dates **The affected vehicles were manufactured between 20 July 2004 and 8 July 2011.**

Company recall code **0061830500, 0061660400, 0061830400**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and **Poland**

Alert number **[A12/00392/21](#)**

Product **Pickup truck**

Risk type **Injuries**

The wiring harness connector of the rear outboard seatbelt pre-tensioner may not be correctly locked in position. This can prevent the pre-tensioner from fully tensioning the seatbelt in the event of an accident, increasing the risk of injury.

Category **Motor vehicles**

Type **Consumer**

Description **Model Year: D-MAX 2020 - 2021.**

Brand **Isuzu**

Name **D-MAX**

EC-type approval/model **e13*2007/46*2324*xx**

Production dates **The affected vehicles were manufactured between September 2020 and January 2021.**

Company recall code **W9086**

Weekly report number **Report-2021-12**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Thailand**

Measures taken by economic operators **Recall of the product from end users
Importer**

Products were found and measures were taken also in **Poland
Romania
Sweden**

Alert number **[A12/00394/21](#)**

Product **Passenger car**

Risk type **Fire
Injuries**

A contact defect can develop over time due to friction corrosion on the plug connection between the cable harness and the fan controller. The insulation of the cable harness can therefore become damaged over time, which could trigger a short circuit. This could result in a vehicle fire, even if the car is parked.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **ALPINA**

Name **ALPINA B3 / D3**

EC-type approval/model **Individual approval**

Production dates **The affected vehicles were manufactured between 20 July 2004 and 8 July 2011.**

Company recall code **0061830500, 0061660400, 0061830400**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00398/21](#)**

Product **Passenger car**

Risk type **Injuries**

The trailer coupling device may be defective. This can cause the trailer to detach inadvertently, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **Grandland X**

EC-type approval/model **Type: Z
e2*2007/46*0597*11 ; e2*2007/46*0597*13 - * 18**

Production dates **The affected vehicles were manufactured between 10 September and 30 December 2020.**

Company recall code **E212100022 (21-C-012)**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Croatia
Poland
Sweden**

Alert number **[A12/00420/21](#)**

Product **Balloons**



Risk type **Chemical**

The amount of nitrosamines released by the balloons is too high (measured value up to 1.7 mg/kg). Nitrosamines are carcinogenic via inhalation, ingestion or dermal exposure. A child can be exposed to them by putting the balloon in the mouth.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

Category **Toys**

Type **Consumer**

Description **Helium-grade latex balloons in a colourful mix of pastel colours. This product was sold online, in particular via Amazon.**

Packaging description **Plastic film with multi-coloured printing**

Brand **O-Kinee**

Name **Party Balloons**

Type / number of model **ASIN B07PK7WCNL**

Barcode **X0014RZCRH**

Weekly report number **Report-2021-12**

Alert number **[A12/00396/21](#)**

Product **Bus**

Risk type **Fire**

An insulation fault may lead to a short circuit and increase the risk of fire.

Category **Motor vehicles**

Type **Professional**

Description **Bus**

Brand **EvoBus**

Name **eCitaro, eCitaro G**

EC-type approval/model **Models: 628 10, 628 11
Type-approval numbers: e1*2007/46*1985,
e1*2007/46*2083**

Production dates **October 2020 to January 2021**

Company recall code **54.10M21141A**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00409/21](#)**

Product **Passenger car**

Risk type **Injuries**

The gas generator of the passenger airbag may be defective. This could lead to uncontrolled inflation and the release of metal fragments when the airbag is activated, causing injury to the occupants.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Fisker**

Name **Karma**

EC-type approval/model **Individual approval**

Production dates **The affected vehicles were manufactured between September 2011 and October 2012.**

Company recall code **58417001**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **-**
https://www.karmaautomotive.com/karmab2c/en/campaigns_2012fisker

Alert number **[A12/00403/21](#)**

Product **Balloons**



Risk type **Chemical**

The amount of nitrosamines released by the balloons is too high (measured value up to 2,72 mg/kg). Nitrosamines are carcinogenic via inhalation, ingestion or dermal exposure. A child can be exposed to them by putting the balloon in the mouth.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

Category **Toys**

Type **Consumer**

Description **Five yellow balloons packed in transparent plastic bag.**

Brand **Unknown**

Name **Ballon, Party balloons**

Type / number of model **0225**

Barcode **3858190102250**

Weekly report number **Report-2021-12**

Alert submitted by **Croatia**

Is the product counterfeit? **Unknown**

Alert number **[A12/00410/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Fire
Injuries**

The wading depth is incorrectly stated in the instructions for use. As a result, the vehicle could be used in inappropriate wading depth conditions, leading to electrical faults and increased risk of fire.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **MERCEDES-BENZ**

Name **Vito**

EC-type approval/model **Type-approval numbers: e1*2007/46*0457*23 - *25,
e1*2007/46*0459*13 - *14
Types: 639/2, 639/5**

Production dates **The affected vehicles were manufactured between
5 February and 24 November 2020.**

Company recall code **VS2TIEFAWD**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00413/21](#)**

Product **Passenger car**

Risk type **Injuries**

The brake system module may contain a software error. This could result in insufficient brake assist in the event of emergency braking, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Jeep Wrangler (JL), model year: 2021.**

Brand **Jeep**

Name **Wrangler**

EC-type approval/model **e4*2001/116*0116*38**

Production dates **Model year: 2021**

Company recall code **Y09**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00411/21](#)**

Product **Passenger car**

Risk type **Injuries**

The trailer hitch may be defective. As a result the trailer may become detached inadvertently, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Citroen**

Name **C5 Aircross**

EC-type approval/model **e2*2007/46*0642*10, Type: A**

Production dates **The affected vehicles were manufactured between 4 and 21 December 2020.**

Company recall code **HMS**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <https://www.citroen.de/zubehoer-service/instandhaltung-und-reparatur/pruefen-ihres-fahrzeuges-auf-rueckrufaktion.html>**

Products were found and **Poland
Sweden**

Alert number **[A12/00412/21](#)**

Product **Passenger car**

Risk type **Injuries**

The trailer hitch may be defective. As a result, the trailer could become detached inadvertently, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car.**

Brand **Peugeot**

Name **3008**

EC-type approval/model **Type-approval number: e2*2007/46*0534*16, Type: M**

Production dates **The affected vehicles were manufactured between 7 and 23 December 2020.**

Company recall code **KGX**

Weekly report number **Report-2021-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <https://www.peugeot.de/teile-und-zubehor/prufung-ihres-fahrzeugs-auf-ruckrufaktionen.html>**

Products were found and measures were taken also in **Malta
Poland
Sweden**

Alert number **[A12/00419/21](#)**

Product **Fall protection plate**



Risk type **Chemical**

The product contains an excessive amount of polycyclic aromatic hydrocarbons (PAH)s, including benzo(a)pyrene and benzo(e)pyrene, (measured values correspondingly 2.9 ppm and 2.3 ppm) PAHs are carcinogenic and are restricted in articles who come in direct contact with skin.

The product does not comply with the REACH Regulation.

Category **Construction products**

Type **Consumer**

Description **Black fall protection plate, used in playgrounds, nursing homes etc. The product was also sold online.**

Brand **Unknown**

Name **Fallskyddsplatta svart**

Type / number of model **00-004-383-1**

Weekly report number **Report-2021-12**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **Germany**

Alert number **[A12/00400/21](#)**

Product **Soft toy**



Risk type **Choking**

Small parts (plastic eyes, metal chain) may easily detach from the toy. The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put small parts or the stuffing material in the mouth and choke on them.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Soft toy - teddy bear with metal chain attached. Size of the toy: 13 cm.**

Brand **Unknown**

Name **Plush Toy - Teddy Bear**

Barcode **EAN 5906729638393**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Alert number **[A12/00402/21](#)**

Product **Plastic doll**



Risk type **Chemical**

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 20,8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll.**

Packaging description **Cardboard box with plastic window.**

Brand **Unknown**

Name **Girl**

Type / number of model **LEJ 342511 (on attached label)
NO.Q18 (on packaging)**

Barcode **EAN: 5903321034745**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Alert number **[A12/00404/21](#)**

Product **Plastic doll**



Risk type **Chemical**

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 20,5% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll.**

Packaging description **Cardboard box.**

Brand **Unknown**

Name **Pretty Angel**

Type / number of model **LEE 781519 (on attached label)**

Barcode **EAN: 5902388628652**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Alert number **[A12/00408/21](#)**

Product **Plastic doll**



Risk type **Chemical**

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 25,4% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll.**

Packaging description **Cardboard box with plastic window.**

Brand **Unknown**

Name **Fashion Happy Time**

Type / number of model **LEC009033 (on attached label)**

Barcode **EAN: 5902388127834**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Alert number **[A12/00406/21](#)**

Product **Plastic toys**



Risk type **Chemical**

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 20,7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Set of plastic bath toys.**

Packaging description **Net bag.**

Brand **Mega Creative**

Name **Zabawka do kapieli**

Type / number of model **INDEX 454146**

Barcode **EAN 5903246484199**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Alert number **[A12/00414/21](#)**

Product **Motorcycle**

Risk type **Injuries**

Excessive grease was applied to the O-ring of the reservoir piston in the ABS (Anti-lock Braking System) modulator. As a result, foreign matter may adhere to the grease and become pinched in the check valve during braking, causing input pressure leak and increasing the braking distance.

Category **Motor vehicles**

Type **Consumer**

Description **Model code (Model): SD08 (CRF1100AL), SD09 (CRF1100D4L), SD10 (CRF1100AL, CRF1100ALL, CRF1100DL4L). Model (type): CRF1100AL (2ED), CRF1100D4L (2ED, ED), CRF1100AL (CM), - CRF1100ALL (2TH), CRF1100DL4L (2J, J, 2MA, 2TH).**

Brand **Honda**

Name **CRF1100A, CRF1100D4**

EC-type approval/model **CRF1100A2/A4/D2/D4 - e4*168/2013*00115*00; CFR1100A/D - e4*168/2013*00118*00**

Production dates **The affected vehicles were manufactured between 6 November and 19 December 2019.**

Company recall code **3LP**

Weekly report number **Report-2021-12**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Importer**

Alert number **[A12/00399/21](#)**

Product **Toy puzzle**



Risk type **Choking**

The puzzle contains a small part (rooster's wattle). A small child may put small part in the mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Rooster-shaped toy puzzle.**

Packaging description **Foil packaging.**

Brand **Unknown**

Name **Ukladanka**

Type / number of model **1908K888/L2893**

Barcode **EAN: 5104732167439**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Alert number **[A12/00401/21](#)**

Product **Plastic doll**



Risk type **Chemical**

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 19,3% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic mermaid doll. The doll emits lights (fishtail contains non-replaceable batteries).**

Packaging description **Cardboard box with plastic window.**

Brand **Midex**

Name **Grace Mermaid**

Type / number of model **BB214538/8198**

Barcode **EAN 5900733535471**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**

Alert number **[A12/00415/21](#)**

Product **Passenger car**

Corrigendum **null**

Risk type **Fire**

The Anti-Lock Brake System (ABS) modules may malfunction internally. This could cause an electrical short circuit over time, increasing the risk of fire in the engine compartment.

Category **Motor vehicles**

Type **Consumer**

Description **Model year: 2020; VINs: TMAJ2813MLJ000000 ~ TMAJ2813MLJ997665, TMAJ2817ALJ000007 ~ TMAJ3817GLJ179856.**

Brand **Hyundai**

Name **Tucson (TLe)**

EC-type approval/model **e21*NKS*0055*00, e11*2007/46*2724*.**

Production dates **The affected vehicles were manufactured between February 2017 and August 2020.**

Company recall code **11DC03**

Weekly report number **Report-2021-12**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures taken by economic operators **Recall of the product from end users
Importer**

Alert number

[A12/00407/21](#)

Product

Push-along toy



Risk type

Choking

A small part (plastic connector) may easily detach form the toy. A child may put the small part in the mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category

Toys

Type

Consumer

Description

Plastic push-along toy in the shape of a dog.

Packaging description

Foil bag.

Brand



Unknown

Name

Push Animal Toys / Happy Paradise

Alert number **[A12/00405/21](#)**

Product **Swing**

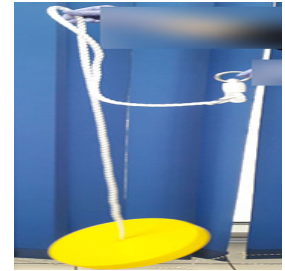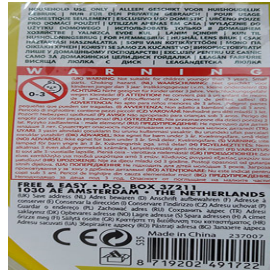

Risk type **Injuries**

The swing is not sufficiently resistant to load. As a consequence, under load the seat may separate from the rope and the child may fall off the swing and suffer injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-8.

Category **Toys**

Type **Consumer**

Description **Plastic disc swing.**

Packaging description **Plastic packaging.**

Brand **Unknown**

Name **Disc Swing**

Type / number of model **237007 S35**

Barcode **EAN 8719202491722**

Weekly report number **Report-2021-12**

Alert submitted by **Poland**