

Alert number **[INFO/00085/21](#)**

Product **Necklace**



Risk type **Chemical**

The product contains a too high level of cadmium (90% by weight). Cadmium is damaging to human health because it accumulates in the body, damaging kidneys and bones, and can cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Ladies' collar necklace, crocheted black Gothic style. The product is sold online, in particular via eBay.**

Brand **Unknown**

Name **Halskette Damen Collier schwarz Gothik-Stil gehäkelt**

Batch number **eBay: 222976880617**

Weekly report number **Report-2021-14**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Alert number **[INFO/00086/21](#)**

Product **Necklace**



Risk type **Chemical**

The product contains a too high level of cadmium (40% by weight). Cadmium is damaging to human health because it accumulates in the body, damaging kidneys and bones, and can cause cancer.

The product does not comply with the REACH Regulation

Category **Jewellery**

Type **Consumer**

Description **Necklace with a pearl disc and silver angel wings. The product was also sold online, in particular via eBay.**

Brand **Unknown**

Name **Halskette Scheibe Perle Engelsflügel Silber**

Batch number **eBay: 223999265678**

Weekly report number **Report-2021-14**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Alert number **[A12/00473/21](#)**

Product **Earrings**



Risk type **Chemical**

The product's cadmium content is too high (80% by weight in the drop part of the earring). Cadmium is harmful to human health because it accumulates in the body, damages the kidneys and the bones and is carcinogenic.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Pair of drop earrings, golden with coloured sdecorations. The product is also sold online, in particular via Amazon.**

Brand **OYEFLY**

Type / number of model **Ohrstecker**

Batch number **X0014ASWA3
ASIN: B07PXXBJX1**

Weekly report number **Report-2021-14**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Alert number

[A12/00484/21](#)

Product

Children's sweatshirt



Risk type

Strangulation

There are long functional cords with free ends in the hood of the product. They can become trapped during various activities of a child, leading to strangulation.

The product does not comply with the General Product Safety Directive and the relevant European Standard EN 14682.

Category

Clothing, textiles and fashion items

Type

Consumer

Description

Children's sweatshirt (black-yellow colour) with yellow lettering. The product was also sold online.

Packaging description

Transparent plastic bag.

Brand

KILPI

Name

KILPI COTNY JB KJ0090KI

Type / number of model

COTNY

Batch number

JB KJ0090KI

Barcode

8592913199510

Weekly report number

Report-2021-14

Alert number **[A12/00481/21](#)**

Product **Studded tyre**

Risk type **Injuries**

Due to an error in the production process, the tyres could potentially show an instantaneous pressure loss. This could impair the vehicle handling, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Type: 205/55 R16 94 T.; Serial numbers: 1CP 03CWT5 1820, 1CP 03CWT5 1920**

Brand **Continental**

Name **IceContact 3**

EC-type approval/model **E4-30R-0241210**

Weekly report number **Report-2021-14**

Alert submitted by **Finland**

Is the product counterfeit? **No**


Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code - **<https://www.mynewsdesk.com/fi/continental-rengas-oy/pressreleases/continental-kaeynnistaee-oma-aloitteisesti-vaihto-ohjelman-nastarenkaille-suomessa-ruotsissa-norjassa-ja-virossa-3070457>**

Alert number **[A12/00483/21](#)**

Product **Rubber grass mat**

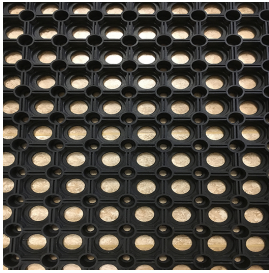

Risk type **Chemical
Environment**

The product contains an excessive amount of polycyclic aromatic hydrocarbons (PAH)s (measured values up to: 2.0 ppm for benzo(a)pyrene, 2.8 ppm for benzo(e)pyrene, 2.0 ppm for benzo(a)anthracene, and 2.6 ppm for chrysene). These PAHs may cause cancer and are also mutagenic and toxic for reproduction.

The product does not comply with the REACH Regulation.

Category **Construction products**

Type **Professional**

Description **Black rubber mat for lawns.**

Brand **Unknown**

Name **Gumminät gräs**

Type / number of model **8000062**

Weekly report number **Report-2021-14**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **Unknown**

Alert number **[A12/00471/21](#)**

Product **Jumpbag**



Risk type **Chemical**

The foam material in the product contains an excessive amount of the flame retardant tris(2-chloro-1-methylethyl) phosphate (TCPP) (measured values: up to 24 mg/kg). TCPP can be harmful to children if it is swallowed.

The product does not comply with the requirements of the Toy Safety Directive.

Category **Toys**

Type **Consumer**

Description **Red jumpbag made of cotton (twill) filled with foam.**

Brand **Unknown**

Name **Hopsäck röd 100% bomull (twill)**

Type / number of model **2509**

Weekly report number **Report-2021-14**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **Poland**

Measures taken by economic **Stop of sales**

Alert number **[A12/00474/21](#)**

Product **Toy guitar**



Risk type **Choking**

The strap of the toy guitar has no quick release mechanism. If worn around the neck, it could form a loop and become trapped, leading to strangulation.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Plastic toy guitar (blue, white, green) with colourful buttons etc. yellow strap (belt); battery compartment (for 3 x AA batteries; empty), screwed.**

Packaging description **Cardboard box with cellophane window.**

Brand **Unknown**

Name **Guitar Butterfly Music**

Type / number of model **Artikelnummer: 229116**


Weekly report number **Report-2021-14**

Alert submitted by **Austria**

Is the product counterfeit? **No**

Alert number **[A12/00472/21](#)**

Product **Bedside sleeper**

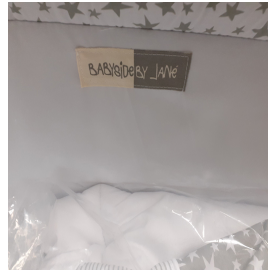

Risk type **Strangulation**

The distance from the highest surface of the mattress to the top of the drop side is smaller than the required 120 mm. If the baby moves his/her head aside towards the parents' bed while sleeping, his/her throat may get caught at the drop side. This may block the respiratory tracts and lead to strangulation.

The product does not comply with the requirements of the General Product Safety Directive and the relevant European Standard EN 1130.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Bedside sleeper/co-sleeping cot for babies up to 9 kg. The product was sold online.**

Packaging description **Cardboard packaging**

Brand **JANÉ**

Name **Babyside**

Type / number of model **code 6801 and 6802, depending on the color - T.01, T.25, T.83**

Weekly report number **Report-2021-14**

Alert submitted by **Bulgaria**

Alert number **[A12/00482/21](#)**

Product **Bedside sleeper**



Risk type **Strangulation**

The distance from the highest surface of the mattress to the top of the drop side is smaller than the required 120 mm. If the baby moves his/her head aside towards the parents' bed while sleeping, his/her throat may get caught at the drop side. This may block the respiratory tracts and lead to strangulation.

The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 1130.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Bedside sleeper, size 90x52x60 cm, for children up to 12 months, 11 kg. The product was sold online, in particular via Amazon.**

Packaging description **Cardboard packaging**

Brand **Cangaroo**

Type / number of model **Shared Love P-9**

Barcode **3800146248048, 3800146248055, 3800146247737**

Weekly report number **Report-2021-14**

Alert submitted by **Bulgaria**

Alert number **[A12/00479/21](#)**

Product **Passenger car / Light commercial vehicle**

Risk type **Fire**

The fuel line may be installed incorrectly. As a result, it could become damaged, leading to increased risk of fire.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car / Light commercial vehicle**

Brand **Mercedes-Benz**

Name **Citan**

EC-type approval/model **e2*2007/46*0130*21, Type: X**

Production dates **The affected vehicles were manufactured between 1 February 2018 and 24 April 2019.**

Company recall code **C1LEITUBI**

Weekly report number **Report-2021-14**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00480/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

The seat frame of the passenger seat may not have been welded correctly. This could increase the risk of injury in the event of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **Mercedes-Benz**

Name **Vito**

EC-type approval/model **Type-approval numbers: e1*2007/46*0457*25, e1*2007/46*0458*20-*21, e1*2007/46*0459*14, Types: 639/2, 639/4, 639/5**

Production dates **The affected vehicles were manufactured between 26 November and 4 December 2020.**

Company recall code **VS2SITZNAT**

Weekly report number **Report-2021-14**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00475/21](#)**

Product **Bus/coach**

Risk type **Injuries**

The roller-blind covers are not sufficiently fire-resistant (requirements of R 118) and therefore it can melt and drip onto passengers.

Category **Motor vehicles**

Type **Professional**

Description **Bus/coach**

Brand **EvoBus**

Name **Setra S 531 DT**

EC-type approval/model **Type approval number: e1*2007/46*0013*
Type: 410 01**

Production dates **June 2020 - July 2020**

Company recall code **68.30U20123A**

Weekly report number **Report-2021-14**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00478/21](#)**

Product **Bus**

Risk type **Injuries**

Due to their small dimension, the hinges could break. An internal pivot-hung window could detach from its hinges and become unstuck, injuring passengers.

Category **Motor vehicles**

Type **Professional**

Description **Bus**

Brand **EvoBus**

Name **Conecto, Intouro, Setra LE Business, Setra UL Business**

EC-type approval/model **Models: 628B01,628B02,633 01,633 04,633 05
Type-approval numbers: e1*2007/46*0036,
e1*2007/46*0037, e1*2007/46*0012, e1*2007/46*0014,
e1*2007/46*0018**

Production dates **From September 2016 to January 2021**

Company recall code **67.00U21140A**

Weekly report number **Report-2021-14**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[INFO/00087/21](#)**

Product **Passenger car**

Risk type **Injuries**

The propellant used in the airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants.

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles equipped with SDI propellant generators from the Takata production plants Monclova 2 and Freiberg.**

Brand **Volkswagen**

Name **Passat, Polo**

EC-type approval/model **e1*2001/116*0307*##, e1*2001/116*0510*##, Types: 3C, 6R**

Production dates **The affected vehicles were manufactured in 2007.**

Company recall code **69BE**

Weekly report number **Report-2021-14**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00477/21](#)**

Product **Circular saw blade**



Risk type	Injuries
	The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.
	The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 60745-2.
Category	Hand tools
Type	Consumer
Description	Circular chain saw with dimensions 22,2 mm, with 9 teeth, for angle grinder 125mm. The product was also sold online.
Packaging description	In a plastic packaging.
Brand	Powermat
Type / number of model	PM0892
Weekly report number	Report-2021-14
Alert submitted by	Slovenia
Is the product counterfeit?	Unknown

Alert number **[A12/00476/21](#)**

Product **Lifejacket**



Risk type **Drowning**

Some cylinders of the lifejacket could be empty making inflation of the product impossible.

The product does not comply with the requirements of the Personal Protective Equipment Directive.

Category **Protective equipment**

Type **Consumer**

Description **Inflatable lifejacket for adults. The product was also sold online.**

Brand **TRIBORD**

Name **LJ150 NEW**

Type / number of model **8491769**

Batch number **Products sold between 15.02. - 10.03 2021.**

Barcode **3608459556665**

Weekly report number **Report-2021-14**

Alert submitted by **Romania**

Is the product counterfeit? **No**