

Alert number **[A12/00635/21](#)**

Product **Jewellery set**



Risk type **Chemical**

The product contains an excessive amount of cadmium and lead (measured values: up to 83% and 2,8% by weight, respectively, in the bracelet). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Set of matching jewellery comprising a gold-coloured necklace, a bracelet, a pair of earrings and a ring. The product is also sold online, in particular via Wish.**

Packaging description **Packed in a plastic bag containing the following information: P00267636-001, Ad0721, 61154175 and 511 made in China.**

Brand **Unknown**

Name **Costume tribal africain plaqué or strass mariage fête collier boucles d'oreilles bracelet bague**

Weekly report number **Report-2021-19**

Alert submitted by	France
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Removal of this product listing by the online marketplace Other

Alert number

[A12/00639/21](#)

Product

Necklace and earrings

Risk type

Chemical

The product releases an excessive amount of nickel (measured values up to 0.73 µg/cm²/week) and contains an excessive amount of lead (measured values: up to 34% by weight). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.

The product does not comply with the REACH Regulation.

Category

Jewellery

Type

Consumer

Description

Set comprising a pair of silver-coloured metal earrings with diamanté stones and a matching necklace. The product was also sold online, in particular via Wish.

Packaging description

Packaged in a plastic bag.

Brand

Unknown

Name

Women' s Stunning Red Strainestone Crystal Teardrop Necklace Long Dangle Earrings Silver Wedding Bri

Weekly report number

Report-2021-19

Alert submitted by

France

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Alert number	<u>A12/00636/21</u>
Product	Necklace with pendant



Risk type **Chemical**

The product releases an excessive amount of nickel (measured values up to 10 µg/cm²/week) and contains an excessive amount of cadmium (measured values: up to 88% by weight). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Silver-coloured metal necklace, comprising several metal charms with openwork shapes (star, moon, other) and red stones/beads, packed in a bag. The product was also sold online, in particular via Wish.**

Brand **Unknown**

Name **Black or Red Triple Moon Necklace Occult Pagan Wicca, Wiccan Triple Moon Goddess Pendant Necklace Pen**

Weekly report number **Report-2021-19**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Alert number **[A12/00637/21](#)**

Product **Bracelet**



Risk type **Chemical**

The product releases an excessive amount of nickel (measured values: up to 7.9 µg/cm²/week) and contains an excessive amount of cadmium (measured values: up to 87% by weight). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Gold-coloured metal bracelet with three decorations — an infinity-symbol charm, a medal and a bead. The product was also sold online, in particular via Wish.**

Packaging description **The product is packed in a bag.**

Brand **Unknown**

Name **Bracelet Infinity personnalisé en argent doré, bracelet à breloques perles lettre initiale, cadeaux**

Weekly report number **Report-2021-19**

Alert submitted by **France**

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Alert number **[A12/00638/21](#)**

Product **Necklace and bracelet**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured values: up to 86% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Set consisting of a gold-coloured metal necklace and bracelet, with links in the shape of coffee beans, packed in a bag. The product was also sold online, in particular via Wish.**

Brand **Unknown**

Name **Lot de bracelets en acier inoxydable argenté avec chaîne à maillons et grains de café**

Weekly report number **Report-2021-19**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators

Removal of this product listing by the online marketplace
Other



Alert number	<u>INFO/00111/21</u>
Product	LED string lights



Risk type	Electric shock
	The insulation is inadequate and the creepage distance between the primary and secondary circuits is not sufficient. As a result of these defects, the product poses a risk of electric shock.
	The product does not comply with the Low Voltage Directive and the relevant European standards EN 60598 and EN 61347.
Category	Lighting chains
Type	Consumer
Description	Waterproof LED meteor shower rain lights for outdoor use. The product contains a travel adaptor. The product was also sold online, in particular, via Wish.
Brand	Unknown
Weekly report number	Report-2021-19
Alert submitted by	France
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Removal of this product listing by the online marketplace Other

Alert number **[A12/00662/21](#)**

Product **Bracelet**

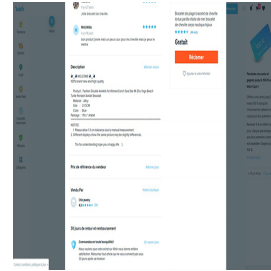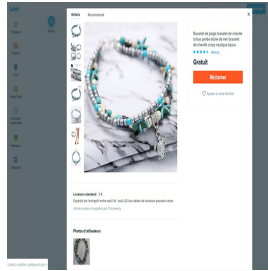

Risk type **Chemical**

The bracelet's clasp contains lead (measured value: 0,67% by weight). Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Bracelet consisting of silver-coloured metal parts. Includes starfish-shaped pendants, blue and beige beads and a silver-coloured metal charm in the shape of a turtle. The product was sold online, in particular via Wish.**

Packaging description **Packaged in a plastic bag.**

Brand **Unknown**

Name **Bracelet de plage bracelet de cheville tortue perlée étoile de mer bracelet de cheville corps nautiq**

Weekly report number **Report-2021-19**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin



People's Republic of China

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Alert number **[A12/00663/21](#)**

Product **Jewellery set**

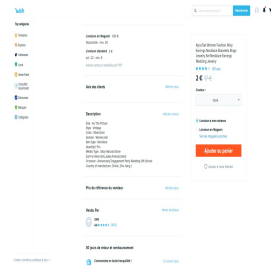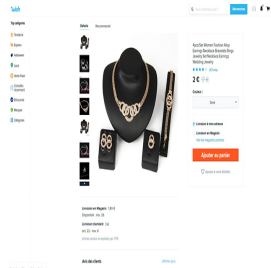

Risk type **Chemical**

The product contains lead and cadmium (measured values: up to 34% and 91% by weight, respectively). Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children, while cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Set comprising necklace, bracelet, ring and a pair of earrings, all made of brass-coloured metal. The 'sleeper' earrings have a stud in the shape of intertwining circles; the ring has a mount in the shape of set intertwining circles. The product was sold online, in particular via Wish.**

Brand **Unknown**

Name **4pcs/Set Women Fashion Alloy Earrings Necklace Bracelets Rings Jewelry Set Necklace Earrings Wedding**

Weekly report number **Report-2021-19**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures taken by economic operators



**Removal of this product listing by the online marketplace
Other**

Alert number

[A12/00664/21](#)

Product

Bracelet

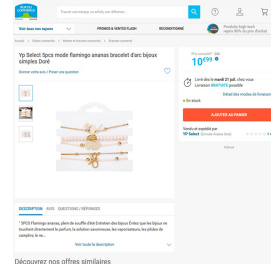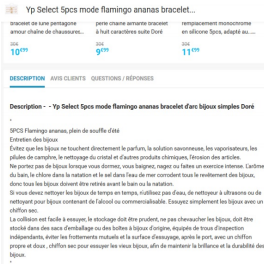

Risk type

Chemical

The bracelet with the pink flamingo pendant contains excessive amounts of cadmium and lead (measured values 62% an 0,099% by weight, respectively). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.

The product does not comply with the REACH Regulation.

Category

Jewellery

Type

Consumer

Description

Bracelet (pink flamingo pendant) selected from a set of five bracelets. The product is also sold online.

Packaging description

Packaged in a plastic bag

Brand

Unknown

Name

Yp Select 5pcs mode flamingo ananas bracelet d'arc bijoux simples Doré

Weekly report number

Report-2021-19

Alert submitted by

France

Is the product counterfeit?

Unknown

Country of origin



Unknown

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Alert number **[A12/00665/21](#)**

Product **Bracelet**

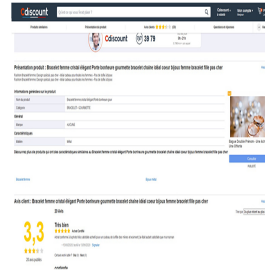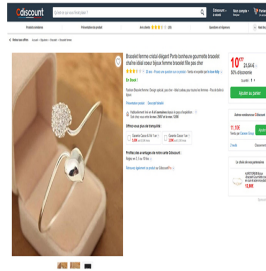

Risk type **Chemical**

The product contains excessive amounts of cadmium and lead (measured values 82% an 0,11% by weight, respectively). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Bracelet with two hearts. The product was sold online, in particular via CDiscount.**

Packaging description **Individually packaged in a plastic bag**

Brand **Unknown**

Name **Bracelet femme cristal élégant Porte bonheur gourmette bracelet chaîne idéal coeur bijoux femme**

Weekly report number **Report-2021-19**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin


People's Republic of China

Measures taken by economic operators

Withdrawal of the product from the market
Other

Alert number **[A12/00631/21](#)**

Product **Balloons**

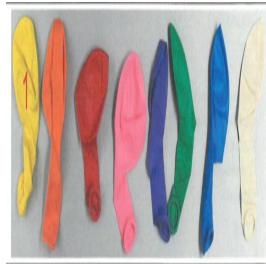

Risk type **Chemical**

The rubber of the balloon releases an excessive amount of n-nitrosodiethylamine (NDEA), n-nitrosomorpholine (NMOR) and n-nitrosodiethanolamine (NDELA) (measured values: 0.008 mg/kg, 0.060 mg/kg and 0.050 mg/kg, respectively). NDEA, NMOR, and NDELA are n-nitrosamines, which may cause cancer through ingestion or dermal exposure. A child could be exposed to it when touching or putting the product in the mouth.

The product does not comply with the Toy Safety Directive and the relevant European standard EN 71-12.

Category **Toys**

Type **Consumer**

Description **100 plain balloons, of various colours.**

Packaging description **Transparent plastic bag containing the 100 balloons.**

Brand **ETS FERRY
FERRY JOUETS**

Name **100 ballons luxe colorés**

Type / number of model **303205**

Batch number **3000(30-1920-10)**

Barcode **3 286 413 032 051**

Weekly report number **Report-2021-19**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Alert number

[A11/00035/21](#)

Product

Self-balancing scooter (hoverboard)



Risk type

**Fire
Injuries**

The product featured poor quality as the power cords, which are exposed to movement between the two motors, are routed through a steel pipe with burr edges at both ends. During the life of the product, the insulation of the power cords will be damaged by the sharp edges to such that in the battery may short-circuit occurs and explodes during use. As a result, the user might lose control and fall off the scooter and suffer injuries.

The product does not comply with the requirements of the relevant European standards EN 60335 and EN 62133.

Category

Hobby/sports equipment

Type

Consumer

Description

Black and yellow self-balancing scooter for use as a personal transport device for persons with lithium ion battery (36 V 4 Ah), LED lighting and battery charger. Size: 605 mm*194 mm*181 mm. The product is also sold online.


Packaging description	The product is sold in a colourful (yellow/orange) cardboard box.
Brand	Motus
Name	DESKOROLKA ELEKTRYCZNA / HOVERBOARD
Type / number of model	Take it XD 6.5
Barcode	5 901821 992589
Weekly report number	Report-2021-19
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	07/11/2020

Alert number

A12/00661/21

Product

Self-balancing scooter (hoverboard)

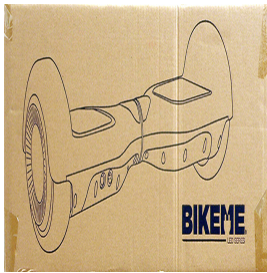

Risk type

**Burns
Fire
Injuries**

The battery does not have a device that monitors the cells temperature, hence it may overheat during charging, and the hoverboard cover may ignite. The product may cause a fire and the user may suffer burns. In addition, the power cords, which are exposed to movement between the two motors, are routed through a steel pipe with burr edges at both ends. During the life of the product, the insulation of the power cords will be damaged by the sharp edges to such that in the battery may short-circuit occurs and explodes during use. As a result, the user might lose control and fall off the scooter and suffer injuries.

The product does not comply with the requirements of the relevant European standards EN 60335 and EN 62133.

Category

Hobby/sports equipment

Type

Consumer

Description

Self-balancing scooter for use as a personal transport

device for persons with lithium ion battery (36 V 2 Ah), LED lighting and battery charger nr. XHK-800-4208. The product was sold online, in particular via eMAG.

Packaging description	The product is sold in a brown and colourful cardboard boxes.
Brand	BIKEME
Name	BALANCE SCOOTER / Elektromos gördeszka
Barcode	5 999565 592134
Weekly report number	Report-2021-19
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	07/01/2021
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	07/01/2021

Alert number

[A11/00034/21](#)

Product

Self-balancing scooter (hoverboard)



Risk type

**Fire
Injuries**

The product featured poor quality as the power cords, which are exposed to movement between the two motors, are routed through a steel pipe with burr edges at both ends. During the life of the product, the insulation of the power cords will be damaged by the sharp edges to such that in the battery may short-circuit occurs and explodes during use. As a result, the user might lose control and fall off the scooter and suffer injuries.

The product does not comply with the requirements of the relevant European standards EN 60335 and EN 62133.

Category

Hobby/sports equipment

Type

Consumer

Description

Pink self-balancing scooter for use as a personal transport device for persons with lithium ion battery and battery charger.

Packaging description	The product is sold in a brown cardboard box.
Brand	Õ CHIC
Name	Balancing Scooter
Type / number of model	SMART-S
Barcode	82191026143483
Weekly report number	Report-2021-19
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	26/10/2020

Alert number **[A12/00629/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

Due to a manufacturing defect, the wheel bolts may be tightened with incorrect torque. This could lead to the detachment of a wheel, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **OPEL**

Name **Vivaro**

EC-type approval/model **e2*2007/46*0533*13, e*2007/46*0532*14**

Production dates **AM2021**

Company recall code **20-C-182**

Weekly report number **Report-2021-19**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **24/12/2020**

Products were found and measures were taken also in **Germany
Greece
Poland**

Slovakia



Alert number

[A12/00642/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 5%). The total filtration capacity of the mask is insufficient (measured values: as low as 45%). Consequently, an excessive amount of particles or microorganisms might pass through the mask; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the PPE Regulation and the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Black particle filter mask with small valve.

Packaging description

The product is sold packed in a black and red plastic wrapping, containing a single item.

Brand

Dr. Frei

Name

Protection Mask

Batch number

exp. 2022

Barcode

3800732484840

Weekly report number

Report-2021-19

Alert submitted by	Iceland
Is the product counterfeit?	Unknown
Country of origin	Unknown
Measures taken by economic operators	Recall of the product from end users Importer
Date of entry into force	01/04/2021

Alert number **[A12/00628/21](#)**

Product **701 ENDURO LR**

Risk type **Fire**

Due to the shape and mounting position of the motorcycles' front fuel tanks, occasional abrasion may occur on both fuel lines. This could result in a fuel leakage, increasing the risk of fire.

Category **Motor vehicles**

Type **Consumer**

Description **Motorcycle**

Brand **Husqvarna**

EC-type approval/model **e1*168/2013*00032*01**

Production dates **Model year: 2020**

Weekly report number **Report-2021-19**

Alert submitted by **Austria**

Is the product counterfeit? **No**

Country of origin **Austria**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **27/04/2021**

Company recall code **- <https://www.husqvarna-motorcycles.com/de-de/service/safety-information.html>**

Products were found and measures were taken also in **France
Greece
Poland
Sweden
Slovenia**

Alert number

[A12/00643/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 73%). Furthermore, the total filtration capacity of the mask is insufficient (measured mean values: as low as 60%). Consequently, an excessive amount of particles or microorganisms might pass through the mask; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

White respiratory protective half-face mask

Packaging description

The product is sold in a soft clear plastic pouch with the CE marking and barcode printed on it. Each pouch contains 10 masks.

Brand

Unknown

Name

Rykgrímur FFP2V 10 stk

Barcode

2 900058 502007



Weekly report number

Report-2021-19

Alert submitted by	Iceland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Importer
Date of entry into force	18/03/2021

Alert number **[A12/00625/21](#)**

Product **Bouncy toy**

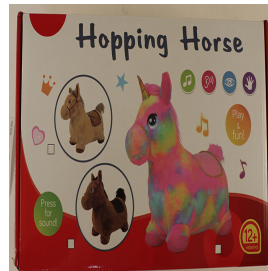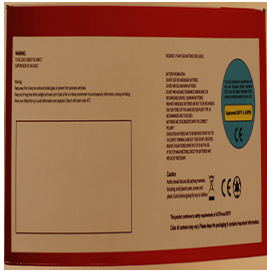

Risk type

**Chemical
Choking**

The white plastic material of the product contains an excessive amount of diisobutyl phthalate (DIBP) (measured value: 17% by weight). Phthalates may harm the health of children, causing possible damage to the reproductive system. A small part (air stopper plug) is easily detachable by hands. A child may put the small part (air stopper plug) in the mouth and choke on it.

The product does not comply with the REACH Regulation and the requirements of the Toy Safety Directive.

Category

Toys

Type

Consumer

Description

Inflatable pink bouncy toy in the shape of a unicorn, with sound.

Packaging description

Packed in a cardboard box. The box has a white background and red highlights. The product name 'Hopping horse' is in front and there are product pictures on the cover.

Brand

YOYO ROCK

Name

Hopping horse

Type / number of model

102417390

Weekly report number

Report-2021-19



Alert submitted by	Finland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Import rejected at border Importer
Date of entry into force	21/04/2021

Alert number

[A12/00644/21](#)

Product

Particle filter mask

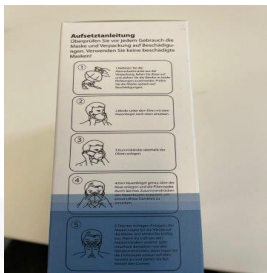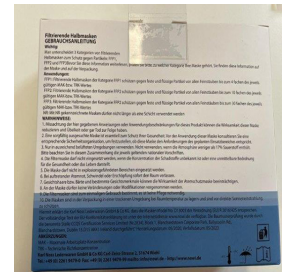

Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 54%). Additionally, the product's packaging bears a CE marking but not the product itself, which is not certified as protective equipment by a relevant body. Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **White particle filter mask in a white/blue box. Each packaging unit contains 10 masks. The CE marking was affixed as an addition. The product is also sold online.**

Packaging description	The product is sold in a white/blue box; each packaging unit contains 10 masks. The CE marking was affixed as an addition.
Brand	Unknown
Name	Mund- und Nasenmaske
Type / number of model	D13003
Barcode	4333692653626
Weekly report number	Report-2021-19
Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Importer

Alert number **[A12/00645/21](#)**

Product **Passenger car**

Risk type **Injuries**

The welding of the tow bar may be faulty. As a result, the trailer coupling could break, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Citroen**

Name **C5**

EC-type approval/model **e2*2007/46*0642*01 to *11, Type: A**

Production dates **The affected vehicles were manufactured between 18 July 2017 and 14 December 2020.**

Company recall code **HNX**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Poland
Sweden**

Alert number **[A12/00646/21](#)**

Product **Passenger car**

Risk type **Injuries**

The welding of the tow bar may be faulty. As a result, the trailer coupling could break, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Peugeot**

Name **3008, 5008**

EC-type approval/model **e2*2007/46*0534*00 to*12 and *14 to *16, Type: M**

Production dates **The affected vehicles were manufactured between 15 December 2016 and 19 December 2020.**

Company recall code **KJJ**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Poland
Sweden**

Alert number **[A12/00649/21](#)**

Product **Passenger car**

Risk type **Injuries**

An unsuitable material is used for the steering gear's steering rack. This could lead to restricted steering function, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Fiat**

Name **500**

EC-type approval/model **e3*2018/858*00001*04, Type: FA1**

Production dates **The affected vehicles were manufactured between 25 February and 6 April 2021.**

Company recall code **6328**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00648/21](#)**

Product **Passenger car**

Risk type **Injuries**

The front wheel-arch covers may not have been attached correctly. As a result, a wheel-arch cover could detach completely while the vehicle is in motion, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Model series: X247.**

Brand **Mercedes-Benz**

Name **GLB**

EC-type approval/model **e1*2007/46*1909*01-09, Type: F2B**

Production dates **The affected vehicles were manufactured between 23 April 2019 and 13 November 2020.**

Company recall code **8890088**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <http://www.Mercedes-Benz>**

Products were found and measures were taken also in **Greece
Poland**

Alert number **[A12/00632/21](#)**

Product **Lorry**

Risk type **Fire**

Hydraulic fluid may leak from a poorly pressed hydraulic hose in the hydraulic fan system. This could create a risk of fire.

Not specified

Category **Motor vehicles**

Type **Professional**

Description **Lorry**

Brand **Mercedes-Benz**

Name **Unimog**

EC-type approval/model **Type approval number: e1*2007/46*1215, e1*2007/46*1216, Type: UGE-232, UGE-453**

Production dates **From 30/04/2019 to 01/08/2019**

Company recall code **2021U55W06**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00647/21](#)**

Product **Passenger car**

Risk type **Injuries**

The two interior roof grab handles on the left side in the travel direction may not have been attached correctly. As a result, a handle could become detached if a vehicle occupant holds on to it when entering or exiting the vehicle, leading to increased risk of injury.

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 213**

Brand **Mercedes-Benz**

Name **E-Class**

EC-type approval/model **e1*2001/116*0501 *48 - *49, e1*2007/46*1560 *22- *23, Types: 212, R1ES**

Production dates **The affected vehicles were manufactured between 30 November and 1 December 2020.**

Company recall code **8192004**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**


Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code - **<https://www.mercedes-benz.de>**

Alert number **[A12/00659/21](#)**

Product **Particle filter mask**

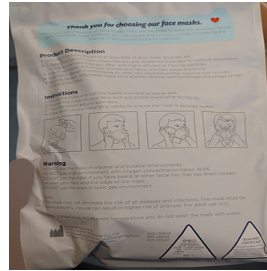

Risk type **Health risk / other**

The product advertises a protective potential against particles but its filtering capacity has not been tested by a relevant competent European conformity assessment body. Additionally, it was found that the particle/filter retention of the material is insufficient (measured values: up to 30%); thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **White respiratory protective masks with external metal nose clip, five layers, and "KN95" embossed on the side. The product is also sold online.**

Packaging description **white/blue plastic packaging, five respiratory protective masks per pack**

Brand **HG**

Name **Disposable Face Mask**

Type / number of model **KN95-A**

Batch number **20200423 (production batch)
MFD: 032020
LOT:573627**

	EXP: 032023
Weekly report number	Report-2021-19
Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Removal of this product listing by the online marketplace Importer
Date of entry into force	03/05/2021
Measures taken by economic operators	Withdrawal of the product from the market Importer

Alert number **[A12/00634/21](#)**

Product **Plush toy**



Risk type **Choking**

Small parts (the eyes, the nose and the bead of the cap) can easily detach. A child may put them in the mouth and choke on them.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **The toy is made of soft plush in the shape of a dog with a large head. The coat is made of textile, the cap is made of felt and the eyes, the nose and the upper part of the cap - the bead - are made of plastic.**

Brand **Unknown**

Name **Plush toy - Dog**

Type / number of model **SK-28591**

Barcode **6880319285916**

Weekly report number **Report-2021-19**

Alert submitted by **Slovakia**

Is the product counterfeit? **No**

Country of origin	People's Republic of China
Measures ordered by public authorities	Warning consumers of the risks Retailer
Date of entry into force	20/10/2020
Measures ordered by public authorities	Recall of the product from end users Retailer
Date of entry into force	20/10/2020
Measures ordered by public authorities	Withdrawal of the product from the market Retailer
Date of entry into force	20/10/2020

Alert number **[A12/00630/21](#)**

Product **Lorry**

Risk type **Injuries**

Due to a malfunction of the neutral gear position, the vehicle may start to move, even when the parking brake is applied and the gear is in neutral. This may even occur after the driver has left the cab.

Category **Motor vehicles**

Type **Professional**

Description **Lorry**

Brand **Mercedes-Benz**

Name **Arocs, Zetros**

EC-type approval/model **Models: 963-0-A, 963-4-A, 963-2-A, 963-0-B, 963-4-B, 963-2-B, 963-0-C, 963-0-D, 963-7-E, 963-4-E, 963-2-E, 963-0-F, 963-4-F, 963-2-F, 963-8-G, 963-8-H
Type-approval numbers: e1*2007/46*0726 bis *0732, *0735 bis *0743**

Production dates **27/05/2019 to 15/10/2020**

Company recall code **PARAM-EAPU**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Greece
Croatia**

**Poland
Slovenia**



Alert number **[A12/00654/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Fire**

The manufacturing tolerances of the fuel supply line are incorrect. As a result, the fuel supply line may leak, leading to an increased risk of fire.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **NISSAN**

Name **NV400**

EC-type approval/model **e2*2007/46*0137*21, Type: M1**

Production dates **The affected vehicles were manufactured between 2 January 2018 and 25 April 2019.**

Company recall code **PN1C1**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Greece**

Alert number **[A12/00650/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Fire**

The fuel line may come into contact with the valve cover. This could result in a fuel leakage, increasing the risk of fire.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **Renault**

Name **Master**

EC-type approval/model **Types: ML, MA, MC, VC, VB, MB
e2*2007/46*0022*23-*26, e2*2007/46*0016*32-*34,
e2*2007/46*0017*21-*23, e2*2007/46*0048*16-*18,
e2*2007/46*0049*29-31, e2*2007/46*0019*28-*30**

Production dates **The affected vehicles were manufactured between 2 January 2018 and 24 April 2019.**

Company recall code **ODHB**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and **Greece
Poland**

measures were taken also in **Sweden**



Alert number **[A12/00627/21](#)**

Product **Table lamp**



Risk type **Burns
Electric shock**

The lamp is attractive to children and it is not equipped with a transformer or converter. It is instable and may easily overturn. The live parts of the socket contact may become accessible. The bulb can become very hot (168.6 °C) and be touched freely. Consequently the children may suffer burns or electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Category **Lighting equipment**

Type **Consumer**

Description **Lava lamp with rising and sinking coloured balls in liquid.
Size: Ø110 mm x 420 mm.**

Packaging description **Colourful cardboard box.**

Brand **Rabalux**

Name **Lámpatest (on the packaging) LOLLIPOP 2**

Type / number of model **4107**

Barcode **5 998250 341071**

Weekly report number **Report-2021-19**

Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Manufacturer
Date of entry into force	27/01/2021

Alert number **[A12/00626/21](#)**

Product **Table lamp**



Risk type **Burns
Electric shock**

The lamp is attractive to children and it is not equipped with a transformer or converter. It is instable and may easily overturn. The live parts of the socket contact may become accessible. The bulb can become very hot (175.5 °C) and be touched freely. Consequently the children may suffer burns or electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Category **Lighting equipment**

Type **Consumer**

Description **Rainbow coloured, metal decorative lava lamp with glittering particles flowing in liquid.**

Packaging description **Colourful cardboard box.**

Brand **Rabalux**

Name **GLITTER RAINBOW**

Type / number of model **7009**

Barcode **5 998250 370095**

Weekly report number **Report-2021-19**

Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Manufacturer
Date of entry into force	28/01/2021
Measures ordered by public authorities	Recall of the product from end users Manufacturer
Date of entry into force	28/01/2021

Alert number **[A12/00641/21](#)**

Product **Air humidifier**



Risk type **Electric shock**

The product is attractive to children. During playing, live parts can become accessible indirectly (via the water) and a child can receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60335-1 and EN 60335-2-98.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Cat-shaped plastic-covered ultrasonic orange air humidifier. The product was also sold online.**

Packaging description **Cubic-like cardboard box with a plastic lid on top. One side of the box shows a picture of a baby and another one a picture of the product. The upper side is light purple.**

Brand **BAYBY**

Name **Air humidifier**

Type / number of model **BBH 8002**

Batch number **2019800210**

Barcode **8 590669 289493**

Weekly report number **Report-2021-19**

Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	05/02/2021
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	05/02/2021

Alert number

[A12/00658/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The product advertises a protective potential against particles but its filtering capacity has not been tested by a relevant competent European conformity assessment body. Additionally, it was found that the particle/filter retention of the material is insufficient (measured values: up to 67%), and the mask does not properly adapt to the face. Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Respiratory protective face mask in white and blue packaging with 'KN95' printed in red, pack of 10

Packaging description

Respiratory protective face mask in white and blue packaging with 'KN95' printed in red, pack of 10

Brand

FUPING

Name

KN95 Folding Protective Mask

Type / number of model

KN95

Weekly report number

Report-2021-19

Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Stock will be returned to LAVIKA Retailer
Measures taken by economic operators	Recall of the product from end users Retailer
Measures taken by economic operators	Withdrawal of the product from the market Retailer

Alert number

[A12/00640/21](#)

Product

Air humidifier



Risk type

Electric shock

The product is attractive to children. During playing, live parts can become accessible indirectly (via the water) and a child can receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60335-1 and EN 60335-2-98.

Category

Electrical appliances and equipment

Type

Consumer

Description

Bear-shaped plastic-covered ultrasonic white air humidifier. The product was also sold online.

Packaging description

Colourful cardboard box with a picture of a child sleeping and one of the air humidifier.

Brand

Hauser

Name	Ultrasonic humidifier / Ultrahangos hidegpárásító
Type / number of model	UH-58
Barcode	5 998777 315999
Weekly report number	Report-2021-19
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	25/01/2021
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	25/01/2021

Alert number

[A12/00657/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The product bears a CE marking but is not certified as protective equipment by a relevant body. Additionally, the particle/filter retention of the material is insufficient (measured values: up to 85%), and the mask does not properly adapt to the face leading to an insufficient total filtration capacity (measured mean values: up to 72%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

White foldable mask with outer nose clip and with ear harnesses. The product is labeled CE FFP2, EN 149, GOOYU KN95. The product was also sold online.

Packaging description

Light transparent plastic pouch, with the contact details of the manufacturer and the importer printed on one side.

Brand

GOOYU

Name

Kokkuklapitav mask KN95

Batch number

2025/05

Barcode	4772013226321
Weekly report number	Report-2021-19
Alert submitted by	Estonia
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Retailer
Date of entry into force	03/05/2021
Measures taken by economic operators	Recall of the product from end users Retailer
Date of entry into force	03/05/2021
Company recall code	- https://www.k-rauta.ee/kp/uudised/9

Alert number **[A12/00656/21](#)**

Product **Baby's shoes**



Risk type **Chemical**

The chromium (VI) level in the leather of the outsole and the edging is too high (6.9 and 14.8 mg/kg, respectively). Chromium (VI) has a sensitising effect and can trigger allergic reactions in contact with the skin.

The product does not comply with the REACH Regulation.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Blue felt crawling shoes for babies, with light grey leather edging on the instep and around the toes, and leather outsole, intended for 6 to 12 month-old babies.**

Packaging description **Printed cardboard box with viewing window, printed cardboard hanger**

Brand **Walkx baby**

Name **Walkx Baby Krabbelschuhe, Filz**

Type / number of model **2009010058153**

Barcode **4 047247 108683**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **03/05/2021**

Measures taken by economic operators **Stop of sales
Distributor**

Date of entry into force **03/05/2021**

Alert number **[A12/00633/21](#)**

Product **Night light**



Risk type **Burns
Electric shock
Fire**

The lamp is attractive to children. The dimensions of the flat plug are less than required. As a result, live parts are accessible and this could lead to an electric shock. The plastic part of the plug is combustible. The lamp can cause burns or catch fire during use.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Category **Lighting equipment**

Type **Consumer**

Description **Star-shaped nightlight with 4 LEDs and switch. The product can be plugged directly into the socket.**

Packaging description **Packaging: transparent plastic blister with paper back.**



Brand	Qiaolian
Name	LED NIGHT LIGHTING
Type / number of model	QL-514 (on the packaging) QQF-81117 (on the label)
Barcode	1 811281 170547 (on the label) 6 947551 985148 (on the packaging)
Weekly report number	Report-2021-19
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	09/12/2020
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	09/12/2020

Alert number

A12/00660/21

Product

Particle filter mask

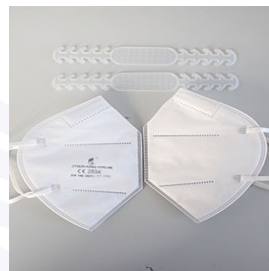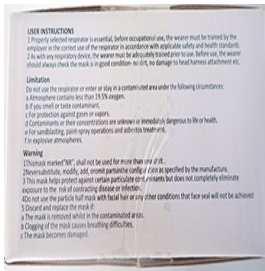

Risk type

Health risk / other

The mask does not properly adapt to the face leading to an insufficient total filtration capacity (measured mean values: up to 66%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and the relevant European standard EN 149.

Category	Protective equipment
Type	Professional
Description	The mask has a nose clip sewn into the nose area, accompanied by a foam strip for sealing. The product is also sold online.
Packaging description	The product is sold in a white cardboard packaging containing 20 items per box. There is an additional packaging as a double pack in a plastic bag with printed instructions for use.
Brand	Unknown
Name	Partikelfiltrierende Halbmaske
Type / number of model	CY2020-KZ002 FFP2 NR Non-medical
Batch number	202008
Barcode	6973181510016
Weekly report number	Report-2021-19
Alert submitted by	Germany
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Importer
Measures taken by economic operators	Stop of sales Importer

Alert number **[A12/00652/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to a manufacturing defect, the control plates of the backrest recliner in the second row of seats may break. In this case, the backrest may not be secured in the event of an accident, increasing the risk of injury to the rear passengers.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **BMW**

Name **i3**

EC-type approval/model **e1*2007/46*1213*01, e1*KS07/46*1213*00, Type: BMWi-1**

Production dates **The affected vehicles were manufactured between 19 February 2021 and 5 March 2021.**

Company recall code **0052980100**

Weekly report number **Report-2021-19**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Poland
Sweden**

Alert number **[A12/00655/21](#)**

Product **Lighting chain**



Risk type **Burns
Electric shock
Fire**

The cable is not properly anchored and is too thin. The accessible wires have only basic insulation and can come into contact with sharp edges of the controller unit. The cable could detach or get damaged, leaving live conductors accessible. The dimensions of the mains plug are substantially less than required. The user could touch accessible live parts, which may cause an electric shock. The cable could overheat, leading to burns or fire.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598-1 and 60598-2-20.

Category **Lighting chains**

Type **Consumer**

Description **Decorative lighting chain with 98 non-replaceable colourful miniature lamps (grain of rice bulbs) and a plastic green control unit with 8 programs. Power: 55W, Frequency: 60 Hz, Voltage: 220 V.**

Packaging description **Orange cardboard box.**

Brand **Unknown**

Name **NEW / LED karácsonyi égősor**

Type / number of model **1101050 (on the packaging)
1101053 (on the label)**

Barcode	8 000011 010502 (on the packaging) 8 000011 010533 (on the label)
Weekly report number	Report-2021-19
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	02/03/2021
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	02/03/2021

Alert number **[A12/00653/21](#)**

Product **Passenger car**

Risk type **Injuries**

When liquid/droplets are present on the rear seat control display, there's a risk that the signal to the display is maintained and perceived by the system as a "constant" touch. As a result, the front seat could be inadvertently moved until its end position, increasing the risk of injury.

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles equipped with a rear seat control display; Model type: S90L (238), XC90 (256).**

Brand **Volvo**

Name **S90L, XC90**

EC-type approval/model **Chassis code: S90L (from 0015022 to 0175391); XC90 (from 0000700 to 0621884).**

Production dates **The affected vehicles were manufactured between 2016 and 2020.**

Company recall code **R10093**

Weekly report number **Report-2021-19**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Sweden**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **29/04/2021**

Products were found and
measures were taken also in

Germany
Greece
Sweden



Alert number

[INFO/00108/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The product bears a CE marking but is not certified as protective equipment by a relevant body. Consequently, it is not proven that the product fulfils the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation.

Category

Protective equipment

Type

Consumer

Description

Disposable protective mask. The mask is of black color.

Packaging description

Sold in a white and blue cardboard packaging containing 50 pieces.

Brand

Jiangyin Rongyi Textile Technology Co., Ltd.

Name

Disposable protective mask

Barcode

8000020200086

Weekly report number

Report-2021-19

Alert submitted by

Luxembourg

Is the product counterfeit?

Unknown

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Distributor**


Date of entry into force **14/04/2021**

Alert number

[INFO/00109/21](#)

Product

Particle filter mask

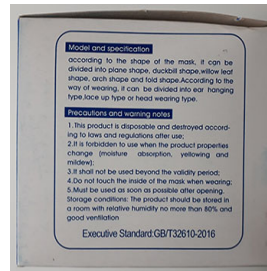

Risk type **Health risk / other**

The product bears a CE marking but is not certified as protective equipment by a relevant body. Consequently, it is not proven that the product fulfils the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation.

Category **Protective equipment**

Type **Consumer**

Description **Disposable face mask**

Packaging description **Sold in a white and blue cardboard packaging containing 50 pieces.**

Brand **Unknown**

Name **Disposable 3-Layer Mask**

Barcode **6996850481066**

Weekly report number **Report-2021-19**

Alert submitted by **Luxembourg**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Distributor**



Date of entry into force **14/04/2021**

Alert number

[INFO/00110/21](#)

Product

Particle filter mask

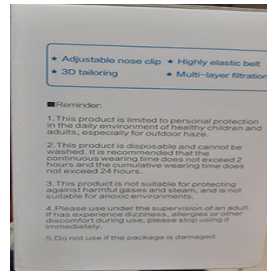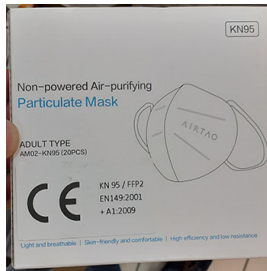

Risk type **Health risk / other**

The product bears a CE marking but is not certified as protective equipment by a relevant body. Consequently, it is not proven that the product fulfils the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation.

Category **Protective equipment**

Type **Consumer**

Description **Protective respiratory filtration half-face mask.**

Packaging description **The product is sold in a white cardboard packaging, with indications "KN95 / FFP2" and EN 149, containing 20 pieces.**

Brand **Airtao**

Name **Non-powered Air-purifying particulate mask**

Type / number of model **AM02-KN95**

Barcode **6971253709757**

Weekly report number **Report-2021-19**

Alert submitted by **Luxembourg**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Distributor**

Date of entry into force **14/04/2021**

Alert number **[A12/00651/21](#)**

Product **Children's sweatshirt**



Risk type **Strangulation**

There are long functional cords with free ends in the hood of the sweatshirt. They can become trapped during various activities of a child, leading to strangulation.

The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 14682.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Children's hoodies with functional cords.**

Brand **4F**

Type / number of model **HJL21-JBLM004-20S
HJL21-JBLM004A-27M
HJZ20-JBLD005-55S**

Weekly report number **Report-2021-19**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Bangladesh**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Measures taken by economic operators

**Withdrawal of the product from the market
Manufacturer**

