

Alert number **[A12/00711/21](#)**

Product **Travel adapter**



Risk type **Electric shock**

**The socket lacks safety shutters. The user could consequently touch live parts and receive an electric shock from them.**

**The product does not comply with the Low Voltage Directive.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Electrical adapter from a European plug to a US plug. The product was sold online, in particular via Wish.**

Brand **Unknown**

Name **EU to US conversion plug**

Type / number of model **9618**

Weekly report number **Report-2021-21**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic **Removal of this product listing by the online marketplace**

operators **Other**




Alert number

**[A12/00717/21](#)**

Product

**Finger paint set**

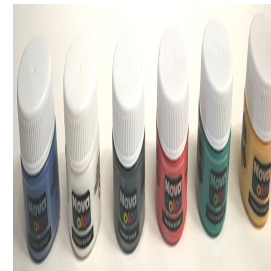

Risk type

**Chemical**

**There is an excessive migration of lead in the white paint (measured value: 1,18 % by weight ). A child could put one in the mouth and suck on it and become exposed to lead. Exposure to lead can result in severe and irreversible neuro-behavioural and neuro-developmental effects to which children are particularly sensitive.**

**The product does not comply with the Toy Safety Directive and with the relevant European standard EN 71-3.**

Category

**Toys**

Type

**Consumer**

Description

**Finger paints sold in a set of 6 colours (green, yellow, white, red, black, blue) of 25 ml each.**

Packaging description

**Cardboard package with an orange sticker.**

Brand

**NOVA COLOR®**

Name

**Finger paint FATİH 25 ml, 6 colours**

Type / number of model

**NC -138**

Barcode

**8697405223862**

Weekly report number

**Report-2021-21**

Alert submitted by

**Slovakia**

Is the product counterfeit?

**No**

Country of origin

**Turkey**

Measures ordered by public authorities

**Warning consumers of the risks  
Retailer**

Date of entry into force

**04/11/2020**

Measures ordered by public authorities

**Recall of the product from end users  
Retailer**

Date of entry into force

**04/11/2020**

Measures ordered by public authorities



**Withdrawal of the product from the market  
Retailer**

Date of entry into force

**04/11/2020**

Alert number **[A12/00713/21](#)**

Product **Slime toy**

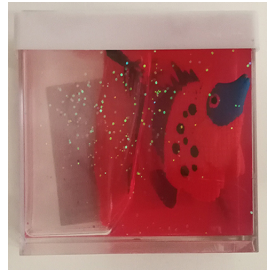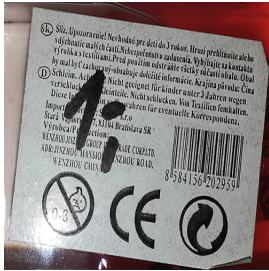

Risk type **Chemical**

**The migration of boron from the toy slime is too high (measured value: 1653,2 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.**

Category **Toys**

Type **Consumer**

Description **Aquarium-shaped container with a plastic fish and a green twig.**

Packaging description **Transparent plastic box with a cardboard label.**

Brand **Unknown**

Name **Slime Fish in the aquarium Tropical ocean**

Barcode **8584156202959**

Weekly report number **Report-2021-21**

Alert submitted by **Slovakia**

Is the product counterfeit? **No**

Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>20/11/2020</b>
Measures ordered by public authorities	<b>Recall of the product from end users Retailer</b>
Date of entry into force	<b>20/11/2020</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Retailer</b>
Date of entry into force	<b>20/11/2020</b>

Alert number **[A12/00710/21](#)**

Product **Rattle set**



Risk type **Choking**

**The bottle-shaped rattle of the set is too small. A child may put it in the mouth and choke on it.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **The set contains rattles in the shape of A plastic bottle, a plastic ball and a whistling toy in the shape of a fish.**

Packaging description **Transparent plastic bag with a paper label.**

Brand **Unknown**

Name **Rattle set**

Type / number of model **ITEM NO: 40740**

Barcode **8588588407401**

Weekly report number **Report-2021-21**

Alert submitted by **Slovakia**


Is the product counterfeit? **No**

Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Retailer</b>
Date of entry into force	<b>16/11/2020</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>16/11/2020</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Retailer</b>
Date of entry into force	<b>16/11/2020</b>



Alert number **[A12/00714/21](#)**

Product **Toy gun set**

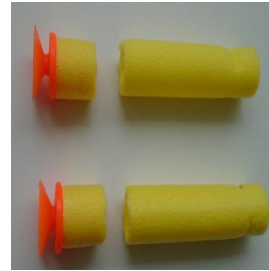

Risk type **Choking**

**The suction cups can be easily detached. If a child puts the projectile in the mouth, the suction cup could detach and obstruct the airways.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Set of orange-black plastic gun and 5 pieces of yellow foam projectiles with an orange suction cup as an impact part.**

Packaging description **Plastic blister with cardboard back.**

Brand **Unknown**

Name **SHOT ZONE super power**

Type / number of model **NO. 684-2, ITEM NO: C04254**

Barcode **5881800042545**

Weekly report number **Report-2021-21**

Alert submitted by **Slovakia**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Retailer**

Date of entry into force

**10/12/2020**

Measures ordered by public authorities

**Recall of the product from end users  
Retailer**

Date of entry into force

**10/12/2020**

Measures ordered by public authorities

**Warning consumers of the risks  
Retailer**

Date of entry into force

**10/12/2020**

Alert number **[A12/00712/21](#)**

Product **Plush toy**



Risk type **Choking**

**Small parts (buttons and suction cup with the ribbon) may be easily detached from the toy. A small child may put the detached element in the mouth and choke on it.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **The toy is made of soft plush in the shape of an elephant dressed in corduroy pants with a suction cup attached to the top of the head with a ribbon.**

Packaging description **Paper label.**

Brand **Unknown**

Name **ELEPHANT with a suction cup**

Type / number of model **ITEM N0: CA4504**

Barcode **5881800045041**

Weekly report number **Report-2021-21**

Alert submitted by **Slovakia**

Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>07/12/2020</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Retailer</b>
Date of entry into force	<b>07/12/2020</b>
Measures ordered by public authorities	<b>Recall of the product from end users Retailer</b>
Date of entry into force	<b>07/12/2020</b>

Alert number **[A12/00709/21](#)**

Product **Wooden toy**



Risk type **Choking**

**Small parts (ears and tail) may easily detach from the toy. A small child may put it in the mouth and choke on it.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **The toy is made of 7 different colour parts in the shape of a cow. These parts are placed on wooden playwood in the shape of a square.**

Packaging description **Paper label.**

Brand **Unknown**

Name **Wooden puzzle - Cow**

Type / number of model **ITEM NO: 62685**

Barcode **8588588626857**

Weekly report number **Report-2021-21**

Alert submitted by **Slovakia**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Warning consumers of the risks  
Retailer**

Date of entry into force

**19/11/2020**

Measures ordered by public authorities

**Recall of the product from end users  
Retailer**

Date of entry into force

**19/11/2020**

Measures ordered by public authorities


**Withdrawal of the product from the market  
Retailer**

Date of entry into force

**19/11/2020**

Alert number **[A11/00038/21](#)**

Product **Smart kettle**

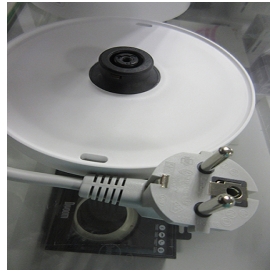

Risk type **Electric shock  
Fire**

**The contact connection on the base of the kettle does not meet the requirements for resistance to moisture. If liquid spills onto the stand, there is a risk of electric shock and short circuit in the mains.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-1 and -2.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White smart kettle. Capacity: 1,5 L; power: 1800W; voltage: 220-240 V, size 21.4x20.3x25.8 cm. The product was also sold online.**

Packaging description **The product is sold in a white and blue box.**

Brand **VIOMI**

Name	<b>VIOMI Smart Kettle</b>
Type / number of model	<b>V-SK152A</b>
Batch number	<b>SK152A20200300417</b>
Barcode	<b>6923185606345</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Latvia</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>28/01/2021</b>



Alert number **[A12/00735/21](#)**

Product **Mini oven**



Risk type **Electric shock  
Fire**

**The earthing protection is inadequate and the product insulation is inappropriate, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product could overheat leading to fire.**

**The product does not comply with the Low Voltage Directive and the relevant European standard EN 60335-2-9.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **A mini oven with tabletop, for use in ordinary kitchens.**

Brand **Andersson**

Name **Tabletop oven**

Type / number of model **MIS 2.0**

Weekly report number **Report-2021-21**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Other : The economic operator is voluntarily recalling the product.  
Other**

Date of entry into force

**09/04/2021**

Measures taken by economic operators

**Recall of the product from end users  
Manufacturer**

Date of entry into force

**09/04/2021**

Measures taken by economic operators

**Stop of sales  
Manufacturer**

Date of entry into force

**09/04/2021**

Company recall code

- <https://support.netonnet.se/hc/sv/articles/360018921198>

Alert number **[INFO/00116/21](#)**

Product **Foldable electric bicycle**



BROMPTON

🚲

Risk type	<b>Injuries</b>
	<b>Due to a software error, the fail-safe function may not operate and the electric system may keep the bike in motion when the user tries to brake in case of emergency, leading to injuries.</b>
	<b>The product does not comply with the requirements of the Machinery Directive and the relevant European Standard EN 15194.</b>
Category	<b>Hobby/sports equipment</b>
Type	<b>Consumer</b>
Description	<b>Folding electric bicycle.</b>
Brand	<b>Brompton</b>
Type / number of model	<b>Brompton Electric</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Germany</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Unknown</b>
Measures taken by economic operators	<b>Recall of the product from end users Retailer</b>

Date of entry into force **07/04/2021**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **07/04/2021**

Alert number **[A12/00718/21](#)**

Product **Expandable toy**



Risk type **Choking Injuries**

**The expanding material increases in size when placed in water by more than 50%. The toy can be put into the mouth and swallowed by children. As the toy expands, it can cause fatal occlusion of the respiratory track or intestinal blockage of small children.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **An egg (size 60 mm) of plastic material containing a figurine of a llama.**

Packaging description **Cardboard box with transparent plastic window.**

Brand **Unknown**

Name **Hatching Eggs Llama Series**

Type / number of model **ADR20945**

Barcode **EAN 5903321116427**

Weekly report number **Report-2021-21**

Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Destruction of the product Importer</b>
Date of entry into force	<b>09/03/2021</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>09/03/2021</b>

Alert number

**[A12/00706/21](#)**

Product

**Inflatable play equipment**



Risk type

**Burns  
Fire**

**The product does not resist to fire, it does not stop burning when the ignition source is removed and it burns rapidly. As a result, there is a risk of fire and burns.**

**The product does not comply with the requirements of the General Product Safety Directive and European standard EN 14960-1.**

Category

**Hobby/sports equipment**

Type

**Consumer**

Description

**Inflatable structures, in different forms, on which children can jump and play. The products are sold online.**

Brand

**Zizo Inflatables**

Name

**Rock'n Roll Extreme, AFo4P Clown, Zig Zag Zap, Tumbling Mat, Gladiator**

Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Sweden</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Belgium</b>
Measures ordered by public authorities	<b>Destruction of the product Distributor</b>
Date of entry into force	<b>23/02/2021</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Distributor</b>
Date of entry into force	<b>23/02/2021</b>



Alert number

**[A12/00707/21](#)**

Product

**Inflatable play equipment**



Risk type

**Burns  
Fire**

**The product does not resist to fire, it does not stop burning when the ignition source is removed and it burns rapidly. As a result, there is a risk of fire and burns.**

**The product does not comply with the requirements of the General Product Safety Directive and European standard EN 14960-1.**

Category

**Hobby/sports equipment**

Type

**Consumer**

Description

**Inflatable structures, in different forms, on which children can jump and play. The products are sold online.**

Brand

**Zizo Inflatables**

Name

**Playbed Farm, Punch'm off Extreme, Inflatable Extreme and Activity Center**

Weekly report number

**Report-2021-21**

Alert submitted by

**Sweden**

Is the product counterfeit?

**No**

Country of origin

**Belgium**

Measures ordered by public

**Destruction of the product**

authorities	<b>Distributor</b>
Date of entry into force	<b>23/02/2021</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Distributor</b>
Date of entry into force	<b>23/02/2021</b>

Alert number **[A12/00702/21](#)**

Product **Novelty lighter**



Risk type **Burns  
Fire**

**The lighter is appealing to children and can easily be mistaken for a toy. Children may play with it and suffer burns or cause a fire.**

**The product does not comply with Commission Implementing Decision (EU) 2016/575 of 29 March 2016 requiring Member States to take measures to ensure that only lighters which are child-resistant are placed on the market and to prohibit the placing on the market of novelty lighters, and with the European standard EN 13869.**

Category **Lighters**

Type **Consumer**

Description **Novelty lighter in the shape of a bitten apple, orange colour.**

Brand **Deltasun**

Type / number of model **2M-14441 30**

Barcode **8 697440 356266**

Weekly report number **Report-2021-21**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Retailer**

Date of entry into force

**22/04/2021**

Alert number **[A12/00703/21](#)**

Product **Novelty lighter**



Risk type **Burns  
Fire**

**The lighter is appealing to children and can easily be mistaken for a toy. Children may play with it and suffer burns or cause a fire.**

**The product does not comply with Commission Implementing Decision (EU) 2016/575 of 29 March 2016 requiring Member States to take measures to ensure that only lighters which are child-resistant are placed on the market and to prohibit the placing on the market of novelty lighters, and with the European standard EN 13869.**

Category **Lighters**

Type **Consumer**

Description **Novelty lighter in the shape of a yellow screwdriver .**

Brand **Take Eagle**

Weekly report number **Report-2021-21**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **22/04/2021**



Alert number **[INFO/00115/21](#)**

Product **Novelty lighter**



Risk type **Burns  
Fire**

**The lighter is appealing to children and can easily be mistaken for a toy. Children may play with it and suffer burns or cause a fire.**

**The product does not comply with Commission Implementing Decision (EU) 2016/575 of 29 March 2016 requiring Member States to take measures to ensure that only lighters which are child-resistant are placed on the market and to prohibit the placing on the market of novelty lighters, and with the European standard EN 13869.**

Category **Lighters**

Type **Consumer**

Description **Billiard ball-shaped lighter, plastic, in different colours: white, white with a wide yellow stripe in the middle and an underlined number 9.**

Brand **Unknown**

Weekly report number **Report-2021-21**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public **Withdrawal of the product from the market**

authorities

**Retailer**

Date of entry into force

**16/04/2021**



Alert number **[A12/00715/21](#)**

Product **Toy slime**



Risk type **Chemical**

**The migration of boron from the toy is too high: 326,12 mg/kg. Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.**

Category **Toys**

Type **Consumer**

Description **Toy slime in a bottle (size 13 cm).**

Packaging description **Plastic bottle.**

Brand **Mega Creative**

Name **Magic Slime**

Type / number of model **INDEKS 429791  
no. CL-750A**

Barcode **EAN 5902643645288**

Weekly report number **Report-2021-21**

Alert submitted by **Poland**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Destruction of the product  
Importer**

Measures taken by economic operators

**Withdrawal of the product from the market  
Importer**

Company recall code

- <http://www.euro-trade.pl/news/komunikat-dotyczacy-magic-slime-index-429791>

Alert number

**A12/00716/21**

Product

**Car windscreen washing fluid**



Risk type

**Chemical**

**The product contains an excessive amount of methanol (measured values: up to 28% by weight), which is acutely toxic to the central nervous system and to the eyes. Furthermore, the required hazard pictograms and warnings are missing. Users have therefore no information on the toxicity of the product. Ingestion or contact with methanol may lead to blindness or death.**

Category

**Chemical products**

Type

**Consumer**

Description

**Blue colored fluid for cleaning car windscreens at cold temperatures such as -16°C, -18°C and -20°C. The product was also sold online.**

Packaging description

**Plastic canisters and plastic pouches of 3L, 4L or 5L.**

Brand	<b>Alexela Automaailm Bauhaus CarMan Carlake GO4 Nordic</b>
Name	<b>Talvine klaasipesuvedelik (ET); Tuulilasinpesuneste (FI)</b>
Type / number of model	<b>Alexela UFI code: 9A20-V0NE-F00M-PAQH Automaailm UFI code: W820-COY1-5004-104F Bauhaus UFI code: K050-TOHT-000D-6Q2J Carlake UFI code: 8R40-90FM-200W-7PAC Carman UFI code: YNHA-UR4E-U109-EYCN GO4 UFI code: 9A20-V0NE-F00M-PAQH</b>
Barcode	<b>NORDIC: 4742516002142 Automaailm: 4743108005183 and 4743108005169 Bauhaus: 6417196778271 Carlake: 6417196777922 Carman: 6410416082462 GO4: 4742516008212 Alexela: 4742631000078</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Estonia</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Estonia</b>
Measures taken by economic operators	<b>Recall of the product from end users Manufacturer</b>
Date of entry into force	<b>22/04/2021</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Manufacturer</b>
Date of entry into force	<b>22/04/2021</b>
Company recall code	- <a href="https://nordicgroup-dup.voog.com/">https://nordicgroup-dup.voog.com/</a>

Alert number **[A12/00744/21](#)**

Product **Trailer**

Risk type **Injuries**

**The space between the tyre and a screw head of the trailer's structure might be insufficient. Consequently, the tyre could become damaged by the screw and burst or leak, increasing the risk of accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Box trailer**

Brand **Humbaur**

Name **HKPA**

EC-type approval/model **Type approval numbers: e1\*2007/46\*0082\*, e1\*2007/46\*0281\*,  
Types: KFZ-Transporter, HA EA G**

Production dates **The affected units were manufactured in 2020.**

Company recall code **0004**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France**

Alert number

**[A12/00719/21](#)**

Product

**Children's sweatshirt**



Risk type

**Strangulation**

**The products bear cords with free ends in the hood area. The cords may become trapped during various activities of a child, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.**

Category

**Clothing, textiles and fashion items**

Type

**Consumer**

Description

**Children's sweatshirt with hood in green colour with the inscription "Deco Dass" and an outer pocket.**

Brand

**Deco Dass**

Type / number of model

**6842**

Barcode

**0 01 59197 400534**

Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Bulgaria</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Turkey</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>20/04/2021</b>

Alert number

**[A12/00701/21](#)**

Product

**Children`s sweatshirt**



Risk type

**Strangulation**

**There are long functional cords with free ends in the hood. They can become trapped during various activities of a child, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive (GPSD) and the relevant European standard EN 14682.**

Category

**Clothing, textiles and fashion items**

Type

**Consumer**

Description

**Children's sweatshirt with hood in grey colour, with the inscription "BREATHE FREEHOTN" and two side pockets.**

Brand

**Dgs kids**

Weekly report number

**Report-2021-21**

Alert submitted by

**Bulgaria**

Is the product counterfeit?

**Unknown**

Country of origin

**Turkey**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Retailer**


Date of entry into force

**20/04/2021**



Alert number **[A12/00723/21](#)**

Product **Children´s sweatshirt**

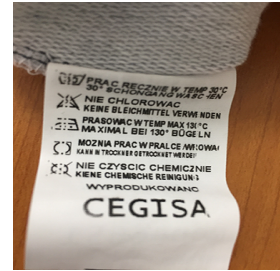

Risk type **Strangulation**

**There are long functional cords with free ends in the hood. They can become trapped during various activities of a child, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Children´s sweatshirt in blue/white colour and with the inscription “1983” in the front.**

Brand **CEGISA**

Type / number of model **6651**

Weekly report number **Report-2021-21**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Turkey**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **20/04/2021**



Alert number **[A12/00734/21](#)**

Product **Children's sweatshirt**



Risk type	<b>Strangulation</b>  <b>There are long functional cords with free ends in the hood of the sweatshirt. They can become trapped during various activities of a child, leading to strangulation.</b>  <b>The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 14682.</b>
Category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Description	<b>Children's sweatshirt in green and black colours, with the inscription "CAUTION KEEP OUT" and an outer pocket.</b>
Brand	<b>Blue Day's kids club</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Bulgaria</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Turkey</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>20/04/2021</b>

---

Alert number **[A12/00721/21](#)**

Product **Children's tracksuit**

---



Risk type **Injuries  
Strangulation**

**The product bear drawstrings with free ends in the neck and waist area. These drawstrings can become trapped during various activities of a child, leading to strangulation or injuries.**

**The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Children's tracksuit consisting of pants and sweatshirt. The sweatshirt has a zipper and hood and the pants have the inscription "UNLIMITED RUN" in the front and two pockets.**

Brand **dmr-x CREATE THE LIFE STYLE**

Type / number of model **7030**

Barcode **8 697030 256150**

Weekly report number **Report-2021-21**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Turkey**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **20/04/2021**

---

Alert number **[A12/00726/21](#)**

Product **Trailer-hitch system**

---

Risk type **Injuries**

**A welding of the trailer-hitch system may be defective and could break. As a result, the trailer may inadvertently detach from the vehicle, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Trailer-hitch system**

Brand **SIARR/Westfalia- Automotive**

Name **P84 (Peugeot 3008), C84 (Citroen C5 Aircross), P1UO (Opel Grandland)**

EC-type approval/model **E13\*55R01/07\*4036\*04, Towing device type 315 226 - class A50-X**

Production dates **7 September 2020 to 7 January 2021**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**


Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/00705/21](#)**

Product **Lighting chain**

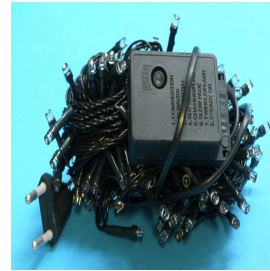

Risk type **Burns  
Electric shock  
Fire**

**The cable is not properly anchored and is too thin. The accessible wires have only basic insulation and can come into contact with sharp edges of the controller unit. The cable could detach or get damaged leaving live conductors accessible. The dimensions of the mains plug are substantially less than required. The user could touch accessible live parts, which may cause an electric shock. The cable could overheat, leading to burns or fire.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Category **Lighting chains**

Type **Consumer**

Description **Decorative lighting chain with 138 non-replaceable white miniature lamps and a control unit with 8 programs.**

Packaging description **Packed in a colourful cardboard box.**

Brand **Unknown**

Name **NEW / LED karácsonyi égősor**

Type / number of model **1101069 (on the packaging); 1101071 (on a label)**

Barcode **8 000011 010694 (on the packaging)  
8 000011 010717 (on a label)**

Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>02/03/2021</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>02/03/2021</b>



Alert number **[A12/00742/21](#)**

Product **Hair dryer**



Risk type **Burns  
Electric shock  
Fire**

**The hair dryer does not have a thermal cut-out device. The plastic material of the casing is combustible. The hair dryer can overheat and catch fire during use causing burns to the user. The distance between the heater and the safety grille is less than required. The user may touch the live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60335-1 and EN 60335-2-23.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White and purple foldable hair dryer.**

Packaging description **Colourful cardboard box**

Brand **Kemei**

Name **hair dryer**

Type / number of model **3365 (on the product), KM-3365 (on the packaging)**

Barcode **6 955549 333659**

Weekly report number **Report-2021-21**

Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>02/02/2021</b>

Alert number

**[A12/00740/21](#)**

Product

**Portable LED lamp**



Risk type

**Burns  
Electric shock  
Fire**

**The cables inside the mains power cord are too thin. They could overheat during use. The insulation and size of the pins of the mains plug and output connector are inappropriate, leaving live parts accessible. The plastic part of the integrated plug of the luminaire is made of combustible material. Live parts may become accessible without the use of any tools. Users may consequently suffer burns, receive an electric shock or the product may cause a fire.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60598.**

Category

**Lighting equipment**

Type

**Consumer**

Description


**Rechargeable and portable camping LED lamp with USB port, which can be operated directly from the mains,**

**batteries or by the solar module. It is supplied with a mains charger.**

Packaging description	<b>Colourful cardboard box.</b>
Brand	<b>high mountain tiger</b>
Name	<b>CAMPING LIGHT</b>
Type / number of model	<b>GSH-7088A</b>
Barcode	<b>6 956881 470880</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>07/10/2020</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>07/10/2020</b>

Alert number **[A12/00741/21](#)**

Product **Lighting chain**

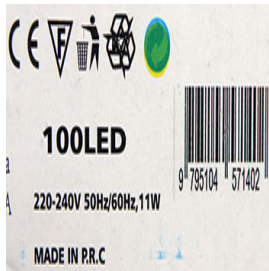

Risk type **Burns  
Electric shock  
Fire**

**The cable is not properly anchored and is too thin. The accessible wires have inadequate insulation. The structure of cord extension socket allows single-pole insertion of plugs. The cable could overheat, burning the user or leading to a fire. The user could touch accessible live parts, which may cause an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Category **Lighting chains**

Type **Consumer**

Description **Lighting chain with 100 non-replaceable, coloured LED lamps. The product includes a socket outlet to connect another lighting chain.**

Packaging description **Colourful cardboard box.**

Brand **Unknown**

Name **100L LED Musica Lights**

Type / number of model **HL100**

Barcode **9 795104 571402**

Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>25/03/2021</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>25/03/2021</b>

Alert number **[A12/00722/21](#)**

Product **Baby doll**



Risk type **Chemical**

**The plastic material of the toy (head and arms) contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), (measured value up to 67.34% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **One baby doll dressed in a romper suit and a cap; inside the back there is a battery compartment (screwed, for 3 x 1.5 AA batteries, batteries included); one baby bottle (pink); 1 dummy chain with a clip and a dummy.**

Packaging description **Cardboard box with cellophane window.**

Brand **SHOV**

Name **Billie Doll 16"**

Type / number of model **JL-3651**

Barcode **4251108702495**

Weekly report number **Report-2021-21**

Alert submitted by	<b>Austria</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Marking the product with appropriate warnings on the risks Retailer</b>
Date of entry into force	<b>11/05/2021</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>11/05/2021</b>



Alert number **[A12/00730/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The polycarbonate roof panel located between the windscreen and the panoramic roof may not have been bonded correctly to the vehicle during a prior repair. In such cases, the adhesive bonding could gradually deteriorate and the panel could become detached from the vehicle, posing a risk to other road users.**

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles fitted with a panoramic roof; Model series: CLA (BR 117), GLA (BR 156), A-class (BR 176), C-class (BR 205), S-class (BR 222), GLC (BR 253), GLE Coupé (BR 292)**

Brand **Mercedes-Benz**

Name **CLA, GLA, A-Class, C-Class, S-Class, GLC, GLE**

EC-type approval/model **e1\*2001/116\*0463\*14 - 20, e1\*2001/116\*0335\*19 - 46, e1\*2001/116\*0396\*09 - 20, e1\*2001/116\*0480\*16 - 40, e1\*2007/46\*1884\*00, e1\*2007/46\*0598\*16 - 26, e1\*2007/46\*0826\*07 - 13  
Types: 245 G, 245 G AMG, 176, 176 AMG, 204, 204 AMG, 204 K, 204 K AMG, 221, 221 AMG, 204 X, 204 X AMG, 166, 166 AMG  
e1\*2001/116\*0470\*04 - 23, 06 - 25, 00 - 20, e1\*2007/46\*1207\*00 - 09, e1\*2007/46\*0928\*00 - 04, e1\*2007/46\*1163\*00, e1\*2001/116\*0431\*29 - 61, e1\*2001/116\*0464\*15 - 22, e1\*2001/116\*0457\*25 - 51**

Production dates **The affected vehicles were manufactured between 2 July 2012 to 21 October 2020.**

Company recall code **7790003**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**

Is the product counterfeit?

**No**

Country of origin

**Germany**

Measures taken by economic operators

**Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in

**Greece**

Alert number **[A12/00736/21](#)**

Product **Passenger car**

Risk type **Fire  
Injuries**

**A short circuit can occur in the Anti-lock Braking System (ABS)/Electronic Stability Program (ESP) module. This could lead to an excessive current flow that can increase the risk of fire in the engine compartment.**

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles, which are not equipped with smart cruise control (SCC).**

Brand **Kia**

Name **Sportage**

EC-type approval/model **e5\*2007/46\*1081, Type: QLE**

Production dates **The affected vehicles were manufactured between 19 March 2015 and 23 October 2020.**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Slovakia**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France  
Greece  
Poland  
Sweden**

---

Alert number **[A12/00732/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The front seats may not be sufficiently stable. As a result, the seat and its occupant could move more than expected in the event of a crash, leading to increased risk of injury.**

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 247**

Brand **Mercedes-Benz**

Name **B-Class**

EC-type approval/model **e1\*2007/46\*1909\*00, Type: F2B**

Production dates **The affected vehicles were manufactured between 23 August and 28 September 2018.**

Company recall code **9190014**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<https://www.Mercedes-Benz.de>**

Alert number **[A12/00729/21](#)**

Product **Passenger car**

Risk type **Fire**

**The electrically heated windscreen washer jets could form cracks due to the use of an unsuitable sealant. As a result, water could enter into the heating element and cause a short circuit, increasing the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Toyota, Lexus**

Name **LC200, LX**

EC-type approval/model **Toyota: e6\*2001/116\*0112\*07, Type: J20(a), Lexus: Individual approval**

Production dates **The affected vehicles were manufactured between 18 December 2012 to 9 February 2018.**

Company recall code **20SMD-116**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Sweden**

Alert number **[A12/00700/21](#)**

Product **Wallet**



Risk type **Chemical**

**The leather in the product contains chromium VI (measured value up to 6.5 mg/kg). Chromium (VI) is sensitising and can trigger allergic reactions.**

**The product does not comply with the REACH Regulation.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Red leather wallet with RFID protection (size: 8,5 cm x 12 cm). There is a small bulldog-dent on the wallet. Wallet can be closed with press stud. There are several credit card pockets, note pockets and coin pocket in the middle of the wallet.**

Packaging description **Transparent plastic pouch (probably only for transportation).**

Brand **Unknown**

Name **RFID Blocking Wallet**

Type / number of model **Style no. 7091 PS**

Barcode **6430011135240**

Weekly report number **Report-2021-21**

Alert submitted by	<b>Finland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>India</b>
Measures ordered by public authorities	<b>Import rejected at border Importer</b>
Date of entry into force	<b>04/05/2021</b>

Alert number **[A12/00725/21](#)**

Product **Balloons**



Risk type **Chemical**

**The rubber of the balloon releases an excessive amount of N-nitrosamines and N-nitrosable (measured values: 0.072 mg/kg and 2.92 mg/kg respectively). These substances may cause cancer through ingestion or dermal exposure. A child could be exposed to it when touching or putting the product in the mouth.**

**The product does not comply with the Toy Safety Directive and the relevant European standard EN 71-12.**

Category **Toys**

Type **Consumer**

Description **Latex inflatable balloons, creamy white colour.**

Packaging description **Plastic bag with paper label.**

Brand **DONGFANG**

Name **Round balloons**

Type / number of model **A3**

Barcode **859550000039**

Weekly report number **Report-2021-21**

Alert submitted by **Czechia**



Is the product counterfeit? **Unknown**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **01/05/2021**

Alert number **[A12/00694/21](#)**

Product **Lighting chain**

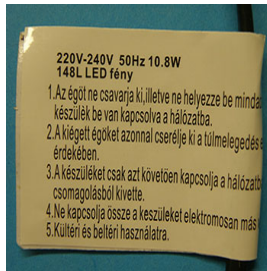

Risk type **Burns  
Electric shock  
Fire**

**The cable is not properly anchored and is too thin. The accessible wires have inadequate insulation. The structure of the cord extension socket allows single-pole insertion of plugs. The product is not protected against moisture but is recommended for outdoor use. The cable could overheat, leading to burns or fire. The water could penetrate the product or the user could touch accessible live parts, which may cause an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Category **Lighting chains**

Type **Consumer**

Description **Lighting chain with 139 non-replaceable, white LED lamps. The product includes a socket outlet that allows the connection of another lighting chain.**

Packaging description **In a plastic box**

Brand **Unknown**

Name **148L LED fény**

Type / number of model **KD-148L LED fény**

Weekly report number **Report-2021-21**

Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Retailer</b>
Date of entry into force	<b>25/03/2021</b>

---

Alert number **[A12/00728/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The trailer coupling device may be defective. This can cause the trailer to detach inadvertently, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **Grandland**

EC-type approval/model **Type: Z  
e2\*2007/46\*0597\*02 , e2\*2007/46\*0597\*18**

Production dates **The affected vehicles were manufactured between 7 November 2017 and 29 December 2020.**

Company recall code **E212100021 (21-C-050)**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Greece  
Poland  
Sweden**

Alert number **[A12/00731/21](#)**

Product **Lorry combination**

Risk type **Injuries**

**Defective fastening of the tilt cylinder may cause unintentional tilting of the driver's cab.**

Category **Motor vehicles**

Type **Professional**

Description **Lorry combination**

Brand **Scania**

Name **R500, S730**

EC-type approval/model **Models: 4x2, 4x4, 4x4+2, 6x2, 6x4, 6x6, 8x2, 8x4, 6x2/4, 8x2/4, 6x2\*4, 8x2\*6, 8x2-2, 8x2/\*6, 8x4+4, 6x2/2, 6x4/4, 6x4\*4, 8x4/4, 8x4\*6, 8x4-2, 8x6, 8x6/4, 8x6+2, 8x8, 8x8-2, 10x4\*6, 10x4/6.  
Type-approval numbers: e4\*130/2012\*130/2012\*0025\*05; e4\*595/2009\*627/2014C\*0015\*03; e4\*595/2009\*2018/932D\*0015\*07**

Production dates **From 01/01/2019 to 30/12/2020**

Company recall code **RC201850**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Sweden**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Sweden**

Alert number **[A12/00708/21](#)**

Product **Bowls, plates and mugs**



Corrigendum	<b>a typo in the description has been corrected</b>
Risk type	<b>Burns Injuries</b>  <b>The product can break and potentially cause burns if hot food is contained.</b>  <b>The product does not comply with the requirements of the General Product Safety Directive.</b>
Category	<b>Kitchen/cooking accessories</b>
Type	<b>Consumer</b>
Description	<b>Red, blue and yellow bowls, plates and mugs, made of PLA (Polylactic acid or polylactide).</b>
Brand	<b>IKEA</b>
Name	<b>Talrika and Heroisk</b>
Type / number of model	<b>00421411-HEROISK side plate 19 blue/light red 2-p 10417480-TALRIKA side plate 19 dark blue 4-p 30417479-TALRIKA mug 25 cl light red 4-p 30426860-HEROISK mug 25 cl light red/yellow 2-p 40414140- HEROISK bowl 14 green/yellow 80414143-HEROISK plate w 3 comp 22 light red/green 2-p 90417481-TALRIKA deep plate 20 light green 4-p</b>
Batch number	<b>Products sold between August 2019 and May 2021</b>
Weekly report number	<b>Report-2021-21</b>

Alert submitted by	<b>Romania</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Taiwan</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>18/05/2021</b>
Company recall code	- <a href="https://www.ikea.com/ro/ro/customer-service/product-support/recalls/ikea-recheama-farfuriile-bolurile-si-canile-heroisk-si-talrika-pub594e3960">https://www.ikea.com/ro/ro/customer-service/product-support/recalls/ikea-recheama-farfuriile-bolurile-si-canile-heroisk-si-talrika-pub594e3960</a>
Products were found and measures were taken also in	<b>Austria Bulgaria Croatia Cyprus Greece Ireland Malta Poland</b>

Alert number **[INFO/00117/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Fire  
Injuries**

**The fuse configuration may be incorrectly documented in the owner's manual and service documentation. As a result, a fuse could be changed incorrectly and cause increased electricity flow, leading to cable scorching and increased risk of fire or accident.**

Category **Motor vehicles**

Type **Professional**

Description **Car/van**

Brand **Mercedes-Benz**

Name **Sprinter**

EC-type approval/model **Types: 906 AC 35, 906BA50, 906BB50, 906BA35, 906BB35 e1\*2001/116\*0354\*22 - \*25, e1\*2007/46\*0294\*11 - \*13, e1\*2007/46\*0296\*11 - \*13, e1\*2007/46\*0300\*15 - \*18, e1\*2007/46\*0301\*17 - \*20**

Production dates **The affected vehicles were manufactured between 18 September 2018 and 18 November 2019.**

Company recall code **VS3SILUF**

Weekly report number **Report-2021-21**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**



Products were found and  
measures were taken also in

**Slovenia**

Alert number **[A12/00692/21](#)**

Product **Laser pointer**



Risk type **Damage to sight**

**The laser beam is too powerful. Direct viewing of the laser beam could cause damage to sight.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 60825-1.**

Category **Laser pointers**

Type **Consumer**

Description **Black laser pointer. The product was also sold online, in particular via Bol.com.**

Packaging description **In a white cardboard box**

Brand **Topcom**

Name **Laserpointer**

Weekly report number **Report-2021-21**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public **Withdrawal of the product from the market**

authorities


**Other**

Date of entry into force

**19/03/2021**

Alert number **[A12/00695/21](#)**

Product **Children`s sweatshirt**

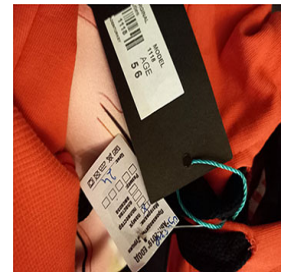

Risk type **Strangulation**

**The products bear cords with free ends in the hood area. The cords may become trapped during various activities of a child, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Children`s sweatshirt “Cuties”, in dark pink and black color. On the front part of the sweatshirts there are rectangular textile applications with the image of a girl with a pink hat with the inscription “cuties” and a second inscription “yeah!!”.**

Brand **Unknown**

Name **“Cuties”**

Type / number of model **1118**

Weekly report number **Report-2021-21**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Turkey**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **05/04/2021**

Alert number	<b><u><a href="#">A12/00699/21</a></u></b>
Product	<b>Children's clothing set</b>



Risk type	<p><b>Injuries</b> <b>Strangulation</b></p> <p><b>The products bear cords with free ends in the hood area and in the waist area. The cords may become trapped during various activities of a child, leading to injuries and/or strangulation.</b></p> <p><b>The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.</b></p>
Category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Description	<b>Three parts set for a girl „Jeliboom“- leggings, blouse and sweatshirt. The set has a white blouse with long sleeves, dark blue leggings and a pink sweatshirt, and all three clothes have a girl`s applique and the inscription „Brawl Stars“.</b>
Brand	<b>„Jeliboom“</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Bulgaria</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Turkey</b>
Measures ordered by public	<b>Withdrawal of the product from the market</b>

authorities

**Retailer**

Date of entry into force

**05/04/2021**





Date of entry into force **26/04/2021**



Alert number **[A12/00698/21](#)**

Product **Children's dress**




Risk type	<b>Injuries Strangulation</b>
	<b>The products bear cords with free ends in the hood area. The cords may become trapped during various activities of a child, leading to strangulation.</b>
	<b>The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.</b>
Category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Description	<b>„Lilax“ dress with long sleeves, Minnie Mouse applique on the part and a hood, in pink color with dark blue sleeves.</b>
Brand	<b>„Lilax“</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Bulgaria</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Turkey</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>05/04/2021</b>

Alert number

**[A12/00697/21](#)**

Product

**Children`s sweatshirt**

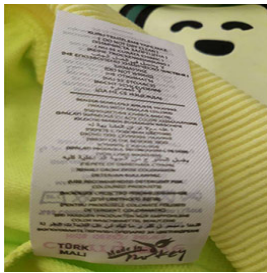

Risk type

**Strangulation**

**The products bear cords with free ends in the hood area. The cords may become trapped during various activities of a child, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.**

Category

**Clothing, textiles and fashion items**

Type

**Consumer**

Description

**Children`s sweatshirt“Cherry love”, in green color. On the front of the sweatshirt there is an image of two avocados and an inscription “LOVECADO”.**

Brand

**„Cherry love“**

Weekly report number

**Report-2021-21**

Alert submitted by

**Bulgaria**

Is the product counterfeit?

**Unknown**

Country of origin

**Turkey**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Retailer**

Date of entry into force

**05/04/2021**

Alert number **[A12/00693/21](#)**

Product **Laser pointer**



Risk type **Damage to sight**

**The laser beam is too powerful. Direct viewing of the laser beam could cause damage to sight.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 60825-1.**

Category **Laser pointers**

Type **Consumer**

Description **Black laser pointer. The product was also sold online, in particular via Bol.com**

Packaging description **In a cardboard box**

Brand **303**

Name **Laser Pointer**

Weekly report number **Report-2021-21**

Alert submitted by **The Netherlands**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic **Withdrawal of the product from the market**

operators

**Other**

Date of entry into force

**26/04/2021**

Alert number **[A12/00696/21](#)**

Product **Children`s sweatshirt**



Risk type	<b>Strangulation</b>
	<b>The products bear cords with free ends in the hood area. The cords may become trapped during various activities of a child, leading to strangulation.</b>
	<b>The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.</b>
Category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Description	<b>Children`s sweatshirt “Likee”, in pink color. On the front of the sweatshirt there is an image of avocado and an inscription “AvoLikee”.</b>
Brand	<b>„Likee“</b>
Type / number of model	<b>1055.9</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Bulgaria</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Turkey</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>

Date of entry into force **05/04/2021**



Alert number **[A12/00737/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The front bonnet lock striker wire may be defective. This could lead to the bonnet opening while driving, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Model: Logan III and Sandero III; Countries of production: Morocco and Romania.**

Brand **Dacia**

Name **Logan, Sandero**

EC-type approval/model **Logan (Pitesti): e19\*2007/46\*0026\*01;  
e19\*2007/46\*0026\*02;  
Sandero (Pitesti): e19\*2007/46\*0026\*00;  
e19\*2007/46\*0026\*01; e19\*2007/46\*0026\*02;  
e19\*2007/46\*0026\*03; e19\*2007/46\*0026\*04;  
Sandero (Tanger): e19\*2007/46\*0026\*00;  
e19\*2007/46\*0026\*01; e19\*2007/46\*0026\*02.**

Production dates **Logan manufactured in the Pitesti Factory between 05/11/2020 and 23/12/2020;  
Sandero manufactured in the Pitesti Factory between 02/09/2020 and 13/01/2021; - Sandero manufactured in the TANGER Factory between 08/10/2020 and 15/01/2021.**

Company recall code **ODLP**

Weekly report number **Report-2021-21**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Morocco**



Measures taken by economic operators

**Recall of the product from end users  
Distributor**

Date of entry into force

**18/05/2021**

Products were found and measures were taken also in

**Greece  
Slovenia  
Sweden**

Alert number

**A12/00704/21**

Product

**Lighting chain**



Risk type

**Electric shock**

**The cable is not properly anchored. The accessible wires can come into contact with sharp edges of the controller unit. The cable could detach or get damaged leaving live conductors accessible. The user could touch the accessible live parts, which may cause an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Category

**Lighting chains**

Type

**Consumer**

Description

**Lighting chain with 180 non-replaceable, white miniature lamps.**

Packaging description

**Packed in a colourful cardboard box.**


Brand

**REALM**

Name	<b>Twinkle Christmas Light Chain / Mikro izzós karácsonyi fényfüzér</b>
Type / number of model	<b>XY-180L-230V</b>
Barcode	<b>8 101312 301808</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>18/02/2021</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>18/02/2021</b>

Alert number **[A11/00037/21](#)**

Product **Glue gun**

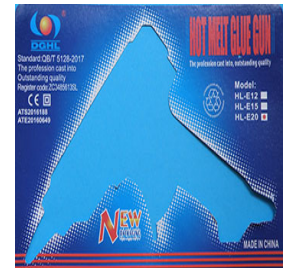

Risk type **Burns  
Fire**

**The cross-section area of the wires in the mains cable is too thin. The cable could overheat, leading to fire and burns.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Blue glue gun with electric heating.**

Packaging description **Packed in a transparent plastic blister with cardboard back.**

Brand **DGHL**

Name **HOT MELT GLUE GUN**

Type / number of model	<b>RJQHAC20W-HLE , HL-E20 (on the label)</b>
Barcode	<b>5 999100 619012</b>
Weekly report number	<b>Report-2021-21</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>12/01/2021</b>

Alert number **[A12/00743/21](#)**

Product **Plastic toy**



Risk type **Injuries**

**The toy contains protruding parts (plastic ring, green and orange keys). These protruding parts, when putting in the mouth, can cause injuries.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Plastic toy keys attached to a key holder, battery powered.**

Packaging description **Cardboard box with plastic window.**

Brand **Shun Long**

Name **baby's musical tinkler**

Type / number of model **2803-3**

Barcode **0631339000005**

Weekly report number **Report-2021-21**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market  
Importer**

Date of entry into force

**08/04/2021**

Alert number **[A12/00727/21](#)**

Product **Mini oven**



Risk type **Electric shock**

**The earthing protection is inadequate and the product insulation is inappropriate, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock.**

**The product does not comply with the Low Voltage Directive and the relevant European standard EN 60335-2-9.**

Category **Kitchen/cooking accessories**

Type **Consumer**

Description **Product has two plates at the top and double glass door at front side. Cooking capacity 30 lit., Power 3200 W.**

Packaging description **Packed in carton box, aprox dimensions 60x40x45 cm.**

Brand **ECG**

Name **Electric stove with hot plates**

Type / number of model **ET 32303 Black  
JK 30B02 RMH**

Barcode **8592131239104**

Weekly report number **Report-2021-21**

Alert submitted by **Croatia**



Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Recall of the product from end users  
Distributor**

Date of entry into force


**12/04/2021**

Company recall code

- <https://www.spar.hr/povlacenje-proizvoda>

Alert number **[A12/00720/21](#)**

Product **Extension lead**

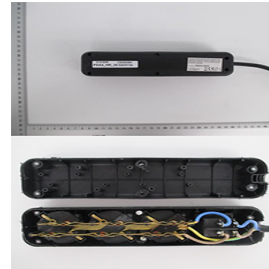

Risk type **Electric shock**

**The material of the product is not sufficiently resistant to abnormal heat, its casing may deform leaving live parts accessible. The user may touch them and suffer burns or get electrocuted.**

**The product does not comply with the requirements of the Low Voltage Directive.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Extension lead with 3 electrical outlets.**

Brand **Tedi**

Name **103 BK**

Type / number of model **Original producers model 103BK**

Weekly report number **Report-2021-21**

Alert submitted by **Croatia**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public **Warning consumers of the risks**

authorities	<b>Distributor</b>
Date of entry into force	<b>27/05/2021</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>27/05/2021</b>

Alert number **[A12/00738/21](#)**

Product **Face paint set**



Risk type **Microbiological**

**The product contains an excessive level of aerobic mesophilic bacteria (measured value: 260000 cfu/g) . If used on damaged skin, or if it comes into contact with the eyes, the product may cause infection or irritation.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Consumer**

Description **Six jars of natural face paint and three eco-friendly makeup applicators. Colours of the face paints are: red, yellow, green, blue, black and white. The product was also sold online.**

Packaging description **Outer packaging is green and beige. There are images of the six jars of natural face paint and applicators on the back of the carton.**

Brand **Natural Earth Paint**

Name **Natural Face Paint**

Barcode **793573035950**

Weekly report number **Report-2021-21**

Alert submitted by **Ireland**

Is the product counterfeit? **Unknown**

Country of origin **United States**

Measures taken by economic operators **Stop of sales  
Retailer**

Date of entry into force **27/04/2021**

Measures taken by economic operators **Stop of sales  
Importer**

Alert number **[A12/00724/21](#)**

Product **Suntan oil**



Risk type **Health risk / other**

**The actual protection factor of the suntan is lower than declared (measured value: SPF 7.8). Consequently, user might be under-protected against UV radiation increasing the risk of sunburns or skin cancer.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Consumer**

Description **The suntan oil with sun protection factor SPF 30.**

Packaging description **100ml blue plastic bottle with a white cap and a hinged lid. On the back it is stated: "High protection factor, waterproof, etc."**

Brand **Alta Herba**

Name **Natural suntan oil with mineral filters, SPF 30**

Batch number **52307-6/22**

Barcode **8595673702877**

Weekly report number **Report-2021-21**

Alert submitted by **Czechia**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **17/05/2021**

---

Alert number **[A12/00739/21](#)**

Product **Flashing Yoyo Ball**

---



Risk type **Strangulation**

**The toy is elastic and can be considerably stretched during use. A child could swing the toy around the head and twist it around the neck, causing strangulation.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Soft squishy light=up yoyo ball.**

Packaging description **The product is sold with no packaging.**

Brand **Unknown**

Name **Pileczka**

Type / number of model **1001294**

Barcode **EAN 5902444012944**

Weekly report number **Report-2021-21**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**



Country of origin

**People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market  
Importer**

Date of entry into force

**20/04/2021**

Measures taken by economic operators

**Destruction of the product  
Importer**

Date of entry into force

**20/04/2021**

Alert number **[A12/00733/21](#)**

Product **Battery charger**



Risk type **Electric shock**

**The electrical insulation and the creepage/clearance distances are inadequate. The user may receive an electric shock from live parts. Live parts may become accessible, a person could touch them and receive an electric shock.**

**The product does not comply with the Low Voltage Directive and the relevant European standard EN 60335-2-29.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Charger for two batteries. Input 100-240 VAC, 50/60 Hz; output 1.2 VDC, 200 mA; 9 VDC, 20 mA, AAx1120mA, AAx2 120mA, AAx1120mA, AAx2 120mA.**

Packaging description **Plastic transparent blister.**

Brand **Westrom**

Name **Westrom Battery charger**

Type / number of model **PH03L2E/C812B**

Batch number **848345**

Barcode **2000221312638**

Weekly report number **Report-2021-21**

Alert submitted by	<b>Lithuania</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Importer</b>