

Alert number **[A12/00791/21](#)**

Product **Lighting chain**



Risk type **Electric shock**

**The insulation between the internal circuit and the external casing is insufficient. Consequently, the casing of the product could become live, increasing the risk of the user receiving an electric shock.**

**The product does not comply with the requirements of the Low Voltage directive and the relevant European standards EN 60598-1, EN 60598-2-20, EN 61347-1 and EN 61347-2-13.**

Category **Lighting chains**

Type **Consumer**

Description **Lighting chain consisting of 8 waterproof tubes containing blue LED stripes.**

Packaging description **The product was also sold online.**

Brand **Unknown**

Name **LED PIOGGIA DI STELLACADENTE - E12061-3-FBA E2-01-01**

Type / number of model **2020-11876**

Weekly report number **Report-2021-22**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Removal of this product listing by the online marketplace  
Other**

Products were found and measures were taken also in

**Ireland**

---

Alert number **[A12/00779/21](#)**

Product **Particle filter mask**

---



Risk type **Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as 73%) and the total filtration capacity of the mask is insufficient (measured mean values: as low as 60%). Furthermore, the mask does not fit correctly to the face of the user. Consequently, an excessive amount of particles or microorganisms might pass through the mask; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.**

Category **Protective equipment**

Type **Consumer**

Description **White respiratory protective half-face mask.**

Packaging description **The product is sold in a white cardboard box containing 10 pieces.**

Brand **Unknown**

Name **KN95 mask**

Weekly report number **Report-2021-22**

Alert submitted by **Iceland**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users  
Distributor**

Date of entry into force **23/03/2021**

Company recall code - <https://rv.is/thjonusta-/innkollun-voru/>

Alert number **[A12/00780/21](#)**

Product **Children's swing**



Risk type	<p><b>Injuries</b></p> <p><b>The knots of the rope may come loose, causing the rope to detach from the seat. As a result, the child may fall from the seat and suffer injuries.</b></p> <p><b>The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-8.</b></p>
Category	<b>Toys</b>
Type	<b>Consumer</b>
Description	<b>Round Swing with net for children between 3 and 10 years old, with a diameter of 100 cm and a weight of 4.21 kg.</b>
Packaging description	<b>Cardboard box with a picture of two children using the swing.</b>
Brand	<b>Nordic Play</b>
Name	<b>Round Swing with net</b>
Type / number of model	<b>805-454</b>
Barcode	<b>5705858069364</b>
Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Iceland</b>

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users  
Retailer**

Date of entry into force **28/04/2021**

---

Alert number **[A12/00745/21](#)**

Product **Passenger car**

---

Risk type **Fire  
Injuries**

**The condensed water drainage hose of the air-conditioning system may not be properly fitted and could spontaneously detach. Consequently, condensation water could enter the passenger compartment and corrode electrical components, which could lead to short-circuits increasing the risk of fire. Additionally, this corrosion might cause different electrical systems to malfunction, increasing the risk of accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Mercedes-Benz**

Name **GLE, GLS**

EC-type approval/model **Type aproval number: e1\*2007/46\*1885\*00-10  
Type: H1GLE (BR 167)**

Production dates **The affected vehicles were manufactured from 28/08/2018  
to 18/07/2020.**

Company recall code **8391106**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - <https://www.mercedes-benz.de>

Products were found and  
measures were taken also in

**Greece**  
**Croatia**  
**Poland**  
**Sweden**  
**Slovenia**  
**Slovakia**



---

Alert number **[A12/00746/21](#)**

Product **Vehicle part**

---

Risk type **Injuries**

**Cracks may form at the tow bar's connection with the car and it could break. Consequently, the trailer could inadvertently become detached while driving, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Tow bar sold as vehicle part, which can be retrofitted, among others, to Mercedes-Benz GLC passenger cars.**

Brand **ACPS**

Name **Oris**

EC-type approval/model **E7 55R-011616**

Production dates **The affected units were manufactured from 15 July 2015 to 18 November 2020**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Hungary**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number

**[A11/00039/21](#)**

Product

**Play frame with slide and swings**

Risk type

**Entrapment  
Injuries**

**The toy has partially closed openings and accessible holes which can cause injuries to the child or in which children's fingers can become trapped.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-8.**

Category

**Toys**

Type

**Consumer**

Description

**Wooden structure consisting of a tower to which are attached a green plastic slide and a gantry with 3 hanging elements (2 swings and 1 swing with 2 seats facing each other). The product was also sold online.**

Packaging description

**4 packages**

Brand

**Soulet / Forest Style**

Name

**Structure Happy Slide + Discovery set**

Type / number of model

**Happy Slide 150 + Discovery Set / 004195**

Barcode

**3598740041959**


Weekly report number

**Report-2021-22**

Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>France</b>
Measures taken by economic operators	<b>Making the marketing of the product subject to prior conditions Manufacturer</b>
Date of entry into force	<b>01/03/2021</b>

Alert number **[A12/00749/21](#)**

Product **Bedside sleeper**

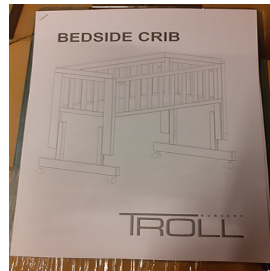

Corrigendum **Notification A12/00749/21 is updated based on information provided by the competent authority on 8 June 2021 concerning the measure taken.**

Risk type **Injuries**

**The adjustable side of the bedside sleeper can be set too low and there is no mechanism to secure the co-sleeper to the bed. As a consequence, the baby may fall and suffer injuries.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 1130.**

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **White wooden bedside sleeper. The product is sold online.**

Packaging description **Cardboard box.**

Brand **TROLL nursery**

Name **Loft Bedside Crib**

Type / number of model **ART. NR. 211.33  
ART. NR. 211.53**

Barcode **5420031100602  
5420031100787**

Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Belgium</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Latvia</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>06/06/2021</b>
Company recall code	- <a href="https://www.mikaelfalk.be/fr/avis-important-troll-bedside-crib">https://www.mikaelfalk.be/fr/avis-important-troll-bedside-crib</a>

Alert number **[A12/00801/21](#)**

Product **Baby nest**



Risk type **Strangulation**

**The drawstrings at the bottom of the product are too long when tightened. Baby's head can become trapped by the drawstrings, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European Standards EN 16890, EN 16780, EN 16781 and EN 1466.**

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Baby nest in white and pink.**

Packaging description **Transparent plastic package.**

Brand **DREAMBEE**

Name **Babynestje - nid de bébé**


Type / number of model	<b>ON 773100 ON 799419 20200053 ON 831686</b>
Batch number	<b>2020/2</b>
Barcode	<b>5414057812670</b>
Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Belgium</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Unknown</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>12/05/2021</b>
Company recall code	- <a href="https://www.dreambaby.be/e/fr/db/rappels">https://www.dreambaby.be/e/fr/db/rappels</a> - <a href="https://www.dreambaby.be/e/nl/db/recalls">https://www.dreambaby.be/e/nl/db/recalls</a>

Alert number

**A12/00770/21**

Product

**Particle filter mask**

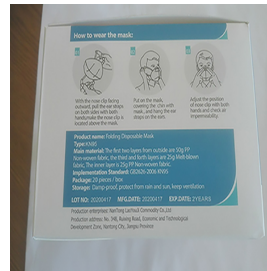

Risk type

**Microbiological**

**The total filtration capacity of the mask is insufficient (measured mean values: as low as 48%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**White disposable protective respiratory filtration half-face mask, foldable, marked with "KN95". The product is also sold online.**

Packaging description

**The product is sold in plastic pouches of 5 pieces, included in a cardboard box (20 x 10 x 10mm) containing 20 pieces (4 plastic pouches).**

Brand

**FRIEND JI**

Name

**KN95 Protective Mask**

Type / number of model

**KN95 (folding disposable mask)**

Batch number

**20200417**



Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Malta</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>04/05/2021</b>

Alert number

**[A12/00784/21](#)**

Product

**Children necklace with pendant**



Risk type

**Chemical**

**The crown of the watch (pendant) contains an excessive amount of lead (measured values: up to 2,5% by weight). Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.**

**The product does not comply with the REACH Regulation.**

Category

**Jewellery**

Type

**Consumer**

Description

**Orange necklace with pendant (watch formed as an owl). The product is also sold online.**

Packaging description

**Plastic bag with cardboard**

Brand

**Højtryk**

Type / number of model

**NK506**

Batch number

**00914474/NK506**

Weekly report number

**Report-2021-22**

Alert submitted by

**Denmark**

Is the product counterfeit?

**Unknown**


Country of origin	<b>Unknown</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Other</b>
Date of entry into force	<b>06/01/2021</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Other</b>
Date of entry into force	<b>06/01/2021</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>06/01/2021</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>06/01/2021</b>

Alert number

**[A12/00768/21](#)**

Product

**Particle filter mask**

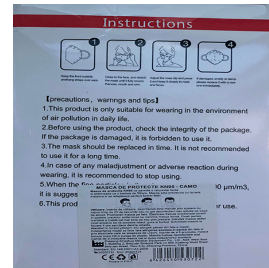

Risk type

**Health risk / other**

**The total filtration capacity of the mask is insufficient (measured mean values: as low as 65%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the PPE Regulation and the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**The mask is of grey-green camouflage coloured material and with a valve. The mask has white straps that fit around the ears.**

Packaging description

**10 masks in a white-red cardboard box. Every mask is wrapped individually in a transparent plastic bag.**

Brand

**YWSH**

Name

**KN95 Protective mask (non-medical)**

Type / number of model

**SH-ZH12**

Batch number

**20200731**

Barcode

**6426450530722**

Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Romania</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>11/05/2021</b>

Alert number **[A12/00775/21](#)**

Product **Passenger car**

Risk type **Injuries**

**Incorrect rims may be mounted due to incorrect information on the off-sets for the 16-inch and 17-inch wheel rims stated in the EC Certificate of Conformity (CoC). As a result, contact between tyre and body can occur, which could cause a tyre to or burst due to the internal pressure and lead to increased risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **Corsa**

EC-type approval/model **Type: U  
e2\*2007/46\*0639\*08 , e2\*2007/46\*0639\*11**

Production dates **The affected vehicles were manufactured between  
19 December 2019 and 31 July 2020.**

Company recall code **E202006770 (21-C-021)**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Greece  
Croatia  
Poland**

**Sweden  
Slovakia**



Alert number

**[A12/00747/21](#)**

Product

**Plastic doll with accessories**



Risk type

**Chemical**

**The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 1.89% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Plastic doll dressed with shorts and shirt accompanied with varied plastic accessories.**

Packaging description

**The product is sold in a transparent plastic packaging.**

Brand

**Unknown**

Type / number of model

**ITEM NO: ZHW124**

Barcode

**5 907616 609427**

Weekly report number

**Report-2021-22**

Alert submitted by

**Poland**

Is the product counterfeit?

**Unknown**



Country of origin **Unknown**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **25/03/2021**

Alert number

**[A12/00761/21](#)**

Product

**Plastic doll with accessories**

Risk type

**Chemical**

**The plastic material of the toy contains an excessive amount of di-‘isononyl’ phthalate (DINP)(measured value: up to 0.23% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system and liver.**

**The product does not comply with the REACH Regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Plastic baby doll with clothing and several plastic accessories (baby bottle, diaper and toilet seat).**

Packaging description

**The product is sold in a cardboard box with a transparent plastic window.**

Brand

**Unknown**

Name

**The Lovely Baby**

Type / number of model

**KX6228/OC0462874**

Barcode

**5 903039 716049**

Weekly report number

**Report-2021-22**

Alert submitted by

**Poland**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **12/04/2021**

Alert number **[A12/00765/21](#)**

Product **Remote-controlled toy car**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of benzyl butyl phthalate (BBP), diisodecyl phthalate (DIDP) and di-n-octyl phthalate (DNOP) (measured values up to: 0.32 %, 0.56% and 0.21% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Battery operated remote-controlled plastic toy car.**

Packaging description **The product is sold in a cardboard box with a transparent plastic window.**

Brand **HENGJIAN**

Name **Wild Striker**

Type / number of model **RC0524 (689-367)**

Barcode **1 401404 609674**

Weekly report number **Report-2021-22**

Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Unknown</b>
Measures ordered by public authorities	<b>Import rejected at border Importer</b>
Date of entry into force	<b>12/04/2021</b>

Alert number

**[A12/00758/21](#)**

Product

**Plastic doll with accessories**



Risk type

**Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP)(measured value: 10.3% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Plastic baby doll with plastic accessories.**

Packaging description

**The product is sold in a pink cardboard packaging with a transparent plastic window.**

Brand

**Rong Long**

Name

**Lovely baby doll**

Type / number of model

**ZA3331 (8653)**

Barcode

**1 401404 667698**

Weekly report number

**Report-2021-22**

Alert submitted by

**Poland**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **12/04/2021**

Alert number **[A12/00760/21](#)**

Product **Plastic doll with accessories**



Risk type **Chemical**

**The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 8.6% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Plastic doll with clothes and varied plastic accessories.**

Packaging description **The product is sold in a pink cardboard packaging with a transparent plastic window.**

Brand **Rong Long**

Name **Baby lovely playset**

Type / number of model **ZA2930 (8262)**

Barcode **1 401404 105626**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**



Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **12/04/2021**

Alert number **[A12/00759/21](#)**

Product **Plastic doll with accessories**



Risk type **Chemical**

**The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP)(measured value: 10 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Plastic baby doll with clothing and plastic accessories.**

Packaging description **The product is sold in a cardboard packaging with a transparent plastic window.**

Brand **Rong Long**

Name **my first doll**

Type / number of model **ZA2932 (8123)**

Barcode **1 401404 106623**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **12/04/2021**

Alert number **[A12/00772/21](#)**

Product **Plastic doll**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 11.4 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Plastic baby doll with a plastic highchair and accessories.**

Packaging description **The product is sold in a cardboard packaging with a transparent plastic window.**

Brand **Rong Long**

Name **baby highchair**

Type / number of model **ZA2931 (8380)**

Barcode **1 401404 105862**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **12/04/2021**

---

Alert number	<b><u><a href="#">A12/00766/21</a></u></b>
Product	<b>Set of plastic dolls with accessories</b>

---



Risk type	<b>Chemical</b>  <b>The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 17 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.</b>  <b>The product does not comply with the REACH Regulation.</b>
Category	<b>Toys</b>
Type	<b>Consumer</b>
Description	<b>Set consisting of three plastic dolls with different clothes and plastic accessories.</b>
Packaging description	<b>The product is sold in a cardboard box with a transparent plastic window.</b>
Brand	<b>CERLO</b>
Name	<b>Fashion beautiful sunshine / Pretty Girls</b>
Type / number of model	<b>8847A</b>
Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border  
Importer**

Date of entry into force

**12/04/2021**

Alert number

**[A12/00757/21](#)**

Product

**Set of plastic dolls with accessories**



Risk type

**Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP)(measured value up to 19.4 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Set of two plastic dolls with clothing and plastic accessories (shoes).**

Packaging description

**The set is sold on a cardboard sheet and wrapped in a transparent plastic bag.**

Brand

**Unknown**

Name

**Bailee**

Type / number of model

**NO.2023-A  
NO.2023-B**

Weekly report number

**Report-2021-22**

Alert submitted by

**Poland**

Is the product counterfeit?

**Unknown**



Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border  
Importer**

Date of entry into force

**12/04/2021**

Alert number

**[A12/00763/21](#)**

Product

**Set of plastic dolls with accessories**



Risk type

**Chemical**

**The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP)(measured value: 19 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Set of two plastic dolls with clothing and plastic accessories.**

Packaging description

**The set is sold in a cardboard box with a transparent plastic window.**

Brand

**Unknown**

Name

**Beauty Lovely Girl**

Type / number of model

**9338A  
9338B**

Weekly report number

**Report-2021-22**

Alert submitted by

**Poland**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border  
Importer**

Date of entry into force

**12/04/2021**

Alert number **[A12/00764/21](#)**

Product **Set of plastic dolls with accessories**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP)(measured value: 21 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Set consisting of two plastic dolls with clothes and plastic accessories.**

Packaging description **The set is sold on a cardboard sheet and wrapped in a plastic bag.**

Brand **Unknown**

Type / number of model **NO.2011-A**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Import rejected at border  
Importer**

Date of entry into force

**12/04/2021**



Alert number

**[A12/00796/21](#)**

Product

**Plastic doll with accessories**



Risk type

**Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 10.4 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Plastic doll with several clothing accessories.**

Packaging description

**The product is sold in a pick cardboard box with a transparent plastic window.**

Brand

**Unknown**

Name

**Lovely girl**

Type / number of model

**9430A  
9430B  
9430C**

Weekly report number

**Report-2021-22**

Alert submitted by

**Poland**

Is the product counterfeit?

**Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **12/04/2021**

Alert number **[A12/00797/21](#)**

Product **Plastic doll with accessories**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 36.6 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Plastic doll with several clothing accessories and a hairdryer.**

Brand **Unknown**

Name **CERLO**

Type / number of model **661A  
661B  
661C**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**



Measures ordered by public  
authorities

**Import rejected at border  
Importer**

Date of entry into force

**12/04/2021**

Alert number **[A12/00798/21](#)**

Product **Set of plastic dolls with accessories**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 1.3 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Set of two plastic dolls with varied clothes and plastic accessories.**

Brand **Unknown**

Name **CERLO**

Type / number of model **5539C1**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border  
Importer**

Date of entry into force

**12/04/2021**

Alert number

[\*\*A12/00799/21\*\*](#)

Product

**Set of plastic dolls with accessories**

Risk type

**Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 33.3 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Set of two plastic dolls with accessories.**

Brand

**Unknown**

Name

**CERLO**

Type / number of model

**1033A1  
1033A2  
1033A3**

Weekly report number

**Report-2021-22**

Alert submitted by

**Poland**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border  
Importer**

Date of entry into force

**12/04/2021**

Alert number

**[A12/00795/21](#)**

Product

**Set of plastic dolls with accessories**

Risk type

**Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values: 11.86 % and 0.11 % by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category

**Toys**

Type

**Consumer**

Description

**Set of three plastic dolls with accessories.**

Brand

**Unknown**

Name

**CERLO**

Type / number of model

**9338C**

Weekly report number

**Report-2021-22**

Alert submitted by

**Poland**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border  
Importer**

Date of entry into force

**12/04/2021**

Alert number **[A12/00774/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

**The bolted connection of the center support to the roof rail may become loose. As a result, the roof load could become detached while the vehicle is in motion or in the event of a crash, leading to increased risk of injury and posing a threat to other road users.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **Mercedes-Benz**

Name **Vito, V-Class**

EC-type approval/model **Types: 639/2, 639/4, 639/5  
e1\*2007/46\*0457\*25, e1\*2007/46\*0457\*27,  
e1\*2007/46\*0458\*20, e1\*2007/46\*0459\*13**

Production dates **The affected vehicles were manufactured between 17 September and 18 November 2020.**

Company recall code **VS2DACHTRA**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

**Slovenia**



Products were found and  
measures were taken also in



Alert number **[A12/00794/21](#)**

Product **Set of plastic dolls with accessories**



Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 14.3 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Set of four plastic dolls with clothing and accessories.**

Brand **Unknown**

Name **CERLO**

Type / number of model **8847B**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public **Import rejected at border**

authorities

**Importer**

Date of entry into force

**12/04/2021**

Alert number **[A12/00792/21](#)**

Product **Plastic doll with accessories**



Risk type **Chemical**

**The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), di-‘isononyl’ phthalate (DINP) and dibutyl phthalate (DBP)(measured values up to: 4.72 %, 3.26 % and 0.27 % by weight, respectively) These phthalates may harm the health of children, causing possible damage to their reproductive system and liver.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Plastic doll with several clothing accessories in plastic or fabric.**

Packaging description **The product is sold on a cardboard sheet and in a transparent plastic bag.**

Brand **Unknown**

Name **CERLO**

Type / number of model **2011B**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **12/04/2021**

Alert number **[A12/00793/21](#)**

Product **Jumping ball**



Risk type **Chemical**

**The plastic material of the product contains an excessive amount of diisobutyl phthalate (measured value up to: 37.67 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Jumping ball with handle, made of soft pink plastic material with a unicorn drawn on it.**

Packaging description **The product is sold in a white plastic net with cardboard label attached.**

Brand **Unknown**

Name **Jumping Ball Ballon Sauter**

Type / number of model **863449**

Barcode **3 245676 159103**

Weekly report number **Report-2021-22**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Importer**

Date of entry into force **13/05/2021**

Alert number

**[A12/00756/21](#)**

Product

**Particle filter mask**



Risk type

**Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as 85%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**White half-face particle filter mask, branded FFP2.**

Packaging description

**Multi-pack cardboard holder containing 50 items, individually wrapped in cellophane envelopes.**

Brand

**TRN MedTeks Face Mask**



Name	<b>TRNMT</b>
Type / number of model	<b>NRFM002</b>
Batch number	<b>010750</b>
Barcode	<b>8682780742039</b>
Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Italy</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Turkey</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Manufacturer</b>

Alert number **[A12/00788/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The clipping of the control button of the hand-brake restraint system might be incorrect. Consequently, the hand-brake might not be correctly engaged when used, leading to the vehicle to spontaneously move when parked, increasing the risk of accident or injuries to by-passers.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car.**

Brand **CITROËN**

Name **Berlingo**

EC-type approval/model **Type: K9  
e2\*2007/46\*0624\*10  
e2\*2007/46\*0625\*11**

Production dates **The affected vehicles were manufactured between 19 February 2021 and 4 March 2021.**

Company recall code **HPX**

Weekly report number **Report-2021-22**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force

**19/04/2021**

Products were found and  
measures were taken also in

**Croatia  
Malta  
Slovenia**

---

Alert number **[A12/00773/21](#)**

Product **Passenger car**

---

Risk type **Fire  
Injuries**

**Due to a defective screw connection, the starter motor positive cable may become damaged by the relative movements of the starter. Consequently, the cable could come into contact with the housing of the starter and cause a short circuit, which could lead to an engine stall and increased risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles with AMG petrol engine and 4MATIC; Model series: E-Class (BR 213), AMG GT 4-Door Coupé (BR 290)**

Brand **MERCEDES-BENZ**

Name **E-Class, AMG GT**

EC-type approval/model **e1\*2001/116\*0501\*31 - \*49, e1\*2007/46\*1560\*04 - \*22, e1\*2007/46\*1878\*00 - \*11; Types: 212, R1ES, R1EAMG**

Production dates **The affected vehicles were manufactured between 15 February 2017 and 27 November 2020.**

Company recall code **5491302**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code **- <http://www.Mercedes-Benz>**

Products were found and  
measures were taken also in

**Croatia**  
**Poland**  
**Sweden**  
**Slovenia**



---

Alert number **[A12/00789/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The clipping of the control button of the hand-brake restraint system might be incorrect. Consequently, the hand-brake might not be correctly engaged when used, leading to the vehicle to spontaneously move when parked, increasing the risk of accident or injuries to by-passers.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **PEUGEOT**

Name **Rifter, Partner**

EC-type approval/model **e2\*2007/46\*0624\*10  
e2\*2007/46\*0625\*11**

Production dates **The affected vehicles were manufactured from 19 February 2021 to 4 March 2021.**

Company recall code **KLC**

Weekly report number **Report-2021-22**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force

**19/04/2021**

Products were found and  
measures were taken also in

**Croatia  
Malta**

Alert number **[A12/00790/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The clipping of the control button of the hand-brake restraint system might be incorrect. Consequently, the hand-brake might not be correctly engaged when used, leading to the vehicle to spontaneously move when parked, increasing the risk of accident or injuries to by-passers.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **Combo**

EC-type approval/model **e2\*2007/46\*0622\*10  
e2\*2007/46\*0623\*11**

Production dates **The affected vehicles were manufactured from 19 February 2021 to 4 March 2021.**

Company recall code **21-C-062**

Weekly report number **Report-2021-22**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**



Date of entry into force

**22/04/2021**

Products were found and  
measures were taken also in

**Greece  
Sweden  
Slovakia**

Alert number **[A12/00783/21](#)**

Product **Motorcycle gloves**



Risk type **Chemical**

**The product contains chromium VI (measured value: 25.3 mg/kg). Chromium (VI) is sensitising, can trigger allergic reactions and can cause cancer.**

**The product does not comply with the Personal Protective Equipment and REACH Regulations and with the relevant European standards EN 13594 and EN 420.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Brown leather motorcycle gloves**

Packaging description **The gloves have a label but no packaging.**

Brand **Kawasaki**

Name **RS Leather Gloves**

Type / number of model **077RGM0236**

Barcode **21-0103358-001-01**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin

**Pakistan**

Measures taken by economic operators

**Withdrawal of the product from the market  
Distributor**

Date of entry into force

**11/05/2021**

Measures taken by economic operators

**Recall of the product from end users  
Distributor**

Date of entry into force

**11/05/2021**

Measures taken by economic operators

**Stop of sales  
Distributor**

Date of entry into force

**11/05/2021**

Alert number **[A12/00755/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

**The hydraulic power steering assistance may be defective and could fail. This will lead to increased risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **Mercedes-Benz**

Name **Sprinter**

EC-type approval/model **906BB50/4x4, 906BB35/4x4, 906BB50/4x4, 906BA50/4x4, 906BA35/4x4, 906BB35/4x4, 906BA50/4x4, 906BA35/4x4, 906BB35G, 906BA35G, 906FUT35, 906FUT35, 906BA50G  
Types: 06 AC 30, 906 AC 35, 906 AC 35/4x4, 906BB30, 906BA30, 906BA50, 906BB50, 906BB50, 906BA35, 906BB35, 906BA50, 906BA35, 906BB35, e1\*2001/116\*0353\*18, e1\*2001/116\*0354\*20, e1\*2001/116\*0424\*14 - \*17, e1\*2007/46\*0279\*11, e1\*2007/46\*0280\*10, e1\*2007/46\*0294\*08, e1\*2007/46\*0295\*11, e1\*2007/46\*0296\*08, e1\*2007/46\*0297\*09, e1\*2007/46\*0298\*10, e1\*2007/46\*0299\*11, e1\*2007/46\*0300\*13, e1\*2007/46\*0301\*14 - \*15, e1\*2007/46\*0304\*05 - \*08, e1\*2007/46\*0305\*10 - \*13, e1\*2007/46\*0307\*08, e1\*2007/46\*0308\*05 - \*09, e1\*2007/46\*0309\*07, e1\*2007/46\*0310\*07, e1\*2007/46\*0311\*08, e1\*2007/46\*0312\*11 - \*15, e1\*2007/46\*0556\*07, e1\*2007/46\*0557\*08, e1\*2007/46\*1075\*05, e1\*2007/46\*1076\*06, e1\*2007/46\*1093\*05**

Production dates **The affected vehicles were manufactured between 15 January 2017 and 4 March 2021.**

Company recall code **NV3LETULPX (469508)**

Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Germany</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Germany</b>
Measures taken by economic operators	<b>Recall of the product from end users Manufacturer</b>
Products were found and measures were taken also in	<b>Greece</b>

Alert number **[A12/00771/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

**The total filtration capacity of the mask is insufficient (measured mean values: as low as 78%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.**

Category **Protective equipment**

Type **Consumer**

Description **White foldable face mask with ear-loops and outside nose clip.**

Packaging description **White/blue plastic bag with 5 masks inside.**

Brand **Unknown**

Name **MASK**

Type / number of model **AP-83001**

Batch number **20.05.2020**

Barcode **4741491000563**

Weekly report number **Report-2021-22**

Alert submitted by	<b>Estonia</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>17/05/2021</b>
Measures taken by economic operators	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>17/05/2021</b>

Alert number **[A12/00754/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The towbar swivel mechanism may have a defective locking pin. As a result, the pin could break while driving, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **VW**

Name **Tiguan**

EC-type approval/model **Type: 5N  
e1\*2001/116\*0450\*00, \*25 - \*41, e1\*2007/46\*0487\*00, \*15 - \*17**

Production dates **The affected vehicles were manufactured between 23 February 2016 and 14 March 2019.**

Company recall code **66M6**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France  
Greece  
Croatia  
Malta  
Romania**



**Sweden  
Slovenia  
Slovakia**



Alert number **[A12/00752/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The vehicles may be fitted with a towbar with a swivel mechanism that may have a defective locking pin. As a result, the pin could break while driving, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Audi**

Name **A4, A5, A6, A7**

EC-type approval/model **e1\*2007/46\*1801\*, e1\*2001/116\*0430\*, Types: F2, B8**

Production dates **January 2018, plus accessory retrofits from August 2015 to December 2018**

Company recall code **66M7**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France  
Croatia  
Romania  
Sweden  
Slovenia  
Slovakia**

---

Alert number **[A12/00750/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The hood hinge could be defective and may not hold the hood closed as designed while the vehicle is in motion. As a result, the hood may flip open without warning and could fully detach from the vehicle, posing a risk to the following traffic.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Lamborghini**

Name **Aventador**

EC-type approval/model **e3\*KS07/46\*0075\*, Type: 834**

Production dates **The affected vehicles were manufactured between 31 March 2017 and 15 January 2021.**

Company recall code **L734-R.01.21**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

---

Alert number **[A12/00751/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The retractor of the front right seatbelt may be defective. As a result, the seat belt may fail to lock when the car brakes strongly or if it tips to the side, leading to increased the risk of injury.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **VW**

Name **T-Roc**

EC-type approval/model **e13\*2007/46\*1845\*, Type: A1**

Production dates **The affected vehicles were manufactured between 24 February and 10 March 2021.**

Company recall code **69BX**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Portugal**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**


Products were found and measures were taken also in **France  
Greece  
Croatia  
Slovenia  
Slovakia**

Alert number

**A12/00778/21**

Product

**Self-balancing scooter (hoverboard)**

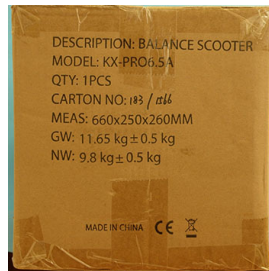

Risk type

**Burns  
Fire  
Injuries**

The battery does not have a device that monitors the cells temperature, hence it may overheat during charging, and the hoverboard cover may ignite. The product may cause a fire and the user may suffer burns. In addition, the product featured poor quality as the power cords, which are exposed to movement between the two motors, are routed through a steel pipe with burr edges at both ends. During the life of the product, the insulation of the power cords will be damaged by the sharp edges to such that in the battery may short-circuit occurs and explodes during use. As a result, the user might lose control and fall off the scooter and suffer injuries.

The product does not comply with the requirements of the Low Voltage Directive and of the relevant European standards EN 60335-1, EN 60335-2 and EN 62133-2.

Category

**Hobby/sports equipment**

Type

**Consumer**

Description	<b>Black and green self-balancing scooter for use as a personal transport device for persons with lithium ion battery and battery charger.</b>
Packaging description	<b>The product is sold in a brown and colourful cardboard box.</b>
Brand	<b>Kawasaki</b>
Name	<b>BALANCE SCOOTER</b>
Type / number of model	<b>KX-PRO6.5A</b>
Barcode	<b>5 905279 820265</b>
Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>28/11/2020</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>28/11/2020</b>

---

Alert number **[INFO/00118/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**Due to the use of defective materials, the crankshaft position sensor's signalling may be incorrect. As a result the engine will not be able to function.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Jeep**

Name **Grand Cherokee**

EC-type approval/model **e4\*2007/46\*0186\*24, Type: WK**

Production dates **The affected vehicles were manufactured between 31 May 2014 and 10 February 2020.**

Company recall code **W90**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/00762/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The software of the Skid control ECU (Electronic Control Unit) which monitors and controls various functions related to the brake system may be defective. As a result, the electronic parking brake could become inoperative, increasing the risk of an accident.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Model (WMI): Yaris HV (VNK); VIN Range: KBAC3#0A000502 - 0A147621; Model year: 2020~2021.**

Brand **Toyota**

Name **Yaris HV**

EC-type approval/model **e6\*2007/46\*0437\*01**

Production dates **The affected vehicles were manufactured between 6 July 2020 and 28 April 2021.**

Company recall code **21SMD-039**

Weekly report number **Report-2021-22**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Importer**



Products were found and  
measures were taken also in

**Bulgaria**  
**Greece**  
**Croatia**  
**Iceland**  
**Poland**  
**Romania**  
**Sweden**  
**Slovenia**  
**Slovakia**

Alert number **[A12/00787/21](#)**

Product **Expandable toy**



Risk type **Choking Injuries**

**The expanding material increases in size when placed in water by more than 50%. The toy can be put into the mouth and swallowed by children. As the toy expands, it can cause fatal occlusion of the respiratory track or intestinal blockage of small children.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **An egg (size 60 mm) made of plastic material, containing a dinosaur figurine.**

Packaging description **Plastic packaging.**

Brand **Unknown**

Name **Growing pet**

Type / number of model **ITEM N0: LSB1375-1**

Barcode **EAN 5902729420150**

Weekly report number **Report-2021-22**

Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>28/04/2021</b>

Alert number **[A12/00786/21](#)**

Product **Expandable toy**



Risk type **Choking Injuries**

**The expanding material increases in size when placed in water by more than 50%. The toy can be put into the mouth and swallowed by children. As the toy expands, it can cause fatal occlusion of the respiratory track or intestinal blockage of small children.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **An egg (size 60 mm) made of plastic material, containing a dinosaur figurine.**

Packaging description **Plastic packaging.**

Brand **Unknown**

Name **Growing pet**

Type / number of model **ITEM N0: LSB1375-2**

Barcode **EAN 5902729420167**

Weekly report number **Report-2021-22**

Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>28/04/2021</b>

Alert number **[A12/00753/21](#)**

Product **Sleep bag**



Risk type **Choking**

**The puller of the slide fastener (zip) could detach generating a small part. A child could put it in the mouth and choke.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 16781:2018.**

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Child sleep bag, 100% polyester and 100% cotton.**

Brand **Unknown**

Type / number of model **„Хипо”/арт. 210825, 210826, 210827, 210828, 210887 depending of the size**

Weekly report number **Report-2021-22**

Alert submitted by **Bulgaria**

Is the product counterfeit? **No**

Country of origin **Bulgaria**

Measures ordered by public authorities **Withdrawal of the product from the market  
Manufacturer**

Date of entry into force **29/04/2021**



Alert number

**[A12/00776/21](#)**

Product

**Electric scooter**



Risk type

**Burns  
Fire  
Injuries**

**The battery does not have a device that monitors the cells temperature, hence during charging it may overheat, and the e-scooter may ignite. The product may cause a fire and the user may suffer burns. In addition, the mechanical strength of the steering column is inadequate and may be deformed or broken during use. As a result, the user might lose control and fall off the e-scooter and suffer injuries.**

**The product does not comply with the requirements of the Machinery Directive and of the relevant European standard EN 62133-2 and the European standard EN 71-1.**

Category

**Machinery**

Type

**Consumer**

Description

**Black and green electric scooter with battery charger. The product is also sold online.**

Packaging description

**The product is sold in a brown cardboard box.**



Brand	<b>FOREVER</b>
Name	<b>Electric Scooter (on the product), Scooter JOY (on the packaging)</b>
Type / number of model	<b>JOY J-200</b>
Barcode	<b>5 900495 736741</b>
Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>20/11/2020</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>20/11/2020</b>

Alert number

**[A12/00777/21](#)**

Product

**Electric scooter**



Risk type

**Burns  
Fire  
Injuries**

**The battery does not have a device that monitors the cells temperature, hence during charging it may overheat, and the e-scooter may ignite. The product may cause a fire and the user may suffer burns. In addition, the end of the scooter handle has a smaller diameter than required, hence the user's hands may slip down while the user is riding the scooter. Furthermore, The diameter of the locking holes on the handlebar is larger than the required value and shear points are formed at the holes which can cause injuries of the fingers.**

**The product does not comply with the requirements of the Machinery Directive and of the relevant European standard EN 62133-2 and the European standard EN 71-1.**

Category

**Machinery**

Type

**Consumer**

Description

**Electric scooter with battery charger with model HLT-118B-**

**2520900E.**

Packaging description	<b>The product is sold in a colourful cardboard box.</b>
Brand	<b>DENVER</b>
Name	<b>Kids Kick Electric Scooter</b>
Type / number of model	<b>SCK-5300 Black</b>
Barcode	<b>5706751043987</b>
Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>06/11/2020</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>06/11/2020</b>
Products were found and measures were taken also in	<b>Germany</b>

Alert number **[A12/00767/21](#)**

Product **Sleep bag**



Risk type **Choking**

**The puller of the slide fastener (zip) could detach generating a small part. A child could put it in the mouth and choke.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 16781:2018.**

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Sleep bag intended for babies made of 100% cotton.**

Brand **Unknown**

Type / number of model **Summer №212270, 212271, 212272, 212273, 212274**

Weekly report number **Report-2021-22**

Alert submitted by **Bulgaria**

Is the product counterfeit? **No**

Country of origin **Bulgaria**

Measures ordered by public authorities **Withdrawal of the product from the market  
Manufacturer**

Date of entry into force **29/04/2021**



Alert number **[A12/00748/21](#)**

Product **Sleep bag**



Risk type **Choking**

**The puller of the slide fastener (zip) could detach generating a small part. A child could put it in the mouth and choke.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 16781:2018.**

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Sleep bag intended for babies made of 100% cotton.**

Brand **Unknown**

Type / number of model **Summer Comfort; art.№212142, 212174, 212178, 212147, 212198, 212124, 212187, 212149, 212188, 212204**

Weekly report number **Report-2021-22**

Alert submitted by **Bulgaria**

Is the product counterfeit? **No**

Country of origin **Bulgaria**

Measures ordered by public authorities **Withdrawal of the product from the market  
Manufacturer**

Date of entry into force **29/04/2021**



Alert number **[A12/00800/21](#)**

Product **Submersible pump**



MICUL FERMIER	
SINGLE-PHASE SPIRAL DIVING PUMP	
Model: QGD3-120-1.1	Speed: 2800 r/min
Power: 1.1 KW/ 1.5 HP	Amps: 6.2 A
Capacity: 3 m <sup>3</sup> /h	Voltage: 220 V
Head: 120 m	Frequency: 50 Hz
Insulation: E	Pipe diameter: 1"
Executive standard: XK06-003-00453	

PRODUCĂTOR:  
**GOLDEN FISH SRL**  
 Sat Ștefăneștii de jos, Comuna Ștefăneștii de jos,  
 Strada Linia de centură, Nr.2 G,  
 Corp A, Județ Ilfov  
 Tel: 0752510318  
 E-mail: contact@micul-fermier.ro



Risk type **Electric shock**

**The mains cable is not properly anchored. The accessible wires can come into contact with sharp edges of the casing parts. The cable could detach or damage leaving live conductors accessible. The accessible metal parts can become live due to the possible interruption of continuity of the protective conductors. The user could touch the accessible live parts, which may cause an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-2-41.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Cylindrical submersible pump with stainless steel cover; class I. The product is sold online.**

Packaging description **Colourful cardboard box.**



Brand	<b>MICUL FERMIER</b>
Name	<b>POMPĂ SUBMERSIBILĂ DE ADĂNCIME</b>
Type / number of model	<b>QGD3-120-1.1; GF-0705 (on hte packagong)</b>
Barcode	<b>6 426910 004879</b>
Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>14/01/2021</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>14/01/2021</b>

Alert number **[A12/00782/21](#)**

Product **Expandable toy**



Risk type **Choking Injuries**

**The expanding material increases in size when placed in water by more than 50%. The toy can be put into the mouth and swallowed by children. As the toy expands, it can cause fatal occlusion of the respiratory track or intestinal blockage of small children.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **An egg (size 60 mm) made of easily breaking material, containing turtle figurine made of expandable material.**

Packaging description **Cardboard box.**

Brand **Unknown**

Name **Growing Pet / Chelonian Egg**

Type / number of model **BZES6614**

Barcode **EAN 5901986746614**

Weekly report number **Report-2021-22**

Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>13/04/2021</b>

Alert number

**[A12/00781/21](#)**

Product

**Farm jack / rack-and-pinion jack**



Risk type

**Injuries**

**The jack is not sufficiently resistant to load and may not lift nor lower the load properly. As a consequence, the load may fall uncontrollably and cause injuries to the user.**

**The product does not comply with the requirements of the Machinery Directive and relevant European standard EN 1494.**

Category

**Machinery**

Type

**Consumer**

Description

**Red farm jack 48" intended to lift up to 3000 kg. The product was also sold online.**

Packaging description

**Cardboard box.**

Brand

**Tamforce**

Name

**Farm jack / off road jack**

Type / number of model

**48"**

Barcode

**6438284103546**

Weekly report number

**Report-2021-22**

Alert submitted by

**Finland**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Recall of the product from end users  
Manufacturer**

Date of entry into force


**25/05/2021**

Alert number

**[A12/00785/21](#)**

Product

**KN95 Mask Disposable Protective Mask**

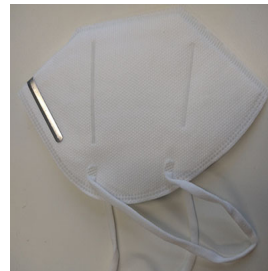

Risk type

**Health risk / other**

**The product bears a CE marking but its filtering capacity has not been tested by a relevant competent European conformity assessment body. The particle/filter retention of the material is insufficient (measured values: as low as 69%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**Protective respiratory filtration half-face mask**

Packaging description

**The masks are sold sealed in a paper/plastic packaging, six per pack. Product information (brand, model, company, instructions for use) are shown in black lettering on a white background with green markings on the back.**

Brand

**MDWayson**

Type / number of model

**MD-PM001**

Batch number

**MFG: 20042101  
LOT: 2020/4/21**

Weekly report number	<b>Report-2021-22</b>
Alert submitted by	<b>Germany</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Removal of this product listing by the online marketplace Other</b>
Measures taken by economic operators	<b>Removal of this product listing by the online marketplace Retailer</b>

Alert number **[A12/00802/21](#)**

Product **Passenger car**

Risk type **Fire**

**The left tank strap may not have been screwed correctly and could become loose, causing the fuel tank to come into contact and become damaged by the drive shaft. This might result in a fuel leak, leading to increased risk of fire and posing a risk to the following traffic.**

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 205, model with a large fuel tank.**

Brand **Mercedes-Benz**

Name **C-Class**

EC-type approval/model **e1\*2001/116\*0457\*43 -\*48, Type: 204K**

Production dates **The affected vehicles were manufactured between 22 and 24 January 2020.**

Company recall code **4790011**

Weekly report number **Report-2021-22**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code **- <https://www.mercedes-benz.de>**