

Alert number

[A12/00912/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 22%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Protective respiratory filtration half-face mask, without valve, for single use.

Packaging description

The product is sold in a blue and white plastic pouch containing 5 masks, marked with "KN95" and "GB2626-2006".

Brand

SCYFKZ

Weekly report number

Report-2021-25

Alert submitted by

Italy

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

Date of entry into force

03/03/2021

Alert number

[A12/00913/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 38%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Protective respiratory filtration half-face mask, without valve, for single use.

Packaging description

The product is sold in a blue and white plastic pouch containing 5 masks, marked with "KN95=FFP2" on one side and "3D MASK Pharmacy" on the other. The product claims protection against PM2.5, dust and viruses.

Brand

UNECH

Name

Folding Respirator

Weekly report number

Report-2021-25

Alert submitted by

Italy

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **03/03/2021**

Alert number **[A12/00914/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 75%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **Protective respiratory filtration half-face mask, without valve, for single use.**

Packaging description **The product is sold, packed in a transparent plastic pouch, in a cardboard box containing 50 items, marked with "KN95", and claiming compliancy to the European standard EN 149.**

Brand **ANHUI ZHONGNAN**

Name **KN 95 PROTECTIVE MASK**

Weekly report number **Report-2021-25**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **03/03/2021**

Alert number

[A12/00915/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 34%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Protective respiratory filtration half-face mask.

Packaging description

The product is sold in a blue and white plastic pouch containing 10 items, marked with both "KN95" and "FFP2", and claiming compliancy to the European standard EN 149.

Brand

JY-JUNYUE

Name

KN 95 FACE MASK

Weekly report number

Report-2021-25

Alert submitted by

Italy

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures ordered by public
authorities


**Withdrawal of the product from the market
Other**

Date of entry into force

03/03/2021

Alert number **[A12/00916/21](#)**

Product **Particle filter mask**

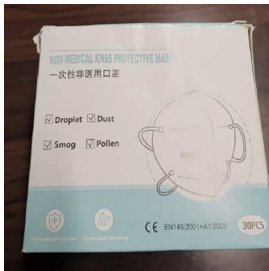

Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 68%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **Protective respiratory filtration half-face mask.**

Packaging description **The product is sold in a cardboard box containing 30 items, marked with "KN95", and claiming compliancy to the European standard EN 149. The product also claims protection against droplets, dust, smog and pollen.**

Brand **WENZHOU XILIAN**

Name **FACE MASK KN 95**

Weekly report number **Report-2021-25**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force


03/03/2021

Alert number

[A12/00917/21](#)

Product

Particle filter mask

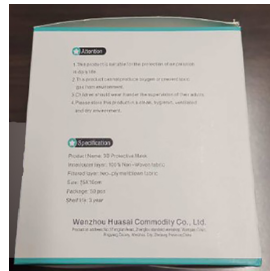

Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 75%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Protective respiratory filtration half-face mask.

Packaging description

The product is sold in a cardboard box containing 50 items, marked with "KN95", and claiming compliancy to the European standard EN 149.

Brand

WENZHOU HUASAI

Name

3D PROTECTIVE MASK

Weekly report number

Report-2021-25

Alert submitted by

Italy

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures ordered by public
authorities


**Withdrawal of the product from the market
Other**

Date of entry into force

03/03/2021

Alert number **[A12/00918/21](#)**

Product **Particle filter mask**

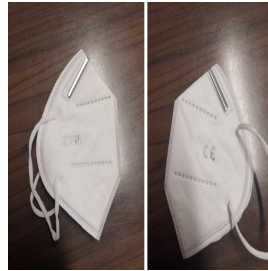

Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 65%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **Protective respiratory filtration half-face mask.**

Packaging description **The product is sold in a cardboard box containing 50 items, marked with "KN95", "FFP2" and "FDA".**

Brand **ZHONGKANG**

Name **KN 95 - EAR MOUNTED MASK**

Weekly report number **Report-2021-25**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Ban on the marketing of the product and any
accompanying measures
Other**

Date of entry into force

03/03/2021

Alert number

[A12/00919/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 80%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Protective respiratory filtration half-face mask.

Packaging description

The product is sold in a cardboard box containing 10 items, marked with "KN95" and "FFP2", and claiming compliancy to the European standard EN 149.

Brand

**TONGCHENG
WENXIN**

Name

WENXIN

Weekly report number

Report-2021-25

Alert submitted by

Italy

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

03/03/2021

Alert number **[A12/00929/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 81%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **White protective respiratory filtration half-face mask, with the brand and the mark "KN95" printed on the side.**

Packaging description **The product is sold in a non-transparent plastic pouch containing 10 items, and claiming compliancy to the European standard EN 149.**

Brand **BI WEI KANG**

Name **FILTER RESPIRATOR**

Type / number of model **9600 TYPE FILTER RESPIRATOR**

Weekly report number **Report-2021-25**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **03/03/2021**

Alert number **[A12/00908/21](#)**

Product **Finger paint**



Risk type **Chemical**

The blue finger paint releases an excessive amount of nitrosamines (measured total value: 60.14 mg/ kg), among which 4-nitrosomorpholine (NMOR) and n-nitrosodiethanolamine (NDELA). Nitrosamines may cause cancer through ingestion or dermal exposure. A child could be exposed to them when touching or putting the product in the mouth.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-12.

Category **Toys**

Type **Consumer**

Description **Three transparent plastic cups with lids, which are filled with finger paint. Each cup has a paint in a different colour, namely yellow, blue and red.**

Packaging description **The set of three paints is sold in a colourful cardboard box and was also sold online.**

Brand **CREATOYS**

Name **Finger paint**

Type / number of model **FPR 80**

Barcode **4 895007 214170**

Weekly report number	Report-2021-25
Alert submitted by	Czechia
Is the product counterfeit?	No
Country of origin	Hong Kong
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	27/05/2021
Measures ordered by public authorities	Temporary ban on the supply, offer to supply and display of the product Importer
Date of entry into force	25/05/2021

Alert number **[A12/00932/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 86%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **Protective respiratory filtration half-face mask, with the brand and the claims "FFP3" and "EN 149" printed on the side of the product.**

Packaging description **The product is sold, packed individually in a transparent and blue plastic pouch, in a blue and white cardboard box containing 30 items, with the claims "FFP3" and "BFE > 99%".**

Brand **LEIKANG**

Name **LEIKANG**

Weekly report number **Report-2021-25**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **03/03/2021**

Alert number **[A12/00933/21](#)**

Product **Particle filter mask**

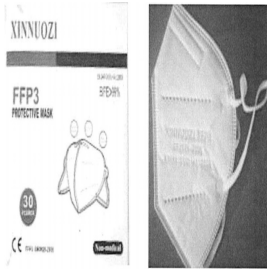

Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 84%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **Protective respiratory filtration half-face mask, with the brand.**

Packaging description **The product is sold, packed individually in a transparent and white plastic pouch, in a white cardboard box containing 30 items, with the claims "FFP3", "BFE>99%" and of compliancy to the European standard EN 149.**

Brand **XINNUOZI**

Name **FFP3 protective mask**

Weekly report number **Report-2021-25**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **03/03/2021**

Alert number **[A12/00928/21](#)**

Product **Particle filter mask**

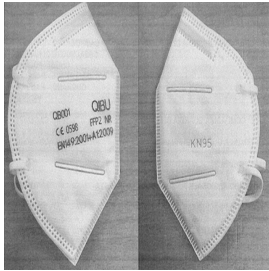

Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 91%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **White protective respiratory filtration half-face mask.**

Brand **QIBU**

Name **FFP2 QIBU**

Type / number of model **QB 001**

Batch number **20210120**

Weekly report number **Report-2021-25**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

07/05/2021

Alert number **[A12/00902/21](#)**

Product **Baby nest**



Risk type **Entrapment
Injuries
Strangulation
Suffocation**

If the head of the baby is placed into the wrong direction, it may get trapped in the gap opening. Because of horizontal gaps, the bumper part may cover the baby's mouth and nose causing suffocation. The product has long cords that can cause injuries and strangulation. Furthermore, the product is not accompanied by any purchase information, warnings, nor instructions for use.

The product does not comply with the requirements of the General Product Safety Directive and the standards EN 16890, EN 16780 and EN 16781.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Baby nest made of 50% cotton and 50% polyester and available in different colors. The baby nest is adjustable by cords to the size needed. The product is sold online.**

Packaging description **Thin transparent plastic packaging with a sticker with the brand name, the product name, the reference, the composition of the textile fabric and the information "FABRICADO EM PORTUGAL".**

Brand **MAIORISTA**

Name **Ninho para bebe ajustavel**

REF. 2503-0031

Type / number of model	
Barcode	EAN : 327505737317
Weekly report number	Report-2021-25
Alert submitted by	Luxembourg
Is the product counterfeit?	No
Country of origin	Portugal
Measures ordered by public authorities	Warning consumers of the risks Retailer
Date of entry into force	08/06/2021
Measures ordered by public authorities	Temporary ban on the supply, offer to supply and display of the product Retailer
Date of entry into force	27/04/2021
Measures ordered by public authorities	Recall of the product from end users Retailer
Date of entry into force	08/06/2021
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Retailer
Date of entry into force	08/06/2021

Alert number

[A12/00927/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 84%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

White protective respiratory filtration half-face mask, with transverse orientation and printing, claiming compliance to the relevant European standard EN 149.

Packaging description

The product is sold in a transparent cellophane pouch containing three items and an information leaflet in Italian containing instructions for use, the dates of production, and the names and addresses of the manufacturer and of the distributor.

Brand

Safemed Saglik Urunleri Haydar Bozdemir

Name

Mascherina FFP2 5 strati

Type / number of model

P0102

Weekly report number

Report-2021-25

Alert submitted by	Italy
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	04/05/2021

Alert number **[A12/00924/21](#)**

Product **Ring**



Risk type **Chemical**

The product contains cadmium (measured value 84,6 % by weight). Cadmium is harmful to human health, because it accumulates in the body and can damage organs and it may cause cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Ring in silver color with transparent and blue stones.**

Packaging description **The ring is packed in a transparent plastic package, and a label with the identification data LR 072-10 was affixed to the package.**

Brand **Unknown**

Name **Ring LR 072 -10**

Type / number of model **LR 072 - 10**

Weekly report number **Report-2021-25**

Alert submitted by **Slovakia**

Is the product counterfeit? **No**

Country of origin **Singapore**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **09/06/2021**

Alert number **[INFO/00131/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

The functioning of the emergency call system may in some cases be impaired. The communication module software will be updated on affected vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **Mercedes-Benz**

Name **EQV, Sprinter, eSprinter, eVito, Vito, V-Class**

EC-type approval/model **639/2, 639/2, 639/2, 639/4, 639/4, 639/5, KL3A4, FL3A4, KL3A5, KL3A5, FL3A5
Types: 906 AC 35, 906 AC 35, 906 AC 35/4x4, 906BA50, 906BB50, 906BA35, 906BB35, 906BB50/4x4, 906BB35/4x4, 906BA50/4x4, 906BA35/4x4, e1*2001/116*0354*17, e1*2001/116*0354*21*26, e1*2001/116*0424*15 -*17, e1*2007/46*0294*10*14, e1*2007/46*0296*10*14, e1*2007/46*0300*15*19, e1*2007/46*0301*17*21, e1*2007/46*0304*06*08, e1*2007/46*0305*11*13, e1*2007/46*0308*06*08, e1*2007/46*0312*12*14, e1*2007/46*0457*11, e1*2007/46*0457*13*14, e1*2007/46*0457*16*26, e1*2007/46*0458*12, e1*2007/46*0458*13*20, e1*2007/46*0459*08*13, e1*2007/46*1760*00*04, e1*2007/46*1761*00*04, e1*2007/46*1762*00*02, e1*2007/46*1762*04, e1*2007/46*1763*00*04**

Production dates **The affected vehicles were manufactured between 12 August 2013 and 22 February 2021**

Company recall code **VSXHERMPOS (5497551), VSXHERMPOB (5497555)**

Weekly report number **Report-2021-25**

Alert submitted by **Germany**

Is the product counterfeit?

No

Country of origin

Germany

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in

Greece

Alert number **[A12/00921/21](#)**

Product **Necklace**



Risk type **Chemical**

The product contains an excessive amount of nickel (measured value 331 µg/cm²/week). Nickel can cause skin reactions, dermatitis, indigestion, decreased lung function, bronchitis and an increased risk of lung cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **60 cm long chain of silver color.**

Packaging description **Transparent plastic bag without any marking.**

Brand **Unknown**

Name **The Chain 60 cm**

Weekly report number **Report-2021-25**

Alert submitted by **Slovakia**

Is the product counterfeit? **No**

Country of origin **Singapore**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **09/06/2021**



Alert number **[A12/00920/21](#)**

Product **Bracelet**



Risk type **Chemical**

The product contains an excessive amount of nickel (measured value 90 µg/cm²/week). Nickel can cause skin reactions, dermatitis, indigestion, decreased lung function, bronchitis and an increased risk of lung cancer.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Bracelet connected from several thin silver-coloured wires.**

Packaging description **The bracelet is packed in a transparent plastic bag, with no markings on the bag.**

Brand **Unknown**

Weekly report number **Report-2021-25**

Alert submitted by **Slovakia**

Is the product counterfeit? **No**

Country of origin **Singapore**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **09/06/2021**



Alert number **[A12/00911/21](#)**

Product **Lorry**

Risk type **Injuries**

The gas pressure regulators could be faulty. As a consequence, the tank may burst in case of very high temperatures (e.g. in the event of a fire).

Category **Motor vehicles**

Type **Professional**

Description **Lorry**

Brand **IVECO**

Name **Stralis, S-Way NP**

EC-type approval/model **Type approval numbers: e3*2007/46*0135*13 - *17, e3*2007/46*0136*17 - *19, e3*2007/46*0143*16
Type: BA3C, 2Y3C, 1A3C**

Production dates **From 31/10/2018 to 05/02/2020**

Company recall code **7V1**

Weekly report number **Report-2021-25**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00935/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to a manufacturing problem, the vehicle-sensitive locking mechanism may not lock as intended when the vehicle decelerates or is tilted to a significant extent. In addition, since the moulded ribs have not been fully formed in the injection-moulding machine, the sensor axis in the mechanism may become detached or dislodged. In the event of sudden braking before an accident or if the vehicle is too tilted, the occupant of the right-hand front-row seat may not be restrained as intended, and is therefore exposed to an increased risk of injury.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **LAND ROVER**

Name **Range Rover Evoque (LZ)**

EC-type approval/model **e5*2007/46*0076*04, e5*2007/46*0076*05**

Production dates **The affected vehicles were manufactured between 16 February and 8 March 2021.**

Company recall code **N568**

Weekly report number **Report-2021-25**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Date of entry into force

19/05/2021

Company recall code

- <https://topix.jaguar.jlrext.com/>

Products were found and measures were taken also in


Poland

Alert number

A12/00907/21

Product

Lighting chain

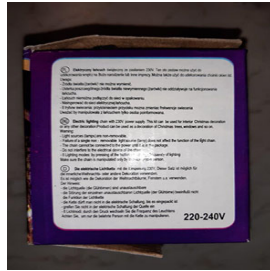

Risk type

Electric shock

The power cord of the electronic unit is not properly anchored. Consequently, it could easily tear apart, leaving live parts accessible. Additionally, the mechanical strength of the power unit is insufficient. Thus, it could easily brake or be opened, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598-2-20.

Category

Lighting chains

Type

Consumer

Description

Lighting chain consisting of 100 non-replaceable LED lights, equipped with an electronic unit for lighting effects with a switch of 8 functions.

Packaging description

The product is sold in a cardboard box.

Brand	Unknown
Name	Phenix LED LIGHT 100L=10M+1.6M
Type / number of model	V8F50
Barcode	6 954871 268639
Weekly report number	Report-2021-25
Alert submitted by	Czechia
Is the product counterfeit?	No
Country of origin	Unknown
Measures ordered by public authorities	Withdrawal of the product from the market Retailer

Alert number **[A12/00938/21](#)**

Product **Passenger car**

Risk type **Injuries**

The cylinder crankcase could be cracked, which could damage the pistons and consequently they may become jammed. This could lead to an engine failure, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Audi**

Name **RSQ8, RS6, RS7, SQ7, SQ8, S8**

EC-type approval/model **Types: F2, 4L, F8
e1*2007/46*1840, e1*2001/116*0367, e1*2007/46*1751,
e1*2001/116*0350**

Production dates **The affected vehicles were manufactured between
28 September and 21 December 2020**

Company recall code **10G9**

Weekly report number **Report-2021-25**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00909/21](#)**

Product **Skin care gel**



Risk type **Chemical**

According to the list of ingredients, the product contains retinoic acid (tretinoin), which should be prescribed by and used under the supervision of a practitioner and is forbidden in cosmetic products. Retinoic acid is teratogenic and can lead to embryopathy and affect or kill the unborn child.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **20 grams of gel advertised as for skin care. The product was also sold online.**

Packaging description **The product is sold in a metal tube and is packaged in a cardboard box.**

Brand **MERANINI**

Name **Tretinoin Gel USP**

Type / number of model **A-Ret Gel 0.05% 20g**

Weekly report number **Report-2021-25**

Alert submitted by **Hungary**

Is the product counterfeit?

No

Country of origin

Unknown

Measures ordered by public
authorities

**Ban on the marketing of the product and any
accompanying measures
Distributor**

Date of entry into force

03/06/2021

Alert number **[A12/00934/21](#)**

Product **Electric bus**

Risk type **Injuries**

In the event of failure of the Controller Area Network (CAN) communication of the traction chain when the vehicle is stopped or in departure mode, the absence of information at low speed can block the rear axle when the driver expects it to follow the departure mode rule. That results in a deviation in trajectory, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Professional**

Description **12-metre electric urban bus, low floor throughout, with two steering axles, category M3, class 1.**

Brand **ALSTOM APTIS**

EC-type approval/model **e2*2007/46*0715*01**

Company recall code **2021-01**

Weekly report number **Report-2021-25**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **30/04/2021**

Alert number **[A12/00937/21](#)**

Product **Vehicle component - Stabilising damper**

Risk type **Injuries**

The steering stabilisation damper may be faulty. This could result in reduced directional stability, increasing the risk of an accident.

Category **Motor vehicles**

Type **Consumer**

Description **Vehicle component - Stabilising damper**

Brand **SAF**

Name **02 376 1012 01, 02 376 1013 01**

EC-type approval/model **Not applicable**

Production dates **1.1.2020 - 31.12.2020**

Company recall code **SI-376-190521-01**

Weekly report number **Report-2021-25**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00922/21](#)**

Product **Passenger car**

Risk type **Injuries**

The ignition coils may fail and the ignition coil fuse may blow. As a result, the engine may stop while driving and not restart, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Subaru Impreza and XV, model year 2017 - 2019**

Brand **Subaru**

Name **Impreza, XV**

EC-type approval/model **E13*2007/46*1648*05; E13*2007/46*1648*06; E13*2007/46*1648*02; E13*2007/46*1678*03; E13*2007/46*1648*04; E1*2007/46*1648*02; E1*2007/46*0597*08;**

Production dates **Model Year: 2017 - 2019**

Company recall code **SRT308**

Weekly report number **Report-2021-25**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and
measures were taken also in

Slovakia



Alert number **[A12/00925/21](#)**

Product **Lighting chain**



Risk type **Burns
Electric shock
Fire**

The cable is not properly anchored and is too thin. The accessible wires have inadequate insulation. The dimensions of the mains plug are substantially less than required. The structure of the cord extension socket allows single-pole insertion of plugs. The product is not protected against moisture but is recommended for outdoor use. The cable could overheat, leading to burns or fire. The water could penetrate the product or the user could touch accessible live parts, which may cause an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Category **Lighting chains**

Type **Consumer**

Description **Icicle-shaped lighting chain with 500 non-replaceable, white LED lamps. The product includes a socket outlet that allows the connection of another lighting chain. The product is sold online.**

Packaging description **Colourful cardboard box.**

Brand **Unknown**

Name **lampki ozdobne**

Type / number of model **ART N.: 1789**

Barcode	6 000980 917897
Weekly report number	Report-2021-25
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	27/05/2021
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	27/05/2021

Alert number **[A12/00923/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to improper software of the FCM ECU (Forward Collision Mitigation), camera images might be processed incorrectly and a possible collision might be detected falsely. As a result, the FCM system might operate primary braking, leading to increased risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Model codes: ASX (GA0W), Eclipse Cross (GK0W), Eclipse Cross PHEV (GL3W), Outlander (GF0W), Outlander PHEV (GG0W)**

Brand **Mitsubishi**

Name **ASX, Eclipse Cross, Eclipse Cross PHEV, Outlander, Outlander PHEV**

EC-type approval/model **e1*2001/116*0406*29; e1*2001/116*0406*31; e1*2001/116*0406*32; e1*2001/116*0406*33; e1*2007/46*0368*15; e1*2007/46*0368*19; e1*2007/46*0368*21; e1*2007/46*0368*22; e1*2007/46*1769*00; e1*2007/46*1769*01; e1*2007/46*1769*02; e1*2007/46*1769*04; e1*2007/46*1769*05; e1*2007/46*1769*06; e1*2007/46*1769*07; e1*2007/46*1769*11; e1*2007/46*1769*12**

Production dates **Eclipse Cross: Model Year 2018-2021
Eclipse Cross PHEV: Model Year 2021,
Outlander: Model Year 2017-2020
ASX: Model Year 2018-2020
Outlander PHEV: Model Year 2020**

Company recall code **ENL-21-014-SR**

Weekly report number **Report-2021-25**

Alert submitted by	Poland
Is the product counterfeit?	Unknown
Country of origin	Japan
Measures taken by economic operators	Recall of the product from end users Manufacturer
Products were found and measures were taken also in	Greece Sweden

Alert number **[INFO/00130/21](#)**

Product **Passenger car**

Risk type **Injuries**

A problem may occur with the current Telematic control unit (TCU) software, which could affect the functionality of the eCall system. As a result, emergency service may not be contacted in case of need.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **FORD**

Name **Explorer, Puma, Focus, S-Max, Galaxy, Kuga**

EC-type approval/model **Types: DEH, DFK, WUJ, J2K
e13*2007/46*1911*06-*09; e13*2007/46*2188*02, *03, *05;
e13*2007/46*2217*00-*01; e9*2007/46*3165*00,*02-*04**

Production dates **The affected vehicles were manufactured between 15 July 2019 and 12 February 2021**

Company recall code **21C12**

Weekly report number **Report-2021-25**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Greece
Poland**

Alert number **[A12/00926/21](#)**

Product **Toy tent**



Risk type **Burns
Cuts
Injuries**

The material of the tent is easily flammable and the flame propagation is too high. If it catches fire, the child could suffer burns. Furthermore, the tent's frame is not sufficiently stable and can break when using the product. This could lead to injuries or cuts with the sharp edges.

The product does not comply with the Toy Safety Directive and the relevant European standards EN 71-1 and EN 71-2.

Category **Toys**

Type **Consumer**

Description **Toy tent made of textile material with foldable metal frame supplied with plastic balls.**

Packaging description **Cardboard box.**

Brand **Unknown**

Name **Giraffe Tent**

Type / number of model **ITEM NO. 6734154
NO.2030A**

Batch number **02PL1901**

Barcode **EAN 6902019010367**

Weekly report number	Report-2021-25
Alert submitted by	Poland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Importer
Date of entry into force	07/05/2021

Alert number **[A12/00904/21](#)**

Product **Children's bed**



Risk type **Injuries**

The construction of the children bed is not stable enough and during normal play (when jumping) of the child, it may break and lead to injury.

The product does not comply with the requirements of the General Product Safety Directive and with the applicable European standard EN 1725.

Category **Furniture**

Type **Consumer**

Description **Children bed in the shape of a car supplied with mattress. The product is sold online.**

Packaging description **Cardboard packaging.**

Brand **Unknown**

Type / number of model **Sides set Light MG Plus New**

Barcode **200000003142, 2000000011257, 2000000019352**

Weekly report number **Report-2021-25**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Russian Federation**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **28/05/2021**

Alert number **[A12/00906/21](#)**

Product **Children's bed**



Risk type **Injuries**

The construction of the children bed is not stable enough and during normal play (when jumping) of the child, it may break and lead to injury.

The product does not comply with the requirements of the General Product Safety Directive and with the applicable European standard EN 1725.

Category **Furniture**

Type **Consumer**

Description **Children's bed in the shape of a car supplied with mattress. The product is sold online.**

Packaging description **Cardboard packaging.**

Brand **Unknown**

Type / number of model **UNO ALFA S6 UNO BETA UNO STAR**

Barcode **2000000011967; 2000000012032; 2000000012216**

Weekly report number **Report-2021-25**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Russian Federation**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **28/05/2021**

Alert number **[A12/00905/21](#)**

Product **Children's bed**



Risk type **Injuries**

The construction of the children bed is not stable enough and during normal play (when jumping) of the child, it may break and lead to injury.

The product does not comply with the requirements of the General Product Safety Directive and with the applicable European standard EN 1725.

Category **Furniture**

Type **Consumer**

Description **Children's bed in the shape of a car supplied with mattress. The product is sold online.**

Packaging description **Cardboard packaging**

Brand **Unknown**

Type / number of model **NEO with wheels**

Barcode **2000000013688; 2000000015392; 20000179339572**

Weekly report number **Report-2021-25**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Russian Federation**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **28/05/2021**

Alert number **[A12/00903/21](#)**

Product **Children's bed**



Risk type **Injuries**

The construction of the children bed is not stable enough and during normal play (when jumping) of the child, it may break and lead to injury.

The product does not comply with the requirements of the General Product Safety Directive and with the applicable European standard EN 1725.

Category **Furniture**

Type **Consumer**

Description **Children bed in the shape of a truck supplied with mattress. The product is sold online.**

Packaging description **Cardboard packaging.**

Brand **Unknown**

Type / number of model **DUO - 11**

Barcode **2000000015149;2000000015170;2000000019437;2000000015200;2000000015231;2000000015262;2000000015293;2000000019413;2000000019420;2000000015705;2000000000411**

Weekly report number **Report-2021-25**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Russian Federation**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **28/05/2021**

Alert number **[A11/00047/21](#)**

Product **Light commercial vehicle**

Risk type **Fire**

The fuel return hose may be defective. This can result in a diesel fuel leakage, increasing the risk of fire.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Light commercial vehicle**

Brand **Fiat professionnel**

Name **Talento**

EC-type approval/model **e2*2007/46*0497**

Production dates **The affected vehicles were manufactured between 9 March and 11 December 2020**

Company recall code **6318**

Weekly report number **Report-2021-25**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **26/02/2021**

Poland

Products were found and
measures were taken also in



Alert number **[A12/00936/21](#)**

Product **Passenger car**

Risk type **Injuries**

The latching of the fuel delivery module to the fuel tank may be defective and could be released while the vehicle is being driven. As a result, fuel may leak from the fuel tank, posing a risk to the following traffic.

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 223.**

Brand **Mercedes- Benz**

Name **S-Class**

EC-type approval/model **Type: R2S
e1*2007/46*2115*02**

Production dates **The affected vehicles were manufactured between 15 and 23 March 2021.**

Company recall code **4790012**

Weekly report number **Report-2021-25**

Alert submitted by **Germany**

Is the product counterfeit? **No**


Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code - **<http://www.Mercedes-Benz>**

Alert number **[A12/00930/21](#)**

Product **Desk lamp**

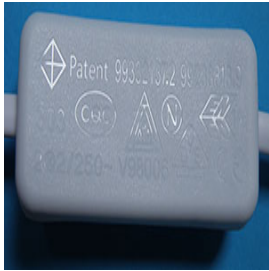

Risk type **Burns
Electric shock
Injuries**

The lamp is attractive to children but it is not equipped with a transformer or converter. Live parts and hot surfaces (214 ° C) can be touched directly. As a result, the user can suffer burns and receive an electric shock. In addition the mechanical strength of the luminaire is inadequate, it can easily break causing cutting injuries.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Category **Lighting equipment**

Type **Consumer**

Description **Smiley ceramic table lamp with white textile lampshade.**

Packaging description **Colourful cardboard box.**

Brand **STRÜHM**

Name **Asztali lámpa**

Type / number of model **EMO E14**

Barcode **5 901477 300042**

Weekly report number **Report-2021-25**

Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	17/11/2020
Products were found and measures were taken also in	Germany

Alert number	<u>A12/00939/21</u>
Product	Children's clothing set



Risk type	Choking The small decorative elements on the blouse and leggings are easily detached and a child might put these in the mouth and choke on them The product does not comply with with the General Product Safety Directive.
Category	Clothing, textiles and fashion items
Type	Consumer
Description	Clothing set for children up to 3 years, including a blouse with short sleeves and leggings. The blouse is yellow with a black inscription "BRAVE GIRLS" "Just Be Cool" with many small stones glued. The leggings are black with an inscription on the left leg "Just Be Cool" and a small stone
Brand	LUMINOSO
Type / number of model	Kod-L313
Barcode	2 136329 703136
Weekly report number	Report-2021-25
Alert submitted by	Bulgaria
Is the product counterfeit?	Unknown
Country of origin	Turkey

Measures ordered by public
authorities

**Withdrawal of the product from the market
Retailer**

Date of entry into force

16/06/2021

Alert number	A12/00941/21
Product	Children's clothing set



Risk type	Choking The small decorative stones glued on the blouse are easily detached and a child might put these in the mouth and choke on them. The product does not comply with the General Product Safety Directive.
Category	Clothing, textiles and fashion items
Type	Consumer
Description	Clothing set for children up to 3 years comprising a blouse with short sleeves and leggings. The blouse is light green with the inscription "Mine lives Pretty chic So Cool" and has many small stones glued to it.
Brand	LUMINOSO
Type / number of model	Kod:P-920
Barcode	1 936329 709203
Weekly report number	Report-2021-25
Alert submitted by	Bulgaria
Is the product counterfeit?	Unknown
Country of origin	Turkey

Measures ordered by public
authorities

**Withdrawal of the product from the market
Retailer**

Date of entry into force

16/06/2021

Alert number	<u>A12/00942/21</u>
Product	Children's clothing set



Risk type	Choking The small decorative stones glued on the blouse are easily detached and a child might put these in the mouth and choke on them. The product does not comply with the General Product Safety Directive.
Category	Clothing, textiles and fashion items
Type	Consumer
Description	Clothing set for children up to 3 years, comprising a blouse with short sleeves, a skirt-body and a headband. The blouse is white, with an image of a girl and many decorative stones.
Brand	BABY ROSE
Type / number of model	code 3350
Barcode	4 983201 133509
Weekly report number	Report-2021-25
Alert submitted by	Bulgaria
Is the product counterfeit?	Unknown
Country of origin	Turkey

Measures ordered by public
authorities

**Withdrawal of the product from the market
Retailer**

Date of entry into force

16/06/2021

Alert number **[A12/00940/21](#)**

Product **Children`s clothing set**



Risk type **Choking**

The small decorative elements glued on the blouse are easily detached and a child might put these in the mouth and choke on them.

The product does not comply with the General Product Safety Directive.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Clothing set for children up to 3 years old, comprising a pink skirt and a white blouse with short sleeves, with the inscription "Wonderful", with a picture of a rose and hearts and with many glued small stones and a sewn butterfly with a big stone**

Brand **BEBUS**

Type / number of model **code 1408**

Barcode **1 000000 042375**

Weekly report number **Report-2021-25**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Turkey**

Measures ordered by public
authorities

**Withdrawal of the product from the market
Retailer**

Date of entry into force

16/06/2021

Alert number **[A12/00931/21](#)**

Product **Particle filter mask**



Product certificate	
Product name:	KN95 face mask
Item number:	1 / BC11.5/12
Specification:	4 ply -2ply non-woven fabric, 1ply melt-blown fabric, 1 ply anti-static cotton
Standard:	EN149:2001+A1:2009
Report number:	201TC0302361M
Qty:	Specs/bag
Manufacturer:	Dongguan Bochuan Intelligent Equipment Co., Ltd.
Batch number:	CA/AE
Manufacturing date:	16 Apr 2020
Expiry Date:	16 Apr 2022
Inspection:	passed

Risk type **Health risk / other**

The total filtration capacity of the mask is insufficient (measured mean values: as low as 71%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **Protective respiratory filtration half-face mask. The product is also sold online.**

Brand **Prosafety**

Name **KN95 face mask**

Type / number of model **1/BC11.5/12
518902-01**

Batch number **CA/AE**

Weekly report number **Report-2021-25**

Alert submitted by **Belgium**

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Importer**