
Alert number **[INFO/00132/21](#)**

Product **Passenger car**

Risk type **Burns
Injuries**

**The bolting of the engine connecting rods may be faulty.
This may lead to oil leaks and engine failure.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Porsche**

Name **718 Spyder / 718 Boxster GTS, 718 Cayman GT4 / 718 Cayman GTS 4.0**

EC-type approval/model **e13*2007/46*1607*11 -*12; Type: 982**

Production dates **The affected vehicles were manufactured between 18 September 2020 and 4 March 2021.**

Company recall code **AMA4**

Weekly report number **Report-2021-26**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **France
Greece
Poland**

Alert number

[A12/00943/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 15%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

White protective respiratory filtration half-face mask.

Packaging description

The product is sold in white-blue plastic pouches containing 5 items each, with the claim KN95.

Brand

Anysound

Name

KN95 Self-Priming Filter & Anti Particle Respirator - 5 masks' pack

Weekly report number

Report-2021-26

Alert submitted by

Germany

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Warning consumers of the risks
Other**

Date of entry into force

31/05/2021

Alert number **[A12/00944/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 15%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **White protective respiratory filtration half-face mask, sold in white-blue plastic pouches containing 10 items each, with the claim KN95.**

Brand **Anysound**

Name **KN95 Self-Priming Filter & Anti Particle Respirator - 10 masks' pack**

Weekly report number **Report-2021-26**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Warning consumers of the risks
Other**

Date of entry into force

31/05/2021

Alert number **[A12/00945/21](#)**

Product **Light commercial vehicle**

Risk type **Injuries**

Due to a production error in the assembly line, the 230V cable in the area of the head airbag may have been incorrectly installed. As a result, the head air bag would not provide sufficient protection as the 230V cable might hinder its full inflation, leading to increased risk of injury.

Category **Motor vehicles**

Type **Consumer**

Description **Light commercial vehicle**

Brand **VW**

Name **Crafter**

EC-type approval/model **Type: SYN1E
e1*2007/46*1613*08, *11, *13, *15**

Production dates **The affected vehicles were manufactured between 16 October 2018 and 4 March 2020.**

Company recall code **69CG**

Weekly report number **Report-2021-26**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **France**

Alert number **[A12/00960/21](#)**

Product **Wristwatch**



Risk type **Chemical**

The product releases an excessive amount of nickel (measured value: 2.19 µg nickel/cm²/week). Nickel is a highly sensitising contact allergen and may cause allergic skin reactions if present in articles that come into direct and prolonged contact with the skin.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Ladies' wristwatch with length-adjustable stainless-steel strap, quartz movement, water-resistant up to 5 bar.**

Packaging description **Watch displayed on cushion, in plastic blister packaging with printed cardboard insert.**

Brand **IDEEN WELT**

Name **Damen-Edelstahlarmbanduhr "Simon M."**

Barcode **4305615763880**

Weekly report number **Report-2021-26**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Retailer
Measures taken by economic operators	Stop of sales Retailer
Date of entry into force	01/06/2021
Company recall code	- https://www.rossmann.de/unternehmen/presse/pressemeldungen/210608-Rueckruf-Damen-Armbanduhr-Edelstahl-silber.html

Alert number **[A12/00954/21](#)**

Product **Passenger car**

Risk type **Injuries**

In the event of a very serious accident involving damage to the high-voltage vehicle electrical system, the 12-volt electrical system and its components may be damaged by high-voltage transmission due to a software defect in the battery management system. This may, in the event of an accident, lead to the failure of post-crash functions (e.g. eCall, hazard warning system, etc.).

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **BMW**

Name **iX3**

EC-type approval/model **Type: G3XE
e1*2007/46*2130**

Production dates **The affected vehicles were manufactured between 22 July 2019 and 6 May 2021.**

Company recall code **61030600**

Weekly report number **Report-2021-26**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and **Greece
Poland**

measures were taken also in

Sweden
Slovenia



Alert number **[A12/00966/21](#)**

Product **USB charger**



Risk type **Electric shock**

The insulation of the product is inadequate. The user could receive an electric shock from accessible (live) parts.

The product does not comply with the requirements of the Low Voltage Directive and the relevant standard EN IEC 62368.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White and black USB power supply unit with two ports and connecting cable.**

Packaging description **Cardboard box with transparent window.**

Brand **HX**

Name **2in1 FAST SMART CHARGER**

Type / number of model	HX101 (on the product); XH-101 (on the packaging); XH-101C (on the label)
Barcode	6 001835 000085
Weekly report number	Report-2021-26
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Distributor
Date of entry into force	27/05/2021

Alert number **[A12/00959/21](#)**

Product **Passenger car**

Risk type **Injuries**

The functioning of the parking brake is impaired. This may cause unintended vehicle movements, increasing the risk of injury.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Opel**

Name **Movano**

EC-type approval/model **e1*2007/46*0471*26, e1*2007/46*0362*27, *29, Types: MS, MR**

Production dates **The affected vehicles were manufactured between 15 February and 27 May 2021.**

Company recall code **E212104361 (21-C-103)**

Weekly report number **Report-2021-26**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Hungary
Poland
Slovakia**

Alert number **[A12/00953/21](#)**

Product **Bus/coach**

Risk type **Injuries**

A poorly installed wiring harness could lead to the door opening while the vehicle is in motion.

Category **Motor vehicles**

Type **Professional**

Description **Bus/coach**

Brand **EVOBUS**

Name **Setra LE Business**

EC-type approval/model **Type approval number: e1*2007/46*0014*24,
e1*2007/46*0018*24
Type: 633 04, 633 05**

Production dates **From 05/08/2020 to 27/11/2020**

Company recall code **72.14U21161A**

Weekly report number **Report-2021-26**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00957/21](#)**

Product **Passenger car**

Risk type **Injuries**

The fixing screws for the ball joints may be missing. This could lead to a loss of control over the vehicle during driving, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Ball joints**

Brand **Citroen**

Name **C3 V4 (B618)**

EC-type approval/model **e2*2007/46*0003*58, e2*2007/46*0003*61, e2*2007/46*0003*62, e2*2007/46*0003*63, e2*2007/46*0003*64, e2*2007/46*0060*30**

Production dates **The affected vehicles were manufactured between 3 January 2020 and 24 March 2021.**

Company recall code **HTD**

Weekly report number **Report-2021-26**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Slovakia**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force

09/06/2021

Products were found and
measures were taken also in

**Poland
Slovenia**

Alert number **[A11/00049/21](#)**

Product **Baby nest**



Risk type **Injuries
Strangulation
Suffocation**

The cords could potentially trap the child's toes, possibly leading to injuries. The child's nose and mouth could become stuck in the horizontal gaps between the mattress and the side of the nest, leading to a risk of suffocation. The presence of openings at the junction of the sides of the baby nest, at the end, could trap the child's head, leading to a risk of strangulation.

The product does not meet the requirements of the General Product Safety Directive and the relevant European standard EN 16890.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Baby nest comprising a light blue mattress with a grey surround, decorated with clouds. The mattress can be withdrawn from the cover by means of a zip closure, and the surround can be tightened by means of cords.**

Packaging description **Plastic bag, transparent on one side and more opaque on the other. A green label slipped into the packaging presents the product. The product was sold online, in particular via Amazon.**

Brand **Babysom**

Name **Réducteur de lit / Nid d'ange**

1433116

Type / number of model

Weekly report number **Report-2021-26**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **27/04/2021**

Alert number **[A12/00958/21](#)**

Product **Passenger car**

Risk type **Injuries**

The anti-rust treatment of the cradle may be insufficiently thick. As a result the cradle could break due to corrosion, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **VIN range: VF7 NX5GZT FY514848 to VF7 NC5FS9 GY500080**

Brand **Citroen**

Name **C4 V2 DS4 (B7)**

EC-type approval/model **e2*2007/46*0040*22, e2*2007/46*0040*23, e2*2007/46*0079*11**

Production dates **The affected vehicles were manufactured between 2 and 13 March 2015.**

Company recall code **GZH**

Weekly report number **Report-2021-26**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force

03/07/2021

Products were found and
measures were taken also in

**Poland
Slovenia**

Alert number

[A12/00947/21](#)

Product

Plastic reusable ice cubes



Risk type

Choking

Due its colour, size and shape the product may be considered by a child as food. If swallowed it may obstruct the airways and cause choking.

The product does not comply with the requirements of the General Product Safety Directive.

Category

Kitchen/cooking accessories

Type

Consumer

Description

Multi-colour reusable ice cooling cubes (in flamingo or pineapple shape) made of soft plastic material

Packaging description

Sold in packages containing 20 pieces of cubes.

Brand

NANU-NANA

Name

20 x Eiswürfel

Batch number	LOT 802199
Barcode	2000729058007
Weekly report number	Report-2021-26
Alert submitted by	Poland
Is the product counterfeit?	Unknown
Country of origin	Unknown
Measures taken by economic operators	Withdrawal of the product from the market Distributor
Date of entry into force	28/04/2021

Alert number **[A11/00048/21](#)**

Product **Toy scooter**



Risk type **Injuries**

There are accessible gaps between moving parts of the scooter. Body parts (fingers) may become trapped. Consequently, a child may suffer injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Toy scooter with plastic wheels, its frame is made of metal. The toy may be folded, its handlebar may be adjusted to user's height.**

Packaging description **Cardboard box.**

Brand **L.O.L. SURPRISE!**

Name **Street Scooter**

Type / number of model **HX1921-512
Item N° 28546**

Barcode **EAN 8001011285464**

Weekly report number **Report-2021-26**

Alert submitted by **Poland**

Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	26/03/2021
Products were found and measures were taken also in	Slovenia

Alert number **[A12/00946/21](#)**

Product **Passenger car**

Risk type **Injuries**

The resistance characteristics of the fuel pump components against high fuel pressure may be inadequate. As a result, cracks may be formed on the welded parts of the pump and a fuel leak may occur, posing a risk to the following traffic.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **TOYOTA**

Name **TOYOTA AURIS, C-HR, COROLLA / LEXUS NX300, RX300**

EC-type approval/model
**Lexus RX300: e6*2007/46*0163*03
 Toyota C-HR : e11*2007/46*3641*01 e6*2007/46*0338*00
 e6*2007/46*0338*01 e6*2007/46*0338*02
 Toyota Corolla: e6*2007/46*0318*00 e6*2007/46*0318*01
 e6*2007/46*0318*02 e6*2007/46*0318*03
 e6*2007/46*0318*04**

Production dates
**C-HR - Production period from 27.11.2017 to 27.04.2021.
 C-HR- frame code NGX10, NGX50, WMI: NMT, Range by frame number: VDS - KY3BX#, KY4BX#, LY3FX#, LY4FX#;
 VIS - 0R034898 - 0R079674, 0R034900 - 0R081931,
 0R010046 - 0R017271, 0R010048 - 0R015502
 COROLLA - frame code NRE210, WMI: SB1, Range by frame number: VDS - KA3BE#, ZA3BE#; VIS - 0E000501 - KE000531, 0E000508 - 0E022611; Production period from 18.06.2018 to 09.04.2021.
 AURIS - frame code NRE185, WMI: SB1, Range by frame number: VDS - MA3JE#, ZA3JE#; VIS - 0E052266 - 0E061348, 0E056325 - 0E061346; Production period from 06.11.2017 to 30.11.2018.
 NX300 - frame code AGZ10, AGZ15, WMI: JTJ, Range by frame number: VDS - YARBZ#, BARBZ#; VIS - 02157565-02171136, 02179154-02250427; Production period from 17.05.2018 to 04.02.2021.**

RX300 - frame code AGL20, AGL25, WMI: JTJ, Range by frame number: VDS - ZAMCA#, BAMCA#; VIS - 02039925 - 02039925, 02050723-02143839; Production period from 29.03.2018 to 02.03.2021.

Company recall code	21SMD-041
Weekly report number	Report-2021-26
Alert submitted by	Bulgaria
Is the product counterfeit?	No
Country of origin	Japan
Measures taken by economic operators	Recall of the product from end users Importer
Products were found and measures were taken also in	Greece Hungary Poland Sweden Slovenia

Alert number **[A12/00962/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 72.5%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Professional**

Description **Protective respiratory filtration half-face mask. The product was sold online, in particular via Amazon.**

Packaging description **The product is sold in transparent plastic pouches.**

Brand **DECADE**

Name **Respirator FFP2 respiratory protective mask FFP2**

Type / number of model **univent-medical**

Batch number **Art-Nr. 1488**

Barcode **4250397303499**

Weekly report number **Report-2021-26**


Alert submitted by	Germany
Is the product counterfeit?	No
Country of origin	Germany
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Other
Date of entry into force	21/05/2021

Alert number

[A12/00963/21](#)

Product

Particle filter mask

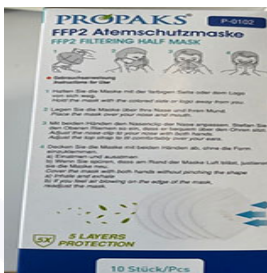

Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 58%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Protective respiratory filtration half-face mask. The product is also sold online.

Packaging description

The product is sold in individual transparent plastic pouches, packed in a white and blue cardboard box containing a total of 10 masks. The smaller packaging unit lacks the declaration of conformity, and the corresponding

link or reference.

Brand	PROPAKS
Name	FFP2 Atemschutzmaske
Type / number of model	P-0102 P0102
Barcode	8699234662980
Weekly report number	Report-2021-26
Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Withdrawal of the product from the market Other
Measures ordered by public authorities	Withdrawal of the product from the market Other
Measures taken by economic operators	Withdrawal of the product from the market Importer
Measures taken by economic operators	Withdrawal of the product from the market Distributor

Alert number **[A12/00956/21](#)**

Product **Passenger car**

Risk type **Injuries**

The fuel feeding impeller in the fuel pump, which is made of resin material, may be swollen and deformed due to the insufficient material density caused by the improper injection molding process. Consequently, the impeller may interfere with the fuel pump housing, resulting in the fuel pump malfunction. As a result, the engine could stop while driving, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Suzuki Jimny manufactured between 09.05.2018 and 22.11.2018.**

Brand **Suzuki**

Name **Jimny**

EC-type approval/model **e6*2007/46*0253*00**

Production dates **The affected vehicles were manufactured between 9 May and 22 November 2018**

Company recall code **97GQ**

Weekly report number **Report-2021-26**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Japan**

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in

**Greece
Croatia
Sweden
Slovenia**

Alert number **[A12/00955/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to improper design, the lead wires in the driver and passenger side door harness could be damaged or cut by the repeated motion of opening and closing the doors. This may cause the curtain and side airbags to not deploy correctly in the event of an accident, increasing the risk of injury.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Suzuki Jimny manufactured from start of production to 02.12.2020**

Brand **Suzuki**

Name **Jimny**

EC-type approval/model **e6*2007/46*0253*00**

Production dates **From start of production to 2 December 2020**

Company recall code **97GN**

Weekly report number **Report-2021-26**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and
measures were taken also in

Greece
Croatia
Sweden
Slovenia

Alert number **[A12/00950/21](#)**

Product **Laser pointer**



Risk type	<p>Damage to sight</p> <p>The laser beam is too powerful. Direct viewing of the laser beam could cause damage to sight.</p> <p>The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 60825-1.</p>
Category	Laser pointers
Type	Consumer
Description	Black laser pointer.
Packaging description	Sold in a dark green and black box. The product was also sold online, in particular via Bol.com.
Brand	Home Travelers
Name	Laserpointer

Type / number of model	0011101 (on website) 303 (on product)
Barcode	7442919515535 (on website) 2950012395701 (on product case)
Weekly report number	Report-2021-26
Alert submitted by	The Netherlands
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Other
Date of entry into force	26/04/2021

Alert number **[A12/00952/21](#)**

Product **Hot water bottle**



Risk type **Burns**

The water bottle can easily corrode, which will cause the hot water to leak, causing burns to the user.

The product does not comply with the requirements of the General Product Safety Directive.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Metal jar with screw cap**

Packaging description **No packaging. The product was also sold online.**

Brand **Label +**

Name **Bedkruik**

Barcode **4054703990102**

Weekly report number **Report-2021-26**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public **Withdrawal of the product from the market**

authorities

Other

Date of entry into force


10/05/2021

Alert number

[A12/00961/21](#)

Product

Wooden toy car

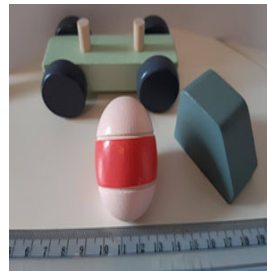

Risk type **Choking**

Small parts (wooden parts and the small ball) may easily detach. A small child may put them in the mouth and choke on them.

The product does not comply with the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Small wooden toy car.**

Packaging description **Toy packed in a plastic bag.**

Brand **Sostrene Grene**

Name **Building truck Rakennustyömaa-auto**

Type / number of model **146864**

Barcode **5711812492338**

Weekly report number **Report-2021-26**

Alert submitted by **Finland**

Is the product counterfeit? **No**

Country of origin	Unknown
Measures ordered by public authorities	Stop of sales Other
Date of entry into force	21/07/2021
Measures taken by economic operators	Recall of the product from end users Manufacturer
Date of entry into force	21/07/2021
Measures taken by economic operators	Withdrawal of the product from the market Manufacturer
Date of entry into force	21/07/2021
Company recall code	- https://press.sostrenegrene.com/recalls/

Alert number **[A12/00951/21](#)**

Product **Hot water bottle**



Risk type **Burns**

The interior of the bottle can easily corrode, causing the hot water to leak and causing burns to the user.

The product does not comply with the requirements of the General Product Safety Directive.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Metal jar with screw cap**

Packaging description **No packaging. The product was also sold online.**

Brand **Bboo**

Name **Bedkruik**

Type / number of model **Art.nr 99000P**

Barcode **4054703990003**

Weekly report number **Report-2021-26**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

Date of entry into force

10/05/2021

Alert number **[A12/00964/21](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The total filtration capacity of the mask is insufficient (measured mean values: as low as 83%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **Black protective respiratory filtration half-face mask. The product is also sold online.**

Packaging description **The product is sold in purple plastic pouches containing 1 item, with a reference to EN 149 and the claims to be FFP2; the product is CE marked.**

Brand **YWSH**

Name **FFP2 Face mask**

Type / number of model **SH-ZK12**

Batch number **202101A**
Production date: 20210120

Weekly report number **Report-2021-26**

Alert submitted by	Belgium
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Importer

Alert number

[A12/00948/21](#)

Product

Set of plastic balls



Risk type

Chemical

The plastic material of the toy contains an excessive amount of diisobutyl phthalate (DIBP) (measured value up to 31,8% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system and/or liver.

The product does not comply with the REACH Regulation.

Category

Toys

Type

Consumer

Description

Set of three inflatable balls made of plastic material.

Packaging description

Net bag.

Brand

Unknown

Name

Sport Toys

Type / number of model

item NO: 8749

Barcode

EAN 5901924019442

Weekly report number

Report-2021-26

Alert submitted by

Poland

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures taken by economic operators

**Withdrawal of the product from the market
Importer**

Date of entry into force

25/05/2021

Measures taken by economic operators

**Destruction of the product
Importer**

Date of entry into force

25/05/2021

Alert number

[A12/00949/21](#)

Product

Self-balancing scooter (hoverboard)



Risk type

**Burns
Electric shock
Fire
Injuries**

The battery does not have a device that monitors the cells temperature, hence it may overheat during charging, and the hoverboard cover may ignite. The product may cause a fire and the user may suffer burns. Furthermore, the dimensions of the socket outlet of battery charger are not suitable. The user could touch the accessible live parts and receive an electric shock. In addition, the power cords, which are exposed to movement between the two motors, are routed through a steel pipe with burr edges at both ends. During the life of the product, the insulation of the power cords can be damaged by the sharp edges, the battery may short-circuit and explode during use. As a result, the user might lose control and fall off the scooter and suffer injuries.

The product does not comply with the requirements of the Low Voltage Directive and of the relevant European standards EN 60335-1, EN 60335-2 and EN 62133-2.

Category

Hobby/sports equipment

Type	Consumer
Description	Black and green self-balancing scooter for use as a personal transport device for persons, with lithium ion battery (25.2V 4.4 Ah), LED lighting with a bluetooth music player and battery charger: CAVON GO
Packaging description	Brown and colourful cardboard box. The product was sold online.
Brand	CAVION
Name	HOVER BOARD
Type / number of model	GO 6.5
Barcode	5 901821 992572
Weekly report number	Report-2021-26
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	02/10/2020
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	02/10/2020

Alert number

[A12/00965/21](#)

Product

Children's fancy dress costume



Risk type

Burns

The fancy dress costume is easily flammable and the flame propagation is too high. If it catches fire, the child could suffer burns.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-2.

Category

Toys

Type

Consumer

Description

Multi-layered, blue tulle skirt with silver crystal decoration, plastic tiara and attachable blonde braided hair.

Packaging description

Transparent plastic bag.

Brand

FunDrag

Name

Artigo para Festa

Type / number of model

REF: 603620

Barcode

6922017603620

Weekly report number

Report-2021-26

Alert submitted by

Hungary

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **03/03/2021**

Measures ordered by public authorities **Recall of the product from end users
Distributor**

Date of entry into force **03/03/2021**