


Alert number

**A12/01047/21**

Product

**Skin lightening cream**

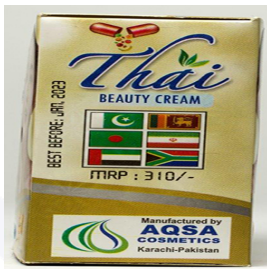

Risk type

**Chemical**

**The product poses a chemical risk because it contains mercury (measured value: 10900 mg/kg). Mercury accumulates in the body and can damage the kidneys, brain and nervous system. Additionally, it may affect reproduction and the unborn child.**

**The product does not comply with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Beauty cream for night use. Removes acne, pimples, dark circles and freckles.**

Packaging description

**Round plastic jar with rectangular cardboard outer box.**

Brand

**AQSA Cosmetics**

Name	<b>Thai Beauty Cream for Night Use</b>
Type / number of model	<b>Best before: December 2021</b>
Barcode	<b>9781855682986</b>
Weekly report number	<b>Report-2021-28</b>
Alert submitted by	<b>Sweden</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Pakistan</b>
Measures ordered by public authorities	<b>Import rejected at border Importer</b>
Date of entry into force	<b>23/11/2020</b>

Alert number

**[A12/01035/21](#)**

Product

**Pressure cooker**



Risk type

**Burns  
Injuries**

**Due to a failure of the security system, the product can open while under pressure and may propel the lid and contents, which would be at a very high temperature. A user can suffer burns or injuries.**

**The product does not comply with the requirements of the Pressure Equipment Directive and the relevant European Standard EN 12778.**

Category

**Kitchen/cooking accessories**

Type

**Consumer**

Description

**Stainless steel pressure cooker 6L.**

Packaging description

**Packaging paper box. The product was sold online.**

Brand

**Unknown**

Name

**Pressure cooker TORO Victoria 6L**

Type / number of model

**270478, Model DSS 2206**

Barcode

**8591177089469**

Weekly report number

**Report-2021-28**

Alert submitted by

**Slovakia**

Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Retailer</b>
Date of entry into force	<b>03/02/2021</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>03/02/2021</b>
Measures ordered by public authorities	<b>Recall of the product from end users Retailer</b>
Date of entry into force	<b>03/02/2021</b>
Company recall code	- <a href="https://www.datart.sk/novinky/sluzby-stiahnutie_vyrobku_nerezovy_hrniec.html">https://www.datart.sk/novinky/sluzby-stiahnutie_vyrobku_nerezovy_hrniec.html</a>

Alert number **[A11/00055/21](#)**

Product **Swing**



Risk type **Entrapment  
Injuries**

**The product has accessible openings and accessible holes, in which children can become trapped or suffer injuries.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-8.**

Category **Toys**

Type **Consumer**

Description **Baby swing made out of wood.**

Brand **Unknown**

Name **Babyswing Captain Babygyngje Kaptajn**

Type / number of model **620966**

Weekly report number **Report-2021-28**

Alert submitted by **Denmark**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Stop of sales  
Other**

Date of entry into force **09/12/2020**



Alert number **[A11/00056/21](#)**

Product **Swing**



Risk type **Entrapment  
Injuries**

**The product has accessible openings and accessible holes, in which children can become trapped or suffer injuries.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-8.**

Category **Toys**

Type **Consumer**

Description **Blue swing. The product was sold online.**

Packaging description **Packed in a green box.**

Brand **Plus**

Name **Swing nest blue/black Plus redegynge Ø98 cm blå/**

Weekly report number **Report-2021-28**

Alert submitted by **Denmark**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **02/12/2020**





Alert number **[A12/01016/21](#)**

Product **Fireworks**



Risk type **Damage to hearing**

**The sound pressure level is too high. Excessive noise levels may cause damage to hearing.**

**The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947-5.**

Category **Pyrotechnic articles**

Type **Consumer**

Description **Bangers, cat. F2, 4 pieces per package.**

Packaging description **Red squared package with grey label and black letters across.**

Brand **Faram Fireworks**

Name **Black Banger**

Type / number of model **0163-F2-2664  
60125  
Black Banger 490  
JX-BNG.490**

Batch number **JX/BNG/E19/0456-1**

Weekly report number **Report-2021-28**

Alert submitted by **Belgium**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Recall of the product from end users  
Importer**

Date of entry into force

**02/06/2021**

Alert number **[A12/01046/21](#)**

Product **Skin lightening cream**



Risk type **Chemical**

**The product poses a chemical risk because it contains mercury (measured value: 12600 mg/kg). Mercury accumulates in the body and can damage the kidneys, brain and nervous system. Additionally, it may affect reproduction and the unborn child.**

**The product does not comply with the Cosmetic Products Regulation**

Category **Cosmetics**

Type **Consumer**

Description **Mfg.Date: 07-2020, Exp.Date: 06-2023**

Packaging description **Round plastic jar in a cardboard outer box.**

Brand **Sheesha**

Name **Sheesha Beauty Cream**

Weekly report number **Report-2021-28**

Alert submitted by **Sweden**

Is the product counterfeit? **Unknown**

Country of origin **Pakistan**

Measures ordered by public authorities

**Import rejected at border  
Importer**

Date of entry into force

**23/11/2020**






Alert number

**A12/01057/21**

Product

**LED lighting chain**

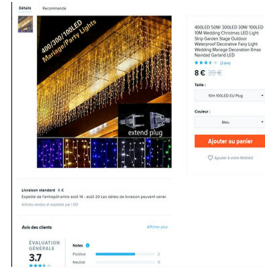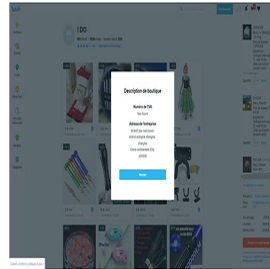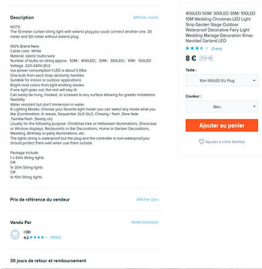

Risk type

**Electric shock**

**The clearance/creepage distances between the primary and accessible secondary circuits of the LEDs are not sufficient, and the product lacks the appropriate insulation of the mains cable, external conductors and LED casings, and against humidity. Accessible parts can become live and the user could receive an electric shock from them. Furthermore, the product's electronic box can be easily opened, the cables are insufficiently anchored and the insulation parts lack dielectric strength. Users have access to live parts of the product and could therefore receive an electric shock when handling it.**

**The product does not comply with the requirements of the Low Voltage Directive and of the relevant European standards EN 60598-2-20 and EN 60598-1.**

Category

**Lighting chains**

Type

**Consumer**

Description

**Fairy string lights, 10 metres in length, with an extension**

**plug to connect another unit. The product was sold online, in particular via Wish.**

Packaging description	<b>Transparent plastic bag</b>
Brand	<b>Unknown</b>
Name	<b>400LED 50M/ 300LED 30M/ 100LED EU 10M Wedding Christmas LED Light Strip Garden Stage Outdoor Waterpr</b>
Type / number of model	<b>EK-04</b>
Batch number	<b>YX00127-10EU-BU 1020-01-L1 2020-01-03</b>
Weekly report number	<b>Report-2021-28</b>
Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Removal of this product listing by the online marketplace Other</b>

---

Alert number **[A12/01032/21](#)**

Product **Mixer for grain**

---

Risk type **Entrapment  
Injuries**

**The devices for stopping the machine when the cover is opened are too easy to override. There is no emergency stop button on this machine and when caught the operator has almost no chance of freeing himself.**

**Directive 2006/42/EC of the European Parliament and of the Council of 17 May 2006 on machinery,**

Category **Machinery**

Type **Professional**

Description **mixer used to mix cereal grains with chemicals but can be used to mix other things**

Brand **Tehnomatik**

Name **Multi-Stream Mixer**

Type / number of model **MS570**

Weekly report number **Report-2021-28**

Alert submitted by **Belgium**

Is the product counterfeit? **Unknown**

Country of origin **Serbia**

Measures taken by economic operators **Withdrawal of the product from the market  
Importer**

Date of entry into force **19/10/2020**

Alert number **[A12/01018/21](#)**

Product **Passenger car**

Risk type **Environment**

**The vehicles concerned are not equipped with the air deflectors normally provided and necessary for the front cooling module. This may lead to CO2 emissions above the regulatory limits.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car, engine 1.2L, code EFC O3S**

Brand **OPEL**

Name **Grandland X**

EC-type approval/model **Type approval numbers: e2\*2007/46\*0597\*11  
e2\*2007/46\*0597\*12 e2\*2007/46\*0597\*13**

Production dates **from 14/08/2019 to 13/09/2019**

Company recall code **21-C-048**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **24/03/2021**



Alert number **[A12/01033/21](#)**

Product **Agricultural tractor**

Risk type **Injuries**

**Possibility for the circlip assembled on the 4-wheel drive clutch to come out of its housing during heavy load application. The consequence, if the stop ring disengages from its groove, is a potential extension of the tractor stopping distance when the tractor speed exceeds 30 km / h.**

Category **Motor vehicles**

Type **Professional**

Description **Agricultural tractor**

Brand **Valtra**

Name **A104, A114, G105, G115, G125E, G135**

EC-type approval/model **Models: A104, A114, G105, G115, G125E, G135  
Type-approval numbers: e17\*167/2013\*00003,  
e17\*167/2013\*00006**

Production dates **From 3.7.2020 to 23.12.2020**

Weekly report number **Report-2021-28**

Alert submitted by **Finland**

Is the product counterfeit? **No**

Country of origin **Finland**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/01042/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The vacuum pump may be damaged by certain materials resulting from chemical corrosion of the timing belt associated with degraded oil. That can lead to reduction or loss of braking assistance, increasing the risk of an accident.**

**The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Citroen**

Name **C3 Picasso (A58), C4 V2 , DS4 (B7), DS3**

EC-type approval/model **e2\*2001/116\*0371\*25, \*26, \*28, \*29  
e2\*2007/46\*0040\*21, \*22 ,\*24 , \*29, \*30  
e2\*2007/46\*0079\*11, \*16, \*17**

Production dates **DS3 from 17/03/2016 to 15/03/2017  
C4 V2 - DS4 (B7) from 16/07/2014 to 08/03/2017  
C3 PICASSO (A58) from 06/09/2014 to 13/03/2017**

Company recall code **HLT**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Slovakia**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **18/06/2021**

Products were found and  
measures were taken also in **Croatia  
Poland**

---

Alert number **[A12/01044/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The ventilation hole of the passenger side airbag is too small, which may result in insufficient deployment of the airbag in the event of activation. Furthermore, the AR suspension arm screws may be lost due to defective heat treatment and the nuts on the anti-roll bar bearings could break due to excessive tightening torque applied. This may impair the control over the vehicle, increasing the risk of an accident.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Citroen**

Name **C5 Aircross**

EC-type approval/model **e2\*2007/46\*0642\*07**

Production dates **The affected vehicles were manufactured between 21 January and 10 March 2020**

Company recall code **HPP**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators

**Recall of the product from end users  
Manufacturer**

Date of entry into force

**29/04/2021**

Alert number **[A12/01048/21](#)**

Product **Wooden toy set**



Risk type **Choking**

**The pieces of the set contain protruding elements. A child may put the pieces into the mouth and the protruding parts could obstruct the airways, causing choking around the pharynx or trachea area.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **The toy consists of a wooden handle with a cord, at the end of which there is small a wooden element with a magnet. The toy set also includes 4 wooden figures with a metal element on the top. The product is also sold online.**

Packaging description **The product is sold in a green cardboard package with a plastic window.**

Brand **HONGJI TOYS**

Name **Funny Board**

Type / number of model **HJD932010E**

Barcode **6939614701116  
6939614705107**

Weekly report number **Report-2021-28**



Alert submitted by	<b>Latvia</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Destruction of the product Retailer</b>
Date of entry into force	<b>25/05/2021</b>
Company recall code	- <a href="https://www.ksenukai.lv/kp/atteikuma-tiesibas/8">https://www.ksenukai.lv/kp/atteikuma-tiesibas/8</a>

Alert number

**[A12/01014/21](#)**

Product

**Particle filter mask**

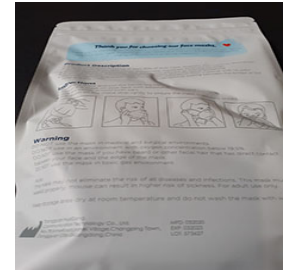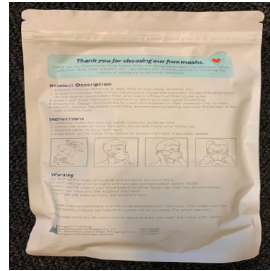

Risk type

**Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as 35%), and the mask does not properly adapt to the face. Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment Regulation and with the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**Protective respiratory filtration half-face mask.**

Packaging description

**The product is sold in a white and blue plastic pouch containing 5 items per packaging. The package indicate the claims FFP2 and KN95 and the CE marking, and makes reference to the European standard EN 149.**



Brand	<b>Unknown</b>
Name	<b>Disposable Face Mask</b>
Type / number of model	<b>D373853</b>
Batch number	<b>573627</b>
Weekly report number	<b>Report-2021-28</b>
Alert submitted by	<b>Belgium</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Importer</b>

Alert number **[A12/01043/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The propellant airbag inflator may experience a material alteration over time due to degradation occurring after prolonged exposure to high absolute humidity, high temperatures and high-temperature cycling. In the event of an airbag being deployed, the excessive internal pressure may cause the inflator body to rupture and metal fragments may pass through the cushion material causing injury to the occupants.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles equipped with TAKATA airbags.**

Brand **CITROEN**

Name **C3 V3; C4 V2 / DS4 (B7); DS3; DS5 (B81)**

EC-type approval/model **e\*KS07/46\*0005\*00, e2\*KS07/46\*0005\*01, e2\*2007/46\*0003\*00, e2\*2007/46\*0003\*40, e2\*2007/46\*0003\*42, e2\*2007/46\*0003\*45, e2\*2007/46\*0040\*02, e2\*2007/46\*0040\*29, e2\*2007/46\*0060\*08, e2\*2007/46\*0060\*09, e2\*2007/46\*0060\*15, e2\*2007/46\*0079\*04, e2\*2007/46\*0079\*05, e2\*2007/46\*0092\*01, e2\*2007/46\*0092\*16, e2\*2007/46\*0156\*01, e2\*KS07/46\*0004\*00, e2\*KS07/46\*0004\*03, e2\*KS07/46\*0004\*09**

Production dates **DS3 from 14/10/2009 to 09/02/2017  
C4 V2 - DS4 (B7) from 29/09/2010 to 10/02/2017  
C3 V3 (A51) from 02/09/2009 to 10/02/2017  
C4 V2 - DS4 (B7) AMLAT from 26/04/2012 to 12/04/2017  
DS5 (B81) from 21/11/2011 to 17/02/2017**

Company recall code **GYB  
GYC  
GYD**

Weekly report number	<b>Report-2021-28</b>
Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>France</b>
Measures taken by economic operators	<b>Recall of the product from end users Manufacturer</b>
Date of entry into force	<b>16/09/2020</b>

Alert number **[A12/01028/21](#)**

Product **Passenger car**

Risk type **Fire**

**The electrodes of the traction batteries may be incorrectly aligned. This could result in a short circuit between the electrodes and lead to a thermal runaway of the battery, causing it to emit toxic smoke without flame.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **Grandland X**

EC-type approval/model **e2\*2007/46\*0597\*11**

Production dates **The affected vehicles were manufactured between 10 and 27 December 2019.**

Company recall code **20-C-168**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **04/12/2020**

Alert number **[A12/01052/21](#)**

Product **Tyre for passenger car**

Risk type **Injuries**

**Hernias or tears may develop on the shoulder of the tyre due to variations in production which may result in an over-thickness of the stuffing on the rod, or from a problem with the end of the overlapping layers due to the specifications of the width of the layers, as air bubbles may form during manufacture. This could lead to a loss of inflation pressure and a potential failure of the tyre, which may interfere with the steering or driving of the vehicle, increasing the risk of accident.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Spare tyre**

Brand **cooper**

Name **DISCOVERER AT3 4S, 275/55R20 and 275/65R18**

EC-type approval/model **275/55R20 0518--1218 1518--1818 2418--3119 3319--3619 4219--4419 275/65R18 2218--3018 3618--4418 0219--1019 1319--3219 3619--411**

Production dates **from 01.02.2018 to 01.12.2019.**

Company recall code **178**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators

**Recall of the product from end users  
Distributor**

Date of entry into force

**25/03/2021**

Company recall code

- <https://www.coopertire.co.uk/recalls/178/france.pdf>

Alert number **[A12/01029/21](#)**

Product **Passenger car**

Risk type **Fire**

**Certain cells of the traction batteries may be missing an anode. This could result in a short circuit and lead to a thermal runaway of the battery, causing it to emit toxic smoke without flame.**

**The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **DS automobiles**

Name **DS7 CROSSBACK E-TENSE**

EC-type approval/model **e2\*2007/46\*0601\*08**

Production dates **The affected vehicles were manufactured between 9 October 12 December 2019.**

Company recall code **HKW**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **01/12/2020**

Alert number **[A12/01030/21](#)**

Product **Passenger car**

Risk type **Fire**

**Certain cells of the traction batteries may be missing an anode. This could result in a short circuit and lead to a thermal runaway of the battery, causing it to emit toxic smoke without flame.**

**The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **Grandland X**

EC-type approval/model **e2\*2007/46\*0597\*11**

Production dates **The affected vehicles were manufactured between 23 October and 6 November 2019.**

Company recall code **20-C-180**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **04/12/2020**



Alert number **[A11/00052/21](#)**

Product **Passenger car**

Risk type **Fire**

**An internal short-circuit may occur in the lithium-ion battery. This could increase the risk of fire.**

**The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Electric passenger car.**

Brand **HYUNDAI**

Name **KONA EV, IONIQ EV**

EC-type approval/model **e4\*2007/46\*1157\*; Type: AEB5E11E11CZ1 (28kW)  
e4\*2007/46\*1259\*, Types: OSF5E11E11B11 -  
OSF5E11E11D11 - OSF5E21E11B11 - OSF5E21E11D11**

Production dates **4 May 2018 - 2 March 2020**

Company recall code **11EVTEMP - 11D043**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **01/07/2021**

Products were found and  
measures were taken also in

## **Croatia**

Alert number

**[A12/01026/21](#)**

Product

**Motorcycle helmet**



Risk type

**Injuries**

**The impact absorption capacity of the helmet is insufficient. In the event of an impact, users may suffer head injuries.**

**The product does not comply with the requirements of the Regulation ECE 22-05.**

Category

**Protective equipment**

Type

**Consumer**

Description

**Full motorcycle helmet with a visor. The product is also sold online.**

Packaging description

**The product is sold in a brown cardboard box.**

Brand

**Biltwell**

Name

**Gringo S DOT**

Type / number of model	<b>1002-201</b>
Batch number	<b>P-6070 (S) P-6011 (M) P-6013 (XXL)</b>
Weekly report number	<b>Report-2021-28</b>
Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Unknown</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>

Alert number **[A12/01031/21](#)**

Product **Passenger car**

Risk type **Fire**

**The electrodes of the traction batteries may be incorrectly aligned. This could result in a short circuit between the electrodes and lead to a thermal runaway of the battery, causing it to emit toxic smoke without flame.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **DS**

Name **DS7 CROSSBACK E-TENSE**

EC-type approval/model **e2\*2007/46\*0601\*08, e2\*2007/46\*0601\*09**

Production dates **The affected vehicles were manufactured between 9 October and 12 December 2019.**

Company recall code **HJW**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **07/12/2020**

Alert number **[A11/00057/21](#)**

Product **Passenger car**

Risk type **Environment**

**In some vehicles, under certain driving conditions, the urea injector may block when the engine is turned off, meaning that no urea will be injected when the car is started up again. This blockage is temporary, and the injector will start working normally again after 12 minutes' driving. This may lead to Nitrogen Oxides (NOx) emissions above the regulatory limits.**

**The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car, vehicles with DV5R [D15DTH / EFC LQP] engine**

Brand **OPEL**

Name **Grandland X**

EC-type approval/model **Type-approval numbers: e2\*2007/46\*0597\*09, e2\*2007/46\*0597\*11, e2\*2007/46\*0597\*13, e2\*2007/46\*0597\*14, e2\*2007/46\*0597\*15, e2\*2007/46\*0597\*16**

Production dates **from 01/10/2019 to 16/03/2020**

Company recall code **20-N-126**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators

**Recall of the product from end users  
Manufacturer**

Date of entry into force

**13/10/2020**

Products were found and measures were taken also in

**Germany  
Croatia**

---

Alert number **[A12/01023/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The window airbags may be defective and could be damaged and not deploy as intended when they are activated. As a result, the protective effect of the airbags could be impaired, increasing the risk of injury in the event of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 247.**

Brand **Mercedes-Benz**

Name **GLB**

EC-type approval/model **e1\*2007/46\*1909\*03, Type: F2B**

Production dates **The affected vehicles were manufactured between 22 April and 28 June 2019.**

Company recall code **9192162**

Weekly report number **Report-2021-28**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**



Alert number **[A12/01053/21](#)**

Product **Children's raincoat**



Risk type	<b>Strangulation</b>
	<b>The product has drawstrings with free ends in the hood. These can become trapped during children's normal activities, resulting in strangulation.</b>
	<b>The product does not comply with the General Product Safety Directive and with the relevant European standard EN 14682.</b>
Category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Description	<b>PVC raincoat, wrapped in a plastic bag with clip closure, with a piece of cardboard printed with an illustration of the product inside.</b>
Packaging description	<b>Wrapped in a plastic bag with clip closure, with a piece of cardboard printed with an illustration of the product inside.</b>
Brand	<b>D&amp;D</b>
Name	<b>Impermeabile per bambino</b>
Type / number of model	<b>DD-006</b>
Barcode	<b>6910023270622</b>
Weekly report number	<b>Report-2021-28</b>
Alert submitted by	<b>Italy</b>

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Importer**

Date of entry into force

**20/02/2020**

---

Alert number **[A12/01027/21](#)**

Product **Passenger car**

---

Risk type **Fire**

**The engine block may crack. This could lead to engine failure, increasing the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Porsche**

Name **Cayenne**

EC-type approval/model **e13\*2007/46\*0900\*11; Types: 9YA**

Production dates **The affected vehicles were manufactured between 28 September 7 December 2020.**

Company recall code **AMB1**

Weekly report number **Report-2021-28**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

---

Alert number **[INFO/00140/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**Stress corrosion cracking may result in increased play between the axle tie rod and the wheel carrier. This could impair the vehicle handling.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Porsche**

Name **Cayenne**

EC-type approval/model **e13\*2007/46\*0900\*11; Types: 9YA, 9YB**

Production dates **The affected vehicles were manufactured between 16 September and 31 October 2020.**

Company recall code **AMA9**

Weekly report number **Report-2021-28**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France  
Greece  
Poland**

Alert number **[A12/01034/21](#)**

Product **Fireworks**



Corrigendum **A12/01034/21: correction of typos in the notification.**

Risk type **Injuries**

**The product is incorrectly labelled, despite the fact that pyrotechnic articles are subject to specific measures for such a use. A consumer using the fireworks for amusement purposes can get injured.**

**The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 16263.**

Category **Pyrotechnic articles**

Type **Consumer**

Description **Soundemitter, category P1, 100 pieces per package (divided in 10 separate packages with 10 pieces each).**

Packaging description **Red square package with yellow/blue label and green letters across.**

Brand **Funke China**

Name **Shising crackers**

Type / number of model **1646-P1-157-020-51  
450BE  
DJF Thunder**

Weekly report number **Report-2021-28**

Alert submitted by	<b>Belgium</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Hong Kong</b>
Measures ordered by public authorities	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>09/06/2021</b>

Alert number **[A12/01021/21](#)**

Product **Quadricycle**

Risk type **Fire**

**If the vehicles are used in snow without the continuously variable transmission (CVT) air intake having been relocated, the stock CVT air intake may become completely obstructed by snow. As a result, the drive belt could overheat, break into pieces and start a fire in the CVT enclosure.**

**The product does not meet the requirements laid down in the Regulation on the type-approval and market surveillance of two- or three-wheel vehicles and quadricycles.**

Category **Motor vehicles**

Type **Consumer**

Description **Quadricycle modified with a track kit. Each vehicle has a unique serial number.**

Brand **can-AM**

Name **Can-Am Traxter**

Production dates **The affected vehicles were manufactured on 1 February 2019.**

Company recall code **2021-7**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Mexico**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **17/06/2021**

Company recall code

- <https://can-am.brp.com/off-road/fr/fr/proprietaires/rappels-de-securite.html>



Alert number **[A12/01024/21](#)**

Product **Earrings**



Risk type **Chemical**

**The product releases an excessive amount of nickel (measured value 0,404 µg/cm<sup>2</sup>/week). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Round earrings in gold design.**

Packaging description **Transparent plastic bag marked with a white paper label with the text Stainless-steel.**

Brand **Unknown**

Name **Stainless steel**

Type / number of model **JE01008A**

Batch number **0209D05**

Weekly report number **Report-2021-28**

Alert submitted by **Slovakia**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities


**Import rejected at border  
Importer**

Date of entry into force

**28/06/2021**

Alert number **[A12/01022/21](#)**

Product **carnival mask**

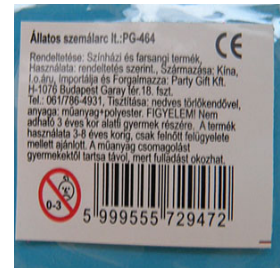

Risk type **Burns**

**The mask is easily flammable and the flame propagation is too high. If it catches fire, the child could suffer burns.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-2.**

Category **Toys**

Type **Consumer**

Description **Plastic, sparkling bunny-shaped eye mask. The mask can be fixed on the head with a rubber band.**

Packaging description **Packaging: a transparent plastic bag.**

Brand **Printgo Party**

Name **Állatos szemálarc**

Type / number of model **It.:PG-464**

Barcode **5999555729472**

Weekly report number **Report-2021-28**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>12/05/2021</b>
Measures ordered by public authorities	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>12/05/2021</b>

Alert number **[A11/00053/21](#)**

Product **USB charger**



Risk type **Electric shock**

**The insulation of the product is inadequate. The user could receive an electric shock from accessible (live) parts.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant standard EN IEC 62368.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Black battery charger with 1 USB port.**

Packaging description **Packaging: cardboard box**

Brand **SBS**

Name **Travel charger**

Type / number of model **37386 / TETR1USB1ASTD**

Barcode	<b>801 841 723 7386</b>
Weekly report number	<b>Report-2021-28</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Distributor</b>
Date of entry into force	<b>16/06/2021</b>

Alert number **[A12/01025/21](#)**

Product **Plastic doll**



Risk type **Chemical**

**The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 23,7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Plastic doll.**

Packaging description **Cardboard box with plastic window.**

Brand **Unknown**

Name **Ice Princess**

Type / number of model **Nr 378625**

Batch number **1908**

Barcode **EAN 5057621786252**

Weekly report number **Report-2021-28**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **United Kingdom**

Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

Date of entry into force **27/05/2021**

Measures taken by economic operators **Destruction of the product  
Distributor**

Date of entry into force **27/05/2021**



Alert number **[A11/00054/21](#)**

Product **USB charger**



Risk type **Electric shock**

**The insulation of the product is inadequate. The user could receive an electric shock from accessible (live) parts.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant standard EN IEC 62368.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Black battery charger with 1 USB port.**

Packaging description **Packaging: blister**

Brand **BOROFONE**

Name **USB TRAVEL CHARGER**

Type / number of model **BA20A**

Barcode **6 931474 702081**

Weekly report number **Report-2021-28**

Alert submitted by **Hungary**

Is the product counterfeit? **No**

Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>25/06/2021</b>
Products were found and measures were taken also in	<b>Lithuania</b>

---

Alert number **[A12/01056/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The fastening elements that secure the brake calipers to the stub axles may not have been tightened to the correct torque. As a result, the movement of the wheels can be restricted and subsequently the tyres may lose pressure, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Tesla**

Name **Model 3, Model Y**

EC-type approval/model **e4\*2007/46\*1293\*00-15; Type: 003**

Production dates **The affected vehicles were manufactured between 16 December 2018 and 17 January 2021.**

Company recall code **SB-21-33-002**

Weekly report number **Report-2021-28**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code **- <https://www.tesla.com/vin-recall-search>**

---

Alert number **[A12/01054/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The seat belt mounts may be defective. This could result in increased risk of injury in the event of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Tesla**

Name **Model 3, Model Y**

EC-type approval/model **e4\*2007/46\*1293; Type: 003**

Production dates **The affected vehicles were manufactured between 6 July 2018 and 21 March 2020.**

Company recall code **SB-21-20-001**

Weekly report number **Report-2021-28**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<https://www.tesla.com/vin-recall-search>**

---

Alert number **[A12/01055/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The ABS (anti-lock braking system) control unit may be defective. This could result in reduced ABS/ESC (electronic stability control) function, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Fiat**

Name **Doblo**

EC-type approval/model **e3\*2007/46\*0002\*46; Type: 263**

Production dates **The affected vehicles were manufactured between 6 June and 28 December 2020.**

Company recall code **6325**

Weekly report number **Report-2021-28**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/01051/21](#)**

Product **Adaptor**



Risk type	<p><b>Burns</b> <b>Electric shock</b></p> <p><b>The rivet connections are inadequate. As a results, live parts remain accessible when the product is plugged to a mains socket. A user might touch them and receive an electric shock. The product is not sufficiently protected against overload. Consequently, it could overheat during normal use, increasing the risk of burns.</b></p> <p><b>The product does not comply with the relevant standards IEC 60884-1 and IEC 60844-2-5.</b></p>
Category	<b>Electrical appliances and equipment</b>
Type	<b>Consumer</b>
Description	<b>Adaptor / plug coupler with three sockets, 16A 250V~ in white colour.</b>
Packaging description	<b>Transparent plastic packaging.</b>
Brand	<b>SPIN electrice</b>
Name	<b>Adaptor / plug coupler with three sockets</b>
Type / number of model	<b>SPN2304</b>
Barcode	<b>5 949054 909264</b>
Weekly report number	<b>Report-2021-28</b>

Alert submitted by	<b>Bulgaria</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>25/06/2021</b>

Alert number **[A12/01049/21](#)**

Product **Fireworks**



Corrigendum **A12/01049/21: correction of typos in the notification.**

Risk type **Injuries**

**The product is incorrectly labelled, despite the fact that pyrotechnic articles are subject to specific measures for such a use. A consumer using the fireworks for amusement purposes can get injured.**

**The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 16263**

Category **Pyrotechnic articles**

Type **Consumer**

Description **Fireworks as a flash device, category P1, 20 pieces per package.**

Packaging description **The product is sold in a square package with green, white and red colours, black lettering across and a buffalo head depicted.**

Brand **Bufalo**

Name **Zanzara**

Type / number of model **0163-P1-5178  
5100**

Weekly report number **Report-2021-28**



Alert submitted by	<b>Belgium</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Albania</b>
Measures ordered by public authorities	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>09/06/2021</b>

Alert number **[A12/01050/21](#)**

Product **Fireworks**



Corrigendum **A12/01050/21: correction of typos in the notification.**

Risk type **Injuries**

**The product is incorrectly labelled, despite the fact that pyrotechnic articles are subject to specific measures for such a use. A consumer using the fireworks for amusement purposes can get injured.**

**The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 16263.**

Category **Pyrotechnic articles**

Type **Consumer**

Description **Fireworks as a flash device, category P1, 10 pieces per package.**

Packaging description **The product is sold in a square package with green, white and red colours, black lettering across and a buffalo head depicted.**

Brand **Bufalo**

Name **Vespa**

Type / number of model **0163-P1-5178  
5101**

Weekly report number **Report-2021-28**

Alert submitted by	<b>Belgium</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Albania</b>
Measures ordered by public authorities	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>09/06/2021</b>

---

Alert number	<b><u><a href="#">A12/01045/21</a></u></b>
Product	<b>Pull-along rattle toy</b>

---



Risk type	<b>Chemical Damage to hearing</b>  <b>The plastic of the product contains an excessive amount of polycyclic aromatic hydrocarbons (PAHs), notably benzo[a]anthracene (BaA)(measured value up to: 1 mg/kg by weight). This PAH may cause cancer. Furthermore, the sound pressure level is too high (measured value: 87 dB). This could lead to temporary / permanent loss of hearing, when the product is used.</b>  <b>The product does not comply with the REACH Regulation and the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.</b>
Category	<b>Toys</b>
Type	<b>Consumer</b>
Description	<b>Two rattles in the form of pull-along plastic ducks. The product was also sold online, in particular, via Wish.com</b>
Packaging description	<b>Transparent plastic bag.</b>
Brand	<b>Unknown</b>
Name	<b>Baby rattles Pull rope animal</b>
Weekly report number	<b>Report-2021-28</b>
Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>Unknown</b>

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Removal of this product listing by the online marketplace  
Other**

Date of entry into force

**21/11/2020**

Alert number **[A12/01036/21](#)**

Product **Interactive soft toy**



Risk type **Burns**

**The surface of the battery compartment can overheat. This can lead to a risk of burns for children.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1 and EN 62115.**

Category **Toys**

Type **Professional**

Description **White cat with orange stripes on its back. Battery operated. The product was sold online.**

Brand **Unknown**

Weekly report number **Report-2021-28**

Alert submitted by **France**



Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Removal of this product listing by the online marketplace  
Other**

Alert number **[A12/01019/21](#)**

Product **Soft toy**

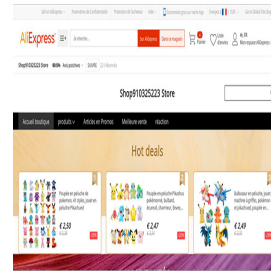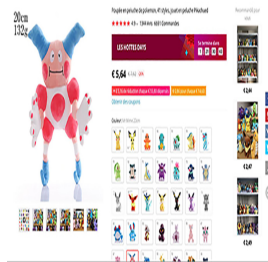

Risk type **Choking  
Suffocation**

**Small parts may easily detach from the toy. The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. A small child may put small parts or the stuffing material in the mouth and choke on them.**

**The product does not comply with the regulations on the safety of toys and standard EN 71-1.**

Category **Toys**

Type **Professional**

Description **Colourful Pokemon soft toy Mr Mime 20cm. The product was also sold online, in particular, via AliExpress**

Brand **Unknown**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**



Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

Alert number

**[A12/01037/21](#)**

Product

**Smoke detector/alarm**

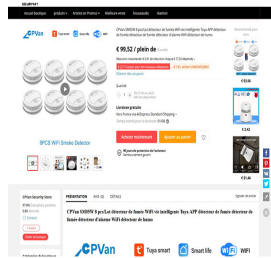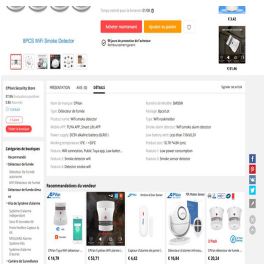

Risk type

**Asphyxiation  
Burns  
Fire**

**The smoke detector does not have sufficient sensitivity. Furthermore, its sound power is too low (measured values: as low as 80 dB). As a result, it cannot perform its function, hence letting fire to develop; if a fire breaks out, the product may fail to generate an alarm signal, causing a risk of asphyxiation and burns to the occupants of the building.**

**The product does not comply with the Construction Products Regulation and with the relevant European standard EN 14604.**

Category

**Construction products**

Type

**Consumer**

Description

**Self-contained smoke detector/alarm for household use. The product was sold online, in particular on AliExpress, without CE marking.**

Packaging description

**The product is sold in a cardboard packaging containing 8 items, with no text on it.**

Brand

**CP Van**

Name

**WiFi smoke detector**

Type / number of model

**SM05W**

Weekly report number

**Report-2021-28**




Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Manufacturer</b>
Measures ordered by public authorities	<b>Removal of this product listing by the online marketplace Distributor</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Manufacturer</b>

Alert number

**[A12/01017/21](#)**

Product

**Giraffe soft toy**

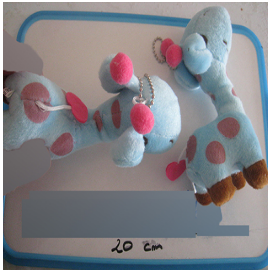

Risk type

**Choking**

**A small element (chain) can detach. A small child may put it in the mouth and choke on it.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category

**Toys**

Type

**Professional**

Description

**Small giraffe soft toy, with brown eyes, spots and hoofs, on a yellow, blue, green or pink background. A small chain is present at the top of the head. The product was sold online, in particular via Wish.**

Brand

**Unknown**

Weekly report number

**Report-2021-28**

Alert submitted by

**France**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators




**Removal of this product listing by the online marketplace  
Other**

Alert number

**A12/01038/21**

Product

**Smoke detector**

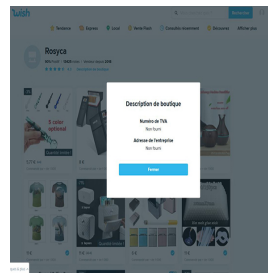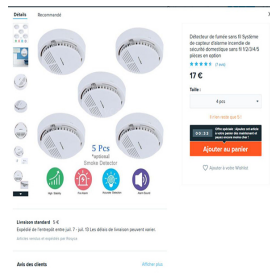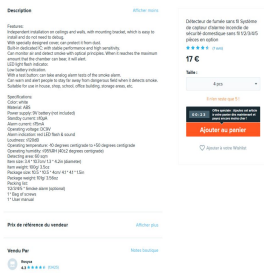

Risk type

**Asphyxiation  
Burns  
Fire**

**The product does not detect smoke; furthermore, its sound power is too low (measured values: as low as 68,9 dB). As a result, it cannot perform its function, hence letting fire to develop; if a fire breaks out, the product may fail to generate an alarm signal, causing a risk of asphyxiation and burns to the occupants of the building.**

**The product does not comply with the Construction Products Regulation and with the relevant European standard EN 14604.**

Category

**Construction products**

Type

**Consumer**

Description

**Wireless self-contained smoke detector. The product was sold online, in particular via Wish.**

Packaging description

**The product is sold in a white cardboard box, containing up to 5 items.**

Brand

**Unknown**

Name

**K-MOON**

Type / number of model

**H9487**

Weekly report number

**Report-2021-28**



Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Removal of this product listing by the online marketplace Other</b>

Alert number

**[A12/01039/21](#)**

Product

**Smoke detector**

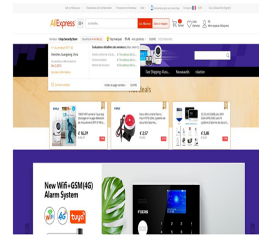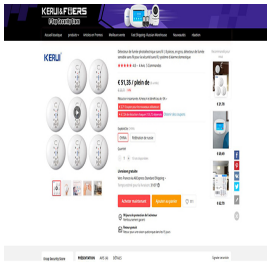

Risk type

**Asphyxiation  
Burns  
Fire**

**The smoke detector does not have sufficient sensitivity. Furthermore, its sound power is too low (measured values: as low as 76,5 dB). As a result, it cannot perform its function, hence letting fire to develop; if a fire breaks out, the product may fail to generate an alarm signal, causing a risk of asphyxiation and burns to the occupants of the building.**

**The product does not comply with the Construction Products Regulation and with the relevant European standard EN 14604.**

Category

**Construction products**

Type

**Consumer**

Description

**Wireless self-contained smoke detector. The product was sold online, in particular via AliExpress.**

Packaging description

**Blue cardboard packaging with the word 'detector' written on top.**

Brand

**KERUI & FUERS  
KERUI and FUERS**

Name

**KERUI**

Type / number of model

**433M/1527**

Weekly report number

**Report-2021-28**




Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Removal of this product listing by the online marketplace Other</b>

Alert number

**A12/01040/21**

Product

**Smoke detector**

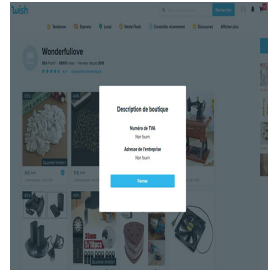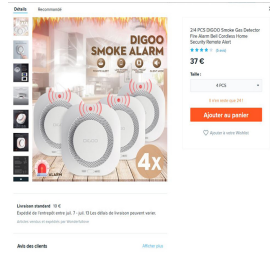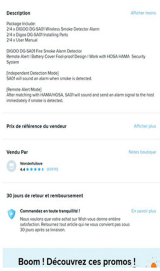

Risk type

**Asphyxiation  
Burns  
Fire**

**The product does not detect smoke; furthermore, its sound power is too low (measured values: as low as 60 dB). As a result, it cannot perform its function, hence letting fire to develop; if a fire breaks out, the product may fail to generate an alarm signal, causing a risk of asphyxiation and burns to the occupants of the building.**

**The product does not comply with the Construction Products Regulation and with the relevant European standard EN 14604.**

Category

**Construction products**

Type

**Consumer**

Description

**Wireless self-contained smoke detector. The product was sold online, in particular via Wish.**

Packaging description

**The product is sold in a cardboard packaging.**

Brand

**DIGOO**

Name

**2/4 Pcs DIGOO Smoke Gas Detector Fire Alarm Bell Cordless Home Security Remote Alert**

Type / number of model

**DG SA01**

Weekly report number

**Report-2021-28**

Alert submitted by	<b>France</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Removal of this product listing by the online marketplace Other</b>





Alert number

**A12/01041/21**

Product

**Smoke detector**

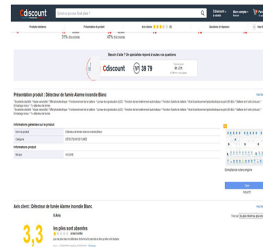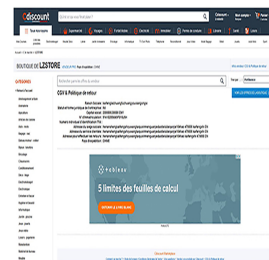

Risk type

**Asphyxiation  
Burns  
Fire**

**The product does not detect smoke; furthermore, its sound power is too low (measured values: as low as 64,9 dB). As a result, it cannot perform its function, hence letting fire to develop; if a fire breaks out, the product may fail to generate an alarm signal, causing a risk of asphyxiation and burns to the occupants of the building.**

**The product does not comply with the Construction Products Regulation and with the relevant European standard EN 14604.**

Category

**Construction products**

Type

**Consumer**

Description

**White wireless self-contained smoke detector. The product was sold online, in particular via CDiscount.**

Packaging description

**The product is sold in a cardboard packaging**

Brand

**Unknown**

Name

**Général Purpose**

Weekly report number

**Report-2021-28**

Alert submitted by

**France**

Is the product counterfeit?

**No**

Country of origin




**People's Republic of China**

Measures ordered by public  
authorities

**Removal of this product listing by the online marketplace  
Other**

Alert number **[A12/01015/21](#)**

Product **Jewellery set**

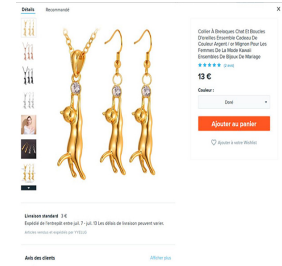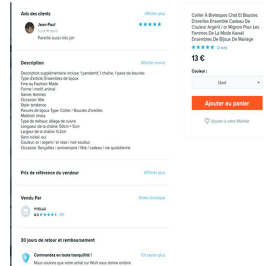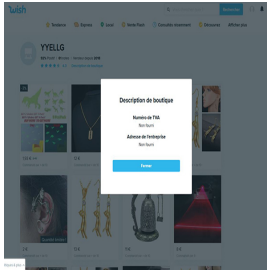

Risk type **Chemical**

**The necklace releases an excessive amount of nickel (measured value up to 0.19 µg/cm<sup>2</sup>/week). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Golden necklace with a cat-shaped pendant from a set comprising a necklace and a matching pair of earrings. The product was also sold online, in particular via Wish.**

Packaging description **The product is sold packaged in individual bags.**

Brand **Unknown**

Name **Collier À Breloques Chat Et Boucles Résultats pour "bijoux sans nickel" Voir le panier D'oreilles**

Weekly report number **Report-2021-28**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin

**Unknown**

Measures taken by economic operators

**Withdrawal of the product from the market  
Other**