

Alert number **[A12/01164/21](#)**

Product **Glue**



Risk type **Chemical**

**The glue contains an excessive amount of toluene (measured values: 2.92% by weight). Toluene is neurotoxic, if inhaled or in contact with the skin, and might also affect the unborn child.**

**The product does not comply with the REACH Regulation.**

Category **Chemical products**

Type **Consumer**

Description **Glue is in a 2 g red tube.**

Packaging description **Product is packed in paper-plastic packaging, marked with the manufacturer's information in Polish and Russian, additional packaging marked with information in the official language.**

Brand **Inter Globus**

Name **Inter Globus CYJANOAKRYLAN SZTYWNY**

Barcode **5906197589654**

Weekly report number **Report-2021-31**

Alert submitted by **Lithuania**

Is the product counterfeit? **No**

Country of origin **Poland**

Measures ordered by public authorities **Withdrawal of the product from the market  
Distributor**

Date of entry into force **09/07/2021**

Alert number

**A12/01156/21**

Product

**Toy make-up set**



Risk type

**Chemical**

**According to the ingredient list, the make-up does not contain authorised Chromium (III) based colourants, but contains chromium (measured value up to: 6.8 mg/kg), which is forbidden in cosmetic products. Chromium can be sensitising, trigger allergic reactions and could cause cancer.**

**The product does not comply with the requirements of the Toy Safety Directive and with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Make-up set consisting of a plastic palette with shadows in different colours and two application brushes, intended for children.**

Packaging description

**The product is sold in a pink cardboard box with a transparent plastic window at its front.**

Brand

**Migliorati**

Name

**Sei BELLA Make-up set**

Type / number of model

**Ref. A307**

Batch number

**202030710**



Weekly report number	<b>Report-2021-31</b>
Alert submitted by	<b>Italy</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Import rejected at border Importer</b>
Date of entry into force	<b>30/06/2021</b>

Alert number

**[A12/01168/21](#)**

Product

**Eyelash serum**

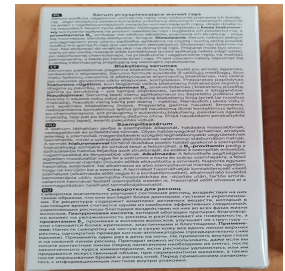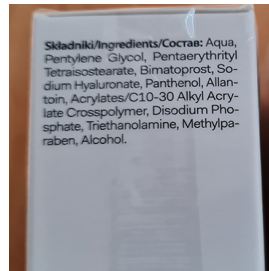

Risk type

**Chemical**

**According to the list of ingredients, the product contains the active substance bimatoprost, which should be used under supervision of an ophthalmologist. Use of the product could result in ocular and ophthalmic side-effects and it should not be used by pregnant and breastfeeding women, as it may affect the child.**

**The product does not comply with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**3 ml of liquid serum advertised as having an eyelash growth effect.**

Packaging description

**The product is packaged in a glass ampoule, inside a white cardboard box, and was also sold online.**

Brand

**OCEANIC**

Name	<b>4 LONG LASHES; SERUM PRZYSPIESZAJACE WZROST RZES / EYELASH SERUM</b>
Weekly report number	<b>Report-2021-31</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Poland</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Distributor</b>
Date of entry into force	<b>09/07/2021</b>

Alert number **[A12/01163/21](#)**

Product **Hiking sandals**



Risk type **Chemical**

**The amount of chromium (VI) in the leather is too high (measured value up to 28 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions.**

**The product does not comply with the REACH Regulation.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Hiking sandals with grey leather insole. The upper part is made of lilac-coloured leather.**

Packaging description **Unpackaged sample with original labelling.**

Brand **Crane**

Name **Trekkingsandalen für Damen**

Type / number of model **Model 2**

Barcode **4088500563245**

Weekly report number **Report-2021-31**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Destruction of the product  
Importer**

Date of entry into force

**16/07/2021**

Measures taken by economic operators

**Recall of the product from end users  
Importer**


Date of entry into force

**16/07/2021**



Alert number **[A12/01152/21](#)**

Product **Children's cot**

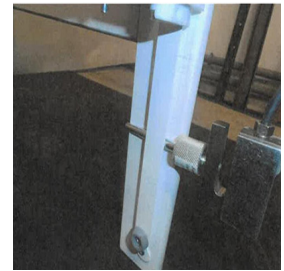

Risk type **Injuries**

**The locking mechanism of the drop side may not work properly and the distance between the floor and the drop side in its lowest position is too small. This may cause injuries to children playing next to the bed unattended.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 716-1.**

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **White wooden cot with pull-out side. The product is sold online.**

Packaging description **Paper box.**

Brand **DREWEX® Meble dla dzieci**

Name **Cot Olek white**

Type / number of model **ID: 25671**

Barcode **5902622000046**

Weekly report number **Report-2021-31**

Alert submitted by **Slovakia**

Is the product counterfeit?

**No**

Country of origin

**Poland**

Measures ordered by public authorities

**Recall of the product from end users  
Retailer**

Date of entry into force

**10/06/2021**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Retailer**

Date of entry into force



**10/06/2021**

Alert number

**[A12/01159/21](#)**

Product

**Particle filter mask**

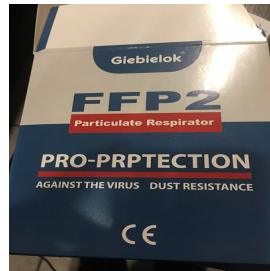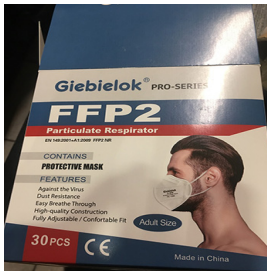

Risk type

**Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as 60%) and the total filtration capacity of the mask is insufficient (measured mean values: as low as 69%). Furthermore, the mask does not properly adapt to the face. Consequently, the product does not fulfil the health and safety requirements, and an excessive amount of particles or microorganisms might pass through the mask; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**White particle filter with the brand, model and claim FFP2/EN 149 printed on it, as well as with the CE 1282 marking.**

Packaging description

**The product is sold in a white/blue cardboard box with the following information: Giebielok® PRO - SERIES; FFP2 Particulate Respirator; Adult Size. The product is packed in boxes of 30 pieces; 6 pieces in cellophane package.**

Brand

**Giebielok®**

Name

**Particulate Respirator FFP2 PRO - SERIES**

**FL0616**

Type / number of model	
Weekly report number	<b>Report-2021-31</b>
Alert submitted by	<b>Slovakia</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Importer</b>
Date of entry into force	<b>25/05/2021</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>25/05/2021</b>
Measures ordered by public authorities	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>25/05/2021</b>

Alert number

**[A12/01173/21](#)**

Product

**Particle filter mask**



Risk type

**Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as 61%) and the total filtration capacity of the mask is insufficient (measured mean values: as low as 74.5%). Furthermore, the mask does not properly adapt to the face. Consequently, the product does not fulfil the health and safety requirements, and an excessive amount of particles or microorganisms might pass through the mask; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**White particle filter mask with the brand/name, model and claim FFP2/EN 149 printed on it, as well as with the CE 202003 marking. The product is also sold online.**

Packaging description

**The product is packed in 5 pieces in a white-blue plastic bag.**

Brand

**Huizhou LexusLance Technology  
LexusLance**

Name

**Particulate Respirator FFP2 Lexuslance**

Type / number of model

**LK-003**

Batch number	<b>2402708</b>
Barcode	<b>8595243843078</b>
Weekly report number	<b>Report-2021-31</b>
Alert submitted by	<b>Slovakia</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>27/05/2021</b>
Measures ordered by public authorities	<b>Recall of the product from end users Retailer</b>
Date of entry into force	<b>27/05/2021</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Retailer</b>
Date of entry into force	<b>27/05/2021</b>
Company recall code	- <a href="https://blog.mall.sk/mall-sk/dolezite-upozornenie-pre-nasich-zakaznikov-nebezpecny-respirator-filtracna-polmaska-ffp2-nr-lexuslance-lk-003-988.html">https://blog.mall.sk/mall-sk/dolezite-upozornenie-pre-nasich-zakaznikov-nebezpecny-respirator-filtracna-polmaska-ffp2-nr-lexuslance-lk-003-988.html</a>

---

Alert number **[A12/01154/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The wishbone screw on the cradle may not be properly tightened. This could cause loss of stability, resulting in loss of control over the vehicle.**

**The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **MOKKA**

EC-type approval/model **e2\*2007/46\*0639\*12**

Production dates **The affected vehicles were manufactured between 8 and 19 February 2021.**

Company recall code **21-C-104**

Weekly report number **Report-2021-31**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **28/06/2021**

Alert number **[A12/01158/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

**The reaction ring in the internal mechanism of the rear right-hand parking brake calliper may break during operation of the parking brake. As a result, the parking brake's braking effect may be lost, increasing the risk of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **Renault**

Name **Master**

EC-type approval/model **Types: MF, VF, VG  
e2\*2007/46\*0023\*41, \*42; e2\*2007/46\*0051\*36;  
e2\*2007/46\*0053\*40, \*41**

Production dates **The affected vehicles were manufactured between May and July 2021.**

Company recall code **C0173**

Weekly report number **Report-2021-31**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**



Alert number **[A12/01157/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The programming of the Pre-Collision System (PCS) feature may be improper, which could cause the application of the pre-crash brake assist function to be delayed. This can result in less overall vehicle speed reduction than designed, increasing the risk of injury.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Model (Frame Code): Prius (ZVW50, ZVW55); VIN Range (Frame Code): KB3FU#03094121 - 03095447 (ZVW50), L93FU#03022600 - 03031244 (ZVW55); Model Year: 2021.**

Brand **Toyota**

Name **Prius**

EC-type approval/model **e6\*2007/46\*0339\*05**

Production dates **The affected vehicles were manufactured between 1 July 2020 and 31 May 2021.**

Company recall code **21SMD-047**

Weekly report number **Report-2021-31**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic **Recall of the product from end users**

operators

**Importer**

Products were found and  
measures were taken also in

**Estonia  
Slovenia**

---

Alert number **[A12/01153/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The wishbone screw on the cradle may not be properly tightened. This could cause loss of stability, resulting in loss of control over the vehicle.**

**The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car.**

Brand **DS automobiles**

Name **DS3 Crossback**

EC-type approval/model **e2\*2007/46\*0639\*12**

Production dates **The affected vehicles were manufactured on 18 February 2021.**

Company recall code **HSZ**

Weekly report number **Report-2021-31**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **09/07/2021**

---

Alert number **[A12/01165/21](#)**

Product **Passenger car**

---

Risk type **Fire**

**The fixing nuts which connect the exhaust downpipe to the catalytic converter may not have been tightened correctly and could loosen over time. This may cause a hot exhaust gas leak into the engine bay, increasing the risk of fire.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Land Rover**

Name **Discovery, Defender**

EC-type approval/model **e5\*2007/46\*0092\*03**

Production dates **Model Year: 2021**

Company recall code **N571**

Weekly report number **Report-2021-31**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and **Slovenia**

measures were taken also in



Alert number **[A12/01155/21](#)**

Product **Pull-along toy**



Risk type **Choking  
Strangulation**

**Small parts can easily detach (caterpillar's feelers). As a consequence, a small child may put them in the mouth and choke on them. Furthermore, the cord of the toy is too long. It may get wrapped around the child's neck and lead to strangulation.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Plastic, educational pull-along toy. Battery powered.**

Packaging description **Cardboard packaging.**

Brand **MaIPlay**

Name **Pull-line Caterpillar**

Type / number of model **NO. QF366-042**

Barcode **EAN: 5901924219361**

Weekly report number **Report-2021-31**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Importer**

Date of entry into force **13/07/2021**

Alert number

**[A12/01169/21](#)**

Product

**Hand disinfectant**



Risk type

**Health risk / other**

**The product contains an insufficient amount of ethanol (measured values: 55.5% by weight). Consequently, it does not kill bacteria or viruses, which could then reach the user, increasing the risk of infection.**

**The product does not comply with the Biocidal Products Regulation.**

Category

**Chemical products**

Type

**Consumer**

Description

**50 ml pack of clear hydro-alcoholic hand sanitizing antibacterial gel. The product is also sold online.**

Packaging description

**The product is sold in a 50 ml transparent plastic bottle with flip top lid.**

Brand

**Wells**

Name

**Álcool Gel Mãos (Hand sanitizer)**

Type / number of model

**Ref. AG**

Batch number

**EXP: 11/2023  
Cód. Forn. 29222  
L: AGO 98/2020**

Barcode

**5600954005714**

Weekly report number

**Report-2021-31**




Alert submitted by	<b>Portugal</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Portugal</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Manufacturer</b>
Date of entry into force	<b>26/07/2021</b>

Alert number

**[A12/01170/21](#)**

Product

**Hand disinfectant**

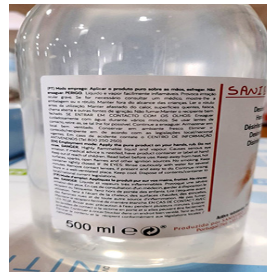

Risk type **Health risk / other**

**The product's content of alcohol is insufficient (measured values: 54% of ethanol and 2% of propan-2-ol, by weight). Consequently, it does not kill bacteria or viruses, which could then reach the user, increasing the risk of infection.**

**The product does not comply with the Biocidal Products Regulation.**

Category **Chemical products**

Type **Consumer**

Description **500 ml pack of clear hydro-alcoholic hand sanitizer with gel consistency. The product is also sold online.**

Packaging description **The product is sold in a 500 ml transparent plastic bottle with manual dosing device.**

Brand **SANIBIOK**

Name **Desinfetante de mãos (Hand disinfectant)**

Type / number of model **DM 10**

Batch number **L2002827  
VAL: 09/2022**

Barcode **5602142001669**

Weekly report number **Report-2021-31**

Alert submitted by	<b>Portugal</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Portugal</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Manufacturer</b>
Date of entry into force	<b>26/07/2021</b>

Alert number

**[A12/01171/21](#)**

Product

**Hand disinfectant**



Risk type

**Health risk / other**

**According to the manufacturer's authorisations, the product contains an ineffective content of alcohol (measured values: 0% of ethanol and 67% of propan-2-ol, by weight). Consequently, it does not kill bacteria or viruses, which could then reach the user, increasing the risk of infection.**

**The product does not comply with the Biocidal Products Regulation.**

Category

**Chemical products**

Type

**Consumer**

Description

**100 ml pack of clear hydro-alcoholic hand sanitizer (liquid solution). The product is also sold online.**

Packaging description

**The product is sold in a 100 ml transparent spray plastic bottle.**

Brand

**Fapil**

Name

**HIDRO-ÁLCOOL**

Batch number

**11/2023  
89603**

Barcode

**5601296896701**

Weekly report number

**Report-2021-31**

Alert submitted by	<b>Portugal</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Portugal</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Manufacturer</b>
Date of entry into force	<b>26/07/2021</b>

Alert number

**[A12/01172/21](#)**

Product

**Disposable nitrile gloves**



Risk type

**Health risk / other**

**The rubber of the glove is too permeable. Consequently, contaminated fluids could pass through the gloves, increasing the risk of infection.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation.**

Category

**Protective equipment**

Type

**Consumer**

Description

**Disposable blue nitrile protective gloves PM525 against chemicals with the permeation performance Type B, powder free. The product is also sold online.**

Packaging description

**The product is sold in a transparent plastic bag packaging with 80 units.**

Brand

**Pecol**

Name

**LUVAS DESCARTÁVEIS EM NITRILO PM525**

Type / number of model

**Lote: gasa22/20M**

Batch number

**ART 005205003027**

Barcode

**5603648861092**

Weekly report number

**Report-2021-31**

Alert submitted by	<b>Portugal</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Unknown</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>27/07/2021</b>

Alert number **[A12/01167/21](#)**

Product **Dog lead**



Risk type **Chemical**

**The leather in the product contains an excessive amount of chromium VI (measured value: 8.2 mg/kg). Chromium (VI) is sensitising, can trigger allergic reactions and can cause cancer.**

**The product does not comply with REACH Regulation.**

Category **Other**

Type **Consumer**

Description **Brown dog lead; size: M. The product is also sold online.**

Brand **sugar dog**

Name **Leder-Hundeleine Mystic Vibes**

Type / number of model **230899 M BR  
5001008962  
59987**

Barcode **4053222767257**

Weekly report number **Report-2021-31**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **India**



Measures taken by economic operators

**Stop of sales  
Retailer**

Measures taken by economic operators

**Stop of sales  
Importer**

Date of entry into force

**27/07/2021**

Measures taken by economic operators

**Recall of the product from end users  
Importer**

Date of entry into force

**27/07/2021**

Alert number

**[A12/01174/21](#)**

Product

**Laser engraving machine**



Risk type

**Damage to sight**

**Unrestricted, invisible laser radiation can be emitted by the product. If reflected or diffused rays hit the eye, they may cause blindness or injuries.**

**The product does not comply with the requirements of the Machinery Directive.**

Category

**Machinery**

Type

**Consumer**

Description

**Laser engraving machine. The product is sold online, in particular via eBay and Amazon.**

Packaging description

**Packed in wooden box with Global Trade Item Number (GTIN).**

Brand

**Unknown**

Type / number of model

**20WFTDBJ**

Barcode

**7669231752886**

Weekly report number

**Report-2021-31**

Alert submitted by

**Germany**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Recall of the product from end users  
Manufacturer**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Manufacturer**

Alert number

**[A12/01175/21](#)**

Product

**Laser engraving machine**



Risk type

**Damage to sight**

**Unrestricted, invisible laser radiation can be emitted by the product. If reflected or diffused rays hit the eye, they may cause blindness or injuries.**

**The product does not comply with the requirements of the Machinery Directive.**

Category

**Machinery**

Type

**Consumer**

Description

**Laser engraving machine. The product is sold online, in particular via eBay and Amazon.**

Packaging description

**Packed in wooden box with Global Trade Item Number (GTIN).**

Brand

**Unknown**

Type / number of model

**5030-50W**

Barcode

**7669231753579**

Weekly report number

**Report-2021-31**

Alert submitted by

**Germany**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Manufacturer**

Measures ordered by public  
authorities

**Recall of the product from end users  
Manufacturer**

Alert number **[A12/01176/21](#)**

Product **Laser engraving machine**



Risk type **Damage to sight**

**Unrestricted, invisible laser radiation can be emitted by the product. If reflected or diffused rays hit the eye, they may cause blindness or injuries.**

**The product does not comply with the requirements of the Machinery Directive.**

Category **Machinery**

Type **Consumer**

Description **Laser engraving machine. The product is sold online, in particular via eBay and Amazon.**

Packaging description **Packed in wooden box with Global Trade Item Number (GTIN).**

Brand **Unknown**

Type / number of model **KH7050-60W**

Barcode **7909991946256**

Weekly report number **Report-2021-31**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Manufacturer**

Measures ordered by public  
authorities

**Recall of the product from end users  
Manufacturer**

Alert number **[A12/01177/21](#)**

Product **Laser engraving machine**



Risk type **Damage to sight**

**Unrestricted, invisible laser radiation can be emitted by the product. If reflected or diffused rays hit the eye, they may cause blindness or injuries.**

**The product does not comply with the requirements of the Machinery Directive.**

Category **Machinery**

Type **Consumer**

Description **Laser engraving machine. The product is sold online, in particular via eBay and Amazon.**

Packaging description **Packed in wooden box with Global Trade Item Number (GTIN).**

Brand **Unknown**

Type / number of model **KH7050-60W**

Barcode **7426621772523**

Weekly report number **Report-2021-31**

Alert submitted by **Germany**

Is the product counterfeit? **No**



Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Manufacturer**

Measures ordered by public  
authorities

**Recall of the product from end users  
Manufacturer**

Alert number **[A12/01178/21](#)**

Product **Laser engraving machine**



Risk type **Damage to sight**

**Unrestricted, invisible laser radiation can be emitted by the product. If reflected or diffused rays hit the eye, they may cause blindness or injuries.**

**The product does not comply with the requirements of the Machinery Directive and the relevant European standards EN 60825 and EN ISO 11553 / EN ISO 14119?**

Category **Machinery**

Type **Consumer**

Description **Laser engraving machine. The product is sold online, in particular via eBay and Amazon.**

Packaging description **Packed in wooden box with Global Trade Item Number (GTIN).**

Brand **Unknown**

Type / number of model **KH1490**

Barcode **7426621772486**

Weekly report number **Report-2021-31**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Manufacturer**

Measures ordered by public  
authorities

**Recall of the product from end users  
Manufacturer**

Alert number

**[A12/01179/21](#)**

Product

**Laser engraving machine**



Risk type

**Damage to sight**

**Unrestricted, invisible laser radiation can be emitted by the product. If reflected or diffused rays hit the eye, they may cause blindness or injuries.**

**The product does not comply with the requirements of the Machinery Directive.**

Category

**Machinery**

Type

**Consumer**

Description

**Laser engraving machine. The product is sold online, in particular via eBay and Amazon.**

Packaging description

**Packed in wooden box with Global Trade Item Number (GTIN).**

Brand

**Unknown**

Type / number of model

**960-100W**

Barcode

**7669231753586**

Weekly report number

**Report-2021-31**

Alert submitted by

**Germany**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Manufacturer**

Measures ordered by public  
authorities


**Recall of the product from end users  
Manufacturer**

Alert number

**[A12/01180/21](#)**

Product

**Laser engraving machine**

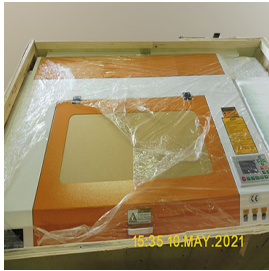

Risk type

**Damage to sight**

**Unrestricted, invisible laser radiation can be emitted by the product. If reflected or diffused rays hit the eye, they may cause blindness or injuries.**

**The product does not comply with the requirements of the Machinery Directive.**

Category

**Machinery**

Type

**Consumer**

Description

**Laser engraving machine. The product is sold online, in particular via eBay and Amazon.**

Packaging description

**Packed in wooden crate with Global Trade Item Number (GTIN).**

Brand

**Unknown**

Type / number of model

**7050-80W**

Barcode

**7426621772509**

Weekly report number

**Report-2021-31**

Alert submitted by

**Germany**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Manufacturer**

Measures ordered by public  
authorities

**Recall of the product from end users  
Manufacturer**

Alert number **[A12/01161/21](#)**

Product **Finger magnet**



Risk type **Injuries**

**The product has a high magnetic flux and can easily break into fragments. If a child swallows two or more of them and/or other metallic objects, they could attract one another causing intestinal blockage or perforation.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1**

Category **Toys**

Type **Consumer**

Description **Set consisting of three separate magnetic rings in blue plastic.**

Packaging description **The product is sold in a blister with a cardboard back. The product was also sold online.**

Brand **ChoseInt Trade Limited**

Name **Fin Gears - Magnetic freestyle ring**

Type / number of model **NO.X8**

Batch number **5214206**

Barcode **4 750733 359 017**



Weekly report number **Report-2021-31**



Alert submitted by	<b>Latvia</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>06/05/2021</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>

Alert number **[A12/01160/21](#)**

Product **Bulb adaptor**

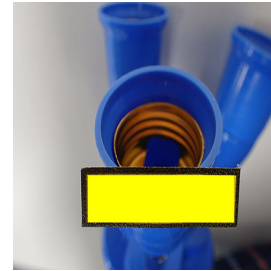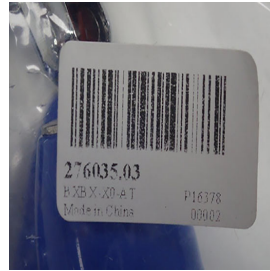

Risk type **Electric shock**

**The screw-part of the bulb holder lacks insulation and becomes live. Consequently, when putting or replacing a bulb, the user might touch it and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60238.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Adapter to fit 3 lightbulbs in a single E27 socket.**

Packaging description **The product is sold in a transparent plastic bag. The product was sold online, in particular via BOL.COM.**

Brand **Unknown**

Type / number of model **276035.03  
B XB X X0-AT P16378**

Weekly report number **Report-2021-31**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market**  
**Other**

Date of entry into force

**22/03/2021**

Alert number **[A12/01166/21](#)**

Product **Toy scooter**



Risk type **Entrapment  
Injuries**

**There are accessible gaps between moving parts of the scooter's handlebar. Consequently a finger of the child may become trapped and injured. The wheels are too small and could get stuck in holes in the ground. Additionally, the scooter's frame lacks the mark indicating the minimal insertion depth of the handlebar, which might be insufficiently inserted and detach while the child is riding the scooter. In both cases, the child to loose balance and fall off, leading to injuries.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Black and blue scooter with two wheels at the front, and one wheel at the back.**

Packaging description **The product is sold in a cardboard box.**

Brand **Smiki**

Name **Hulajnoga 3-kolowa**

Type / number of model **6564977  
WX-MAXI-F/6564976**

Barcode **5 903272 430238**

Weekly report number	<b>Report-2021-31</b>
Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>31/03/2021</b>
Company recall code	- <a href="https://smykgroup.com/pl/ogloszenie-hulajnoji/">https://smykgroup.com/pl/ogloszenie-hulajnoji/</a>

Alert number

**[A12/01162/21](#)**

Product

**Children's bicycle**



Risk type

**Injuries**

**The protective cap at the end of the bicycles cables are not resistant enough and could easily detach. The user could get injured by the metal threads of the ropes. The rear thread brake is not equipped with the suitable locking elements and the pedal can easily break while in use. Consequently the user could easily fall when normally using the product.**

**The product does not comply with the relevant European standard EN ISO 4210-2.**

Category

**Hobby/sports equipment**

Type

**Consumer**

Description

**Children's bicycle in white and neon purple design and 20 inches wheels.**

Brand

**Vedora**

Name

**Bicycle for young adult**

Type / number of model

**Intro 20**

Batch number

**VSE 1708283238**

Weekly report number

**Report-2021-31**

Alert submitted by

**Slovakia**

Is the product counterfeit?

**No**

Country of origin

**Slovakia**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Manufacturer**

Date of entry into force

**15/02/2021**

Measures ordered by public authorities

**Recall of the product from end users  
Manufacturer**

Date of entry into force

**15/02/2021**

Measures ordered by public authorities

**Warning consumers of the risks  
Manufacturer**

Date of entry into force

**15/02/2021**

Alert number **[A11/00061/21](#)**

Product **Toy scooter**



Risk type **Entrapment**

**There are accessible gaps between moving parts of the scooter's handlebar. Consequently a finger of the child may become trapped and injured.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Foldable toy scooter with plastic wheels and adjustable handlebar.**

Packaging description **The product is sold in a cardboard box.**

Brand **Unknown**

Name **Street Scooter Spider-man**

Type / number of model **HX 1848-850  
Item N° 18394**

Barcode **8 001011 183944**

Weekly report number **Report-2021-31**

Alert submitted by **Poland**



Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**




Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

Date of entry into force **23/03/2021**

Company recall code - <http://brimarex.pl/informacje/>

Alert number **[A12/01182/21](#)**

Product **Ring**

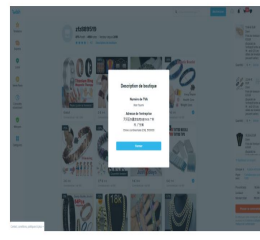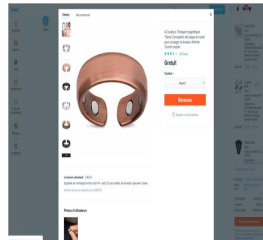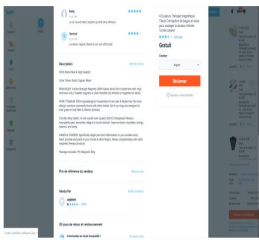

Risk type **Chemical**

**The product contains an excessive amount of cadmium (measured value: 78% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Silver-coloured metal ring with four magnets inside. The product was sold online, in particular via Wish.**

Brand **Unknown**

Name **4 Couleurs Thérapie magnétique Titane Conception de bague en acier pour soulager la douleur Arthrite**

Type / number of model **C03-11-3  
YG101177-1**

Weekly report number **Report-2021-31**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**




Measures taken by economic operators

**Withdrawal of the product from the market**  
**Other**



Alert number **[A12/01181/21](#)**

Product **Bracelet**

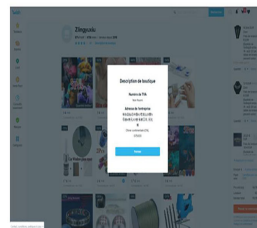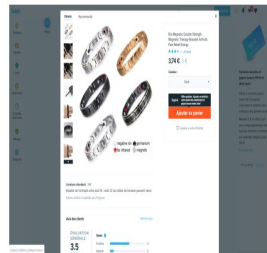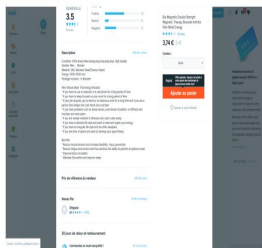

Risk type **Chemical**

**The product contains an excessive amount of lead (measured value: 2,5% by weight). Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Gold-coloured metal bracelet with grey, black, white and red decorations. The product was sold online, in particular via Wish.**

Packaging description **Packaged in a transparent bag.**

Brand **Unknown**

Name **Bio Magnetic Double Strength Magnetic Therapy Bracelet Arthritis Pain Relief Energy**

Type / number of model **D01-18-2  
YG101098-4**

Weekly report number **Report-2021-31**

Alert submitted by **France**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market  
Other**