

Alert number

[INFO/00148/21](#)

Product

Necklace with pendant



Risk type

Chemical

The product's cadmium content is too high (90% by weight). Cadmium is harmful to human health because it accumulates in the body, damages the kidneys and bones, and may be carcinogenic.

The product does not comply with the REACH Regulation.

Category

Jewellery

Type

Consumer

Description

dark necklace with pendant (Witcher wolf). The product is also sold online, in particular via Amazon.

Packaging description

black velvet bag

Brand

JINX (counterfeit)

Name

The Witcher Wild Hunt - Witcher Wolf Medallion

Batch number

PO*LL052215

Barcode

**840285193338
ASIN: B019HZR6N2**

Weekly report number

Report-2021-34

Alert submitted by

Germany

Is the product counterfeit? **Yes**

Country of origin **Poland**

Measures taken by economic operators **Removal of this product listing by the online marketplace**
Other

Alert number **[A12/01230/21](#)**

Product **Children's blouse**



Risk type **Choking**

Small decorative parts can easily detach from the garment. A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of General Product Safety Directive.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Pink blouse with short lace sleeves, intended for children aged 1-2 years. The garment has a little girl and three mushrooms with silver pebbles and the inscription "My Favorites Mushrooms".**

Brand **BOINC !**

Name **Catchy Girls**

Type / number of model **92 cm, 1-2 years**

Barcode **8691100347205**

Weekly report number **Report-2021-34**

Alert submitted by **Romania**

Is the product counterfeit? **Unknown**

Country of origin **Turkey**

Measures ordered by public authorities **Withdrawal of the product from the market
Retailer**

Date of entry into force **25/06/2021**

Alert number **[A12/01237/21](#)**

Product **Electrical Fan Heater**



Risk type	Burns Electric shock The plastic of the product can easily melt, leaving live or moving parts accessible. Consequently, a user could touch live / moving parts, or the hot surface, and could sufferer and electric shock or burns. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-2-30.
Category	Electrical appliances and equipment
Type	Consumer
Description	2000W White Freestanding Fan Heater.
Brand	GoodHome
Name	GoodHome Colenso 2000W White Freestanding Fan Heater (FH-115)
Type / number of model	FH-115
Barcode	5059340046921
Weekly report number	Report-2021-34
Alert submitted by	Ireland
Is the product counterfeit?	No

Country of origin

People's Republic of China

Measures taken by economic operators

**Recall of the product from end users
Distributor**

Measures taken by economic operators

**Recall of the product from end users
Importer**

Company recall code

- <https://www.diy.com/product-information/product-recall>

Alert number **[A12/01236/21](#)**

Product **Electrical Fan Heater**



Risk type	Burns Electric shock The plastic of the product can easily melt, leaving live or moving parts accessible. Consequently, a user could touch live / moving parts, or the hot surface, and could sufferer and electric shock or burns. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-2-30.
Category	Electrical appliances and equipment
Type	Consumer
Description	2000W White Oscillating Fan Heater
Brand	GoodHome
Name	GoodHome Colenso 2000W White Oscillating Fan Heater (FH-715)
Type / number of model	FH-715
Barcode	5059340046938
Weekly report number	Report-2021-34
Alert submitted by	Ireland
Is the product counterfeit?	No

Country of origin

People's Republic of China

Measures taken by economic operators

**Recall of the product from end users
Importer**

Measures taken by economic operators

**Recall of the product from end users
Distributor**

Company recall code

- <https://www.diy.com/product-information/product-recall>

Alert number **[A12/01232/21](#)**

Product **Laser pointer**



Risk type **Damage to sight**

The laser beam is too powerful. Direct viewing of the laser beam could cause damage to sight.

The product does not comply with the relevant European standard EN 60825.

Category **Laser pointers**

Type **Consumer**

Description **Laser pointer**

Packaging description **Yellow cardboard box with transparent plastic window.**

Brand **Divepro**

Name **Duiklaser (Diving laser)**

Type / number of model **L6 (Serial number 20214767)**

Weekly report number **Report-2021-34**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public **Withdrawal of the product from the market**

authorities

Other

Date of entry into force

16/03/2021

Products were found and
measures were taken also in

Ireland

Alert number **[INFO/00141/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to a software defect, there may be a sporadic loss of performance during driving and the response to pressing the accelerator pedal may be impeded.

Category **Motor vehicles**

Type **Consumer**

Description **Electric vehicle**

Brand **Audi**

Name **e-tron GT, RS e-tron GT**

EC-type approval/model **e1*2018/858*00005, Type: FW**

Production dates **The affected vehicles were manufactured between 20 November 2020 and 20 April 2021**

Company recall code **93L3**

Weekly report number **Report-2021-34**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Bulgaria
Croatia
France
Ireland**

Alert number **[A12/01234/21](#)**

Product **Plastic doll**



Risk type **Chemical**

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 40,6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll.**

Packaging description **Cardboard box with plastic window.**

Brand **Guangda**

Name **Mermaid**

Type / number of model **NO. 700
NO. 700 A**

Weekly report number **Report-2021-34**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities

**Destruction of the product
Distributor**

Date of entry into force

16/06/2021

Measures ordered by public authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

17/06/2021

Alert number **[A11/00066/21](#)**

Product **Trampoline sprinkler**



Risk type **Injuries**

The product lacks instructions for use and a warning label to warn against using the trampoline in wet conditions. Because the trampoline becomes wet it can cause injuries.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard 71-1, 2 and 3.

Category **Toys**

Type **Consumer**

Description **The product is a water hose that can be mounted on a trampoline which makes the mat wet.**

Brand **Unknown**

Name **Trampoline Waterpark**

Weekly report number **Report-2021-34**

Alert submitted by **Denmark**

Is the product counterfeit? **No**

Country of origin **Sweden**

Measures taken by economic operators **Withdrawal of the product from the market
Retailer**

Date of entry into force **21/07/2021**



Alert number **[A12/01233/21](#)**

Product **Duvet and Pillowcase Set**



Risk type	Injuries Strangulation The trim of the bedding may become detached and form a loop in which a limb or a body part of the user may become trapped, leading to injuries or strangulation. The product does not comply with the requirements of the General Product Safety Directive.
Category	Other
Type	Consumer
Description	Duvet and pillowcase set, with a pink or teal coloured patterns. The product is intended for children of age between 36 months and 8 years old.the product was sold online.
Brand	NEXT
Name	Magical Woodland Duvet and Pillowcase Set
Type / number of model	Pink Teal
Batch number	215341 332567
Weekly report number	Report-2021-34
Alert submitted by	Ireland
Is the product counterfeit?	No

Country of origin **Pakistan**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **07/12/2020**

Company recall code - <https://www.bromley.gov.uk/leaflet/329603/22/680/d>

Alert number

A12/01235/21

Product

Plastic doll



Risk type

Chemical

The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and Di-n-octyl phthalate (DNOP) (measured values up to 47 % and 3.7% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category

Toys

Type

Consumer

Description

The doll's head is made of soft plastic and the body of hard plastic. The doll wears a dress and its synthetic fibre hair is tied with a rubber band.

Packaging description

Cardboard-plastic box.

Brand

Unknown

Name

Fashion baby Angel

Type / number of model

art. NO. 1357

Weekly report number

Report-2021-34

Alert submitted by

Lithuania

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Importer**

Date of entry into force

23/07/2021

Alert number **[A12/01238/21](#)**

Product **Passenger car**

Risk type **Injuries**

The support for the rail of the front passenger seat may be defective due to the weld not being properly cooled. This could impair the seat retention and the safety belt performance, increasing the risk of injury in the event of an accident.

The product does not meet the requirements of the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **Grandland X**

EC-type approval/model **e2*2007/46*0597*19**

Production dates **The affected vehicles were manufactured on 12 February 2021.**

Company recall code **21-C-030**

Weekly report number **Report-2021-34**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **19/01/2021**



Alert number **[A12/01239/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

The centring pin for the rear suspension spring may not be properly welded. This could lead to the rear suspension spring being detached, increasing the risk of an accident.

The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **PEUGEOT**

Name **Expert 4, Traveller**

EC-type approval/model **e2*2007/46*0532*15, e2*2007/46*0533*16**

Production dates **The affected vehicles were manufactured between 15 and 21 April 2021.**

Company recall code **KNG**

Weekly report number **Report-2021-34**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **02/07/2021**



Alert number **[A12/01240/21](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

The centring pin for the rear suspension spring may not be properly welded. This could lead to the rear suspension spring being detached, increasing the risk of an accident.

The product does not meet the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **CITROEN**

Name **Jumpy 4, Spacetourer**

EC-type approval/model **"e2*2007/46*0530*15, e2*2007/46*0531*16"**

Production dates **The affected vehicles were manufactured between 15 and 22 April 2021.**

Company recall code **HTB**

Weekly report number **Report-2021-34**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **02/07/2021**



Alert number **[A12/01229/21](#)**

Product **Passenger car**

Risk type **Injuries**

The plastic logo on the steering wheel air bag module cover may become brittle over time. Due to this, the logo may shatter during a normal air bag deployment and plastic fragments may hit occupants leading to serious injuries.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **- Mazda 3 (BK); VIN range: JMZBK**** *1 100033 - 527682, JM7BK**** *1 103077 - 206291.**

Brand **Mazda**

Name **3 (BK)**

EC-type approval/model **e1*2001/116*0234*00, e1*2001/116*0234*01, e1*2001/116*0234*02, e1*2001/116*0234*03, e1*2001/116*0234*04, e1*2001/116*0234*05, e1*2001/116*0234*06, e1*2001/116*0234*07**

Production dates **From 18 February 2003 through 22 June 2006.**

Company recall code **AM026A**

Weekly report number **Report-2021-34**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Japan**


Measures taken by economic **Recall of the product from end users**

operators


Distributor

Products were found and
measures were taken also in

**Germany
Ireland**

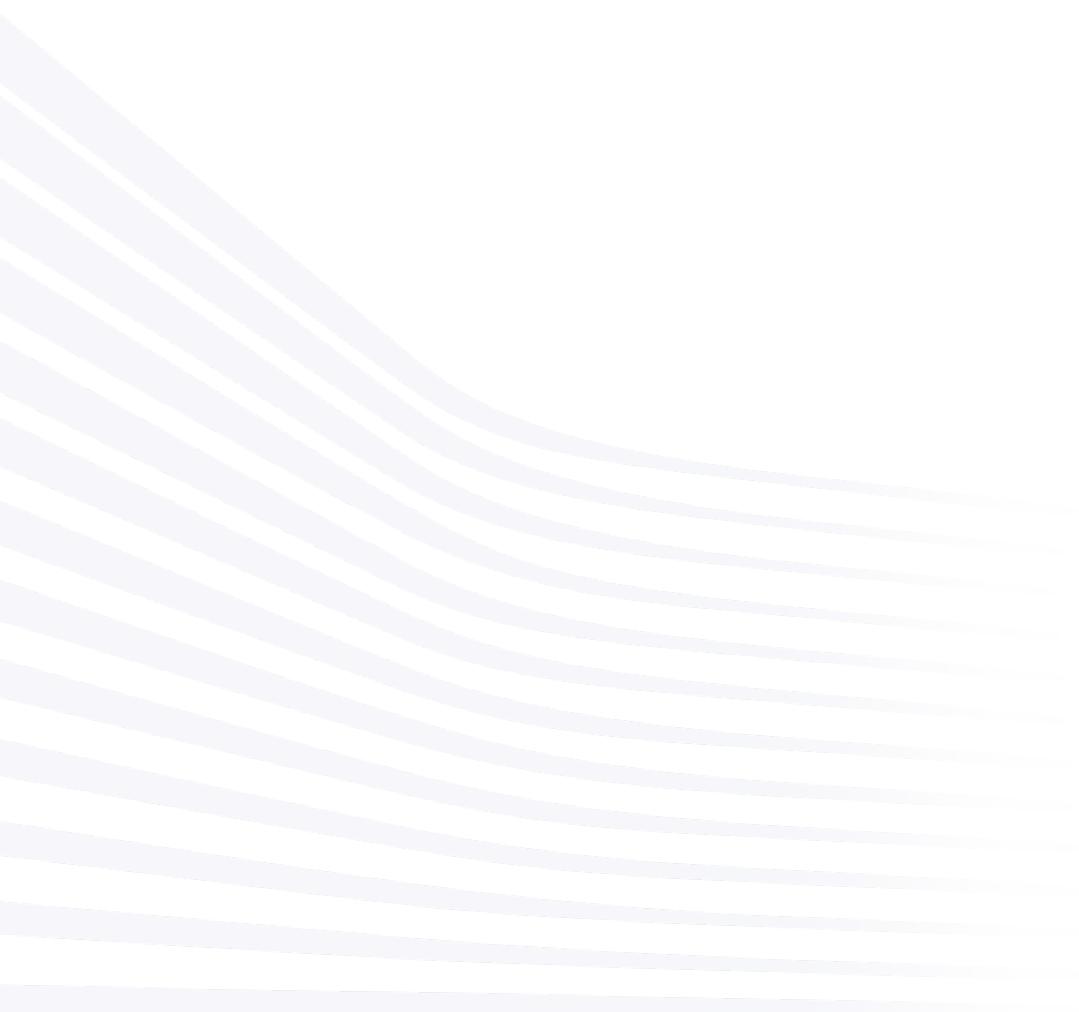

Alert number	<u>A12/01242/21</u>
Product	Toy bow and arrows

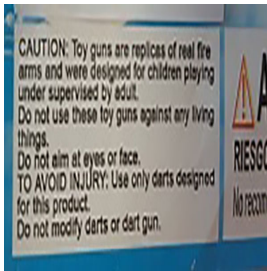

Risk type **Choking**

The arrows' suction cups can be easily detached. If a child puts them in the mouth, the suction cups could detach and obstruct the airways.

The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Yellow-red toy bow with three arrows (yellow, blue and red) with a yellow suction cup at the end.**

Packaging description **The product is sold in a colourful plastic and cardboard blister.**

Brand **Unknown**

Name **Indian Archery**

Type / number of model **8569**

Batch number **201912001**

Barcode **1499703000001**

Weekly report number **Report-2021-34**

Alert submitted by	The Netherlands
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Other
Date of entry into force	21/04/2021

Alert number **[A12/01241/21](#)**

Product **Pacifier clip**



Risk type **Choking**

The product can easily break releasing small parts. A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 12586.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **The pacifier clip with name is handmade from a satin cord with silicone and wooden beads, wooden letter beads or acrylic letter beads, a wooden clip and a wooden button with brand logo. The product is also sold online.**

Packaging description **The product is packaged in a plastic pouch.**

Brand **Babyzus**

Name **Speenkoord**

Weekly report number **Report-2021-34**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin **The Netherlands**

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

Date of entry into force

30/04/2021

Company recall code

- <https://www.babyzus.com>

Alert number **[A12/01243/21](#)**

Product **Wooden Carrousel**



Risk type	Choking
	Small parts (the buttons) can easily detach from the toy. A small child may put them in the mouth and choke on them.
	The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN -1.
Category	Toys
Type	Consumer
Description	A white/grey colored music box. The product is also sold online, in particular via Bol.com.
Packaging description	The product is sold in a packed in a transparent packaging.
Brand	BamBam
Name	Musical Duck Carrousel
Type / number of model	81528
Barcode	8711811085774
Weekly report number	Report-2021-34
Alert submitted by	The Netherlands
Is the product counterfeit?	Unknown

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

03/06/2021

Alert number **[A12/01231/21](#)**

Product **Passenger car**

Risk type **Injuries**

Due to incorrect welding of the control arms, a loss of control of the vehicle may occur. This will increase the risk of accident and of injuries to the occupants of the vehicle.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Aiways**

Name **U5**

EC-type approval/model **e13*2007/46*2315*00 - 02, Type MAS861-WVTA**

Production dates **31.12.2020 to 31.01.2021**

Weekly report number **Report-2021-34**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/01227/21](#)**

Product **Passenger car**

Risk type **Injuries**

The hydraulic control unit (HCU) of the integrated braking system (IBS) presents a defect. This can result in the reduction of braking assistance and loss of ABS functionality leading to an increased risk of accident and therefore risk of injuries to the occupants of the vehicle.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Jeep**

Name **Compass**

EC-type approval/model **e3*2007/46*0508*07, Type MP**

Production dates **25.11.2020 to 02.03.2021**

Company recall code **Y27**

Weekly report number **Report-2021-34**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A11/00067/21](#)**

Product **Electric kettle**



Risk type **Electric shock**

The insulation of the supply cable may easily get damaged, leaving live parts accessible to the user. The living parts can overheat and the user may consequently touch them and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335-1 and EN 60335-2.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Electric water kettle 1.8 l, 220 - 240V, 50/60Hz, 1500 - 1800W.**

Packaging description **Cardboard box.**

Brand **ACTIVER**

Name **Electric Water Kettle**

Type / number of model **14018051/A16211**

Barcode **8591022449233**

Weekly report number **Report-2021-34**

Alert submitted by **Czechia**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **11/05/2021**

Measures ordered by public authorities **Withdrawal of the product from the market
Manufacturer**

Date of entry into force **21/07/2021**

Alert number **[A12/01244/21](#)**

Product **Pencil case**



Risk type **Chemical**

The pencil case contains di(2-ethylhexyl) phthalate (DEHP) (measured value: up to 7.8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Stationery**

Type **Consumer**

Description **Pink glossy PU pencil case with violet zipper (silver pull). Pencil case has diamond shape stitching on it. Batch is an assortment of different colours.**

Brand **Unknown**

Name **penaali kiiltävä**

Type / number of model **CO1720033**

Batch number **04/2021**

Barcode **6419860655383**

Weekly report number **Report-2021-34**

Alert submitted by **Finland**

Is the product counterfeit? **Unknown**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **04/08/2021**

Alert number **[A12/01228/21](#)**

Product **Glue**

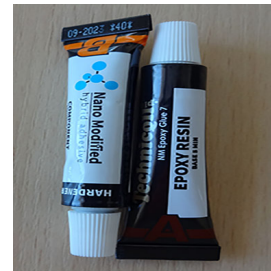

Risk type **Chemical**

The glue contains an excessive amount of toluene (measured values: 0.71% by weight). Toluene is neurotoxic, if inhaled or in contact with the skin, and might also affect the unborn child.

The product does not comply with the REACH Regulation.

Category **Chemical products**

Type **Consumer**

Description **Universal epoxide glue.**

Packaging description **Plastic cardboard packaging.**

Brand **Technicqll.pl**

Name **EPOXY**

Type / number of model **E-362**

Barcode **5902051001362**

Weekly report number **Report-2021-34**

Alert submitted by **Lithuania**

Is the product counterfeit? **Unknown**

Country of origin

Poland

Measures ordered by public
authorities

**Withdrawal of the product from the market
Retailer**

Alert number **[A12/01249/21](#)**

Product **Electrical Bicycle**



Risk type **Injuries**

There may be a defect (small cracks may appear) in the carbon fork of the high-speed pedal that could lead to the fork breaking. Therefore, the bike might be unstable, and the user could lose control and fall off, leading to injuries and accidents.

The product does not comply with the requirements of the Machinery Directive and the relevant European Standard EN 15194.

Category **Hobby/sports equipment**

Type **Consumer**

Description **High Speed Pedal Electrical Cycle.**

Brand **DutchID**

Name **DutchID High Speed PEDELEC**

Type / number of model **Model Urban HS**

Batch number **e4*2002/24*3199*01**

Weekly report number **Report-2021-34**

Alert submitted by **The Netherlands**

Is the product counterfeit? **Unknown**

Country of origin

The Netherlands

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Date of entry into force

22/06/2021

Alert number **[A11/00068/21](#)**

Product **USB charger**



Risk type **Electric shock**

The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts.

The product does not comply with the requirements of the Low Voltage Directive and the relevant standard EN IEC 62368.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Black battery charger with 1 USB port.**

Packaging description **Packaging: blister / cardboard box with window**

Brand **CELLECT**

Name **HÁLÓZATI TÖLTŐ / TRAVEL CHARGER**

Type / number of model **MTCB-TYPE-C**

Barcode **5999076770779**

Weekly report number **Report-2021-34**

Alert submitted by **Hungary**

Is the product counterfeit? **No**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Importer**

Date of entry into force

10/05/2021

Alert number **[A12/01245/21](#)**

Product **Passenger car**

Risk type **Injuries**

The windscreen may be incorrectly bonded and could become detached from the body of the car in the event of a crash. The passenger airbag being deployed in this case, could not be supported by the windscreen as intended. As a result, the restraining effect of the passenger airbag could be impaired, increasing the risk of injury.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **SMART**

Name **EQ Fortwo**

EC-type approval/model **e1*2001/116*0413*45, Type: 451**

Production dates **18.11.2020 to 23.11.2020**

Company recall code **6790003**

Weekly report number **Report-2021-34**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/01246/21](#)**

Product **Christmas light chain**



Risk type **Electric shock**

The product can easily be damaged if bend, but can still be used despite live parts becoming accessible. Furthermore, some parts of the products (conductor and wires) have an insufficient diameter, hence heating up easily and breaking the insulation. A user could touch a live part and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and of the relevant European standards EN 60598-1 and EN 60598-2.

Category **Lighting chains**

Type **Consumer**

Description **100 LED Christmas light chain of light bulbs. Product also sold online.**

Packaging description **Cardboard box**

Brand **Home Living**

Name **Pisca Led**

Type / number of model **ART. No.: 21**

Barcode **4794844211420**

Weekly report number **Report-2021-34**

Alert submitted by	Lithuania
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer

Alert number **[A12/01247/21](#)**

Product **Charcoal barbecue**



Risk type **Burns
Fire**

The horizontal plan of the barbecue becomes too hot reaching a temperature of 87 degrees above the ambient temperature (the limit is 50 degrees). The grill is difficult to manipulate under loading. As a consequence, the user could suffer burns and the product could cause fire.

The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 1860-1.

Category **Kitchen/cooking accessories**

Type **Consumer**

Description **Charcoal barbecue; size:134x58x91**

Brand **Naterial**

Name **Icarus**

Type / number of model **11500251**

Barcode **EAN: 3276000413639**

Weekly report number **Report-2021-34**

Alert submitted by **Romania**

Is the product counterfeit? **No**

Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Retailer
Company recall code	- https://www.leroymerlin.ro/docs/regulamente/rechemare-produs-gratar.pdf
Products were found and measures were taken also in	Greece

Alert number

A12/01248/21

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 62%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

10 white masks per box, with 'KN95' printed on both sides of each mask. Product sold online, in particular via eBay with the identification code #274871075226.

Packaging description

The secondary packaging is a yellow and blue cardboard box.

Brand	Unihope
Name	Unihope KN95 Maske - Face Mask 3D Pro
Type / number of model	Rxn-001
Batch number	20200402160105
Barcode	6934933806474
Weekly report number	Report-2021-34
Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Other
Date of entry into force	16/08/2021
Measures taken by economic operators	Recall of the product from end users Retailer
Date of entry into force	16/08/2021
Measures taken by economic operators	Withdrawal of the product from the market Retailer
Date of entry into force	16/08/2021