


Alert number **[A12/01252/21](#)**

Product **Anklet**

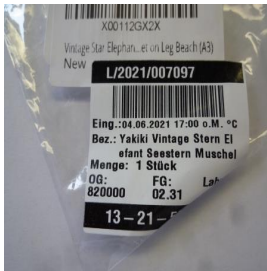

Risk type **Chemical**

**The product contains excessive amounts of cadmium (measured values: up to 98.3% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **The anklet is made of three separate bands of various material combinations and pendants in various shapes. The product in question here is style A3. The product was sold online, in particular via Amazon.**

Packaging description **Bag made of transparent, colourless plastic.**

Brand **Yakiki**

Name **Vintage star elephant starfish shell tortoise anklet for women bracelet on leg Beach (A3)**

Type / number of model **X00112GX2X**

Weekly report number **Report-2021-35**

Alert submitted by **Germany**

Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Removal of this product listing by the online marketplace Other</b>
Date of entry into force	<b>27/07/2021</b>
Measures taken by economic operators	<b>Ban on the marketing of the product and any accompanying measures Other</b>
Date of entry into force	<b>27/07/2021</b>
Measures taken by economic operators	<b>Making the marketing of the product subject to prior conditions Other</b>
Date of entry into force	<b>27/07/2021</b>

---

Alert number **[A12/01260/21](#)**

Product **Passenger car**

---

Risk type **Fire**

**The screw connection of an electrical connector at the pre-fuse box in the passenger footwell may be defective, which could increase the electrical transition resistance at that connection. As a result, the high electrical currents flowing through the connection could increase the temperature in this area, increasing the risk of fire.**

Category **Motor vehicles**

Type **Consumer**

Description **Model series: BR 223.**

Brand **Mercedes-Benz**

Name **S-Class**

EC-type approval/model **e1\*2007/46\*2115\*01-03, Type: R2S**

Production dates **07.10.2020 to 31.03.2021**

Company recall code **5491025**

Weekly report number **Report-2021-35**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/01258/21](#)**

Product **Finger paints**



Risk type **Microbiological**

**Contamination with *Pseudomonas aeruginosa* has been detected in the yellow and the blue paints (measured value: 240000 cfu/g). There is a risk of contracting infections as the paint may come in contact with the mouth, hands and eyes or with skin which is already damaged.**

**The product does not comply with the requirements of the Toy Safety Directive.**

Category **Toys**

Type **Consumer**

Description **Water-soluble finger paints, yellow (produced 12-01-126/2020-01) and blue (produced 18-01-121/2020-01), both in 150 g plastic containers, in sets of four finger paints (colours: yellow, red, blue and green).**

Packaging description **Each colour in a separate plastic container, all four colours in cardboard box.**

Brand **CREATHEK**

Name **Wasserlösliche Fingermalfarben**

Type / number of model **633 09 508**

Barcode **4018501049547**

Weekly report number	<b>Report-2021-35</b>
Alert submitted by	<b>Germany</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Germany</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Other</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Company recall code	- <a href="https://www.vedes-gruppe.de/presse/produkt-rueckrufe/item/153-rueckruf-fingerfarben-von-creathek">https://www.vedes-gruppe.de/presse/produkt-rueckrufe/item/153-rueckruf-fingerfarben-von-creathek</a>
Products were found and measures were taken also in	<b>Austria</b>

Alert number **[A12/01261/21](#)**

Product **Passenger car**

Risk type **Fire**

**Friction corrosion on the connector from the wiring harness to the blower regulator may cause fluctuations in the electrical resistance, which can lead to overheating and damage to the wiring harness insulation. That can result in a short circuit, leading to a vehicle fire, even if the vehicle is parked.**

Category **Motor vehicles**

Type **Consumer**

Description **Model series E70, E71.**

Brand **BMW**

Name **X5, X6**

EC-type approval/model **e1\*2001/116\*0420\*, e1\*2007/46\*0421\*, e1\*2007/46\*0412\*, e1\*2007/46\*0454\*, Types: X70, X5, X6, X-N1**

Production dates **The affected vehicles were manufactured between 21 August 2006 and 21 August 2011.**

Company recall code **0061890500**

Weekly report number **Report-2021-35**

Alert submitted by **Germany**

Is the product counterfeit? **No**


Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Denmark  
Poland  
Sweden**

Alert number **[A12/01256/21](#)**

Product **Toy pool**

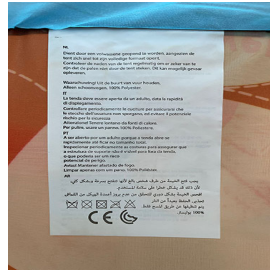

Risk type **Chemical**

**The plastic material of the toy contains an excessive amount of diisodecyl phthalate (DIDP) (measured value up to: 20.09% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Inflatable pool made of reinforced fabric, in which children can play. The product is provided with playing balls. The product was also sold online.**

Packaging description **Cardboard box.**

Brand **Colibrì**

Name **BOX 100 Palline**

Type / number of model **703-1**

Batch number **P21-1102**

Barcode **8054188271389**

Weekly report number **Report-2021-35**

Alert submitted by	<b>Italy</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Taiwan</b>
Measures ordered by public authorities	<b>Import rejected at border Importer</b>
Date of entry into force	<b>06/07/2021</b>



---

Alert number **[A12/01262/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The vehicles are equipped with side airbags that were developed for testing purposes. As a result, the airbags' protective effect would be impeded, increasing the risk of injury in the event of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **AUDI**

Name **Q4 (Q4 35 e-tron, Q4 40 e-tron)**

EC-type approval/model **Type: FZ  
e1\*2018/858\*00006\***

Production dates **27.4.2021 to 21.5.2021**

Company recall code **69CT**

Weekly report number **Report-2021-35**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

---

Alert number **[INFO/00150/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The seats may move unintentionally. This may result in a pinch point injury.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **BENTLEY**

Name **Continental GT**

EC-type approval/model **Type: 3S  
e13\*2007/46\*0634\***

Production dates **The affected vehicles were manufactured between 5 February 2018 and 28 June 2021.**

Company recall code **RE21/26**

Weekly report number **Report-2021-35**

Alert submitted by **Germany**



Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/01259/21](#)**

Product **Bath toy set**

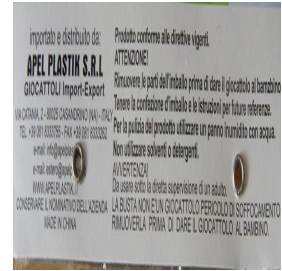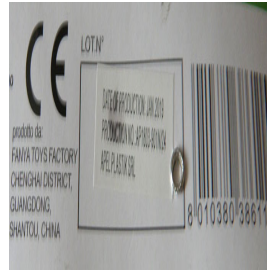

Risk type **Choking**

**Small plastic parts (squeaking element) may easily detach from the toy. A small child may put them in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Set of 6 colourful, whistling plastic sea animals. For children older than 6 months.**

Packaging description **Plastic bag with cardboard closure.**

Brand **Apel Plastik**

Name **MORBIDONI**

Type / number of model **AP1803-901N/24**

Barcode **8010380386115**

Weekly report number **Report-2021-35**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users  
Distributor**

Date of entry into force **04/08/2021**

Measures ordered by public authorities **Withdrawal of the product from the market  
Distributor**

Date of entry into force **04/08/2021**

Alert number **[A12/01273/21](#)**

Product **Passenger car**

Risk type **Injuries**

**The engine management software could cause the oil/vacuum pump, which supplies vacuum for brake assistance (brake boost), to become damaged. This may occur when 1) pressing the engine start/stop button two times in rapid succession, or 2) depressing the brake pedal very briefly while pressing the engine start/stop button. This could result in a loss of brake assistance and increased stopping distance, increasing the risk of an accident.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Frame code: DB03, DB41, DB42); Model year: 2018~2021.**

Packaging description **VIN Range: DB03 (DB0C0#MW021819 - MW021825), DB41 (DB410#0W020412 - 0W025834, DB410#0W009014 - 0W045795), DB42 (DB420#0W020336 - 0W045804).**

Brand **Toyota**

Name **Supra**

EC-type approval/model **e1\*2007/46\*1982\*00**

Production dates **The affected vehicles were manufactured between 31 July 2018 and 15 June 2021.**

Company recall code **21SMD-063**

Weekly report number **Report-2021-35**

Alert submitted by **Portugal**

Is the product counterfeit?

**No**

Country of origin

**Germany**

Measures taken by economic operators

**Recall of the product from end users  
Importer**

Products were found and measures were taken also in

**Greece  
Croatia  
Poland  
Sweden**

---

Alert number **[A12/01263/21](#)**

Product **Passenger car**

---

Risk type **Injuries**

**Due to a production defect affecting the instrument panel, the passenger airbag may not function properly. This will increase the risk of injury in the event of an accident.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **BMW**

Name **X5**

EC-type approval/model **Type: G5X  
e1\*2007/46\*1918**

Production dates **21.05.2019 to 29.04.2021**

Company recall code **0051270500, 0051280500**

Weekly report number **Report-2021-35**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Sweden**

Alert number **[A12/01264/21](#)**

Product **Extension lead**



Risk type **Electric shock**

**The live pin holes of the sockets are not automatically shuttered when a plug is not inserted. As a result, water could enter and a user or a child could insert an object into live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **7-way multi-socket extension cable - 16A.**

Packaging description **The product is packaged in a clear plastic bag closed with a piece of cardboard.**

Brand **AIGOSTAR**

Name **MULTIPRESA 7 POSIZIONI**

Type / number of model **7X16A/250V~MAX.2500W**

Barcode **8433325186838**

Weekly report number **Report-2021-35**

Alert submitted by **Italy**



Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **10/06/2020**

Alert number **[A12/01265/21](#)**

Product **Extension lead**



Risk type **Electric shock**

**The live pin holes of the sockets are not automatically shuttered when a plug is not inserted. As a result, water could enter and a user or a child could insert an object into live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **6-way multi-socket extension lead - 16A.**

Packaging description **The product is packaged in a clear plastic bag closed with a piece of cardboard.**

Brand **AIGOSTAR**

Name **MULTIPRESA 6 POSIZIONI**

Type / number of model **6X16A/250V~MAX.2500W**

Barcode **8433325178444**

Weekly report number **Report-2021-35**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **10/06/2020**

Alert number **[A12/01266/21](#)**

Product **Extension lead**



Risk type **Electric shock**

**The live pin holes of the sockets are not automatically shuttered when a plug is not inserted. As a result, water could enter and a user or a child could insert an object into live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **5-way multi-socket extension cable.**

Packaging description **The product is packaged in a clear plastic bag closed with a piece of cardboard.**

Brand **AIGOSTAR**

Name **5 WAYS SOCKET**

Type / number of model **5X16A/250V~MAX.2500W**

Barcode **8433325186807**

Weekly report number **Report-2021-35**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **10/06/2020**

Alert number **[A12/01267/21](#)**

Product **Extension lead**



Risk type **Electric shock**

**The live pin holes of the sockets are not automatically shuttered when a plug is not inserted. As a result, water could enter and a user or a child could insert an object into live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **4-way multi-socket extension lead.**

Packaging description **The product is packaged in a clear plastic bag closed with a piece of cardboard.**

Brand **AIGOSTAR**

Name **MULTIPRESA 4 POSIZIONI**

Type / number of model **4X16A/250V~MAX.2500W**

Barcode **8433325186784**

Weekly report number **Report-2021-35**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **10/06/2020**

Alert number **[A12/01268/21](#)**

Product **Extension lead**



Risk type **Electric shock**

**The live pin holes of the sockets are not automatically shuttered when a plug is not inserted. As a result, water could enter and a user or a child could insert an object into live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **7-way multi-socket extension lead.**

Packaging description **The product is packaged in a clear plastic bag closed with a piece of cardboard.**

Brand **AIGOSTAR**

Name **MULTIPRESA SCHUKO 7 VIE**

Type / number of model **S11 10A / P17/11 16A**

Barcode **8433325186753**

Weekly report number **Report-2021-35**

Alert submitted by **Italy**



Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **10/06/2020**

Alert number **[A12/01269/21](#)**

Product **Extension lead**



Risk type **Electric shock**

**The live pin holes of the sockets are not automatically shuttered when a plug is not inserted. As a result, water could enter and a user or a child could insert an object into live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **6-way multi-socket extension lead.**

Packaging description **The product is packaged in a clear plastic bag closed with a piece of cardboard.**

Brand **AIGOSTAR**

Name **6 USCITE MULTIPRESA SCHUKO**

Type / number of model **S11, P17/11**

Barcode **8433325186739**

Weekly report number **Report-2021-35**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **10/06/2020**

Alert number **[A12/01270/21](#)**

Product **Extension lead**



Risk type **Electric shock**

**The live pin holes of the sockets are not automatically shuttered when a plug is not inserted. As a result, water could enter and a user or a child could insert an object into live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **4-way multi-socket extension lead.**

Packaging description **The product is packaged in a clear plastic bag closed with a piece of cardboard.**

Brand **AIGOSTAR**

Name **MULTIPRESA SCHUKO 4 VIE**

Type / number of model **4 VIE P17/11**

Barcode **8433325186708**

Weekly report number **Report-2021-35**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**


Date of entry into force **10/06/2020**

Alert number

**[A12/01272/21](#)**

Product

**Multi-socket adaptor**

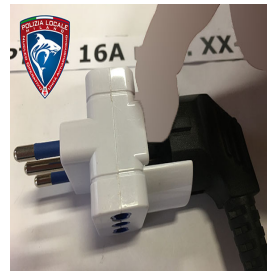

Risk type

**Electric shock**

**The live pin holes of the sockets are not automatically shuttered when a plug is not inserted. As a result, water could enter and a user or a child could insert an object into live parts and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Category

**Electrical appliances and equipment**

Type

**Consumer**

Description

**3-way multi-socket adaptor.**

Packaging description

**The product is packaged in a clear plastic bag closed with a piece of cardboard.**

Brand

**AIGOSTAR**

Name

**3 WAY ADAPTOR 16A**

Type / number of model

**P 17/11, P40**

Barcode

**8433325179700 - 8433325187217**

Weekly report number

**Report-2021-35**

Alert submitted by

**Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **10/06/2020**

Alert number **[A11/00069/21](#)**

Product **Electrical Cables**



Risk type **Fire**

**Due to incorrect amp labelling, excess current is drawn through the cable. This can lead to ignition, which may spread to surrounding combustible materials leading to a fire.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Electrical Cable**

Brand **Pitacs Time**

Name **Pitacs Time 2 Core Electrical Cables**

Type / number of model **2192Y, 3182Y**

Barcode **5055268786796, 5018486437840, 5055268787038, 5055268787007, 5018486486404, 5055268787014, 5055268787045**

Weekly report number **Report-2021-35**

Alert submitted by **Ireland**

Is the product counterfeit? **No**



Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Other : . Other</b>
Date of entry into force	<b>06/05/2021</b>
Measures taken by economic operators	<b>Warning consumers of the risks Manufacturer</b>
Date of entry into force	<b>06/05/2021</b>

Alert number **[A12/01250/21](#)**

Product **Audio Headset**



Risk type **Environment**

**The metal (solder) in the jack contains an excessive amount of lead and of cadmium (measured values up to 87,8 % and 4,7% by weight, respectively). Also, the metal (solder) of the PCB speaker contains an excessive amount of lead (measured values up to 14,9 % by weight). Lead and cadmium pose a risk to the environment.**

**The product does not comply with the requirements of the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).**

Category **Hobby/sports equipment**

Type **Consumer**

Description **White headset**

Packaging description **The packaging is a white cardboard box**

Brand **BLUE STAR**

Name **BLUE STAR AUDIO HEADSET JM36**

Type / number of model **AUDIO HEADSET JM36**

Barcode **5901737377463**

Weekly report number **Report-2021-35**


Alert submitted by	<b>Slovenia</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>02/08/2021</b>
Products were found and measures were taken also in	<b>Lithuania</b>

Alert number

**A12/01255/21**

Product

**LED/UV nail lamp**

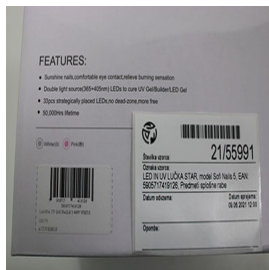

Risk type

**Environment**

**The lead content in different parts of the product is above the concentration limits.**

**Article 4 (1) of Directive 2011/65/EC on the restriction of the use of certain hazardous substances in electric and electronic equipment**

Category

**Electrical appliances and equipment**

Type

**Consumer**

Description

**LED/UV NAIL lamp**

Packaging description

**The packaging is white**

Brand

**Sofi**

Name

**LED/UV nail lamp SOFI NAILS 5**

Type / number of model

**UVLED Nail Lamp**

Barcode

**5905717419126**

Weekly report number

**Report-2021-35**

Alert submitted by

**Slovenia**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market  
Distributor**

Date of entry into force

**02/08/2021**

Alert number **[A12/01253/21](#)**

Product **Elevating platform for waste containers**



Risk type **Cuts  
Entrapment  
Health risk / other**

**- Stability risks; - risks of access to the carrier; - risks due to edges; - risk of the load falling freely; - risk of break-up during operation; - risk of the load falling off the carrier; - risks from falling or ejected objects; - risks in the design of the machinery because it is not watertight.**

**The product does not comply with the requirements of the Machinery Directive 2006/42/EC**

Category **Machinery**

Type **Professional**

Description **Elevating platform for municipal solid waste (MSW) containers**

Brand **TECONSUB**

Type / number of model **Modelo CT4**

Weekly report number **Report-2021-35**

Alert submitted by **Spain**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures ordered by public authorities

**Ban on the marketing of the product and any accompanying measures  
Manufacturer**

Measures ordered by public authorities

**Recall of the product from end users  
Manufacturer**


Measures ordered by public authorities

**Withdrawal of the product from the market  
Manufacturer**



Alert number **[A12/01257/21](#)**

Product **Particle filter mask**

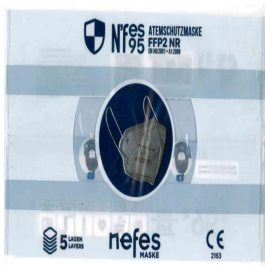

Risk type **Health risk / other**

**The particle/filter retention of the material is insufficient (measured values: as low as 67%). Consequently, the product does not fulfil the health and safety requirements, and an excessive amount of particles or microorganisms might pass through the mask, increasing the risk of infection; thus, even if combined with other recommended measures, it may not properly protect.**

**The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.**

Category **Protective equipment**

Type **Consumer**

Description **White protective respiratory filtration half-face mask, marked with FFP2 and with the CE marking printed on.**

Packaging description **Box with logo, description of the product, quantity (10 units), protective layers (5) and indication of the EN149:2001 + A1:2009 and the filter efficiency (>95%). Instructions for use in English and German.**

Brand **nefes MASKE**

Name **N'fes 95 ATEMSCHUTZMASKE**

Type / number of model **95 FFP2 NR**

Weekly report number **Report-2021-35**



Alert submitted by	<b>Italy</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Turkey</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Importer</b>

Alert number **[A12/01254/21](#)**

Product **Lorry**

Risk type **Injuries**

**The housing of the temperature pressure valve of the gas installation may spontaneously fracture during refueling. If the temperature pressure valve is broken, the relevant gas tank empties completely within a couple of minutes. The consequences of an unintentional gas leak could be anything from an injury to a thermal event, depending on the environmental condition and situation.**

/

Category **Motor vehicles**

Type **Professional**

Description **Lorry**

Brand **Mercedes-Benz**

Name **Actros, Econic**

EC-type approval/model **Type: NGE-L42, NGE-L62N, 963-0-A, 963-4-A, 963-0-C, NGE-L42, NGE-L62N, 963-0-A, 963-4-A, 963-0-C  
Type: e1\*2007/46\*1223\*00-17, e1\*2007/46\*1222\*00-17, e1\*2007/46\*0726\*00-19, e1\*2007/46\*0727\*00-07, e1\*2007/46\*0732\*00-20, e1\*2018/858\*00001\*00-01, e1\*2018/858\*00029\*00-01, e1\*2018/858\*00039\*00, e1\*2018/858\*00040\*00, e1\*2018/858\*00045\*00**

Production dates **From 1.7.2015 to 1.7.2021**

Company recall code **DRU-VENTIL**

Weekly report number **Report-2021-35**

Alert submitted by **Germany**

Is the product counterfeit? **No**


Country of origin **Germany**

Measures taken by economic operators

**Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in

**Poland**

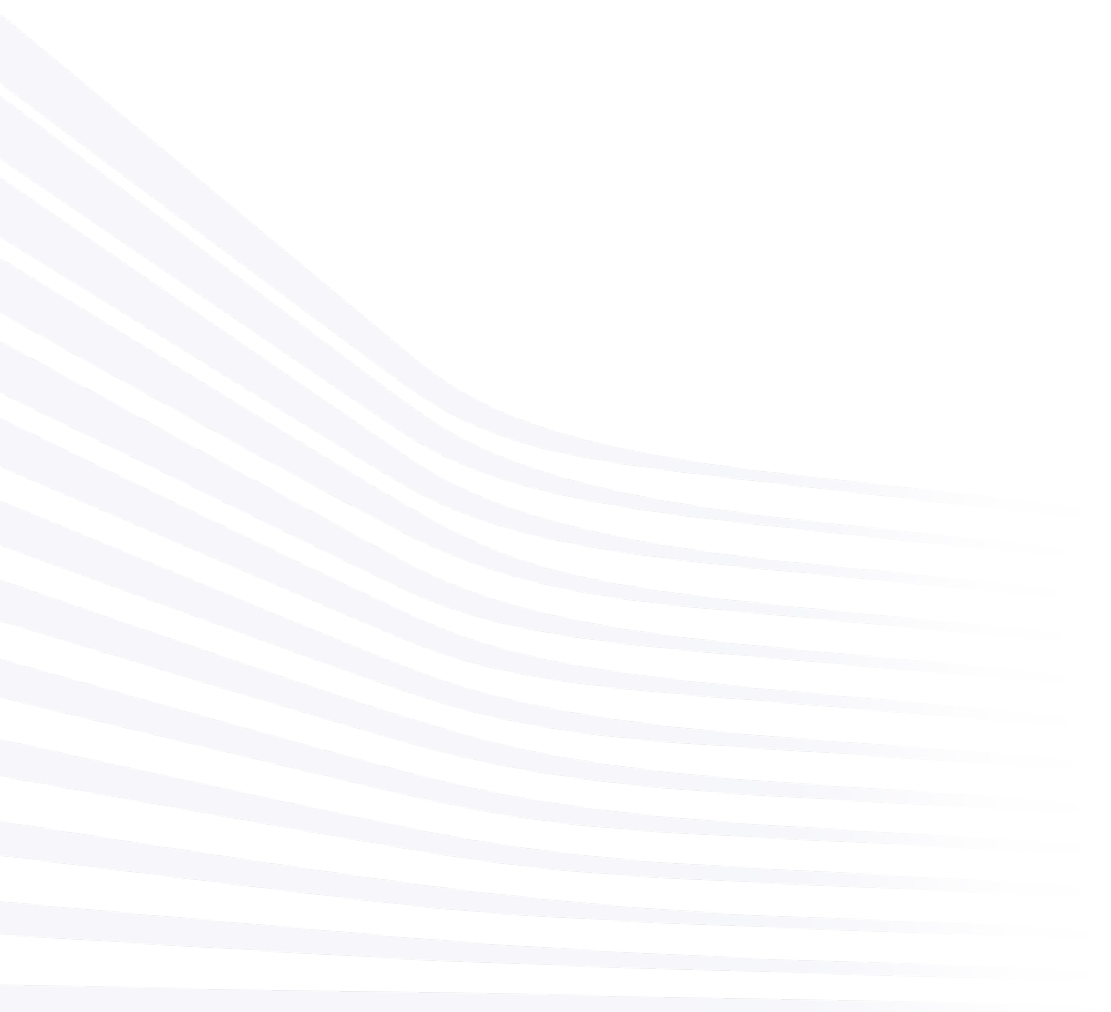

Alert number

**[A12/01251/21](#)**

Product

**Children's car seat**



Risk type

**Injuries**

**In case of a frontal crash, the child car seat (CRS) may not give the protection against head displacement as required. As a consequence, the child could be injured. Furthermore, the mass group in the manual does not correspond to one indicated in the label and for which the product is intended.**

**The product does not comply with Regulation UN/ECE N. 44-04.**

Category

**Childcare articles and children's equipment**

Type

**Consumer**

Description

**Sparco child car seat; 4142 Turvaistuin 0-18 kg, age 0+, I. The product was also sold online.**

Brand

**Sparco**

Name

**Sparco 4142 Turvaistuin, 00923GR, Baby seats / 4142 PO6924**

Type / number of model

**4142 Sparco turvaistuin 0-18 kg**

Batch number

**FI2019049324**

Barcode

**6430039735125**

Weekly report number

**Report-2021-35**

Alert submitted by	<b>Finland</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>02/07/2021</b>
Company recall code	- <a href="https://www.blueimport.fi/wp-content/uploads/2021/08/Sparco_takaisinvento_99x88.pdf">https://www.blueimport.fi/wp-content/uploads/2021/08/Sparco_takaisinvento_99x88.pdf</a>