
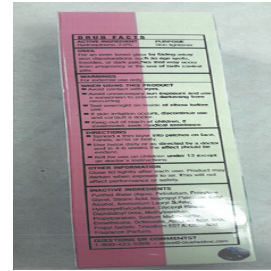


Alert number

**A12/01280/21**

Product

**Skin lightening product**

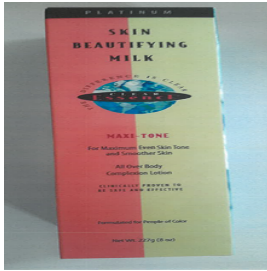

Risk type

**Chemical**

**According to the list of ingredients, the product contains Hydroquinone (2.0%). Hydroquinone can cause skin irritation and dermatitis.**

**The product does not comply with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Skin lightening body Lotion. The product is sold online, in particular via eBay.**

Packaging description

**Two-toned outer cardboard box, pink and beige. One side of the box is blue and white, and contains product information in French.**

Brand

**Clear Essence**

Name

**Platinum Skin Beautifying Milk Maxi-Tone**

Batch number

**#190812-1  
EF141  
Expiry date: 08/21**

Barcode

**737192001002**

Weekly report number

**Report-2021-36**

Alert submitted by

**Ireland**

Is the product counterfeit? **Unknown**


Country of origin **United States**

Measures taken by economic operators **Withdrawal of the product from the market  
Retailer**

Date of entry into force **05/08/2020**

Alert number **[A12/01275/21](#)**

Product **Novelty lighter**

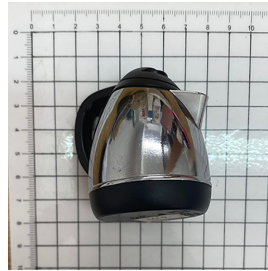

Risk type **Burns  
Fire**

**The lighter is appealing to children and can easily be mistaken as a toy. Children may play with it and suffer burns or cause a fire. No lighter shall be appealing to children.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 13869.**

Category **Lighters**

Type **Consumer**

Description **Novelty lighter in the shape of a kettle.**

Brand **Unknown**

Weekly report number **Report-2021-36**

Alert submitted by **Cyprus**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **26/05/2021**

Alert number **[A12/01276/21](#)**

Product **Novelty lighter**



Risk type **Burns  
Fire**

**The lighter is appealing to children and can easily be mistaken as a toy. Children may play with it and suffer burns or cause a fire. No lighter shall be appealing to children.**

**The products do not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 13869.**

Category **Lighters**

Type **Consumer**

Description **Novelty lighter in the shape of a lipstick.**

Brand **MXM CHINA**

Type / number of model **P10-X08**

Weekly report number **Report-2021-36**

Alert submitted by **Cyprus**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **26/05/2021**

Alert number

**[A12/01287/21](#)**

Product

**Set of soft toys with key ring**



Risk type

**Choking**

**Small parts (a plastic eye from the doll and the ring of the bear-key ring) may easily detach from the toys . A small child may put them in the mouth and choke on them.**

**The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.**

Category

**Toys**

Type

**Consumer**

Description

**Set of 2 handmade soft toys. One in the shape of a girl, the other in the shape of a little bear that is also a key ring. the product was also sold online, in particular via Bol.com**

Packaging description

**There is no packaging for the keychain bear. The girl doll comes with a transparent plastic wrapping and a label.**

Brand

**PARASTU**

Weekly report number

**Report-2021-36**

Alert submitted by

**Belgium**

Is the product counterfeit?

**No**

Country of origin

**Belgium**

Measures taken by economic

**Recall of the product from end users**


operators **Manufacturer**

Date of entry into force **17/08/2021**

Company recall code - <https://www.facebook.com/Parastu.kom/>

Alert number **[A12/01284/21](#)**

Product **Extension lead**

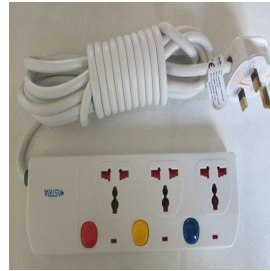

Risk type **Electric shock**

**The diameter of the mains cable too small for the type of plug, leaving live parts accessible. A user may touch a part of the product that is at high voltage and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **3-way multi-socket extension lead.**

Packaging description **The product is packaged in a clear plastic casing with blue cardboard.**

Brand **ASTRA**

Name **3 WAYS SOCKET OUTLET**

Type / number of model **W203S**

Weekly report number **Report-2021-36**

Alert submitted by **Cyprus**

Is the product counterfeit? **Unknown**



Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Date of entry into force **23/08/2021**

Alert number **[A12/01285/21](#)**

Product **Girls' dress**



Risk type **Strangulation**

**The product has cords with free ends at the level of the shoulders. These can become trapped during children's normal activities, resulting in strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Sleeveless dress bearing shoulder straps with free ends to be tied at the shoulder area, designed for 5 years old girls.**

Brand **Joyce**

Type / number of model **21546**

Weekly report number **Report-2021-36**

Alert submitted by **Cyprus**

Is the product counterfeit? **No**

Country of origin **Greece**

Measures ordered by public authorities **Withdrawal of the product from the market  
Distributor**

Date of entry into force **26/04/2021**



Alert number **[A11/00070/21](#)**

Product **Outdoor Light**



Risk type **Electric shock**

**The instruction manual indicates a class of insulation that does not correspond to the product's class (class 1 basic insulation needing earth protection). Thereby, if the product is installed according to the instructions, it will not have earth protection. As a consequence, a person may touch part of the product that is at high voltage and receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60958.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Outdoor light in the shape of a lantern. The product is also sold online.**

Packaging description **Full colour cardboard box.**

Brand **ZINC**

Name **Aaron Outdoor PIR Lantern**

Type / number of model **817/1395  
817/9531**

Weekly report number **Report-2021-36**

Alert submitted by **Ireland**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Other : Provision of an engineer to check the installation of the lantern and earth it if required  
Importer**

Measures taken by economic operators

**Other : Withdrawal of product from the market to rework the stock and provide updated corrected instructions  
Importer**

Date of entry into force

**24/06/2021**

Company recall code

-  
<https://www.argos.ie/static/StaticDisplay/includeName/productRecalls.htm#Aaron-outdoor-PIR-lanterns>

Alert number **[A12/01288/21](#)**

Product **Clothing set**



Risk type **Injuries**

**The short trousers have long cords with free ends in the waist area that can become trapped during children's normal activities, resulting in injuries.**

**The product does not comply with the requirements of the General Product Safety Directive and with the relevant European standard EN 14682.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Set of sleeveless blouse and pair of short trousers designed for 6 year old girls. The short trousers are black and white and bear very long functional cords at the waist area.**

Brand **EBITA**

Type / number of model **214062**

Weekly report number **Report-2021-36**

Alert submitted by **Cyprus**

Is the product counterfeit? **No**

Country of origin **Turkey**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **26/04/2021**



Alert number

**[A12/01274/21](#)**

Product

**Multi gas monitor device**



Risk type

**Burns**

**The product lacks CE marking, manufacturer identification information and technical documentation. Consequently, it might not fulfil the applicable safety and technical requirements and could measure gas concentrations incorrectly, increasing the risk of a gas explosion that could cause burns to the user.**

**The product does not comply with the requirements of the Directive on equipment and protective systems intended for use in potentially explosive atmospheres.**

Category

**Explosive atmospheres equipment**

Type

**Consumer**

Description

**Multi gas monitoring and measuring device. The device is used to measure the concentrations of various gases. Item size: 11.45 x 6.44 x 4.45 cm / 4.50 x 2.53 x 1.75 inches; Item weight: 200 g.**

Packaging description

**Package size: 20 x 11 x 7 cm / 7.87 x 4.33 x 2.75 inches; Package weight: 475 g / 16.8 oz.**

Brand

**Smart Sensor**

Name

**ST8990 Multi Gas Monitor**

Type / number of model

**AS8990**

Weekly report number

**Report-2021-36**



Alert submitted by	<b>Germany</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Stop of sales Manufacturer</b>
Date of entry into force	<b>11/08/2021</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>11/08/2021</b>

Alert number **[A12/01278/21](#)**

Product **Plastic doll**



Risk type **Chemical**

**The product contains an excessive amount of di-2-ethylhexyl phthalate (DEHP) (measured value: 33% by weight) and dibutyl phthalate (DBP)(measured value: 0.32% by weight). These phthalates may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Blue, plastic mermaid doll with a blue fish, starfish and seahorse accessory. It is lit by pressing the switch on her neck.**

Packaging description **Transparent blister with cardboardbox.**

Brand **Le Royal**

Name **Princess Mermaid**

Type / number of model **N.: R20518-2**

Weekly report number **Report-2021-36**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Distributor**


Date of entry into force **01/07/2021**

Measures ordered by public authorities **Recall of the product from end users  
Distributor**

Date of entry into force **01/07/2021**

Alert number **[A12/01277/21](#)**

Product **Plastic doll**

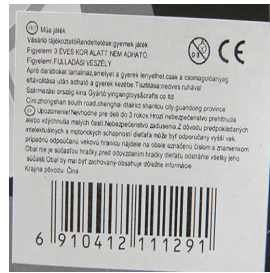

Risk type **Chemical**

**The product contains an excessive amount of di-2-ethylhexyl phthalate (DEHP) (measured value: 32% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Toys**

Type **Consumer**

Description **Blue and pink, plastic mermaid doll with accessories and coloured lights.**

Packaging description **Blister with cardboard back.**

Brand **Lovely**

Name **Lovely**

Type / number of model **N. LY-2603**

Barcode **6910412111291**

Weekly report number **Report-2021-36**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>14/06/2021</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>14/06/2021</b>

Alert number **[A12/01281/21](#)**

Product **Charger**



Risk type **Electric shock**

**The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts.**

**The product does not comply with the requirements of the Low Voltage Directive and the relevant standard EN IEC 62368.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White phone charger; rated voltage 100-240 VAC; nominal frequency 50/60 Hz; output 5 VDC (direct current); rated current (output) 1.0 A; protection against electric shock - class II.**

Packaging description **Plastic cardboard box.**

Brand **HOCO**

Name **hoco.accessory**

Type / number of model **C11**

Barcode **6957531047728**

Weekly report number **Report-2021-36**

Alert submitted by **Lithuania**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Distributor**

Alert number **[A12/01279/21](#)**

Product **Hair gel**



Risk type **Chemical**

**According to the list of ingredients, the product contains the preservatives methylchloroisothiazolinone and methylisothiazolinone (MCI and MI), which are prohibited in leave-on products. Dermal contact with MCI and MI can provoke allergic dermatitis to sensitised persons.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Consumer**

Description **Hair styling gel used on wet and dry hair.**

Packaging description **Transparent plastic jar in various colors (blue, white, yellow, pink and green) with a white screw cap with a volume of 150 ml.**

Brand **Unknown**

Name **bük HAIR STYLING GEL**

Batch number **12-2021**

Barcode **5906608002000**

Weekly report number **Report-2021-36**

Alert submitted by **Czechia**



Is the product counterfeit?

**No**

Country of origin

**Poland**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Retailer**

Date of entry into force

**26/07/2021**

---

Alert number **[A12/01286/21](#)**

Product **Charcoal barbecue**

---



Risk type **Burns  
Fire**

**The horizontal plan of the barbecue becomes too hot reaching a temperature of 87 degrees above the ambient temperature (the limit is 50 degrees). The grill is difficult to manipulate under loading. As a consequence, the user could suffer burns and the product could cause fire.**

**The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 1860-1.**

Category **Kitchen/cooking accessories**

Type **Consumer**

Description **Charcoal barbecue; size: 76x48. The product is also sold online.**

Brand **Naterial**

Name **Icarus Beta**

Type / number of model **62356973**

Barcode **3276000413639**

Weekly report number **Report-2021-36**

Alert submitted by **Cyprus**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Recall of the product from end users  
Retailer**

Date of entry into force

**11/08/2021**

Products were found and measures were taken also in

**Greece**

---

Alert number **[A12/01289/21](#)**

Product **Toy rocking horse**

---



Risk type **Injuries**

**The toy doesn't have the required movement limiters. This causes that the user of the toy is not held within the extreme of the bow. A child may tip over and suffer injuries.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Wooden rocking horse.**

Packaging description **No packaging**

Brand **Unknown**

Name **Kon na biegunach**

Type / number of model **DG 340**

Weekly report number **Report-2021-36**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Poland**

Measures taken by economic operators **Withdrawal of the product from the market  
Manufacturer**

Date of entry into force **06/08/2021**

Measures taken by economic operators **Destruction of the product  
Manufacturer**

Date of entry into force **06/08/2021**

Alert number

**[A12/01283/21](#)**

Product

**Fancy-dress mask**



Risk type

**Burns**

**The mask is easily flammable and the flame propagation is too high. If it catches fire, the child could suffer burns.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-2.**

Category

**Toys**

Type

**Consumer**

Description

**Foam mask in the shape of a pumpkin.**

Brand

**GoDan**

Name

**Foam mask "Pumpkin"**

Type / number of model

**TZ-MPDY**

Barcode

**EAN 5902973137293**

Weekly report number

**Report-2021-36**

Alert submitted by

**Poland**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Destruction of the product  
Importer**

Date of entry into force

**24/08/2021**

Measures taken by economic operators

**Withdrawal of the product from the market  
Importer**

Date of entry into force

**24/08/2021**

Alert number **[A12/01282/21](#)**

Product **Motorcycle**

Risk type **Fire**

**The fuel hose may have been manufactured using a resin-based extrusion mandrel that was larger than design specification, thus it may have an improperly loose connection with the metal fuel hose connection pipe. As a result, fuel may leak at the joining point, increasing the risk of fire.**

**The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of two- or three-wheel vehicles and quadricycles**

Category **Motor vehicles**

Type **Consumer**

Description **Suzuki motorcycles, models: UH125AL9; UH125AM0; UH200AL9.**

Brand **Suzuki**

Name **UH125AL9; UH125AM0; UH200AL9**

EC-type approval/model **e4\*168/2013\*00038\*01; e4\*168/2013\*00038\*02; e4\*168/2013\*00039\*01.**

Production dates **02.04.2018 - 05.06.2020**

Company recall code **97FW**

Weekly report number **Report-2021-36**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Thailand**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**



Products were found and  
measures were taken also in

**Greece  
Croatia  
Ireland**

