
Alert number **[A12/01683/21](#)**

Product **Passenger car**

Risk type **Fire**

The plug-in coupling of the fuel line may rupture. This can result in the uncontrolled penetration of petrol into the engine compartment and cause a vehicle fire, increasing the risk of injury to persons inside and outside the vehicle and a risk of damage to property.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Jeep**

Name **Wrangler**

EC-type approval/model **e4*2001/116*0116*34, Type JK**

Production dates **24.01.2020 to 18.03.2020**

Company recall code **Y10**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/01682/21](#)**

Product **Passenger car**

Risk type **Fire**

If the earth cable of the 48-V battery in the Focus is not fully secured, this can cause electrical problems and overheating of the earth cable. This can cause a vehicle fire in extreme cases.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Ford**

Name **Focus**

EC-type approval/model **e13*2007/46*1911*08 - *11, Type: DEH**

Production dates **13.08.2020 - 19.01.2021**

Company recall code **21S36**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <http://www.etis.ford.com>**

Products were found and
measures were taken also in

France

Alert number **[A12/01670/21](#)**

Product **Milling machine**



Risk type	<p>Electric shock Injuries</p> <p>Safety parts of the machine's control system (emergency stop, main switch lockable in switch off position, interlocking safety guard, mode selector) that are not connected to a safe part of the machine's control system may fail. As a consequence, the operator may get an electric shock or suffer injury.</p> <p>The product does not comply with the requirements of the Machinery Directive and the European standards EN ISO 12100:2011, EN 60204-1:2019.</p>
Category	Machinery
Type	Professional
Description	Vertical and horizontal milling machine
Brand	HAAS MILL
Name	HAAS MINIMILL
Type / number of model	1161894
Weekly report number	Report-2021-48
Alert submitted by	Slovakia
Is the product counterfeit?	No

Country of origin

United States

Measures taken by economic operators

**Recall of the product from end users
Distributor**

Date of entry into force

24/08/2021

Alert number

[A12/01636/21](#)

Product

Particle filter mask



Risk type

Health risk / other

The product bears a CE marking but its filtering capacity has not been tested by a relevant competent European conformity assessment body. The visual inspection of the product reveals that its material composition, structure and shape are inappropriate. Consequently, it is not proven that the product fulfils the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Protective respiratory filtration half-face mask with the CE marking printed on.

Packaging description

Masks wrapped in cellophane envelopes and placed in cardboard packaging bearing information on the batch, the year and month of production and the expiry date; CE marking mentions the standard EN 149.

Brand

GAOZHEN

Name

Disposable Face Mask

Type / number of model

**2020DFM LIP
Type Adult GZ1**

Batch number	20A-LIP-GZ Expiry date: 11.2021 Production date: 05.2020
Weekly report number	Report-2021-48
Alert submitted by	Italy
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Importer
Date of entry into force	04/08/2020

Alert number **[A12/01641/21](#)**

Product **Cutting mat**



Risk type **Chemical**

The green plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 1.6% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Other**

Type **Consumer**

Description **A green plastic cutting mat**

Packaging description **Transparent plastic**

Brand **Unknown**

Type / number of model **B 3045**

Barcode **6417027116166**

Weekly report number **Report-2021-48**

Alert submitted by **Finland**

Is the product counterfeit? **No**

Country of origin **Taiwan**

Measures ordered by public
authorities

**Import rejected at border
Importer**

Date of entry into force

12/11/2021

Alert number **[A12/01671/21](#)**

Product **Motorcycle**

Risk type **Injuries**

The break caliper's safety cotter pin may be damaged. This could cause the rider to fall off the motorcycle, increasing the risk of injury.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of two- or three-wheel vehicles and quadricycles.

Category **Motor vehicles**

Type **Consumer**

Description **Motorcycle**

Brand **GASGAS
HUSQVARNA**

Name **Husqvarna TE; Husqvarna FE; GASGAS EC; GASGAS EC F**

EC-type approval/model
**e1*168/2013*00023*03
e1*168/2013*00051*03
e1*168/2013*00241*00
e1*168/2013*00241*01
e1*168/2013*00242*00
e1*168/2013*00242*01**

Production dates
**GASGAS EC F: MY 2022
GASGAS EC: MY 2021
GASGAS EC: MY 2022
Husqvarna FE: MY 2022
Husqvarna TE: MY 2022**

Company recall code
**13_1952218
13_1952219**

Weekly report number **Report-2021-48**

Alert submitted by **Austria**



Is the product counterfeit? **No**

Country of origin **Austria**

Measures taken by economic operators	Recall of the product from end users Manufacturer
Date of entry into force	10/11/2021
Measures taken by economic operators	Recall of the product from end users Manufacturer
Date of entry into force	19/11/2021
Company recall code	- https://www.gasgas.com/de-at/service/safety-information.html - https://www.husqvarna-motorcycles.com/de-de/service/safety-information.html
Products were found and measures were taken also in	France Greece Luxembourg Sweden

Alert number **[A12/01648/21](#)**

Product **Baby soother**

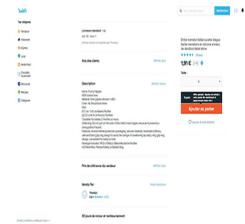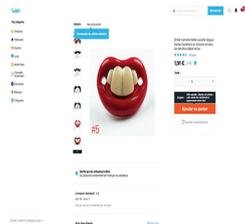

Risk type **Chemical**

The product contains Bisphenol A (BPA) (measured value: 0.1 mg/kg). BPA may damage fertility and has been identified as a substance affecting the hormonal systems of humans and animals.

The product does not comply with the requirements of the General Product Safety Directive and the relevant European standard EN 1400.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Baby soother made of a red and beige plastic collar in the shape of a mouth with teeth, and a flexible, transparent plastic teat. Sold online, namely via Wish.**

Packaging description **Plastic bag**

Brand **Unknown**

Name **Drôle mamelon bébé sucette blague barbe mamelons en silicone anneau de dentition bébé tétine**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Products were found and measures were taken also in

Ireland

Alert number **[A12/01650/21](#)**
Product **Babies' soother**



Risk type **Chemical**

The product contains Bisphenol A (BPA) (measured value: 8.59 mg/kg). BPA may damage fertility and has been identified as a substance affecting the hormonal systems of humans and animals.

The product does not comply with the requirements of the General Product Safety Directive and the European standard EN 1400.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Babies' soother comprising a blue translucent plastic guard and a transparent flexible plastic nipple. The product is sold online, in particular via Wish.**

Packaging description **Thermoformed plastic blister packaging/cardboard.**

Brand **MUMLOVE**

Name **Sucette anti-poussière en silicone Silicone Le sommeil de bébé Calme la bouche ne contient pas de ni**

Type / number of model **P1048-YLL913--BU-01-C02L 13**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures taken by economic operators

**Withdrawal of the product from the market
Other**

Products were found and measures were taken also in

Ireland

Alert number **[A12/01678/21](#)**

Product **Passenger car**

Risk type **Injuries**

The clutch pressure plate may overheat, resulting in an increased risk of fire.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Jeep**

Name **Gladiator, Wrangler**

EC-type approval/model **Einzelabnahmen, Typen: JT, JL**

Production dates **10.7.2020 - 19.2.2021**

Company recall code **Y01**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/01646/21](#)**

Product **Wooden puzzle**



Risk type **Choking**

The product contains loose small parts. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **The toy is made of 18 different colored wooden parts of geometric shape, which are placed on a wooden plywood in the shape of a square.**

Packaging description **Transparent plastic foil.**

Brand **Unknown**

Type / number of model **STJ140038**

Barcode **5902388607787**

Weekly report number **Report-2021-48**

Alert submitted by **Slovakia**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators	Withdrawal of the product from the market Distributor
Date of entry into force	14/10/2021
Measures taken by economic operators	Recall of the product from end users Distributor
Date of entry into force	14/10/2021
Measures taken by economic operators	Warning consumers of the risks Distributor
Date of entry into force	14/10/2021

Alert number **[A12/01647/21](#)**

Product **Bus/coach**

Risk type **Injuries**

Supports and brackets for TFT monitors may have a limited lifespan. The supports/brackets concerned are special orders from customers. In the event of a fault (fatigue failure), these may break and fall into the passenger area together with the monitor. This may cause injuries.

/

Category **Motor vehicles**

Type **Professional**

Description **Bus/coach**

Brand **MAN**

Name **Lion's City 12, Lion's City 18, Lion's City 19**

EC-type approval/model **e1*2007/46*1955*02-08, e1*2007/46*1956*02, 04, 05-07, 09, Type: B.2007.46.017, B.2007.46.018**

Production dates **From 03.04.2017 to 22.07.2021**

Company recall code **7699TR**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/01638/21](#)**

Product **Motorcycle**

Risk type **Injuries**

The engine speed may decrease momentarily when quickly opening the throttle from the fully closed position to a slightly opened position. As a result, the engine could stall at the time of starting or stopping, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of two- or three-wheel vehicles and quadricycles.

Category **Motor vehicles**

Type **Consumer**

Description **Honda motorcycles manufactured in Kumamoto factory. Model code X-ADV750M (RH10), NSS750M (RH11), NC750XDM (RH9); Mode year: 2021**

Packaging description **VIN's: X-ADV750M (from JH2RH10A4MK000017 to JH2RH10A0MK013556), NSS750M (from JH2RH11A6MK000020 to JH2RH11A3MK008740) and NC750XDM (from JH2RH09B5MK000016 to JH2RH09B0MK006872).**

Brand **Honda**

Name **X-ADV750M, NSS750M, NC750XDM**

EC-type approval/model **e6*168/2013*00057*00, e6*168/2013*00064*00, e6*168/2013*00066*00**

Production dates **NC750XDM (from 23 December 2020 to 14 September 2021)
NSS750M (from 29 September 2020 to 14 September 2021)
X-ADV750M (from 23 October 2020 to 6 September 2021)**

Company recall code **3MD**

Weekly report number **Report-2021-48**

Alert submitted by **Portugal**

Is the product counterfeit?

No

Country of origin

Japan

Measures taken by economic operators

**Recall of the product from end users
Importer**

Products were found and measures were taken also in

**Estonia
Greece
Croatia
Ireland
Poland
Sweden
Slovenia
Slovakia**

Alert number **[A12/01640/21](#)**

Product **Passenger car**

Risk type **Injuries**

A software error in the control unit for the instrument cluster may result in no visual or audible warning being given when passengers in the rear seat do not have their seatbelt fastened, increasing the risk of injuries in the event of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Seat**

Name **Arona, Ibiza**

EC-type approval/model **KJ
e9*2007/46*3134*31**

Production dates **14.6.2021 - 23.6.2021**

Company recall code **90S5**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

- **<http://seat>**

Company recall code

Products were found and
measures were taken also in

Greece
Sweden

Alert number **[A12/01654/21](#)**

Product **Multiplug socket**



Risk type **Electric shock**

The product is improperly designed and not adequately protected against electric shock. Furthermore, it has no earth connection. The user could consequently touch live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White rounded multiplug socket. On the label there is indicated the code P3-6, and on the multiplug socket the code TC-3.**

Brand **Unknown**

Type / number of model **P3-6
TC-3**

Barcode **631137076833**

Weekly report number **Report-2021-48**

Alert submitted by **Lithuania**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Withdrawal of the product from the market
Importer**

Date of entry into force

17/11/2021

Alert number **[A12/01639/21](#)**

Product **Passenger car**

Risk type **Injuries**

The object recognition function may work incorrectly under certain circumstances. As a result, the 'Eyesight' emergency braking function could be inadvertently activated, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Subaru Outback, Model year: 2021**

Brand **Subaru**

Name **Outback**

EC-type approval/model **e13*2018/858*00010*00; e1*2007/46*1320*05;**

Production dates **Model year: 2021**

Company recall code **SRT315**

Weekly report number **Report-2021-48**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and **Greece
Ireland**

measures were taken also in

Sweden
Slovakia



Alert number **[INFO/00167/21](#)**

Product **Lighting chain**



Risk type **Electric shock**

The mechanical strength and the water resistance of the control device are not sufficient. As a result, the user could touch accessible live parts or the water could penetrate the product, which may cause an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60598.

Category **Lighting chains**

Type **Consumer**

Description **Lighting chain with a length of 5 m with a device for changing the lighting mode.**

Packaging description **Blue and white cardboard box.**

Brand **Unknown**

Name **LED LIGHTS**

Weekly report number **Report-2021-48**

Alert submitted by **Slovakia**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public authorities

Import rejected at border
Importer



Alert number **[A12/01657/21](#)**

Product **Passenger car**

Risk type **Injuries**

The seatbelt reminder for the rear left and middle seats could fail, i.e. neither visual nor audible indication of whether or not the seat belts are in use, which may increase the risk of injury to passengers.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Fiat**

Name **Talento**

EC-type approval/model **e2*2007/46*0497*19/ FFL**

Production dates **22.7.2021 - 26.7.2021**

Company recall code **6373**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and **Poland**

measures were taken also in



Alert number **[A12/01649/21](#)**

Product **Babies' soother**



Risk type **Chemical**

The product contains Bisphenol A (BPA) (measured value: 0.1 mg/kg). BPA may damage fertility and has been identified as a substance affecting the hormonal systems of humans and animals.

The product does not comply with the requirements of the General Product Safety Directive and the European standard EN 1400.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Babies' soother with the trade name "Elodie details", black, white and gold, representing a monkey head. The product is sold online.**

Brand **Elodie Details**

Name **Elodie details Sucette Playful pepe**

Type / number of model **30100103620NA**

Barcode **7350041670179**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin

Thailand

Measures taken by economic operators

**Withdrawal of the product from the market
Other**

Measures taken by economic operators

**Recall of the product from end users
Distributor**

Alert number **[A12/01644/21](#)**

Product **Plastic toy**



Risk type **Chemical Choking**

The button cell batteries are easily accessible. A child might put them in the mouth and swallow them, which may lead to choking if they enter the airways, or could cause damages to the gastrointestinal tract if they are ingested.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 62115.

Category **Toys**

Type **Consumer**

Description **Plastic toy bird, battery powered.**

Packaging description **Plastic blister.**

Brand **Unknown**

Name **Parrot Birds**

Type / number of model **5022**

Barcode **5900851713935**

Weekly report number **Report-2021-48**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures taken by economic operators

**Withdrawal of the product from the market
Importer**

Date of entry into force

26/10/2021

Alert number

[A12/01645/21](#)

Product

Toy musical instrument set



Risk type

**Choking
Cuts
Damage to hearing**

The rattles can easily break, resulting in small parts, and their handles are too long. A small child may put them in the mouth and choke. The drum can break easily, creating sharp edges which may cause cuts. Moreover, the warning on the safe use of a percussion toy is missing. If the toy is used improperly it may cause damage to hearing.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category

Toys

Type

Consumer

Description

Set of toy musical instruments consisting of a drum with two drumsticks, two maracas rattles, a trumpet-shaped rattle and a rattle with metal bells.

Packaging description

Plastic bag.

Brand

Unknown

Name

Baby musical instruments

Type / number of model

**8838-3A
BZES1781**

Barcode

5902719771781

Weekly report number

Report-2021-48

Alert submitted by	Poland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Importer
Date of entry into force	22/10/2021
Products were found and measures were taken also in	Estonia

Alert number **[A12/01663/21](#)**

Product **Passenger car**

Risk type **Injuries**

The electric tailgate has a defective spindle drive which may cause a pre-tensioned spring to come loose from the housing and injure persons standing nearby.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **VW**

Name **Touareg**

EC-type approval/model **CR
e1*2007/46*1827*##**

Production dates **19/01/2019 - 28/01/2019**

Company recall code **55L6**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Slovakia**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **France
Croatia
Ireland**

**Romania
Sweden
Slovenia**



Alert number **[A12/01642/21](#)**

Product **Electric plug**



Corrigendum	The product is covered by the General Product Safety Directive, as rightly indicated by the national authority.
Risk type	Electric shock The user could receive an electric shock from accessible (live) parts. The product does not comply with the requirements of the General Product Safety Directive.
Category	Electrical appliances and equipment
Type	Consumer
Description	White electric plug, without grounding.
Packaging description	Plastic bag
Brand	PLAST-ROL
Name	Electric plug
Type / number of model	ZN-11
Barcode	5906197307913
Weekly report number	Report-2021-48
Alert submitted by	Lithuania

Is the product counterfeit?

No

Country of origin

Unknown

Measures ordered by public
authorities

**Withdrawal of the product from the market
Importer**

Alert number **[A12/01656/21](#)**

Product **Adjustable wrench**



Risk type **Chemical**

The black material of the handle contains an excessive amount of lead. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.

The product does not comply with the REACH Regulation.

Category **Hand tools**

Type **Consumer**

Description **Adjustable wrench with black/yellow handle**

Packaging description **Transparent plastic pouch**

Brand **FXA**

Name **FXA adjustable wrench 150 mm**

Type / number of model **FXA200089, 501810054**

Barcode **6438313304517**

Weekly report number **Report-2021-48**

Alert submitted by **Finland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **23/11/2021**

Alert number **[A12/01680/21](#)**

Product **Passenger car**

Risk type **Injuries**

The screws of the brake line assembly may not have been properly tightened on the front right wheel housing. This could lead to a significant loss of brake fluid, impairing the correct functioning of the brakes and increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Volkswagen (VW)**

Name **TIGUAN**

EC-type approval/model **e1*2001/116*0450*##**

Production dates **06.09.2021 - 08.10.2021**

Company recall code **19Q5**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Mexico**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force

05/11/2021

Products were found and
measures were taken also in

**Romania
Sweden**

Alert number **[A12/01681/21](#)**

Product **Passenger car**

Risk type **Injuries**

When the button for the electric liftgate is pressed and the key is still in the vehicle, all of the side doors are locked and cannot be opened. To unlock the doors, users have to enter the vehicle through the liftgate, increasing the risk of a injury.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **MAZDA**

Name **3**

EC-type approval/model **e13*2007/46*1972*00 e13*2007/46*1972*01
e13*2007/46*1972*02 e13*2007/46*1972*03**

Production dates **6 November 2018 - 28 May 2019**

Company recall code **AK056A**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **22/11/2021**

Products were found and
measures were taken also in **Slovakia**

Alert number **[A12/01637/21](#)**

Product **Hair dryer**



Risk type **Electric shock**

The distance between the heater and the safety grille is less than required. The mains cable is not properly protected against pulling and twisting. The insulation and size of the pins of the mains plug are inappropriate, leaving live parts accessible. The user may touch the live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60335.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White plastic-covered hair dryer with 2 speeds and 3 temperature settings.**

Packaging description **Packaging: colourful cardboard box.**

Brand **Unknown**

Name	Hairdryer - Intelligent design
Type / number of model	2600
Barcode	6902105050130
Weekly report number	Report-2021-48
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	08/11/2021
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Importer
Date of entry into force	08/11/2021

Alert number **[A12/01662/21](#)**

Product **Passenger car**

Risk type **Injuries**

Certain of the vehicles concerned may unexpectedly stop during driving due to inadvertent activation of the Smart Brake Support system, thereby increasing the risk of collision with a following vehicle.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **MAZDA**

Name **Mazda3 (BP), Mazda CX-30 (DM)**

EC-type approval/model **e13*2007/46*1972*00 e13*2007/46*1972*01
e13*2007/46*1972*02 e13*2007/46*1972*03
e13*2007/46*1972*05 e13*2007/46*2041*00
e13*2007/46*2041*01**

Production dates **6/11/2018 - 19/10/2019**

Company recall code **AK072A**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **17/11/2021**

Company recall code - <https://www.mazda.fr/proprietaires/campagne-rappel/>

Products were found and
measures were taken also in
**Iceland
Slovenia
Slovakia**

Alert number **[A12/01658/21](#)**

Product **Passenger car**

Risk type **Injuries**

In certain vehicles with a calliper disc-brake system, the bolts of the brake callipers on the front axle may not meet the specifications. A brake calliper can detach during braking, which may lead to braking power being reduced and components being lost. That would increase the potential risk of accidents, including for the following traffic.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **MERCEDES-BENZ**

Name **Classe E - CLS - Classe S**

EC-type approval/model **e1*2001/116*0501*51 e1*2007/46*1818*14
e1*2007/46*2115*05**

Production dates **10/2021**

Company recall code **4291015**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic **Recall of the product from end users**

operators

Distributor

Date of entry into force

02/11/2021

Products were found and
measures were taken also in

Greece

Alert number **[A12/01665/21](#)**

Product **Lighting chain**



Risk type

**Burns
Electric shock
Fire**

The cross-sectional area of the external and internal wires is too thin and they can overheat, leading to burns or fire. In the event of damage of the base-insulated wires, the active parts may become accessible, which may cause an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60598.

Category

Lighting chains

Type

Consumer

Description

Lighting chain with 380 non-replaceable LED lamps. The product includes a socket outlet that allows the connection of another lighting chain.

Packaging description

Transparent plastic box

Brand	Unknown
Name	3.0M x 3.0M/LED MERRY CHRISTMAS
Type / number of model	XM-380-R-C-LN
Barcode	6902104579052
Weekly report number	Report-2021-48
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Import rejected at border Importer
Date of entry into force	22/10/2021

Alert number **[A12/01651/21](#)**

Product **Plastic doll**



Risk type **Chemical**

The product contains an excessive amount of di-2-ethylhexyl phthalate (DEHP) (measured value: 38% by weight) and dibutyl phthalate (DBP)(measured value: 0.18% by weight). These phthalates may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll with brown hair in white wedding dress.**

Packaging description **Cardboard box with transparent window.**

Brand **Unknown**

Name **Fashion Girl Beautiful Girl**

Type / number of model **DJ389**

Barcode **6219072251836**

Weekly report number **Report-2021-48**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **21/06/2021**

Alert number **[A12/01653/21](#)**

Product **Plastic doll**



Risk type **Chemical**

The product contains an excessive amount of di-2-ethylhexyl phthalate (DEHP) (measured value: 37% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll with blond hair in pink lace dress.**

Packaging description **Cardboard box with transparent window.**

Brand **ABABABY**

Name **Barbie baba**

Type / number of model **1968A**

Weekly report number **Report-2021-48**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

23/07/2021

Alert number **[A12/01652/21](#)**

Product **Plastic doll**



Risk type **Chemical**

The product contains an excessive amount of di-2-ethylhexyl phthalate (DEHP) (measured value: 35% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Pregnant plastic doll with brown hair in purple dress.**

Packaging description **Cardboard box with transparent window.**

Brand **Abababy**

Name **Fashion Pregnant Woman / Barbie baba**

Type / number of model **SH196A**

Barcode **6220072263217**

Weekly report number **Report-2021-48**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures ordered by public
authorities


**Withdrawal of the product from the market
Distributor**

Date of entry into force

01/07/2021

Alert number **[A12/01660/21](#)**

Product **Plastic doll**

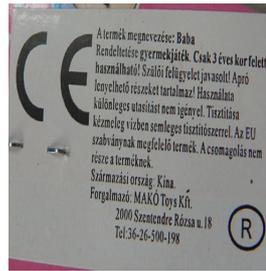

Risk type **Chemical**

The plastic material of the doll's head contains an excessive amount of di-2-ethylhexyl phthalate (DEHP) (measured value: 23% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic baby doll with baby bottle, drinking glass, feeding bowl, spoon and hair dryer.**

Packaging description **Plastic bag with cardboard closure**

Brand **HX Toys**

Name **BaBy's WORLD**

Type / number of model	0721
Barcode	5998665728375
Weekly report number	Report-2021-48
Alert submitted by	Hungary
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	19/07/2021
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	19/07/2021

Alert number **[A12/01655/21](#)**

Product **Inflatable armbands**



Risk type **Chemical**

The product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured values up to 11% by weight). This phthalate may harm the health of children causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Purple inflatable armbands for children above 3 years old with a large blue dolphin print.**

Packaging description **Transparent bag**

Brand **Unknown**

Name **Arm circle**

Type / number of model **CT:960**

Batch number **PBN161E-H15-9**

Barcode **6912372016173
6915101400014**

Weekly report number **Report-2021-48**

Alert submitted by	Czechia
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Retailer
Date of entry into force	10/11/2021

Alert number

[A12/01664/21](#)

Product

Toy bow with arrows



Risk type

Choking

The suction cups of the projectile can easily detach. If a child puts the projectile in the mouth, the suction cups can obstruct the airways and lead to choking.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category

Toys

Type

Consumer

Description

The toy consists of: a black rigid plastic toy pistol with a spring-loaded ejection mechanism and three black rigid plastic projectiles with orange polymeric suction cups; yellow and green toy bow and three green rigid plastic arrows with orange polymer suction cups.

Packaging description

Cardboard back packaging with see-through front.

Brand

Unknown

Name

Shooting Interesting Game

Type / number of model

516022002/1PC

Barcode

4772013161059

Weekly report number

Report-2021-48

Alert submitted by	Lithuania
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	23/11/2021

Alert number **[A12/01667/21](#)**

Product **Elektrisch speelgoedvlak**



Risk type **Environment**

Category **Toys**

Type **Consumer**

Description **Speelgoed is gemaakt van stijf kunststof. Het speelgoed heeft een ingebouwde plastic batterijdoos voor drie AA-batterijen van elk 1,5 V. Met een druk op de knop beweegt het speelgoed, zendt geluid en lichteffecten uit.**

Packaging description **Kartonnen doos.**

Brand **Unknown**

Name **Battleplan Battle**

Type / number of model **art. NO. 3262**

Barcode **2000511104394**

Weekly report number **Report-2021-48**

Alert submitted by **Lithuania**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public **Withdrawal of the product from the market**

authorities

Importer

Date of entry into force

23/11/2021

Alert number

[A12/01669/21](#)

Product

Badspeelgoed set



Risk type **Choking**

Category **Toys**

Type **Consumer**

Description **Set van 6 kleurrijke, fluitende plastic ballen. Voor kinderen ouder dan 6 maanden.**

Packaging description **Verpakkingen: plastic zak met kartonnen sluiting**

Brand **Apel Plastik**

Name **MORBIDONI**

Type / number of model **AP1901-05 N/82**

Barcode **8010380387242**

Weekly report number **Report-2021-48**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **19/10/2021**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **19/10/2021**

Alert number **[A11/00105/21](#)**

Product **Slaapzak**



Risk type **Suffocation**

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Een roze 2,5 tog slaapzak met eenhoorns, regenbogen, olifanten en konijnen.**

Brand **Dunnes Stores**

Name **Unicorn Sleep & Grow Baby Sleep Bag Unicorn Sleep**

Type / number of model **6454486**

Barcode **5099011588787**

Weekly report number **Report-2021-48**

Alert submitted by **Ireland**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users
Importer**

Date of entry into force **19/11/2021**

Alert number **[A12/01666/21](#)**

Product **Muggenracket**



Risk type **Environment**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Een elektrisch racket met zwart handvat, gemaakt voor het doden van muggen.**

Packaging description **Transparant hard plastic.**

Brand **Duga**

Name **Insektsracket**

Type / number of model **55951**

Barcode **7331598559513**

Weekly report number **Report-2021-48**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures taken by economic operators **Withdrawal of the product from the market
Retailer**

Date of entry into force **21/11/2021**



Alert number

[A12/01659/21](#)

Product

Speelgoed muziekinstrumenten set



Risk type

Choking

Category

Toys

Type

Consumer

Description

Speelgoed set met 4 instrumenten en twee varkensfiguren.

Brand

Unknown

Name

The product contains Chinese inscriptions.

Type / number of model

733A-207

Barcode

6931922301132

Weekly report number

Report-2021-48

Alert submitted by

Hungary

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures ordered by public authorities

**Recall of the product from end users
Distributor**

Date of entry into force

07/06/2021

Measures ordered by public

Withdrawal of the product from the market

authorities **Distributor**


Date of entry into force **07/06/2021**

Alert number

[A12/01661/21](#)

Product

Speelgoed keukenset

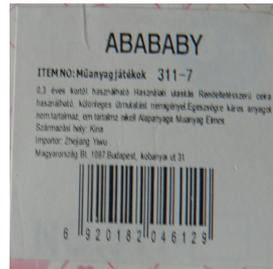

Risk type **Suffocation**

Category **Toys**

Type **Consumer**

Description **Speelgoedset met kunststof keukengerei, citroen, kool, gebakken eieren en hotdogs.**

Packaging description **Plastic zak met kartonnen sluiting.**

Brand **FL/Feng LE (Abababy)**

Name **Kitchen Set**

Type / number of model **311-7**

Barcode **6920182046129**

Weekly report number **Report-2021-48**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **30/06/2021**



Alert number **[A12/01672/21](#)**

Product **Personenauto's**

Risk type **Injuries**

Category **Motor vehicles**

Type **Consumer**

Description **Personenauto's**

Brand **Audi**

Name **E-Tron**

EC-type approval/model **e1*2007/46*1914, Type: GE**

Production dates **06/05/2021 - 14/07/2021**

Company recall code **47R7**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **France
Ireland
Sweden**

Alert number **[A12/01673/21](#)**

Product **Auto**

Risk type **Injuries**

Category **Motor vehicles**

Type **Consumer**

Description **Auto**

Brand **Mercedes-Benz**

Name **EQC**

EC-type approval/model **e1*2001/116*0480*31 - 42, Type: 204X**

Production dates **22.2.2019 to 17.12.2020**

Company recall code **4694013**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code - **<https://www.mercedes-benz.de>**

Products were found and measures were taken also in **France
Greece
Ireland
Luxembourg**

Alert number **[A12/01674/21](#)**
Product **Personenauto's**

Risk type **Injuries**
Category **Motor vehicles**
Type **Consumer**
Description **Personenauto's**
Brand **BMW**
Name **IX**

EC-type approval/model **e1*2018/858*00109, Type: BMWi-N**

Production dates **13.10.2020 to 17.09.2021**

Company recall code **51300500**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Greece
Sweden**

Alert number **[A12/01675/21](#)**

Product **Auto/vrachtwagen**

Risk type **Fire**

Category **Motor vehicles**

Type **Consumer**

Description **Auto/vrachtwagen**

Brand **Mercedes-Benz**

Name **Sprinter**

EC-type approval/model **e1*2007/46*0296*15, e1*2007/46*0301*22 - *23, Type: 906BB50, 906BB35**

Production dates **27.5.2021 to 1.6.2021**

Company recall code **VS3KANALI (1595063)**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/01676/21](#)**

Product **Auto/vrachtwagen**

Risk type **Fire**

Category **Motor vehicles**

Type **Consumer**

Description **Auto/vrachtwagen**

Brand **Mercedes-Benz**

Name **Sprinter**

EC-type approval/model **Type: 906 AC, 35 906 AC 35/4x4, 906BB50, 906BB35, 906BB50/4x4, 906BB35/4x4, e1*2001/116*0354*28, e1*2001/116*0424*19, e1*2007/46*0296*16, e1*2007/46*0301*23, e1*2007/46*0304*10, e1*2007/46*0305*15**

Production dates **16.6.2021 to 16.8.2021**

Company recall code **VS3KABKAN (1595062)**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Greece
Ireland
Luxembourg**

Alert number **[A12/01679/21](#)**

Product **Personenauto's**

Risk type **Injuries**

Category **Motor vehicles**

Type **Consumer**

Description **High-performance sportwagen**

Brand **Ferrari**

Name **FERRARI ROMA**

Production dates **January 2021 - July 2021**

Company recall code **77**

Weekly report number **Report-2021-48**

Alert submitted by **Italy**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **01/09/2021**

Products were found and measures were taken also in **Sweden**

Alert number **[A12/01677/21](#)**

Product **Banden**

Risk type **Injuries**

Category **Motor vehicles**

Type **Consumer**

Description **Banden**

Brand **OVATION**

Name **Tyre**

Production dates **23.11.2020 - 29.11.2020**

Company recall code **OVATION VI-789 (DOT 4720)**

Weekly report number **Report-2021-48**

Alert submitted by **Germany**


Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Importer**

Alert number **[A12/01685/21](#)**

Product **Teddybeer**

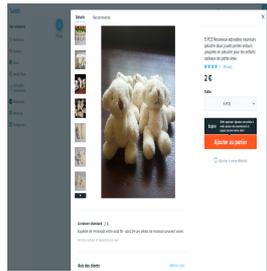

Risk type **Choking**

Category **Toys**

Type **Consumer**

Description **Kleine witte teddybeer met een lus op zijn hoofd. Product online verkocht, vooral op Wish.**

Brand **Unknown**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **Unknown**


Country of origin **People's Republic of China**

Measures taken by economic operators **Removal of this product listing by the online marketplace
Other**

Products were found and measures were taken also in **Ireland**

Alert number **[A12/01684/21](#)**

Product **Zacht speelgoed**

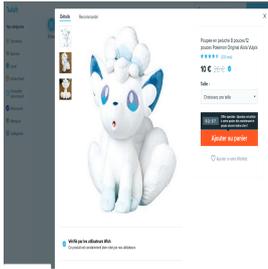

Risk type **Chemical
Choking
Suffocation**

Category **Toys**

Type **Consumer**

Description **Zacht speelgoed in de vorm van een denkbeeldig dier (pokemon-like), blauw en wit met een kleine snaar en een zuignap. Product online verkocht, vooral op Wish.**

Brand **Unknown**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Removal of this product listing by the online marketplace
Other**

Products were found and measures were taken also in **Ireland**

Alert number	<u>A12/01686/21</u>
Product	Speelgoedtelefoon



Risk type	Choking Suffocation
Category	Toys
Type	Consumer
Description	Speelgoed telefoon op wielen die muziek afspeelt. Hoofdkleuren: groen en geel. Product ook online verkocht.
Brand	Unknown
Weekly report number	Report-2021-48
Alert submitted by	France
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Removal of this product listing by the online marketplace Other

Alert number

[A12/01687/21](#)

Product

Mooie jurk voor kinderen



Risk type

**Injuries
Strangulation
Suffocation**

Category

Toys

Type

Consumer

Description

**BAT fancy-dress voor meisjes, kleur: vooral zwart en paars.
Product online verkocht, vooral op Wish.**

Brand

Unknown

Weekly report number

Report-2021-48

Alert submitted by

France

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures taken by economic operators


**Removal of this product listing by the online marketplace
Other**

Alert number

[A12/01668/21](#)

Product

Klederdracht voor kinderen

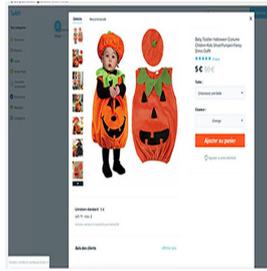

Risk type	Choking Suffocation
Category	Toys
Type	Consumer
Description	Pompoen fancy-dress kostuum voor Halloween (zwart, groen en oranje). Product ook online verkocht, namelijk op Wish.
Brand	Unknown
Weekly report number	Report-2021-48
Alert submitted by	France
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Removal of this product listing by the online marketplace Other
Products were found and measures were taken also in	Ireland

Alert number **[A12/01643/21](#)**

Product **Gearde stopcontactwand**



Risk type **Electric shock**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Witte gearde stopcontactmuur.**

Packaging description **Transparante plastic zak voor stopcontact met referentie 1255030.**

Brand **ZEIGER**

Name **Mara**

Type / number of model **1255030
1255086**

Barcode **3276000704737 (1255086)
3276000704966 (1255030)**

Weekly report number **Report-2021-48**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market
Distributor**

Date of entry into force **26/06/2020**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **20/07/2020**