

Alert number **[A12/00005/22](#)**

Product **Electric scooter**



Risk type **Electric shock
Fire
Injuries**

The presence of water in the footboard's electrical compartment may cause a short circuit and start a fire. In addition, the electrical insulation is inadequate and the clearance /creepage distances between the primary and accessible secondary circuits are not sufficient. The user could receive an electric shock from accessible (live) parts.

The product does not comply with the requirements of the Machinery Directive.

Category **Machinery**

Type **Consumer**

Description **Red, blue, grey or black electric scooter with a lithium battery of 800 W. Product sold online.**

Brand **KAABO**

Name **KAABO MANTIS**

Type / number of model **Mantis 10 : - GT - K800 - Lite - Limited - K2000
Mantis 8 : Lite - Origin - Plus - Up**

Batch number **KBTL 118920101749 and KBTL 118920101727**

Barcode **Mantis 8 Lite : 7141211438992 / 7141211438855
Mantis 8 Lite: 7141211438831/ 7141211437254
Mantis 8 Origin :7141211438756/ 7141211438626
Mantis 8 Origin: 7141211438572/ 7141211436844
Mantis 8 Plus : 7141211438268/7141211438107
Mantis 8 Plus: 7141211438053/ 7141211436783**

Mantis 8 Up : 7141211435601/7141211435496
Mantis 8 Up : 7141211435847/ 7141211435410
Mantis GT : 7141211437407
Mantis GT : 7141211442616/7141211442203
Mantis GT : 7141211442715/ 7141211442654
Mantis K800: 7141211437292
Mantis K800: 7141211441572/ 7141211441183
Mantis K800: 7141211441640/7141211441459
Mantis LIMITED : 7141211436578
Mantis LIMITED : 7141211441657/7141211441893
Mantis LIMITED : 7141211441855/ 7141211441787
Mantis LITE : 7141211437377
Mantis LITE : 7141211442067/7141211442036
Mantis LITE : 7141211442142/ 7141211442104

Weekly report number **Report-2022-1**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**


Measures ordered by public authorities **Recall of the product from end users
Importer**

Measures ordered by public authorities **Other : Suspend marketing
Importer**

Measures ordered by public authorities **Withdrawal of the product from the market
Importer**

Alert number **[A12/00001/22](#)**

Product **Soft toy**

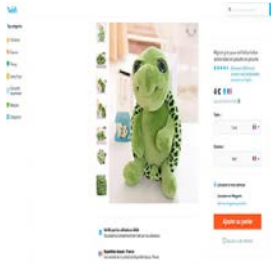

Risk type **Chemical
Choking**

The toy has small parts (the eyes) that can detach easily. A child can put them in the mouth and choke. The suction cup contains an excessive amount of an excessive amount of dibutyl phthalate (DBP)(measured value: up to 5.43% by weight). These phthalates may harm the health of children, causing possible damage to their reproductive system. The eyes of the toy contain an excessive amount of lead (measured value: 15 mg/kg). Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may affect breast-fed or unborn children.

The product does not comply with the requirements of the Toy Safety Directive, REACH and European standards EN 71-1 and EN 71-3.

Category **Toys**

Type **Consumer**

Description **Soft cuddly toy representing a smiling green turtle with two big green eyes and with a suction cup. Product also sold online, namely on Wish.**

Packaging description **Plastic packaging bag**

Brand **Unknown**

Name **Mignon gros yeux vert tortue tortue animal bébé en peluche en peluche**

Weekly report number **Report-2022-1**

Alert submitted by	France
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Removal of this product listing by the online marketplace Other

Alert number

[A11/00002/22](#)

Product

Liquid detergent for toilets



Risk type

Chemical

The product contains skin-sensitizing substances such as methylisothiazolinone (MI) and benzisothiazolinone (BTI) (0.012% and 0.009% by weight, respectively) without a proper labelling (hazard pictogramme and statement, warning sign, risks incurred). Furthermore, the product contains an odoriferous allergen, linalool (0.031% by weight) without indicating it. Dermal contact with MI-containing products can provoke allergic contact dermatitis to sensitised persons. Benzisothiazolinone and linalool are skin sensitisers and can trigger allergic reactions or contact dermatitis.

The product does not comply with the Classification, Labelling and Packaging (CLP) Regulation nor with the Regulation on detergents.

Category

Chemical products

Type

Consumer

Description

Liquid flushing detergent in a black plastic bottle. Product also sold online.

Packaging description

The product is sold in a black plastic bottle with white inscriptions.

Brand

**Dometic
MOBILE LIVING - MADE EASY**

Name

Liquide sanitaire pour chasse d'eau

Type / number of model

500 ml

Batch number	B09122016
Weekly report number	Report-2022-1
Alert submitted by	France
Is the product counterfeit?	Unknown
Country of origin	Unknown
Measures taken by economic operators	Recall of the product from end users Importer
Measures taken by economic operators	Withdrawal of the product from the market Importer
Measures taken by economic operators	Recall of the product from end users Distributor
Measures taken by economic operators	Withdrawal of the product from the market Distributor

Alert number **[A12/00029/22](#)**

Product **Motorcycle**

Risk type **Injuries**

The rear brake disc may not have been attached tightly enough. Once the rear brake disc is detached, the risk of accidents increases.

The product does not meet the requirements laid down in the Regulation on the type-approval and market surveillance of two- or three-wheel vehicles and quadricycles.

Category **Motor vehicles**

Type **Consumer**

Description **Motorcycle**

Brand **Zero Motorcycles**

Name **SR/F**

EC-type approval/model **e9*168/2013*11329*01, Type Z4**

Production dates **10.4.2019 - 19.12.2019**

Company recall code **NS-ZMC-020-417-02**

Weekly report number **Report-2022-1**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00027/22](#)**

Product **Light commercial vehicle**

Risk type **Injuries**

The selector lever may malfunction, leading to unintentional movements of the vehicle. These movements of the vehicle will increase the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Light commercial vehicle**

Brand **Ford**

Name **Transit-Connect**

Production dates **22/04/2013 - 30/04/2021**

Company recall code **21S24**

Weekly report number **Report-2022-1**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code - **<http://www.fordfsa.com/de>**

Alert number **[A12/00002/22](#)**

Product **Decorative articles**



Risk type **Choking**

Due to their characteristic appearance, form, colour and size, the product may be mistaken for foodstuff. The product has small parts that can be easily detached. A small child/vulnerable user may put them in the mouth and choke on them.

The product does not comply with the requirements of the Food Imitating Products Directive.

Category **Decorative articles**

Type **Consumer**

Description **Christmas tree decoration that looks like a cannoli. Product also sold online.**

Brand **KURT S. ADLER**

Name **Ornament Cannoli**

Batch number **537459**

Barcode **0086131497384**

Weekly report number **Report-2022-1**

Alert submitted by **Norway**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Importer**

Date of entry into force **03/12/2021**

Company recall code - https://www.plantasjen.no/on/demandware.static/-/Library-Sites-PlantagenShared/nb_NO/dwb3c1af87/Kurt_Adler_2021_NO_Salgsstopp_EAN.pdf

Alert number **[A12/00004/22](#)**

Product **Decorative articles**



Risk type **Choking**

Due to their characteristic appearance, form, colour and size, the product may be mistaken for foodstuff. The product has small parts that can be easily detached. A small child/vulnerable user may put them in the mouth and choke on them.

The product does not comply with the requirements of the Food Imitating Products Directive.

Category **Decorative articles**

Type **Consumer**

Description **Christmas tree decoration that looks like a ice cream. Product also sold online.**

Brand **KURT S. ADLER**

Name **Ornament Foam Ice Cream**

Batch number **537475**

Barcode **86131581908**

Weekly report number **Report-2022-1**

Alert submitted by **Norway**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Importer**

Date of entry into force **03/12/2021**

Company recall code - https://www.plantasjen.no/on/demandware.static/-/Library-Sites-PlantagenShared/nb_NO/dwb3c1af87/Kurt_Adler_2021_NO_Salgsstopp_EAN.pdf

Alert number **[A12/00006/22](#)**

Product **Tattoo ink**



Risk type **Chemical**

The product contains excessive amounts of individual polycyclic aromatic hydrocarbons (PAHs) (measured values; acenaphthylene: 0.5 mg/kg, naphthalene: 0.5 mg/kg, pyren: 2.2 mg/kg and benzo[a]pyrene 90 ppb). Some PAHs are carcinogenic. Benzo(a)pyrene is a carcinogenic PAH. Naphthalene is a carcinogenic substance for which a safe level cannot be established.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that the level of benzo(a)pyrene (BaP) does not exceed 0.005 mg/kg and the total amount of PAHs do not exceed 0.5 mg/kg.

Category **Chemical products**

Type **Consumer**

Description **Black tattoo ink, also sold online.**

Packaging description **Black 120 ml bottle with yellow and white label**

Brand **Viking**

Name **Viking ink Dark Shadow**

Batch number **L-118**

Weekly report number **Report-2022-1**

Alert submitted by	Sweden
Is the product counterfeit?	Unknown
Country of origin	United States
Measures taken by economic operators	Withdrawal of the product from the market Distributor
Date of entry into force	15/11/2021

Alert number **[A12/00007/22](#)**

Product **Tattoo ink**



Risk type **Chemical**

The product contains the aromatic amine o-toluidine (measured value: 5.7 mg/kg). O-toluidine may cause cancer and might induce mutations.

The Council of Europe Resolution ResAP (2008)¹ on requirements and criteria for the safety of tattoos and permanent make-up, recommends that aromatic amines with carcinogenic, mutagenic, reprotoxic or sensitising properties should neither be present in tattoos and permanent Makeup products nor released from azo-colourants.

Category **Chemical products**

Type **Consumer**

Description **Tattoo ink.**

Packaging description **Black plastic bottle.**

Brand **Perma Blend**

Name **Blackish Brown**

Batch number **B40401
PBBLB200406**

Weekly report number **Report-2022-1**

Alert submitted by **Sweden**

Is the product counterfeit? **Unknown**

Country of origin **United States**

Measures taken by economic operators **Withdrawal of the product from the market
Importer**

Date of entry into force **09/10/2021**

Alert number **[A12/00008/22](#)**

Product **Tatto Ink**



Risk type **Chemical**

The product contains an excessive amount of copper (measured value: 250 ppm). Copper can cause liver and kidney damage and might affect fertility.

The Council of Europe Resolution ResAP (2008)1 on requirements and criteria for the safety of tattoos and permanent make-up, recommends that the levels of copper do not exceed 25 ppm.

Category **Chemical products**

Type **Professional**

Description **Blue tattoo ink.**

Packaging description **Plastic bottle.**

Brand **Eternal Ink**

Name **Eternal Ink True Blue**

Type / number of model **True Blue**

Batch number **013182**

Weekly report number **Report-2022-1**

Alert submitted by **Sweden**

Is the product counterfeit? **Unknown**

Country of origin **United Kingdom**

Measures taken by economic operators **Withdrawal of the product from the market
Importer**

Date of entry into force **12/11/2021**

Alert number **[A11/00122/21](#)**

Product **Ceiling lamp**



Risk type **Electric shock**

The product should be assembled by the users, hence there are accessible live parts; there are no clear safety indications regarding the safety of accessible live parts, or how these can go live. Furthermore, the internal basic insulated conductors are in direct contact with accessible unearthed metal parts. Also, when changing the lamp, the protective glass has to be removed and the internal conductors must be twisted, and could break. A user could receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and with the European standard EN 60598-1.

Category **Lighting equipment**

Type **Consumer**

Description **Gold metal ceiling lamp with five white glass domes.**

Packaging description **Product comes in an unmarked brown cardboard box.**

Brand **Varberg**

Weekly report number **Report-2022-1**

Alert submitted by **Sweden**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Warning consumers of the risks
Other**

Date of entry into force

20/12/2021

Alert number **[A12/00015/22](#)**

Product **Massage gun**



Risk type **Electric shock**

The electrical insulation of the power supply is not sufficient and the clearance /creepage distances between the primary and accessible secondary circuit is inadequate.

The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60335.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Massage hammer supplied with a power supply. Product sold online. Electrical specifications: Massage hammer : 26VDC; 1A; 2400mAh; 51,84Wh Power supply : 100-240VAC; 50/60Hz; 0,8A out: 25,2VDC; 1,0A.**

Packaging description **Sold in a brown cardboard box.**

Brand **HMS**

Name **Lihashuoltovasara**

Type / number of model **PDM4482
Power supply: HGCS35VATO**

Barcode **5907695574265**

Weekly report number **Report-2022-1**

Alert submitted by	Finland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	13/09/2021

Alert number **[A12/00009/22](#)**

Product **Baby wet wipes**



Risk type **Microbiological**

The product is microbiologically contaminated with mesophilic aerobic bacteria and yeast (measured values 820 cfu/g for mesophilic aerobic bacteria and 700 cfu/g for yeasts and molds). If used on damaged skin, or if it comes into contact with the eyes, the product may cause infection or irritation.

The product does not comply with the Cosmetic Products Regulation and with the standard EN ISO 17516.

Category **Cosmetics**

Type **Consumer**

Description **Baby wipes with chamomile, set of two packages with 64 units each.**

Packaging description **Plastic packaging.**

Brand **BECUTAN**

Name **BECUTAN BABY WIPES WITH CHAMOMILE**

Batch number **130720212/098**

Barcode **5310001234775**

Weekly report number **Report-2022-1**

Alert submitted by **Croatia**

Is the product counterfeit? **Unknown**

Country of origin **North Macedonia**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **02/11/2021**

Alert number **[INFO/00001/22](#)**

Product **Candles**



Risk type **Choking**

Due to its presentation, the product can easily be confused with a soft drink. It may therefore be swallowed from the easily opened bottle by a child or vulnerable person, which can cause gastrointestinal irritation.

The product does not comply with the requirements of the Food-imitating Products Directive.

Category **Decorative articles**

Type **Consumer**

Description **Candles in a glass cup imitating a hot drinks: hot chocolate, cappuccino, ice cream, creme brûlée, hot wine etc**

Packaging description **Plastic transparent packaging.**

Brand **Unknown**

Name **Candles from Love**

Weekly report number **Report-2022-1**

Alert submitted by **Bulgaria**

Is the product counterfeit? **No**

Country of origin **Bulgaria**

Measures ordered by public
authorities

**Withdrawal of the product from the market
Manufacturer**



Alert number **[A12/00030/22](#)**

Product **Car tyres**

Risk type **Injuries**

A sudden loss of air pressure in the tyre may occur which may result in a loss of control of the vehicle, leading to an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Car tyres**

Brand **Continental**

Name **ContiEcoContact 5**

EC-type approval/model **235/55R17 103H XL
DOT numbers: CN7AD72Y 4015 to 0221**

Production dates **28.09.2015 - 11.01.2021**

Weekly report number **Report-2022-1**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **24/11/2021**

Measures taken by economic operators **Withdrawal of the product from the market
Manufacturer**

Date of entry into force **24/11/2021**

Company recall code - <https://www.continental-opony.pl/samochod/onas/media/informacje-prasowe/continental-og%C5%82asza-program-dobrowolnej-wymiany-opon>
- <https://www.continental-tires.com/car/tires/technical-services/voluntary-exchange-programs/contiecocontact5/press-release>

Products were found and measures were taken also in **France**

Alert number **[A11/00129/21](#)**

Product **Bracelet**



Risk type **Environment
Health risk / other
Other : Radiation**

The product contains radioactive materials continuously emit ionizing radiation. Therefore, the user could be exposed to an excessive level of ionizing radiation that can cause adverse health effects, including skin irritation as well as damage to tissues and DNA.

The product does not comply with the requirements of the Directive on basic safety standards for protection against the dangers arising from exposure to ionising radiation.

Category **Jewellery**

Type **Consumer**

Description **Bracelet with radioactive material**

Packaging description **Plastic bag**

Brand **Magnetix**

Name **Sillicone bracelet XI; Kids bracelet; sportboost bracelet**

Type / number of model **Magenetix Kids bracelet, 4720iM
Magnetix Sillicone bracelet XI, 4708iXL
Magnetix sportboost bracelet, 4705iM**

Weekly report number **Report-2022-1**

Alert submitted by **The Netherlands**

Is the product counterfeit?

No

Country of origin

The Netherlands

Measures ordered by public authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

16/12/2021

Measures ordered by public authorities

**Warning consumers of the risks
Other**

Date of entry into force

16/12/2021

Alert number **[A12/00013/22](#)**

Product **Passenger car**

Risk type **Injuries**

Parts of the retractable roof that are close to the side-curtain airbag may not be sufficiently held in place in the event of an accident. As a result, when the airbag is deployed, passengers sitting in the back seat may come into contact with materials that can cause cuts.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Vehicles fitted with a retractable roof.**

Brand **DS Automobiles**

Name **DS7 CROSSBACK**

EC-type approval/model **e2*2007/46*0601*10, e2*2007/46*0601*11, e2*2007/46*0601*12, e2*2007/46*0601*13, e2*2007/46*0601*14, e2*2007/46*0601*15, e2*2007/46*0601*16, e2*2007/46*0601*17**

Production dates **31/03/2021 - 28/09/2021**

Company recall code **HVJ**

Weekly report number **Report-2022-1**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic **Recall of the product from end users**

operators

Manufacturer

Date of entry into force

06/10/2021

Products were found and
measures were taken also in

**Germany
Poland**

Alert number **[A12/00011/22](#)**

Product **Passenger car**

Risk type **Injuries**

There is a risk of premature wearing of the rear tyres (inner edge of the wheel) that can lead to a sudden loss of tyre pressure, which may increase the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car fitted with T&N 205/55 R19 97V tyres with a class A label.**

Brand **DS Automobiles**

Name **DS7 CROSSBACK e-Tense**

EC-type approval/model
**e2*2007/46*0601*07
e2*2007/46*0601*08
e2*2007/46*0601*09
e2*2007/46*0601*11
e2*2007/46*0601*12
e2*2007/46*0601*13
e2*2007/46*0601*14
e2*2007/46*0601*15
e2*2007/46*0601*16**

Production dates **19.02.2019 - 18.05.2021**

Company recall code **HWK**

Weekly report number **Report-2022-1**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Date of entry into force

23/11/2021

Alert number **[A12/00017/22](#)**

Product **Passenger car**

Risk type **Fire**

A trapped particle may damage the sealing between the fuel rail and fuel injector, which could cause fuel to leak into the engine compartment. Consequently, leaking fuel may come into contact with hot parts of the engine, increasing the risk of fire.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **CLA (117 platform), CLA (118 platform), GLA (156 platform), GLE/GLS (167 platform), A-Class (177 platform), AMG GT (190 platform), C-Class (205 platform), E-Class (213 platform), S-Class Coupe/Convertible (217 platform), S-Class (222 platform), SL (231 platform),**

Packaging description **E-Class Coupe/Convertible (238 platform), B-Class (246 platform), B-Class/GLB (247 platform), GLC (253 platform), CLS (257 platform), AMG GT 4-doors Coupe (290 platform) and G-Class (463 platform). Vehicles with a petrol engine.**

Brand **Mercedes-Benz**

Name **CLA, GLA, GLE/GLS, A-Class, AMG GT, C-, E-, S-Class, SL, E-Class, B-Class, GLC, CLS, G-Class**

EC-type approval/model **Types: 245G, F2CLA, H1GLE, F2A, 197, 204, 204 K, 212, R1ES, R1EC, F2B, 204 X, R1ECLS, R1EAMG, 463 A e1*2001/116*0470*16 - *23, e1*2007/46*1912*00 - *08, e1*2007/46*1885*00 - *11, e1*2007/46*1829*00 - *12, e1*2007/46*0233*11 - *20, e1*2007/116*0431*39 - *61 e1*2007/116*0457*38 - *51, e1*2007/116*0501*39 - *47, e1*2007/46*1560*09 - *20, e1*2007/46*1666*07 - *17, e1*2007/46*1909*01 - *08, e1*2007/116*0480*20 - *39 e1*2007/46*1818*00 - *10, e1*2007/46*1878*02 - *10, e1*2007/46*1830*00 - *06**

Production dates **27.05.2016 - 24.08.2020**

Company recall code	792034
Weekly report number	Report-2022-1
Alert submitted by	Germany
Is the product counterfeit?	No
Country of origin	Germany
Measures taken by economic operators	Recall of the product from end users Manufacturer
Company recall code	- http://www.Mercedes-Benz.de

Alert number **[A12/00021/22](#)**

Product **Headphones**



Risk type	Environment
	Solders in the earpiece contains an excessive amount of lead (measured value up to 19% by weight). Lead poses a risk to the environment.
	The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).
Category	Electrical appliances and equipment
Type	Consumer
Description	A pair of black headphones. The product is also sold online.
Packaging description	White cardboard box
Brand	Langsdom
Name	JM 21
Barcode	6948541700659
Weekly report number	Report-2022-1
Alert submitted by	Sweden
Is the product counterfeit?	Unknown

Country of origin

People's Republic of China

Measures taken by economic operators

**Other : No measures taken
Retailer**

Alert number **[A12/00022/22](#)**

Product **Ear headphones**



Risk type **Environment**

A solder contains an excessive amount of lead (measured value up to 34.2%). Lead poses a risk to the environment.

The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Ear headphones with cat ears. The product is also sold online.**

Packaging description **Black cardboard box**

Brand **Yongle**

Name **Cat ear headphones**

Type / number of model **72199**

Barcode **6931791200192**

Weekly report number **Report-2022-1**

Alert submitted by **Sweden**

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures taken by economic operators

**Withdrawal of the product from the market
Importer**

Date of entry into force

09/07/2021

Alert number

[A11/00127/21](#)

Product

Sleepmasker with radioactive material



Corrigendum

A11/00127/21: as agreed with the national authorities, a picture of the notified product was included to this case.

Risk type

**Environment
Health risk / other
Other : Radiation**

The product contains radioactive materials continuously emit ionizing radiation. Therefore, the user could be exposed to an excessive level of ionizing radiation that can cause adverse health effects, including skin irritation as well as damage to tissues and DNA.

The product does not comply with the requirements of the Directive on basic safety standards for protection against the dangers arising from exposure to ionising radiation.

Category

Clothing, textiles and fashion items

Type

Consumer

Description

Sleepmasker with radioactive material

Packaging description

Plastic Bag

Brand

Energy Armor

Name

Sleep mask

Type / number of model

736211735560

Weekly report number	Report-2022-1
Alert submitted by	The Netherlands
Is the product counterfeit?	No
Country of origin	The Netherlands
Measures ordered by public authorities	Warning consumers of the risks Other
Date of entry into force	16/12/2021
Measures ordered by public authorities	Withdrawal of the product from the market Other
Date of entry into force	16/12/2021

Alert number **[A11/00128/21](#)**

Product **Necklace**



Risk type **Environment
Health risk / other
Other : Radiation**

The product contains radioactive materials continuously emit ionizing radiation. Therefore, the user could be exposed to an excessive level of ionizing radiation that can cause adverse health effects, including skin irritation as well as damage to tissues and DNA.

The product does not comply with the requirements of the Directive on basic safety standards for protection against the dangers arising from exposure to ionising radiation.

Category **Jewellery**

Type **Consumer**

Description **Jewellery with radioactive material. Product sold online.**

Packaging description **Plastic**

Brand **Magnetix**

Name **Magnetix Magnetic necklace with negative ions of skinfriendly silicons**

Type / number of model **4657iXL**

Weekly report number **Report-2022-1**

Alert submitted by **The Netherlands**

Is the product counterfeit?

No

Country of origin

The Netherlands

Measures ordered by public authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

16/12/2021

Measures ordered by public authorities

**Warning consumers of the risks
Other**

Date of entry into force

16/12/2021

Alert number **[A11/00123/21](#)**

Product **Pendant**



Risk type **Environment
Health risk / other
Other : Radiation**

The product contains radioactive materials continuously emit ionizing radiation. Therefore, the user could be exposed to an excessive level of ionizing radiation that can cause adverse health effects, including skin irritation as well as damage to tissues and DNA.

The product does not comply with the requirements of the Directive on basic safety standards for protection against the dangers arising from exposure to ionising radiation.

Category **Jewellery**

Type **Consumer**

Description **Black pendant containing radioactive material.**

Packaging description **Plastic packaging**

Brand **Unknown**

Name **Quantum Pendant**

Weekly report number **Report-2022-1**

Alert submitted by **The Netherlands**

Is the product counterfeit? **Unknown**

Country of origin **The Netherlands**

Measures ordered by public authorities

Warning consumers of the risks
Other

Date of entry into force

16/12/2021

Measures ordered by public authorities

Withdrawal of the product from the market
Other

Date of entry into force

16/12/2021

Alert number **[A12/00012/22](#)**

Product **Scissor lift jack**



Risk type **Injuries**

The jack cannot hold the rated load without deformation. As a result, the load may fall down uncontrollably, causing injury to the user or bystanders. Furthermore, the jack is not durable enough for consecutive use and may jam after short use. Turning the jammed crank to descend may cause the load to fall down uncontrollably.

The product does not comply with the requirements of the Machinery Directive the European standard EN 1494.

Category **Machinery**

Type **Consumer**

Description **Mechanical car jack.**

Packaging description **Elongated cardboard box with pictures of the product.**

Brand **Torin BigRed**

Name **Haitaritunkki**

Type / number of model **T10152-GS**

Weekly report number **Report-2022-1**

Alert submitted by **Finland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Importer
Date of entry into force	01/12/2021
Company recall code	- https://www.motonet.fi/fi/sivut/takaisinvedot

Alert number **[A12/00028/22](#)**

Product **Passenger Car**

Risk type **Injuries**

The outer pinion of the right driveshaft may break due to lack of heat treatment during the manufacture of the part which may lead to a break in the transmission shaft. The engine will still run, but there is no torque transmission to the drive wheels increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **CITROËN**

Name **C3 V4 C-Elysée**

EC-type approval/model **C3 V4 (B618) e2*2007/46*0003*64 C Elysée
e2*2007/46*0225*16**

Production dates **C3 V4 (B618) 07/04/2021 - 10/04/2021 C-Elysée 12/04/2021 -
21/04/2021**

Company recall code **HVY**

Weekly report number **Report-2022-1**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **29/11/2021**

Products were found and
measures were taken also in **Poland**

Alert number **[A12/00026/22](#)**

Product **Passenger Car**

Risk type **Injuries**

The outer pinion of the right driveshaft may break due to lack of heat treatment during the manufacture of the part which may lead to a break in the transmission shaft. The engine will still run, but there is no torque transmission to the drive wheels, increasing the risk of accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **peugeot**

Name **301**

EC-type approval/model **e2*2007/46*0224*16**

Production dates **12/04/2021 - 21/04/2021**

Company recall code **KQR**

Weekly report number **Report-2022-1**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **29/11/2021**



Alert number **[A12/00023/22](#)**

Product **Massage pen**



Risk type **Environment**

Two solders contain an excessive amount of lead (measured value up to 37% by weight). Lead poses a risk to the environment.

The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Massage pen powered with batteries. The product is also sold online.**

Packaging description **Cardboard box**

Brand **Health & Beauty**

Name **Massager Pen**

Type / number of model **W-912**

Barcode **FV-024**

Weekly report number **Report-2022-1**

Alert submitted by **Sweden**

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures taken by economic operators

**Withdrawal of the product from the market
Importer**

Date of entry into force

12/07/2021

Alert number

[A12/00031/22](#)

Product

Body massager



Risk type

**Chemical
Environment**

The charger cable contains an excessive amount of short chain chlorinated paraffin (SCCPs), di- (2-ethylhexyl) phthalate (DEHP) and di-n-butyl phthalate (DBP) (measured values up to 3.69%, 1.93% and 1.62% by weight, respectively). Two solders contain an excessive amount of lead (measured value up to 63.8% by weight). Phthalates may harm the health of children, causing possible damage to their reproductive system. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans. Lead is harmful to the environment

The product does not comply with the the Persistent Organic Pollutants (POPs) Regulation and with the requirements of the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Category

Electrical appliances and equipment

Type

Consumer

Description

Hand-held electric body massager. Product also sold online.

Packaging description

Cardboard box that has a picture of the product on it

Brand

Fhen Liang

Name

Electric vibration massager / Massageapparat för kroppen

Type / number of model

XF-70

Barcode	6973150520015
Weekly report number	Report-2022-1
Alert submitted by	Sweden
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Importer
Date of entry into force	12/07/2021

Alert number **[A11/00003/22](#)**

Product **Toy rattle**



Risk type **Injuries**

Some parts of the product protrude. If a child puts the toy in the mouth and falls face down, the protruding parts could obstruct the airways, causing choking and injuries around the pharynx or trachea area.

The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **The toy is made of rigid plastic, colourful (orange and yellow), maracas-shaped. It consists of a round hollow part filled with rattling peas and fastened to an elongated handle with a ribbed surface. Weight: 31,4 g and measures (125 x 45 x 45) mm. The product was also sold online.**

Brand **Halilit.**

Name **Maracito**

Type / number of model **MP36524**

Barcode **7290002582823**

Weekly report number **Report-2022-1**

Alert submitted by **Lithuania**

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

17/12/2021

Alert number **[A12/00024/22](#)**

Product **Electrical face massager**



Risk type **Environment**

A solder contains an excessive amount of lead (measured value up to 32% by weight). Lead poses a risk to the environment.

The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Electrical face massager powered by batteries. The product is also sold online.**

Packaging description **Transparent plastic box**

Brand **Unknown**

Name **Ansiktsmassage**

Barcode **VT-010**

Weekly report number **Report-2022-1**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin

People's Republic of China

Measures taken by economic operators

**Withdrawal of the product from the market
Importer**

Date of entry into force

12/07/2021

Alert number **[A12/00014/22](#)**

Product **Children's car seat**



Risk type **Injuries**

In the event of a accident, the car seat may not properly restrain the child to minimize the displacement of the body. As a consequence, the child could be injured.

The product does not comply with Regulation UN/ECE No 44-04.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Children´s car seat in navy and grey colours. The product was also sold online.**

Packaging description **Cardboard Packaging.**

Brand **Halfords Limited**

Name **Halfords I-Size Revolve Child Seat**

Type / number of model **YK0618**

Batch number **327022**

Weekly report number **Report-2022-1**

Alert submitted by **Ireland**

Is the product counterfeit? **No**

Country of origin

People's Republic of China

Measures taken by economic operators

**Recall of the product from end users
Importer**

Date of entry into force

22/12/2021

Company recall code

- <https://washford.a.bigcontent.io/v1/static/halfords-i-size-revolve-child-seat-327022-in-store-and-online-recall-notice>

Alert number **[A12/00032/22](#)**

Product **Fireworks**




Risk type	<p>Burns Damage to hearing</p> <p>The product may explode at too low altitude and can burst too close to the ground. Bystanders can be hit by parts of the firework, causing burns. The sound pressure level is too high and may cause damage to hearing.</p> <p>The product does not comply with the requirements of the Pyrotechnics Directive and the relevant European standard EN 15947.</p>
Category	Pyrotechnic articles
Type	Consumer
Description	Battery of shot tubes. Product also sold online.
Packaging description	Box with picture of a skull and crossbones on black background with flames
Brand	KLASEK PYROTECHNICS
Name	DUMBUM
Type / number of model	C1620DUI14 - 1395-F2-0124/2016
Batch number	1903
Barcode	8595182429074
Weekly report number	Report-2022-1

Alert submitted by	Belgium
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer

Alert number **[A11/00124/21](#)**

Product **Necklace**

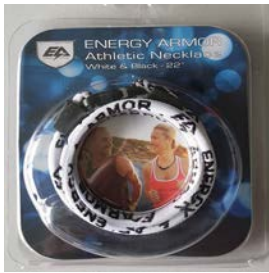

Risk type **Environment
Health risk / other
Other : Radiation**

The product contains radioactive materials continuously emit ionizing radiation. Therefore, the user could be exposed to an excessive level of ionizing radiation that can cause adverse health effects, including skin irritation as well as damage to tissues and DNA.

The product does not comply with the requirements of the Directive on basic safety standards for protection against the dangers arising from exposure to ionising radiation.

Category **Jewellery**

Type **Consumer**

Description **Jewellery with radioactive material**

Packaging description **Plastic**

Brand **Energy Armor**

Name **Energy Armor: Black and white**

Type / number of model **609132886690**

Barcode **609132886690**

Weekly report number **Report-2022-1**

Alert submitted by **The Netherlands**

Is the product counterfeit?

No

Country of origin

The Netherlands

Measures ordered by public authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

16/12/2021

Measures ordered by public authorities

**Warning consumers of the risks
Other**

Date of entry into force

16/12/2021

Alert number **[A11/00126/21](#)**

Product **Bracelet**



Risk type **Environment
Health risk / other
Other : Radiation**

The product contains radioactive materials continuously emit ionizing radiation. Therefore, the user could be exposed to an excessive level of ionizing radiation that can cause adverse health effects, including skin irritation as well as damage to tissues and DNA.

The product does not comply with the requirements of the Directive on basic safety standards for protection against the dangers arising from exposure to ionising radiation.

Category **Jewellery**

Type **Consumer**

Description **Bracelet with radioactive material**

Packaging description **Plastic bag**

Brand **Energy Armor**

Name **Black superbracelet**

Type / number of model **609132886690**

Batch number **609132886690**

Weekly report number **Report-2022-1**

Alert submitted by **The Netherlands**

Is the product counterfeit?

No

Country of origin

The Netherlands

Measures ordered by public
authorities

**Warning consumers of the risks
Other**

Date of entry into force

16/12/2021

Alert number **[A11/00125/21](#)**

Product **Bracelet**



Risk type **Environment
Health risk / other
Other : Radiation**

The product contains radioactive materials continuously emit ionizing radiation. Therefore, the user could be exposed to an excessive level of ionizing radiation that can cause adverse health effects, including skin irritation as well as damage to tissues and DNA.

The product does not comply with the requirements of the Directive on basic safety standards for protection against the dangers arising from exposure to ionising radiation.

Category **Jewellery**

Type **Consumer**

Description **Bracelet with radioactive material**

Packaging description **Plastic**

Brand **Basic Nero**

Name **Basic Nero Bracelet**

Type / number of model **SKU: IO.TIT.046**

Weekly report number **Report-2022-1**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin	The Netherlands
Measures ordered by public authorities	Withdrawal of the product from the market Other
Date of entry into force	16/12/2021
Measures ordered by public authorities	Warning consumers of the risks Other
Date of entry into force	16/12/2021

Alert number **[A12/00019/22](#)**

Product **Bath toy**



Risk type **Choking
Damage to hearing
Suffocation**

The instruments can easily break, resulting in small parts. A small child may put them in the mouth and choke. The sound pressure level is too high. Consequently it can cause damage to hearing. The plastic bag of the packaging is too thin. If a child plays with the packaging, the plastic can cover the mouth and nose, causing the child to suffocate.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Bath toy instrument (water flutes). Product sold online, in particular via AliExpress.**

Packaging description **Plastic bag**

Brand **Unknown**

Weekly report number **Report-2022-1**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators

Removal of this product listing by the online marketplace
Other



Alert number **[A12/00020/22](#)**

Product **Stool**



Risk type **Injuries**

The stool has no locking device and the user can consequently suffer injuries with the clamping points.

The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 12520.

Category **Furniture**

Type **Consumer**

Description **Stool with inverted U-shaped legs bent from a metal tube painted in grey with plastic plugs. Particleboard, foam and synthetic brown leather seat with four wood screws. Outer dimensions: length and width 300 mm, height 440 mm, seat diameter 300 mm.**

Packaging description **Plastic fold.**

Brand **NEW Victoria**

Name **Round metal kitchen chair „Titanas - šokoladas“**

Barcode **4607174088054**

Weekly report number **Report-2022-1**

Alert submitted by **Lithuania**

Is the product counterfeit? **No**

Country of origin **Russian Federation**

Measures ordered by public authorities **Withdrawal of the product from the market
Importer**

Date of entry into force **17/12/2021**

Alert number **[A12/00016/22](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 57%), and the mask does not properly adapt to the face. Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **5 white five-layer respiratory masks labelled only with KN95 GB2626-2006, with visible nose bracket in a foil packaging with black imprint 'KN95 protective mask'. Product sold online, in particular via eBay sold via ebay under number 224389518393.**

Packaging description **Foil packaging with black print 'KN95 protective mask', no manufacturer's details**

Brand **Unknown**

Name **KN95 protective Mask**

Type / number of model **Protective Mask KN95**

Weekly report number **Report-2022-1**

Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	Unknown
Measures ordered by public authorities	Stop of sales Other
Measures taken by economic operators	Stop of sales Importer

Alert number **[A12/00025/22](#)**

Product **Plastic doll**



Risk type **Chemical**

The plastic material of the doll contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 25% and 18% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Pink, blue and green mermaid plastic doll. 11.5 inch. Product sold online, in particular via AliExpress.**

Packaging description **Yellow plastic.**

Brand **Barwa**

Name **New Fashion Handmade Mermaid Doll**

Weekly report number **Report-2022-1**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators

Withdrawal of the product from the market
Other

Date of entry into force

06/10/2021

Alert number

[A12/00018/22](#)

Product

Descaling agent



Risk type

Chemical

The product has a pH of 1.67 ± 0.12 that can cause skin corrosion and eye damage. However, the product is not properly classified and labelled. Therefore, consumers are not adequately warned.

The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

Category

Chemical products

Type

Consumer

Description

Colourless liquid.

Packaging description

White plastic bottle with black cap. Volume: 0.5L.

Brand

Mayeri

Name

Katlakivi-eemamldi

Batch number

A21040041

Barcode

4740060008054

Weekly report number

Report-2022-1

Alert submitted by

Latvia

Is the product counterfeit?	Unknown
Country of origin	Estonia
Measures ordered by public authorities	Marking the product with appropriate warnings on the risks Distributor
Products were found and measures were taken also in	Lithuania

Alert number **[A11/00001/22](#)**

Product **Soft toy**



Risk type **Choking**

Small parts can easily detach (filings). As a consequence, a small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Plush toy in the form of a brown teddy bear, dressed in a red hooded sweatshirt.**

Brand **Unknown**

Name **PLUSH BEAR DRESSED**

Type / number of model **XW-82**

Barcode **3858887900565**

Weekly report number **Report-2022-1**

Alert submitted by **Croatia**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Destruction of the product
Importer**

Date of entry into force

15/12/2021

Measures ordered by public authorities

**Import rejected at border
Importer**

Date of entry into force

15/12/2021

Alert number **[A11/00004/22](#)**

Product **Motorcycle tyre**



Risk type **Injuries**

The tyres are affected by a manufacturing variation. If a person accelerating on a motorbike with the defective tyre the person will lose balance and may fall.

The product does not comply with the requirements of General Product Safety Directive.

Category **Motor vehicles**

Type **Consumer**

Description **Dunlop KR106 MS3 TL motorcycle tyre of the size 120/70 R17, manufacturing weeks 4721 & 4821 & 4921.**

Brand **Dunlop**

Name **Dunlop KR106 MS3 TL**

EC-type approval/model **KR106 MS3 TL, size 120/70 R17 / manufacturing weeks 4721 & 4821 & 4921**

Production dates **Tyres can be identified by the date code week numbers 4721 & 4821 & 4921 behind the letters "DK" branded on one sidewall.**

Weekly report number **Report-2022-1**

Alert submitted by **Luxembourg**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **23/12/2021**

Alert number **[A12/00010/22](#)**

Product **Hammer**



Risk type **Chemical**

The product contains an excessive amount of polycyclic aromatic hydrocarbons (PAHs) (measured values: benz[a]anthracene 120 mg/kg, chrysene 49 mg/kg, benzo[b]fluoranthene 14 mg/kg, benzo[k]fluoranthene 7,5 mg/kg, benzo[j]fluoranthene 6,8 mg/kg, benzo(a)pyrene 25 mg/kg, benzo[e]pyrene 40 mg/kg and dibenz(a,h)anthracene 8,6 mg/kg). PAHs may cause cancer and are also mutagenic and toxic for reproduction.

The product does not comply with the REACH Regulation.

Category **Hand tools**

Type **Consumer**

Description **White rubber hammer with black rubber handle.**

Brand **Fixit Tools**

Name **Rubber Hammer**

Type / number of model **TK1358**

Barcode **6418914767973**

Weekly report number **Report-2022-1**

Alert submitted by **Finland**

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Import rejected at border
Importer**

Date of entry into force

22/12/2021