

Alert number

[A12/00256/22](#)

Product

Particle filter mask



Risk type

Health risk / other

The total filtration capacity of the mask is insufficient (measured mean values: as low as 75%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect the user.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

White respiratory protective half-face mask with valve, marked with FFP2 and with the CE marking printed on.

Packaging description

Cardboard box containing 10 units, with a reference to EN 149 and the claim FFP2 printed on it.

Brand

BALTIC MASKS

Name

PROTECTIVE RESPIRATOR FFP2

Type / number of model

BM-001V

Batch number

BM00001V

Barcode

4779020831180

Weekly report number	Report-2022-6
Alert submitted by	Latvia
Is the product counterfeit?	Unknown
Country of origin	Lithuania
Measures taken by economic operators	Destruction of the product Manufacturer
Date of entry into force	31/08/2021

Alert number **[INFO/00006/22](#)**

Product **Blue plastic bag**



Risk type **Chemical**

The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured values up to 34% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Transparent PVC plastic bag, waterproof, available in different colours (blue, green, pink, black), foreseen for an outdoor use. Product sold online, with codes PCK1067210407RG522, SKU691027-1, and 0630--0--14308.**

Packaging description **Thin plastic**

Brand **Honana**

Name **Honana HN-B65 Colorful Vattentät PVC Travel Storage Bag Rensa Stor Beach Outdoor Tote Bag - Grå**

Type / number of model **1172457
HN-B65**

Batch number **1M90**

Weekly report number **Report-2022-6**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**


Measures taken by economic operators **Other : The product is still for sale. Due to administrative issues, no sales ban has been taken.**
Other

Alert number

[A12/00257/22](#)

Product

WEB CAM

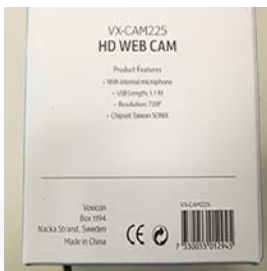

Risk type

Chemical

The solder point in the product contains an excessive amount of Lead (measured values: 29,76%). This is a risk to the environment and health both in the production and in the disposal of the Product.

The product does not comply with the requirements of the Commission Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive), nor with the REACH Regulation.

Category

Communication and media equipment

Type

Consumer

Description

Voxicon HD WEBCAM, Black web camera with charger in a blue and white cardboard box. The product is also sold online.

Packaging description

Blue and white cardboard box

Brand	Voxicon
Type / number of model	VX-CAM225
Barcode	7330053012945
Weekly report number	Report-2022-6
Alert submitted by	Norway
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Other : Stop sale of product until a revised version is available Other
Date of entry into force	28/10/2021
Measures taken by economic operators	Removal of this product listing by the online marketplace Distributor
Date of entry into force	28/10/2021

Alert number

A12/00237/22

Product

Swim seat



Risk type

Drowning

The floating seat is designed and labelled as a toy and children playing with it can drown. Floating seats must be used under constant adult supervision.

The product does not comply with the requirements of the General Product Safety Directive (GPSD) and the European standard EN 13138.

Category

Hobby/sports equipment

Type	Consumer
Description	Inflatable swim ring in the shape of a car with a steering wheel, a horn button and a canopy, in various colours (blue-yellow; purple/green; pink/yellow; blue/green). The car has child attractive features like eyes and a mouth. Product sold online, in particular via Amazon, under ASIN B071WLFV33.
Packaging description	Transparent plastic bag.
Brand	QIAONIUNIU
Name	Baby Pool Float with Canopy Summer Steering Wheel Sunshade Swim Ring Car Inflatable Toys Infants ...
Type / number of model	107379136 X001Q390RF
Weekly report number	Report-2022-6
Alert submitted by	Luxembourg
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Removal of this product listing by the online marketplace Other

Alert number **[A12/00251/22](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 68%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect the user.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the relevant European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **Protective respiratory filtration half-face mask, marked with KN95.**

Packaging description **The product is sold in a white and green cardboard box, bearing the CE marking and indications on the manufacturer/distributor. Individual masks are further packaged in transparent pouches.**

Brand **MUPU**

Name **KN95 MASK**

Weekly report number **Report-2022-6**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Distributor**

Date of entry into force **27/04/2021**

Alert number **[A12/00258/22](#)**

Product **Passenger car**

Risk type **Fire**

The battery may stop working properly during the charging cycle or rolling vehicle, causing an internal short circuit. This will lead to increased risk of fire.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Electric vehicle ZOE equipped with battery BT4 XLR (Extra Long Range) AR1 * 1020 Battery module, manufactured in the Flins factory**

Brand **RENAULT**

Name **ZOE**

EC-type approval/model **'e2*2007/46*0251*19 e2*2007/46*0251*20, AGVYH7**

Production dates **3.01.2021 - 22.02.2021**

Company recall code **ODKQ**

Weekly report number **Report-2022-6**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force

17/01/2022

Products were found and
measures were taken also in

The Netherlands
Poland
Portugal
Sweden

Alert number **[A12/00247/22](#)**

Product **Plush toy**



Risk type **Choking**

Small parts (the nose, the jingle bell and the suction cup) may be easily detached from the toy. A small child may put the detached elements in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Soft toy in the form of a light brown dog (18cm) with a suction cup on top, attached with a textile cord. The toy has a red ribbon with a metal jingle bell around its neck and has black plastic glasses with blue lenses on its eyes. Eyes and nose are in plastic.**

Packaging description **Sold without packaging**

Brand **Unknown**

Type / number of model **4920387**

Barcode **2881149203877**

Weekly report number **Report-2022-6**

Alert submitted by **Slovakia**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures taken by economic operators

**Recall of the product from end users
Distributor**

Date of entry into force

02/12/2021

Measures taken by economic operators

**Warning consumers of the risks
Distributor**

Date of entry into force

02/12/2021

Measures taken by economic operators

**Withdrawal of the product from the market
Distributor**

Date of entry into force

02/12/2021

Alert number **[A12/00252/22](#)**

Product **Plush toy**



Risk type **Choking**

Due to the weakness of the seam on the bottom of the toy, the filling material and small parts (lockable ZIP BAG bag with small balls) may become freely accessible to children. A child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **The toy is made of soft plush in the form of a small piglet of light yellow colour, 30cm. The eyes, nose and cheeks are embroidered and a rough twine is tied around the neck.**

Packaging description **No packaging.**

Brand **Unknown**

Name **Plush toy - Pig**

Type / number of model **ZY-15574**

Batch number **0312-5509561**

Barcode **6912080155744**

Weekly report number **Report-2022-6**

Alert submitted by	Slovakia
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Retailer
Date of entry into force	14/12/2021
Measures taken by economic operators	Warning consumers of the risks Retailer
Date of entry into force	14/12/2021
Measures taken by economic operators	Stop of sales Retailer
Date of entry into force	14/12/2021

Alert number **[A12/00246/22](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 76%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect the user.

The product does not comply with the Personal Protective Equipment Regulation and with the European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **White protective respiratory filtration half-face mask with the marking KN95. Product sold online.**

Packaging description **The product is packed in a transparent plastic pouch containing 10 items, with instructions printed on it. A paper sticker has been added on the product, with the claim "FFP2", the CE marking, and the standard EN 149.**

Brand **DB BIOTECH**

Name **Particulate respirator HG-KN95**

Type / number of model **DB 2002**

Batch number **EXP. 03/2025**


Weekly report number	Report-2022-6
Alert submitted by	Slovakia
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Importer
Date of entry into force	04/01/2022
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	04/01/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	04/01/2022

Alert number

[A12/00236/22](#)

Product

Magnesium cream

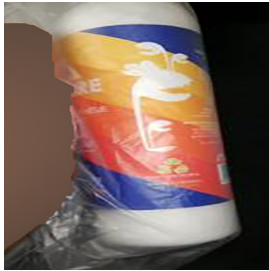

Risk type

**Chemical
Fire**

The product's labelling and packaging lack the warning indications and have inadequate pictogrammes. In the absence of hazard statements, the user is not informed that the product is highly flammable and can cause irritation to the eyes.

The product does not comply with the Classification, Labelling and Packaging (CLP) Regulation.

Category

Chemical products

Type

Consumer

Description

Bottle of magnesium cream 150 ml and 250 ml. Product also sold online.

Packaging description

Polyethylene (HDPE) bottle of 150 ml and 250 ml

Brand

MYLEORE

Name	crème de magnésie extra pure
Type / number of model	Crème de magnésie Myleore 250 ml Block'out (co-branding) Crème de magnésie Myleore 150 ml Crème de magnésie Myleore 150 ml Block'out (co-branding) Crème de magnésie Myleore 250 ml
Barcode	3760357830008 3760357830015 3760357830022 3760357830039
Weekly report number	Report-2022-6
Alert submitted by	France
Is the product counterfeit?	No
Country of origin	France
Measures taken by economic operators	Other : recall of the product for re-labelling Manufacturer
Date of entry into force	13/01/2022

Alert number **[A12/00242/22](#)**

Product **Passenger car**

Risk type **Injuries**

The backrest of the right rear seat is incorrectly welded. In the event of an accident, the occupant may not be properly restrained in the seat and may be injured.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Skoda**

Name **Fabia**

EC-type approval/model **e8*2007/46*0319*00 - 12, 5J**

Production dates **25.02.2021 - 15.03.2021**

Company recall code **72M5**

Weekly report number **Report-2022-6**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **France
Croatia
Ireland**

**The Netherlands
Sweden
Slovenia**



Alert number **[A12/00234/22](#)**

Product **Plastic toy**



Risk type **Choking**

The toy can easily break, generating small parts. A child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Wind-up hopping chick (yellow, orange, black), 9 cm, 20 g, made of hard plastic and textile material. Winding the wheel makes the chick hop forwards.**

Packaging description **The product is not packaged, but there is one label attached.**

Brand **TEDI GmbH & Co KG**

Name **Aufziehbares Küken**

Barcode **74642001201000000100**

Weekly report number **Report-2022-6**

Alert submitted by **Austria**

Is the product counterfeit? **No**

Country of origin	People's Republic of China
Measures taken by economic operators	Destruction of the product Distributor
Date of entry into force	26/01/2022
Measures taken by economic operators	Withdrawal of the product from the market Distributor
Date of entry into force	26/01/2022
Products were found and measures were taken also in	Slovakia

Alert number **[A12/00241/22](#)**

Product **Baby maracas**



Risk type **Choking
Injuries**

If a child puts the toy in the mouth and falls face down, the protruding parts could obstruct the airways, causing choking and injuries around the pharynx or trachea area.

The product does not comply with the requirements of the General Product Safety Directive and the European standard EN 71-1

Category **Toys**

Type **Consumer**

Description **Set of 3 plastic toy maracas in assorted colours. The product is sold on-line, in particular via Amazon.**

Packaging description **Transparent plastic bag.**

Brand **Edushape (the brand name is only on Amazon.com)**

Name **MARACITO 3PC SET**

Type / number of model **ITEM #: HL365-3**

Barcode **608618365032**

Weekly report number **Report-2022-6**

Alert submitted by **Luxembourg**

Is the product counterfeit? **Unknown**

Country of origin **United States**

Measures taken by economic operators **Removal of this product listing by the online marketplace
Other**

Date of entry into force **24/11/2021**

Alert number **[A12/00250/22](#)**

Product **Toy pool**



Risk type **Injuries**

The corner pins can detach from their brackets and may hurt the child seriously if the pin hits the face or the eye of the child.

The product does not comply with the requirements of the Toy Safety Directive and European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Activity toy ball pool, intended for small children to play in surrounded by soft balls. Product also sold online.**

Brand **Cloudberry Castle**

Name **Bollhav**

Type / number of model **10029665
10065745
10065746**

Weekly report number **Report-2022-6**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Date of entry into force

19/12/2021

Company recall code

- <https://www.jollyroom.se/kundservice/aterkallelser/cloudberry-castle-bollhav>
- <https://www.jollyroom.fi/asiakaspalvelu/takaisinvedetyt-tuotteet/cloudberry-castle-pallomeri>
- <https://www.jollyroom.dk/kundeservice/tilbagekaldelser/cloudberry-castle-boldbassin>
- <https://www.jollyroom.de/kundenservice/produkttruckrufe/cloudberry-castle-ballebad>

Alert number **[A12/00224/22](#)**

Product **Light commercial vehicle**

Risk type **Injuries**

The side-marker lights may be non-functioning. As a result, the vehicle may not be seen at all, or may be seen too late, from the side when it is dark or in the twilight, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Light commercial vehicle**

Brand **Fiat Professional**

Name **Ducato**

EC-type approval/model **e3*2007/46*0044*40, Type: 250**

Production dates **27.03.2021 - 22.11.2021**

Company recall code **6402**

Weekly report number **Report-2022-6**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and **The Netherlands
Slovenia**

measures were taken also in



Alert number **[A12/00230/22](#)**

Product **Baby walker**



Risk type **Injuries**

The baby-walker does not provide protection against falls and could fall down a flight of stairs, causing injuries to the child. In addition, there are openings on the tray edge. A small child may put the fingers inside and become trapped.

The product does not comply with the requirements of the General Product Safety Directive and the European standard EN 1273.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Baby walker, 3-level adjustable height, with 4-6 turning rollers, not lockable, material plastic with padded seat, tray with toy console and music (battery). The product is sold online.**

Brand **BabyPlus**

Type / number of model **my first walker**

Barcode **4033997635883**

Weekly report number **Report-2022-6**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin

Germany

Measures ordered by public
authorities

**Ban on the marketing of the product and any
accompanying measures**
Other

Alert number **[A12/00222/22](#)**

Product **Garden table**



Risk type **Injuries**

The table is unstable and does not withstand horizontal endurance testing. The base breaks and may injure persons close to the table.

The product does not comply with the requirements of the General Product Safety Directive and the European standards EN 581-1 and EN 581-3.

Category **Furniture**

Type **Consumer**

Description **Circled and square garden tables, dimensions 60x70 and 60x60x70 cm respectively, made of metal and glass.**

Packaging description **Packed in plastic foil.**

Brand **Fabbygo**

Name **Table**

Type / number of model **SC-091-60
SC-091A-60**

Barcode **000176909
000176911**

Weekly report number **Report-2022-6**

Alert submitted by **Bulgaria**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Importer**

Date of entry into force **14/01/2022**

Alert number **[A12/00228/22](#)**

Product **Plastic toy**



Risk type **Chemical
Environment**

The blue and green plastic contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and di-isobutyl phthalate (DIBP) (measured values up to 15.0 % and 13.7 % by weight respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. The solders in the toy contain lead (measured value up to 50.7 % by weight). Lead poses a risk to the environment.

The product does not comply with the REACH Regulation and with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Category **Toys**

Type **Consumer**

Description **Electric plastic toy in the shape of a duck for bath in soft plastic material. Product sold online, in particular via Joom.**

Packaging description **Thin plastic material.**

Brand **Unknown**

Name **Baby Pet Bath Ankor Leksak**

Type / number of model **91440300MA5FLJ0R7K**

Weekly report number **Report-2022-6**

Alert submitted by	Sweden
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Removal of this product listing by the online marketplace Other
Date of entry into force	04/11/2021

Alert number **[A12/00240/22](#)**

Product **Passenger car**

Corrigendum **The product does not comply with Regulation (EU) 2018/858**

Risk type **Environment**

The CX-5 Diesel has a Selective Catalytic Reduction (SCR) system. There is a SCR/AWD harness that has a unique routing around the SCR tank cover. Over time, contamination (i.e. sand, dirt) on the SCR/AWD harness may cause wear on the harness wiring and insulation due to vibrations of the SCR tank cover. In the worst-case scenario, the electrical circuits in the wiring harness can be disconnected with the MIL/SCR/4WD resulting in that the warning lights do not work properly.

The product does not comply with Regulation (EU) 2018/858

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Mazda**

Name **Mazda CX-5 (KF)**

EC-type approval/model **e13*2007/46*1803*04**

Production dates **15 May 2018 - 24 September 2020**

Company recall code **AM038A**

Weekly report number **Report-2022-6**

Alert submitted by **Romania**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators

**Recall of the product from end users
Distributor**

Date of entry into force

25/01/2022

Products were found and measures were taken also in

**Germany
Poland
Sweden**

Alert number **[A12/00238/22](#)**

Product **Safety reflector**



Risk type **Injuries**

The retroreflective/luminance performance of the product is inadequate. As a result, the user is not sufficiently visible in situations where high visibility is essential.

The product does not comply with the Personal Protective Equipment Regulation.

Category **Protective equipment**

Type **Consumer**

Description **Triangle Safety reflector made of brown plastic, 6mm thick.**

Packaging description **Clear plastic bag with a light cardboard top; the product is visible through the plastic.**

Brand **Unknown**

Name **Safety Reflector**

Type / number of model **220252**

Weekly report number **Report-2022-6**

Alert submitted by **Iceland**

Is the product counterfeit? **Unknown**

Country of origin **Finland**

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Date of entry into force

01/07/2021

Alert number

[A11/00024/22](#)

Product

Children's high chair



Risk type

**Choking
Entrapment
Injuries**

Due to presence of the openings, the stuffing material of the sheathing is accessible. A child could detach the stuffing material and swallow it, which may cause choking. Moreover, presence of the openings poses a risk of finger or body entrapment.

The product does not comply with the requirements of the General Product Safety Directive and with the European standard EN 14988.

Category

Childcare articles and children's equipment

Type

Consumer

Description

Children's high-chair made of plastic material with textile sheathing.

Brand

ZOPA

Name

High Chairs IVOLIA

Type / number of model

ZOP055710

Weekly report number

Report-2022-6

Alert submitted by

Poland

Is the product counterfeit?

Unknown

Country of origin **Unknown**

Measures taken by economic operators **Withdrawal of the product from the market
Distributor**

Date of entry into force **06/12/2021**

Alert number

[A12/00233/22](#)

Product

Set of inflatable beach balls



Risk type

Chemical Choking

The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) and diisobutyl phthalate (DIBP) (measured values up to 26 % and 0,12 % by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system. Furthermore, the balls' stopper can easily detach; a young child may put it into its mouth and choke on it.

The product does not comply with the REACH Regulation and with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category

Toys

Type

Consumer

Description

Set of 12 multi-coloured inflatable beach balls. Product sold online, in particular via Amazon, with ASIN number B01GO92B7U.

Packaging description

Transparent foil bag.

Brand

SYZ

Name

Beach Balls Bulk

Type / number of model

12 Beach Balls Bulk

Batch number

B01GO92B7U

Barcode	X002QFX9L5
Weekly report number	Report-2022-6
Alert submitted by	Luxembourg
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Removal of this product listing by the online marketplace Other
Date of entry into force	24/11/2021

Alert number **[A12/00235/22](#)**

Product **Toy tambourine**



Risk type **Choking**

The bell may get loose from the tambourine's wooden frame and liberate a small part (axe of the bell). A child may put it into its mouth and choke on it.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **The tambourine is round shaped and around 4 cm high, with a wooden wound frame that is the base of the tambourine, and with three bells. On the top of the wooden ring a sheet is placed what can function as a drum. The drum is on top decorated with a Nijntje/ Miffy print in bright basic colours.**

Brand **Bambolino Toys/ TM Essentials BV**

Name **Tambourine Nijntje/Miffy**

Type / number of model **17029**

Batch number **170292-0421V01**

Barcode **8714274170292**

Weekly report number **Report-2022-6**

Alert submitted by	The Netherlands
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Other
Date of entry into force	08/12/2021
Company recall code	- https://tmessentials.nl/index.php/tm-essentials-products-2/brands-and-licenses/bambolino/waarschuwing-nijntje-tamboerijntje

Alert number **[A12/00243/22](#)**

Product **Passenger car**

Risk type **Injuries**

The nuts on the front wheels may come loose, increasing the risk of an accident. This could eventually affect the integrity of the wheel assembly and the vehicle's behaviour, increasing the risk of an accident.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car, front wheels (nuts)**

Brand **MAZDA**

Name **MAZDA 3**

EC-type approval/model **"e13*2007/46*1972*00 e13*2007/46*1972*01 e13*2007/46*1972*02 e13*2007/46*1972*03"**

Company recall code **AK027A**

Weekly report number **Report-2022-6**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Luxembourg**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **30/11/2021**

Products were found and **The Netherlands
Sweden**

measures were taken also in



Alert number **[A12/00232/22](#)**

Product **Fireworks**



Risk type **Damage to hearing**

The rocket may not correctly ascend before exploding, thus not reaching the required safety elevation. The users or spectators could suffer from temporary impairment of hearing.

The product does not comply with the requirements of the Pyrotechnics Directive and the European standard EN 15947.

Category **Pyrotechnic articles**

Type **Consumer**

Description **Rocket of category F2, red, black and yellow wrapper, 10 pieces per package.**

Packaging description **The items are sold in a red and black carton box with white lettering.**

Brand **Bonbridge**

Name **X-treme Rocket**

Type / number of model **3401**

Batch number **3401-2020-1**

Barcode **8714214018349**

Weekly report number **Report-2022-6**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/00226/22](#)**

Product **Lighting chain**



Risk type

**Burns
 Electric shock
 Fire**

The cable is not properly anchored and is too thin. The accessible wires have inadequate insulation. The structure of the cord extension socket allows single-pole insertion of plugs. The cable could overheat, leading to burns or fire. The user could touch accessible live parts, which may cause an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60598.

Category

Lighting chains

Type

Consumer

Description

Lighting chain with 100 non-replaceable red LED lamps. The product includes a socket outlet that allows the connection of another lighting chain.

Packaging description

Transparent plastic box.

Brand	Unknown
Name	100 LED LIGHT MERRY CHRISTMAS
Type / number of model	XM-100-C-L-LN
Barcode	6902104579175
Weekly report number	Report-2022-6
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Other
Date of entry into force	19/01/2022
Measures taken by economic operators	Destruction of the product Retailer
Date of entry into force	19/01/2022

Alert number **[A12/00229/22](#)**

Product **Children's sweater**



Risk type **Choking**

The small decorative elements (beads) can easily be detached from the sweater. A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the General Product Safety Directive.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Burgundy knitted children's sweater decorated with sewn and glued beads. Size: 92**

Packaging description **The product was sold without packaging.**

Brand **Yutokids**

Type / number of model **821**

Weekly report number	Report-2022-6
Alert submitted by	Hungary
Is the product counterfeit?	Unknown
Country of origin	Unknown
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Other
Date of entry into force	09/12/2021
Measures taken by economic operators	Destruction of the product Distributor
Date of entry into force	09/12/2021

Alert number

[A12/00225/22](#)

Product

Children's clothing set



Risk type

Choking

The small decorative elements (beads) can easily be detached from the floral decoration. A small child may put them in the mouth and choke on them. In addition, the easy-open safety pin poses a high risk of eye injury to children.

The product does not comply with the requirements of the General Product Safety Directive.

Category

Clothing, textiles and fashion items

Type

Consumer

Description

Babies' clothing set consisting of a long-sleeved white T-shirt, a floral vest with zipper and hood and pink trousers with inscription "hello little one". The zipped vest is decorated with a floral composition that is fixed with a safety pin. Size: 6-12M.

Packaging description

The product was sold without packaging.

Brand	Hippil Baby
Type / number of model	0251
Barcode	0050611402519
Weekly report number	Report-2022-6
Alert submitted by	Hungary
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	21/01/2022
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	21/01/2022

Alert number **[A12/00231/22](#)**

Product **Particle filter mask**



Risk type **Health risk / other**

The particle/filter retention of the material is insufficient (measured values: as low as 50%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect the user.

The product does not comply with the Personal Protective Equipment Regulation and the European standard EN 149.

Category **Protective equipment**

Type **Consumer**

Description **White particle filter mask with the marking "KN95", sold per 10.**

Packaging description **White and blue cardboard box with markings "CE" and "FFP2", containing 10 items; each item is individually packaged in clear plastic bag.**

Brand **Jiang Xi Rong Ge Technology Co**

Name **KN95 Protective Mask**

Type / number of model **RG-MX-P01**

Batch number **2020081501**

Barcode **6973335160043**

Weekly report number	Report-2022-6
Alert submitted by	Belgium
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Importer

Alert number

A12/00239/22

Product

Babies' romper suit



Risk type

Choking

The small decorative elements (rhinestones) can easily be detached from the product. A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the General Product Safety Directive.

Category

Clothing, textiles and fashion items

Type

Consumer

Description

Pink and checkered, long-sleeve baby rompersuit decorated with rhinestones. Size: 3-6 months

Packaging description

The product was sold without packaging.

Brand

Jolly Joy

Type / number of model

4054

Barcode	2017071440541
Weekly report number	Report-2022-6
Alert submitted by	Hungary
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	15/12/2021
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	15/12/2021

Alert number **[A12/00253/22](#)**

Product **Passenger car**

Risk type **Injuries**

The passenger airbag deactivation switch may have been improperly configured. In the event of a side impact the airbag might not deploy, increasing the risk of injury.

The product does not comply with the requirements laid down in the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Mazda 5 vehicles fitted with a passenger airbag deactivation switch.**

Brand **mazda**

Name **Mazda 5 (CR)**

EC-type approval/model **e13*2001/116*0156*03 e13*2001/116*0156*02
e13*2001/116*0156*01 e13*2001/116*0156*00
e13*2001/116*0156*08 e13*2001/116*0156*07
e13*2001/116*0156*06 e13*2001/116*0156*05
e13*2001/116*0156*04**

Production dates **11.02.2005 - 17.09.2010**

Company recall code **AH003A**

Weekly report number **Report-2022-6**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force

10/12/2021

Products were found and
measures were taken also in

**The Netherlands
Sweden
Slovenia**

Alert number **[A12/00244/22](#)**

Product **Plastic doll**



Corrigendum **A12/00244/22: after further investigations, the notified product was found to be counterfeit.**

Risk type **Chemical**

Some plastic parts (heads of the dolls) contain di-(2-ethylhexyl) phthalate (DEHP) (measured values: up to 21.48% by weight). This phthalate is toxic and harmful for the health of children and may cause damages to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Set of 4 plastic dolls about 28cm tall, 3+ ages.**

Packaging description **Cardboard box with transparent window.**

Brand **Rainbow GIRLS**

Name **Rainbow GIRLS [COUNTERFEIT]**

Type / number of model **1840**

Batch number **LT148**

Barcode **6914818403967**

Weekly report number	Report-2022-6
Alert submitted by	Czechia
Is the product counterfeit?	Yes
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Retailer
Date of entry into force	27/01/2022

Alert number **[A12/00227/22](#)**

Product **Childrens' sandals**



Risk type **Choking**

The small decorative elements (rhinestones) can easily be detached from the product. A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the General Product Safety Directive.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Black sandals decorated with rhinestones. Size: 24**

Packaging description **Cardboard box**

Brand **Inspire**

Type / number of model **PM17-14**

Weekly report number **Report-2022-6**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**


Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **25/01/2022**



Alert number **[A11/00026/22](#)**

Product **Extension cord**

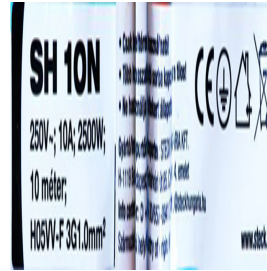

Risk type **Burns
Fire**

The cable inside the mains power cord is too thin. It could overheat during normal use, which could cause burns to the user or even lead to a fire.

The product does not comply with the requirements of the Low Voltage Directive.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Single-socket mains extension lead with 10 meters cable.**

Packaging description **Transparent plastic bag.**

Brand **steck!**

Name **Védőérintkezős hálózati hosszabbító**

Type / number of model **SH 10N**

Barcode **5999082211105**

Weekly report number **Report-2022-6**

Alert submitted by **Hungary**

Is the product counterfeit? **No**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Importer**

Date of entry into force


20/10/2021

Alert number

[A12/00248/22](#)

Product

Electric scooter

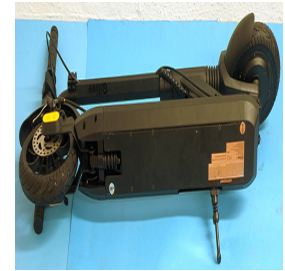

Risk type

Injuries

The distance between the steering column support and the base of the scooter is wide enough to insert fingers when the scooter is folded, but when opening it up the colliding parts adjust to each other, and may cause injuries to the user's hand.

The product does not comply with the requirements of the Machinery Directive and the European standards EN 14619 and EN 17128.

Category

Machinery

Type

Consumer

Description

Black folding electric scooter with battery charger (FOREVER), with "Electric Scooter" written on it. Weight: 11.5 kg

Packaging description

The product is sold in a cardboard box.

Brand

Qilive

Name	Scooter JOY
Type / number of model	151369 / E8.2 Q.4863
Barcode	3245676827125
Weekly report number	Report-2022-6
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	30/12/2021
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	30/12/2021

Alert number **[A12/00249/22](#)**

Product **Bicycle helmet**



Risk type **Injuries**

The helmet can easily break during an impact, thus not sufficiently protecting the user from injuries to the head. Furthermore, the rear belt connection tears out easily, hence the helmet may slip off; the lack of helmet retention can reduce its effectiveness in the event of impact, causing injuries to the head.

The product does not comply with the Personal Protective Equipment (PPE) Regulation and with the European standard EN 1078.

Category **Protective equipment**

Type **Consumer**

Description **Helmet for pedal cyclists and for users of skateboards and roller skates according to EN 1078. Gray Plastic shell over a Styrofoam helmet, of sizes 54-58 cm.**

Packaging description **Clear plastic bag**

Brand **Rawlink**

Type / number of model **44742**

Batch number **138560
manufactured in October 2019**

Barcode **709386447427**

Weekly report number **Report-2022-6**

Alert submitted by	Iceland
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Retailer
Date of entry into force	02/02/2022

Alert number **[A12/00254/22](#)**

Product **Fireworks**



Risk type **Burns
Damage to hearing**

The noise level is too high (measured values: up to 124.8 dB). Consequently it can cause damage to hearing. Furthermore, the product may explode at too low altitude and can burst too close to the ground. Bystanders can be hit by parts of the firework, causing burns.

The product does not comply with the requirements of the Pyrotechnics Directive and European standard EN 15947-1-5.

Category **Pyrotechnic articles**

Type **Consumer**

Description **Fireworks of the type "roman candle", category F2, that can fire 8 shots.**

Packaging description **Transparent plastic packaging containing 4 candles**

Brand **Unknown**

Name **Turbo 8SH**

Type / number of model **2553 / YT-2536 / 1008-F2-69244836**

Batch number **TR20-25368**

Barcode **5425017852650**

Weekly report number **Report-2022-6**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Importer**

Alert number **[A12/00245/22](#)**

Product **LED striplight**



Risk type **Electric shock**

The insulation of the LED control gear unit is not adequate and the clearance/creepage distances between the primary and accessible secondary circuits is not sufficient. When touching it, a user may receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive and the European standards EN 61347-2-13 and EN 61347-1.

Category **Lighting equipment**

Type **Consumer**

Description **LED strip: DS-10W, 12VDC, class III, IP20. Control gear: 220V, 50/60Hz, 12VDC / 5A / 60W**

Packaging description **Sold in a brown cardboard box with printed label.**

Brand **EUROLAMP**

Name **Valonauha, LED**

Type / number of model **147-70251
Control gear: 147-70564**

Barcode **6430014521880**

Weekly report number **Report-2022-6**

Alert submitted by **Finland**

Is the product counterfeit?	Unknown
Country of origin	Greece
Measures ordered by public authorities	Stop of sales Distributor
Date of entry into force	03/02/2022
Measures taken by economic operators	Recall of the product from end users Distributor
Date of entry into force	03/02/2022
Company recall code	- https://nakoislehti.media.fi/uutisvuoksi/2459ebd2-9a41-4998-9331-5fc3978b2983/10?cd_browse-mode=browser&user=61f2434022e0bc4fbe534955&cd_user-id=61f2434022e0bc4fbe534955&cd_user-products=22uuvud1,uv_digi

Alert number

[A12/00255/22](#)

Product

Skin-lightening cream



Risk type

Chemical

The product contains hydroquinone (declared value 2% by weight). Hydroquinone can cause skin irritation and dermatitis.

The product does not comply with the Cosmetic Products Regulation.

Category

Cosmetics

Type

Consumer

Description

Skin-lightening cream with coconut oil and containing hydroquinone (2%), as declared in the list of ingredients.

Packaging description

The product is sold in a 300 ml, mostly white container, with a white cap. Instructions are originally in French, English, and Portuguese, and a label with indications in Swedish was attached over these.

Brand

Ghandour Cosmetics

Name

Coco Care Lightening Cream

Barcode

6203003460497

Weekly report number

Report-2022-6

Alert submitted by

Sweden

Is the product counterfeit?

Unknown

Country of origin

Democratic Republic Of Congo

Measures taken by economic operators

**Stop of sales
Distributor**