

---

Alert number **[A11/00051/22](#)**

Product **Light commercial vehicle**

---

Risk type **Fire**

**The pins on the electrical tow-bar connector may be incorrectly positioned. This could lead to the improper functioning of the trailer lights, increasing the risk of an accident. Moreover, this could lead to a thermal incident in the trailer's integrated auxiliary battery, increasing the risk of fire.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Light commercial vehicle**

Brand **NISSAN**

Name **NV400**

EC-type approval/model **e2\*2007/46\*0145**

Production dates **11.10.2019 - 6.11.2019**

Company recall code **PN0C6**

Weekly report number **Report-2022-12**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force

**27/07/2020**

Products were found and  
measures were taken also in

**The Netherlands**

Alert number **[A12/00472/22](#)**

Product **Powerbank**



Risk type **Burns  
Fire**

**The battery management system does not keep the Lithium-ion cell within the parameters for current, voltage and temperature as specified by the manufacturer and the cells lack a thermal control circuit. The battery can catch fire or explode when it is charged under too high or too low ambient temperature.**

**The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60950-1 and EN 62133.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Powerbank (colours grey, black and white). Product also sold online.**

Packaging description **Cardboard box**

Brand **Kruidvat  
Trekpleister**

Name **Powerbank**

Type / number of model **10000MAH,  
ISW 47.324**

Batch number **19/41**

Weekly report number **Report-2022-12**

Alert submitted by	<b>The Netherlands</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Other</b>
Date of entry into force	<b>20/04/2020</b>
Company recall code	- <a href="https://www.productwaarschuwing.nl/2020/04/terugroepactie-powerbanks-prijsmeeper/">https://www.productwaarschuwing.nl/2020/04/terugroepactie-powerbanks-prijsmeeper/</a> - <a href="https://www.productwaarschuwing.nl/2020/04/terugroepactie-kruidvat-powerbanks/">https://www.productwaarschuwing.nl/2020/04/terugroepactie-kruidvat-powerbanks/</a> - <a href="https://www.productwaarschuwing.nl/2020/04/terugroepactie-trekpleister-powerbanks/">https://www.productwaarschuwing.nl/2020/04/terugroepactie-trekpleister-powerbanks/</a>

---

Alert number **[A12/00479/22](#)**

Product **Light commercial vehicle**

---

Risk type **Injuries**

**Defective welding seams on the front axle control arm may reduce the steering ability of the vehicle. A loss of control cannot be ruled out, increasing the risk of an accident.**

**The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles**

Category **Motor vehicles**

Type **Professional**

Description **Pickup truck/light commercial vehicle.**

Brand **Tropos Motors**

Name **Able**

EC-type approval/model **e9\*168/2013\*11489\*00  
eCUV**

Production dates **01.10.2019 - 15.12.2021**

Company recall code **13-2021**

Weekly report number **Report-2022-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Company recall code **- <http://tropotech.com/contact.html>**

Products were found and **The Netherlands**

measures were taken also in



Alert number **[A12/00469/22](#)**

Product **Passenger car**

Risk type **Injuries**

**The radar sensor may malfunction due to a faulty installation. This can result in a failure to detect a vehicle in front through the PCS (pre-collision system), which will not provide warnings or brake assistance and the vehicle will not show the driver a message or indicator that the PCS is not working. This may increase the risk of an accident.**

**The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Model Name (Model Code): C-HR (MAXH10, NGX10, ZGX10, ZYX11), GR Yaris (GXPA16) and Yaris (KSP211, MXPA11, MXP11); Model Year: 2020-2021; Countries of production: Turkey (C-HR), Japan (GR Yaris) and France (Yaris).**

Packaging description -

Brand **Toyota**

Name **C-HR, GR Yaris, Yaris.**

EC-type approval/model **e6\*2007/46\*0338\*04, e6\*2007/46\*0454\*00, e6\*2007/46\*0437\*01.**

Production dates **C-HR (20.03.2020 - 26.07.2021) , GR Yaris (24.06.2020 - 02.08.2021), Yaris (06.07.2020 - 21.06.2021).**

Company recall code **22SMD-016**

Weekly report number **Report-2022-12**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin

**Turkey**

Measures taken by economic operators

**Recall of the product from end users  
Importer**

Products were found and measures were taken also in

**Bulgaria  
Poland  
Sweden  
Slovenia**



Alert number **[A12/00467/22](#)**

Product **Passenger car**

Risk type **Injuries**

**Due to a faulty calibration of the electronic power steering computer, overheating may occur. This can lead to a possible loss of steering management assistance, increasing the risk of an accident.**

**The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Renault**

Name **Arkana**

EC-type approval/model **e6\*2018/858\*00003 00, e6\*2018/858\*00003 01, e6\*2018/858\*00003 02, e6\*2018/858\*00003 03, e6\*2018/858\*00003 04, e6\*2018/858\*00003 05, e6\*2018/858\*00003 06**

Production dates **11.10.2019 - 21.11.2021.**

Company recall code **ODTM**

Weekly report number **Report-2022-12**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users  
Distributor**

Products were found and  
measures were taken also in

**Bulgaria**  
**Ireland**  
**Iceland**  
**Malta**  
**The Netherlands**  
**Poland**  
**Sweden**

---

Alert number **[A12/00463/22](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The windscreen is not fixed sufficiently to the structure of the car body. In the event of a frontal collision, the windscreen might not be held in place, increasing the risk of an accident/injuries.**

**The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car.**

Brand **Ford**

Name **Mustang Mach-E**

EC-type approval/model **e13\*2007/46\*2387\*00 -\*02, LSK**

Production dates **24.02.2020 - 18.06.2021**

Company recall code **21C22**

Weekly report number **Report-2022-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Mexico**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code **- <http://www.etis.ford.com/>**

Products were found and  
measures were taken also in


**Bulgaria**  
**France**  
**Ireland**  
**Iceland**  
**The Netherlands**  
**Poland**  
**Sweden**

Alert number

**A12/00452/22**

Product

**Particle filter mask**

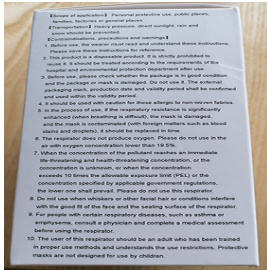

Risk type

**Health risk / other**

**The total filtration capacity of the mask is insufficient (measured mean values: as low as 58%). Consequently, the product does not fulfil the health and safety requirements and it may not properly protect the user.**

**The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 149.**

Category

**Protective equipment**

Type

**Consumer**

Description

**White unbranded face masks. Product sold online.**

Packaging description

**The product is sold in a white and green cardboard box containing 20 masks with the claim FFP2, a reference to the EN 149 standard and with the CE marking.**

Brand

**Unknown**

Name	<b>FFP2 NR Protective Mask</b>
Type / number of model	<b>JH-036</b>
Weekly report number	<b>Report-2022-12</b>
Alert submitted by	<b>Ireland</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Other : Product modification to include hooks. Update to user instructions. Manufacturer</b>
Date of entry into force	<b>01/03/2022</b>
Measures taken by economic operators	<b>Other : Product modification to include hooks. Update to user instructions. Importer</b>
Date of entry into force	<b>01/03/2022</b>

---

Alert number **[A12/00468/22](#)**

Product **Soft toy**

---



Risk type **Choking**

**Small parts can easily detach (eyes). A small child may put them in the mouth and choke.**

**The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN71-1.**

Category **Toys**

Type **Consumer**

Description **Stuffed toy brown dog with a red scarf**

Brand **Unknown**

Type / number of model **AC-11025**

Batch number **L23SHWO20**

Barcode **8019959110250**

Weekly report number **Report-2022-12**

Alert submitted by **Luxembourg**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Retailer**

Date of entry into force

**23/02/2022**



---

Alert number **[A12/00454/22](#)**

Product **Soft toy**

---



Risk type **Choking**

**The product has small parts (eye and nose) that can easily detached. A small child may put them in the mouth and choke.**

**The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Stuffed bear toy**

Brand **CIUDAD SION TOYS**

Type / number of model **P-300**

Barcode **5635235503009**

Weekly report number **Report-2022-12**

Alert submitted by **Luxembourg**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public **Ban on the marketing of the product and any**

authorities

**accompanying measures**  
**Retailer**

Date of entry into force

**23/02/2022**

Alert number **[A12/00477/22](#)**

Product **Toy gun**



Risk type **Chemical  
Choking  
Environment**

**The plastic material of the product contains an excessive amount of organic tin (TBT) (measured value 23 mg/kg). TBT is potentially persistent, bioaccumulative and toxic for the environment. The product also contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP), diisobutyl phthalate (DIBP) and dibutyl phthalate (DBP)(measured values up to 1,3 %, 0,13% and 7,7% by weight, respectively). These phthalates may harm the health of children, possibly causing damage to their reproductive system. In addition, small parts can easily detach (suction cups). A small child may put them in the mouth and choke.**

**The product does not comply with the REACH regulation nor with the European standards EN 71-1 and EN 71-3.**

Category **Toys**

Type **Consumer**

Description **Two plastic toy projectile guns (yellow and blue). Product sold online, in particular via Amazon.**

Brand **LAARNT**

Name **Safety sucker soft egg gun, soft bullet**

Type / number of model **668**

Weekly report number **Report-2022-12**

Alert submitted by	<b>Ireland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Removal of this product listing by the online marketplace Other</b>

---

Alert number **[A12/00465/22](#)**

Product **Children's jumpsuit**

---



Risk type **Strangulation**

**The product has long functional cords with free ends in the neck area. These cords can become trapped during various activities of a child, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14682.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Dungarees with a multicolour floral print designed for children. Product sold online, in particular via AliExpress.**

Brand **Unknown**

Name **Combinaison en coton pour petites filles, sans manches, col licou, imprimé floral, teinture, été**

Type / number of model **2Y**

Weekly report number **Report-2022-12**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators

**Removal of this product listing by the online marketplace  
Other**

Date of entry into force

**30/09/2021**

---

Alert number **[A12/00466/22](#)**

Product **Children's swimsuit**

---



Risk type **Strangulation**

**The product bears functional cords close to the neck and in the back area. The cords may become trapped during various activities of a child, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14682**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Two-piece swimming costume, orange and black. Product sold online, in particular via AliExpress.**

Brand **Unknown**

Name **Maillot de bain pour filles, tenue pour fillettes de 5 à 14 ans, ensemble deux pièces, à imprimé feu**

Weekly report number **Report-2022-12**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators **Removal of this product listing by the online marketplace  
Other**

Date of entry into force **30/09/2021**





Alert number **[A12/00478/22](#)**

Product **Inflatable toy set**



Risk type **Choking  
Suffocation**

**Small parts can easily detach (stoppers). As a consequence, a small child may put them in the mouth and choke. In addition, the plastic of the packaging is too thin. If a child plays with it, the plastic can cover the mouth and nose, causing the child to suffocate.**

**The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Inflatable cross with plastic rings. Product sold online, in particular via Amazon.**

Brand **Lencyotool**

Weekly report number **Report-2022-12**

Alert submitted by **Ireland**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators **Removal of this product listing by the online marketplace  
Other**

---

Alert number **[A12/00451/22](#)**

Product **Oven mitts**

---



Risk type **Burns**

**The product's material is not resistant to high temperatures. When touching a hot surface with it, the user may/will suffer severe burns to the fingers/hand.**

**The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 407.**

Category **Kitchen/cooking accessories**

Type **Consumer**

Description **Set of silicone cooking gloves. Product sold online, in particular on bol.com**

Brand **Unknown**

Name **All you need Siliconen Ovenwanten**

Weekly report number **Report-2022-12**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **24/12/2021**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **24/12/2021**

Measures ordered by public authorities **Warning consumers of the risks  
Other**

Date of entry into force **24/12/2021**

Alert number **[A12/00460/22](#)**

Product **Passenger car**

Corrigendum **At the request of the notifying authority the notification A12/00460/22 has been updated with additional information on the type of risk.**

Risk type **Fire**

**Inadequate attachment of a wiring harness can lead to overheating of the rear window, increasing the risk of fire.**

**The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **CITROEN**

Name **Jumpy, Spacetourer**

EC-type approval/model **V  
e2\*2007/46\*0530\*00, e2\*2007/46\*0530\*01,  
e2\*2007/46\*0530\*02,**

Production dates **20.10.2015 - 13.10.2016**

Company recall code **HQB**

Weekly report number **Report-2022-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code

- <https://www.citroen.de/wartung-services/rueckrufaktion-pruefung.html>

Products were found and  
measures were taken also in

**Croatia**  
**Ireland**  
**The Netherlands**  
**Poland**  
**Sweden**  
**Slovenia**

Alert number **[A12/00459/22](#)**

Product **Passenger car**

Corrigendum **At the request of the notifying authority the notification A12/00459/22 has been updated with additional information on the type of risk.**

Risk type **Fire**

**Inadequate attachment of a wiring harness can lead to overheating of the rear window, increasing the risk of fire.**

**The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **PEUGEOT**

Name **Expert, Traveller**

EC-type approval/model **V  
e2\*2007/46\*0532\*00, e2\*2007/46\*0532\*00,  
e2\*2007/46\*0532\*02,**

Production dates **26.11.2015 - 13.10.2016**

Company recall code **KLH**

Weekly report number **Report-2022-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code

- <https://www.peugeot.de/tools/pruefung-ihres-fahrzeugs-auf-rueckrufaktionen.html>

Products were found and  
measures were taken also in

**The Netherlands**  
**Poland**  
**Slovenia**

Alert number **[A12/00461/22](#)**

Product **Motorcycle**

Risk type **Injuries**

**A faulty ignition control unit may lead to the connecting rod in the cranktrain of the engine to break. This may cause the rear wheel to block, which in turn can lead to an accident.**

**The product does not comply with the Regulation on the approval and market surveillance of two or three wheel vehicles and quadricycles.**

Category **Motor vehicles**

Type **Consumer**

Description **Motorcycle for competitions**

Brand **KTM, Husqvarna, GasGas**

Name **KTM 125 SX ; KTM 150 SX ; KTM 125 XC (US Modell); HQV TC 125 ; GG MC 125**

Production dates **MY 2022**

Company recall code **GG MC 125: 30\_2028163  
HQV TC 125: 30\_2028162  
KTM : 30\_2028161**

Weekly report number **Report-2022-12**

Alert submitted by **Austria**

Is the product counterfeit? **No**

Country of origin **Austria**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **07/03/2022**

Company recall code **- <https://www.gasgas.com/de-at/service/safety-information.html>**



- <https://www.husqvarna-motorcycles.com/de-ch/service/safety-information.html>
- <https://www.ktm.com/de-at/service/Safety.html>

Products were found and  
measures were taken also in

**France**  
**Croatia**  
**The Netherlands**  
**Sweden**  
**Slovenia**

Alert number

**[A11/00049/22](#)**

Product

**Electric swing for babies**



Risk type

**Injuries**

**The swing is not stable enough. As a result, it can tip over and fall, leading to injuries to a child.**

**The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 1273.**

Category

**Childcare articles and children's equipment**

Type

**Consumer**

Description

**Baby swing with batteries and removable toy bar.**

Packaging description

**Cardboard Box**

Brand

**konig kids**

Name

**Baby swing Nakko 20**

Type / number of model

**Nakko 20, 63578**

Barcode

**998168328606**

Weekly report number

**Report-2022-12**

Alert submitted by

**Lithuania**

Is the product counterfeit?

**No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Importer**

---

Alert number **[A12/00462/22](#)**

Product **Passenger car**

---

Risk type **Injuries**

**Defective wheel rims can lead to fatigue fractures. As a result, the wheels can become damaged which can adversely affect the handling of the vehicle, increasing the risk of an accident.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **FIAT**

Name **Tipo**

EC-type approval/model **356  
e3\*2007/46\*0373\*27**

Production dates **13/04/2021 - 28/09/2021**

Company recall code **6383**

Weekly report number **Report-2022-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **France  
The Netherlands  
Poland**

Alert number **[A12/00464/22](#)**

Product **Candles set**



Risk type **Fire**

**The melted material of the candle can ignite and continue to burn during use, which can result in fire.**

**The product does not comply with the requirements of the General Product Safety Directive nor the European standard EN 15493.**

Category **Decorative articles**

Type **Consumer**

Description **A set of 12 pink candles.**

Packaging description **Cardboard and plastic package.**

Brand **GoDan**

Name **Candles**

Type / number of model **SW-SSPR**

Batch number **63MM21**

Barcode **5901238651147**

Weekly report number **Report-2022-12**

Alert submitted by **Finland**

Is the product counterfeit?

**Unknown**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Ban on the marketing of the product and any accompanying measures  
Distributor**

Date of entry into force

**04/03/2022**

Alert number

**[INFO/00018/22](#)**

Product

**Make-up remover**



Risk type

**Microbiological**

**The product is biologically contaminated, with a biofilm on a filling line. Consequently, safe use cannot be guaranteed.**

**The product does not comply with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Make-up removing micelle lotion, 850 ml.**

Packaging description

**Transparent plastic bottle containing 850 ml.**

Brand

**BIODERMA**

Name

**SENSIBIO H2O**

Type / number of model

**850 ml**

Batch number

**22411H  
22413H  
22515H  
22915H  
23012H**

Barcode

**3701129801642**

Weekly report number

**Report-2022-12**

Alert submitted by	<b>Romania</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>France</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>08/03/2022</b>
Company recall code	- <a href="https://www.bioderma.com.ro/sensibio-h2o-850-ml-retragerea-produsului-si-rechemare-lot-22413h">https://www.bioderma.com.ro/sensibio-h2o-850-ml-retragerea-produsului-si-rechemare-lot-22413h</a>



---

Alert number **[A12/00470/22](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The cap on the brake-fluid reservoir may not be able to provide proper ventilation enabling atmospheric pressure to be maintained within the reservoir itself. This may cause the vehicle to lose some or all of its braking capacity, increasing the risk of an accident.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **High-performance sports car**

Brand **Ferrari**

Name **458 Italia, 458 Spider, 458 Speciale, 458 Speciale A, 488 GTB, 488 Spider, J50**

Production dates **08/2009 - 07/2019**

Company recall code **78**

Weekly report number **Report-2022-12**

Alert submitted by **Italy**

Is the product counterfeit? **No**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **01/03/2022**

**The Netherlands**

Products were found and  
measures were taken also in



Alert number **[A12/00453/22](#)**

Product **Plastic toy**



Risk type **Choking  
Damage to hearing**

**The sound pressure level is too high (measured value: up to 112.5 dB). This could lead to permanent or partial hearing loss, when the product is used. Small parts (squeaking elements) may easily detach from the toy. A small child may put these or the stuffing in the mouth and choke.**

**The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Plastic sensory balls, each containing a squeaking element.**

Packaging description **Foil bag.**

Brand **BIGTOYS**

Name **Pilki sensoryczne**

Type / number of model **BPIL6342**

Barcode **5902719776342**

Weekly report number **Report-2022-12**

Alert submitted by	<b>Poland</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>20/12/2021</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Importer</b>
Date of entry into force	<b>20/12/2021</b>

Alert number **[A12/00475/22](#)**

Product **Hair lotion**



Risk type **Chemical**

**According to the list of ingredients the product contains a mixture of the preservatives methylchloroisothiazolinone and methylisothiazolinone (MCI and MI), which are forbidden in leave-on cosmetics. Dermal contact with MCI and MI containing products can provoke allergic contact dermatitis in sensitive persons.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Consumer**

Description **Anti hair loss lotion**

Packaging description **The product is sold in a 12ampoules x 10 ml cardboard box.**

Brand **New Placentyne**

Name **New Placentyne**

Barcode **8029550000126**

Weekly report number **Report-2022-12**

Alert submitted by **Sweden**

Is the product counterfeit? **Unknown**

Country of origin **Italy**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Retailer**

Date of entry into force **17/09/2021**

---

Alert number	<b><a href="#">A12/00474/22</a></b>
Product	<b>Skin-lightening lotion</b>

---



Risk type **Chemical**

**According to the list of ingredients the product contains a mixture of the preservatives methylchloroisothiazolinone and methylisothiazolinone (MCI and MI), which are forbidden in leave-on cosmetics. Dermal contact with MCI and MI containing products can provoke allergic contact dermatitis in sensitive persons.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Consumer**

Description **Skin lightening cream**

Packaging description **450 ml jar**

Brand **Mama Africa Cosmetics**

Name **Mama Africa**

Barcode **6280675002996**

Weekly report number **Report-2022-12**

Alert submitted by **Sweden**

Is the product counterfeit? **Unknown**

Country of origin **Italy**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Retailer**

Date of entry into force **16/09/2021**



Alert number **[A11/00050/22](#)**

Product **Toy guns set**



Risk type **Choking**

**The foam projectiles are too small; a child playing with the toy may put (a) projectile(s) in the mouth and choke.**

**The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Set comprising two toy guns and various projectiles.**

Packaging description **The product is sold in a transparent plastic blister with a coloured cardboard background.**

Brand **GAZELO Toys**

Name **Police shooting set**

Type / number of model **G137421-9311-41B-7257**

Barcode **5900949423760**

Weekly report number **Report-2022-12**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Warning consumers of the risks Importer</b>
Date of entry into force	<b>14/01/2022</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Importer</b>
Date of entry into force	<b>14/01/2022</b>

---

Alert number **[A12/00471/22](#)**

Product **Passenger car**

---

Risk type **Injuries**

**The banjo bolts which are fitted between the flexi-hose and the caliper within the brake assembly on each corner of the vehicle may not function properly because they don't have the necessary holes drilled into them. This can lead to a lack of hydraulic pressure to the affected caliper, resulting in pulling the car sideways when braking, increasing the risk of an accident.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **McLaren**

Name **570GT, 720S, 600LT, GT**

EC-type approval/model **MA3  
e11\*2007/46\*3432, e5\*2007/46\*1205**

Production dates **08.07.2019 - 10.12.2019**

Company recall code **2021/01**

Weekly report number **Report-2022-12**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and  
measures were taken also in

**The Netherlands**



Alert number **[A12/00476/22](#)**

Product **Extension cord**



Risk type **Burns  
Electric shock  
Fire**

**The cross-sectional area of the external and internal wires is too thin and they can overheat, leading to burns or fire. In the event of damage of the base-insulated wires, the active parts may become accessible, which may cause an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **1 socket electric extension cord, with fork, without earthing, 20 m long, orange.**

Packaging description **Plastic packaging**

Brand **SCHUST EL**

Type / number of model **DG-YHB01**

Batch number **0020420**

Barcode **4752182204207**

Weekly report number **Report-2022-12**

Alert submitted by **Lithuania**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Retailer**

Date of entry into force **02/03/2022**

Alert number **[A12/00473/22](#)**

Product **Fan heater**



Risk type **Burns  
Fire**

**The plastic of the product can easily melt, leaving live or moving parts accessible. Consequently, a user could touch live/moving parts, or the hot surface, and could suffer burns. During continuous use, the product could overheat and catch fire.**

**The product does not comply with requirements of the Low Voltage Directive nor with the European Standard EN 60335.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **The product comes in a white/red cardboard package with a photo of the appliance on the outside. The product itself consists of a plastic casing containing all the electric parts.**

Brand **SAstro**

Name **Ceramic PTC Heater**

Type / number of model **000001-001002  
AS-11PTC**

Batch number **01/19**

Weekly report number **Report-2022-12**

Alert submitted by **Cyprus**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Date of entry into force **05/12/2021**



Alert number **[A12/00458/22](#)**

Product **Shower set**



Risk type **Chemical**

**The shower set contains an excessive amount of bis-(2-ethylhexyl) phthalate (DEHP) (measured values up to 17%). This phthalate may harm the health of children, possibly causing damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Other**

Type **Consumer**

Description **Orange shower set with elastic tube**

Packaging description **Transparent plastic cover**

Brand **RILUX**

Name **Banana phone call**

Type / number of model **2023L2418**

Barcode **8034048104606**

Weekly report number **Report-2022-12**

Alert submitted by **Cyprus**

Is the product counterfeit? **No**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Retailer**

Date of entry into force

**04/01/2022**

---

Alert number **[A12/00455/22](#)**

Product **Children's sweatshirt**

---



Risk type **Strangulation**

**There are long functional cords with free ends in the hood of the product. They can become trapped during various activities of a child, leading to strangulation.**

**The product does not comply with the requirements of the General Product Safety Directive nor with the European Standard EN 14682.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Long sleeve hooded sweatshirt designed for 4-years old children. The sweatshirt bears drawstrings with free ends at the neck area.**

Brand **FOX**

Type / number of model **KGW2293604**

Barcode **832368940004**

Weekly report number **Report-2022-12**

Alert submitted by **Cyprus**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Importer**

Date of entry into force

**07/01/2022**

Alert number **[A12/00456/22](#)**

Product **Water shoes**



Risk type **Chemical**

**The shoes contain an excessive amount of bis-(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 15 % by weight, for both phthalates). These phthalates may harm the health of children, possibly causing damage to their reproductive system.**

**The product does not comply with the REACH regulation.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Pair of water shoes**

Brand **BEPII**

Barcode **2000021552722**

Weekly report number **Report-2022-12**

Alert submitted by **Cyprus**

Is the product counterfeit? **No**

Country of origin **Portugal**

Measures ordered by public authorities **Withdrawal of the product from the market  
Distributor**

Date of entry into force **04/01/2022**



Alert number **[A12/00457/22](#)**

Product **Bath mat**



Risk type **Chemical**

**The bath mat contains an excessive amount of bis-(2-ethylhexyl) phthalate (DEHP) (measured values up to 27%). This phthalate may harm the health of children, possibly causing damage to their reproductive system.**

**The product does not comply with the REACH Regulation.**

Category **Other**

Type **Consumer**

Description **Pink bath mat 100% PVC**

Brand **RILUX**

Name **RILUX**

Type / number of model **2013L2418**

Barcode **8034048436271**

Weekly report number **Report-2022-12**

Alert submitted by **Cyprus**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Retailer**

Date of entry into force

**01/04/2022**