

Alert number **[A11/00058/22](#)**

Product **Smart watch**



Risk type **Burns**

The battery can overheat, posing a risk of burns to the users.

The product does not comply with the requirements of the Radio Equipment Directive nor with the European Standard EN 60950-1.

Category **Hobby/sports equipment**

Type **Consumer**

Description **The Fitbit Ionic Smartwatch is a GPS enabled, fitness-oriented smartwatch. The product is equipped with a lithium-ion battery and approximately four day battery life. The product has a 1.4" colour LCD display and was available with multiple band sizes to accommodate varying consumer wrist sizes.**

Brand **Fitbit LLC**

Name **Fitbit Ionic Smartwatch**

Type / number of model **FB503**

Weekly report number **Report-2022-15**

Alert submitted by **Ireland**

Is the product counterfeit? **No**

Country of origin	Taiwan
Measures taken by economic operators	Recall of the product from end users Manufacturer
Date of entry into force	02/03/2022
Company recall code	- https://help.fitbit.com/en/ionic.htm
Products were found and measures were taken also in	Greece Norway Poland Portugal Slovenia

Alert number

[A12/00583/22](#)

Product

Toy torch with sweets



Risk type

**Burns
Chemical
Choking**

The toy can easily break, leaving the button batteries accessible. A child could put them in the mouth, which could cause damage to the child's gastrointestinal tract or choking.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 62115.

Category

Toys

Type

Consumer

Description

Plastic torch with push button, powered by button batteries, all integrated in a support consisting of a spray diffusing a lemon-scented liquid. All batches of the product are covered by this notification.

Packaging description

Coloured plastic tube.

Brand

Mada Sweet

Name

Johnny Bee Torch Spray

Type / number of model

Spay Torch lemon 20 ml

Barcode

6942797402916

Weekly report number

Report-2022-15

Alert submitted by	France
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Distributor
Measures taken by economic operators	Recall of the product from end users Distributor
Date of entry into force	10/03/2022
Company recall code	- https://rappel.conso.gouv.fr/fiche-rappel

Alert number **[A12/00582/22](#)**

Product **Passenger car**

Corrigendum **At the request of the notifying authority the notification A12/00582/22 has been updated with additional information on the model and Risk description.**

Risk type **Injuries**

On some Model S vehicles, the latch assembly of the front hood may be aligned too far rearward. While this alignment does not impact latching of the primary latch with the hood striker, it may prevent latching of the secondary latch. If the primary latch is inadvertently released and the secondary latch is not engaged, the hood may open without warning and obstruct the driver's visibility, increasing the risk of a crash. If the primary latch is inadvertently released, the driver will receive an alert on the user interface.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Tesla**

Name **Model S**

EC-type approval/model **e4*2007/46*0667*##**

Production dates **2014 - 2021**

Company recall code **SB-21-11-003**

Weekly report number **Report-2022-15**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin

United States

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Date of entry into force

20/01/2022

Products were found and measures were taken also in

**Iceland
The Netherlands**

Alert number **[A12/00570/22](#)**

Product **Passenger car**

Risk type **Injuries**

The open circuit detecting system on the high voltage circuit may be over-sensitive and could unnecessarily cut off the electric current. As a result, the vehicle may lose power during driving, increasing the risk of an accident. Moreover, it could be impossible to restart or move the vehicle for several minutes.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car.**

Brand **PEUGEOT**

Name **2008, 208**

EC-type approval/model **e2*2007/46*0639*07 - *11, e2*2007/46*0639*06 - *11**

Production dates **03/07/2019 - 27/09/2020**

Company recall code **KSB**

Weekly report number **Report-2022-15**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **Slovakia**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force

12/01/2022

Products were found and
measures were taken also in

**Ireland
The Netherlands
Poland
Sweden**

Alert number

[INFO/00087/22](#)

Product

Portable battery pack



Risk type

Fire

Due to manufacturing defects, there may be foreign conductive objects inside the battery; when charging, the battery cells may short-circuit and overheat. Furthermore, force needs to be applied on the battery modules which may lead to the mechanical cell damage. The product may catch fire.

The product does not comply with requirements of the Machinery Directive nor with the European standard EN 62281.

Category

Electrical appliances and equipment

Type

Consumer

Description

Lithium battery pack for Greyp e-bike G6, G5 and T5, covering e-bikes sold from February 2019 to January 2022.

Brand

GREYP

Name

Greyp 700WH battery pack

Type / number of model

6G-01

Weekly report number

Report-2022-15

Alert submitted by

Croatia

Is the product counterfeit?

No

Country of origin **Croatia**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **21/03/2022**

Company recall code - <https://press.greyp.com/important-greyp-battery-units-precautionary-measures>

Alert number

[A11/00059/22](#)

Product

Wood planer and thicknesser



Risk type

Electric shock

The basic insulation (not protected against dirt) is inadequate and the clearance/creepage distances between live parts (micro switch connector) and earthed metal part (frame) is not sufficient. Accessible parts can become live and a user could receive an electric shock from them.

The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 61029-2-3.

Category

Machinery

Type

Consumer

Description

Planer-thicknesser for woodwork, with a rotation of 9000 RPM/Min and 230V power. Product sold online.

Brand

Nova

Name

Planer/thicknesser

Type / number of model

NOVA BY-9025A

Batch number

2021.02

Weekly report number

Report-2022-15

Alert submitted by

Finland

Is the product counterfeit?

No

Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Manufacturer
Date of entry into force	16/02/2022
Measures taken by economic operators	Stop of sales Manufacturer
Date of entry into force	16/02/2022
Measures taken by economic operators	Other : Repairing the defect Manufacturer
Date of entry into force	16/02/2022
Measures taken by economic operators	Recall of the product from end users Manufacturer
Date of entry into force	16/02/2022
Products were found and measures were taken also in	Estonia

Alert number **[A12/00563/22](#)**

Product **Passenger car**

Risk type **Injuries**

Vehicles are equipped with wrong wheel screw/s. This may lead to vibration and to the loosening of the wheels during lifetime, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Opel**

Name **Corsa**

EC-type approval/model **U
e2*2007/46*0639*17**

Production dates **15.12.2021 - 23.12.2021**

Company recall code **E222200420 (22-C-012) O6V**

Weekly report number **Report-2022-15**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **The Netherlands**

Alert number

[A12/00569/22](#)

Product

Disposable electronic cigarette



Risk type

Chemical

The product volume exceeds 2 ml. This could lead to the accidental consumption of a high dose of nicotine. Nicotine is acutely toxic in high doses and its inhalation can cause adverse effects on the health.

The product does not comply with the requirements of the Tobacco Products Directive.

Category

Other

Type

Consumer

Description

Disposable electronic cigarette with nicotine-containing liquid (nicotine: 20 mg/ml), with a battery capacity of 550 mAh and a capacity of 800 puffs. The product is sold online.

Packaging description

Pink individual cardboard packaging

Brand

EPA

Name

WATERMELON ICE

Barcode

3800501704127

Weekly report number

Report-2022-15

Alert submitted by

Bulgaria

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Retailer**

Date of entry into force

29/03/2022

Alert number

[**A12/00574/22**](#)

Product

Rechargeable Electronic cigarette

Risk type

Chemical

The product tank volume exceeds 2 ml. This could lead to the accidental consumption of a high dose of nicotine. Nicotine is acutely toxic in high doses and its inhalation can cause adverse effects on the health. Furthermore, the product lacks a child-proof fastening and opening mechanism and is not protected from leaks. As a result, a child could become accidentally exposed to it when handling the product. Nicotine is highly toxic and can endanger the safety of the user / child, especially if the product comes into contact with the skin or is ingested.

The product does not comply with the requirements of the Tobacco Products Directive.

Category

Chemical products

Type

Consumer

Description

Rechargeable electronic cigarette in a packaging containing 1 mod, 1 tank, 2 coils and 1 type-C USB cable plus the manual. The product is sold online.

Packaging description

Individual cardboard package.

Brand

Vaptio

Name

Vaping Marathon LIGH UP YOR LIFE

Type / number of model

Cosmo 2

Batch number

34B7142

	34B6292
Barcode	840029226445
Weekly report number	Report-2022-15
Alert submitted by	Bulgaria
Is the product counterfeit?	No
Country of origin	United States
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	29/03/2022

Alert number

[A12/00575/22](#)

Product

Disposable electronic cigarette



Risk type

Chemical Choking

The product is not protected against breakage. Nicotine is acutely toxic and can endanger the user's safety, if the product comes accidentally into contact with the skin or is ingested. Furthermore, the mouthpiece easily detaches posing the risk of choking to the user or child.

The product does not comply with the requirements of the Tobacco Products Directive.

Category

Chemical products

Type

Consumer

Description

Single-use electronic cigarette containing 2 ml liquid, capacity of battery 650 mAh, 1000+ puffs. The product is sold online.

Packaging description

Individual cardboard packaging.

Brand

Soul

Name

Apple mint and Bubble gum

Type / number of model

SU001

Barcode

**76253546455
76253546662**

Weekly report number

Report-2022-15

Alert submitted by	Bulgaria
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Retailer
Date of entry into force	29/03/2022

Alert number **[A12/00584/22](#)**

Product **Passenger car**

Risk type **Burns
Fire**

The engine covers installed on affected vehicles could detach from their fixings depending on the conditions of use (e.g. very sporty driving, or poor road surfaces) and their age. A loose engine cover could come into contact with the hot area of the exhaust gas turbocharger, increasing the risk of burns or fire.

The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicle.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **VW**

Name **Arteon, Golf, Passat, Tiguan, T-Roc**

EC-type approval/model **A1, CD, 3CC, 5N, 3H
e13*2007/46*1845*, e1*2007/46*2014*,
e1*2001/116*0468*, e1*2001/116*0450*, e1*2007/46*1725***

Production dates **28.02.2020 - 3.02.2022**

Company recall code **10H5**

Weekly report number **Report-2022-15**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and
measures were taken also in

Denmark
France
Greece
Ireland
The Netherlands
Sweden
Slovakia

Alert number **[A12/00565/22](#)**

Product **Passenger car**

Risk type **Fire
Injuries**

The amount of extinguishing sand in the fuse of the high-voltage system is not sufficient in the event of a short circuit to the high-voltage safety system. This may cause it to burst, increasing the risk of injuries. Furthermore, the blown fuse can interrupt electrical flow of current leading to a voltage drop inside the vehicle, increasing the risk of fire.

The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **VW**

Name **Arteon, Golf, Passat, Tiguan, T7**

EC-type approval/model **CD, 3H, 3C, ST, 5N
e1*2007/46*2014*, e1*2007/46*1725*, e1*2001/116*0307*,
e1*2018/858*00018*, e1*2001/116*0450***

Production dates **12.04.2019 - 22.02.2022**

Company recall code **93N4**

Weekly report number **Report-2022-15**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic **Recall of the product from end users**

operators

Manufacturer

Products were found and
measures were taken also in

**France
Croatia
Ireland
Sweden
Slovakia**

Alert number **[A12/00557/22](#)**

Product **Bolt cutter**



Risk type **Chemical**

The product contains an excessive amount of polycyclic aromatic hydrocarbons (PAHs) (measured total value: 121 mg/kg). PAHs may cause cancer and are also mutagenic and toxic for reproduction.

The product does not comply with the REACH Regulation.

Category **Hand tools**

Type **Consumer**

Description **Bolt cutter with a turquoise painted metal frame, a metal cutter head painted black and black plastic handles, approximately 450 mm long. Product also sold online.**

Packaging description **Unpackaged but partly wrapped in plastic foil**

Brand **Work Plus**

Name **Bolzenschneider**

Type / number of model **63418**

Barcode **8714892634183**

Weekly report number **Report-2022-15**

Alert submitted by **Germany**

Is the product counterfeit?

No

Country of origin

Unknown

Measures taken by economic operators

**Recall of the product from end users
Distributor**

Date of entry into force

25/03/2022

Alert number **[A12/00578/22](#)**

Product **Personal watercraft**



Risk type	Drowning Injuries
	The tabs of the portable audio system may break, causing it to dislodge from its support. Consequently, the audio system may hit the user and/or passenger, leading to injuries.
	The product does not comply with the requirements of the Recreational Craft and Personal Watercraft Directive.
Category	Recreational crafts
Type	Consumer
Description	Sea-Doo Spark Model year 2019 to 2022. Watercrafts equipped with a portable audio system.
Brand	Sea-Doo
Type / number of model	Spark
Weekly report number	Report-2022-15
Alert submitted by	Belgium
Is the product counterfeit?	No
Country of origin	Mexico
Measures taken by economic operators	Recall of the product from end users Manufacturer

Date of entry into force **09/09/2019**

Products were found and
measures were taken also in **Slovenia**

Alert number **[A12/00561/22](#)**

Product **False nails**



Risk type **Chemical**

According to the list of ingredients, the glue contains dibutyl phthalate (DBP), which use is forbidden in cosmetic products. This phthalate may harm the health, causing possible damage to the reproductive system or the unborn child.

The product does not comply with the Cosmetic Products Regulation.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Set of plastic nails (12 or 24 pieces), supplied with glue in an orange tube. Various child-like designs are applied to the nails.**

Packaging description **Cardboard white packaging with drawn children (angels), hearts and stars in different colours.**

Brand **Dudustrong**

Type / number of model **S647**

Barcode **6958864456478**

Weekly report number **Report-2022-15**

Alert submitted by **Romania**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **31/03/2022**

Alert number **[A12/00564/22](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Fire**

The wiring harness of the generator may have been erroneously swapped with the wiring harness of the electric steering during assembly. Consequently the steering wiring harness would be secured with the generator fuse (fused too high), and the generator wiring harness with the steering fuse (fused too low). In the event of an additional electrical fault (e.g. damage to the steering wiring harness) the mix-up of the two differently fused wiring harnesses could lead to the steering wiring harness becoming overloaded, increasing the risk of fire.

The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **MERCEDES-BENZ**

Name **Sprinter**

EC-type approval/model **906AC35, 906BB50, 906BB35
e1*2001/116*0354*28, e1*2007/46*0296*15+*16,
e1*2007/46*0301*22*+*23**

Production dates **31.05.2021 - 06.07.2021**

Company recall code **VS3LE54ELE**

Weekly report number **Report-2022-15**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin

Germany

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in

**Ireland
The Netherlands
Poland**

Alert number **[A11/00060/22](#)**

Product **Baby swing**



Risk type **Injuries**

The locking mechanism may disengage too easily. As a result, the child can fall from the baby swing and suffer injuries.

The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 16232.

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Baby swing.**

Packaging description **Cardboard box.**

Brand **FOPPAPEDRETTI**

Name **CARILLON TEDDY**

Barcode **8013440180517**

Weekly report number **Report-2022-15**

Alert submitted by **Croatia**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

15/03/2022

Measures ordered by public authorities

**Ban on the marketing of the product and any
accompanying measures
Distributor**

Date of entry into force

15/03/2022

Alert number **[A12/00559/22](#)**

Product **Plastic ball**



Risk type **Chemical**

The toy contains an excessive amount of diisobutyl phthalate (DIBP) (measured value up to 18.5%). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic ball of a diameter of approximately 25 cm.**

Packaging description **Net bag.**

Brand **TASSO**

Name **Pilka**

Type / number of model **N-932-11**

Barcode **5903268209107**

Weekly report number **Report-2022-15**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	14/03/2022
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	14/03/2022
Measures ordered by public authorities	Withdrawal of the product from the market Other
Date of entry into force	14/03/2022

Alert number

[A12/00562/22](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 51%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect the user.

The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Protective respiratory filtration half-face mask for single-use. The mask is marked with FFP2 and has the CE marking printed on. Product sold online.

Packaging description

The product is sold in a blue cardboard box and further packaged in a white and transparent plastic pouch. Each box contains 20 individually-wrapped masks. Both

packagings have the claim "FFP2" and the CE marking.

Brand	ICE Pro Mask
Name	ICE PRO MASK
Type / number of model	ICE Pro Mask
Batch number	03/2021 03/2024 1022021
Barcode	8682815049676
Weekly report number	Report-2022-15
Alert submitted by	Germany
Is the product counterfeit?	No
Country of origin	Turkey
Measures taken by economic operators	Withdrawal of the product from the market Importer
Date of entry into force	31/03/2022

Alert number **[A12/00566/22](#)**

Product **Passenger car**

Risk type **Burns
Fire**

Engine design covers installed on affected vehicles could come loose from the attachment depending on use (e.g. very sporty driving style or poor road surface conditions) and the running time. If the design cover is not fastened, there is a possibility that it will come into contact with the hot area of the exhaust gas turbocharger, increasing the risk of burns or fire.

The product does not comply with the Regulation on the approval and market surveillance of Motor Vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Skoda**

Name **Kodiaq, Octavia, Superb**

EC-type approval/model **NS, NX, 3T
e8*2007/46*0249*, e8*2007/46*0355*, e8*2007/46*0317***

Production dates **01.08.2020 - 28.02.2022**

Company recall code **10H6**

Weekly report number **Report-2022-15**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code

- <https://www.skoda-auto.de/>

Products were found and
measures were taken also in

France
Ireland
The Netherlands
Slovenia

Alert number

[A12/00579/22](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 74%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect the user.

The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

White particle filter mask with the marking "Hua Guo Tang", sold per 20.

Packaging description

White and red cardboard box with markings "CE" & "FFP2 NR", each item is individually packaged in a white and red plastic bag.

Brand

Unknown

Name

Semimaschera filtrante

Type / number of model

LY-N900-N909

Batch number

20201102

Barcode

8433367625975

Weekly report number **Report-2022-15**

Alert submitted by **Belgium**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Importer**

Alert number **[A12/00558/22](#)**

Product **Night light**



Risk type **Electric shock**

The light source can be unscrewed without removing the luminaire from the mains socket. As a result, live parts are accessible and the user could receive an electric shock from them.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598 and EN 60238.

Category **Lighting equipment**

Type **Consumer**

Description **Night light with switch, E27 lamp socket and pear-shaped warm white LED light source. The product can be plugged directly into the mains socket.**

Packaging description **Cardboard box.**

Brand **LE ROYAL**

Name **lámpák**

Type / number of model **R22614-31**

Barcode **9582261400313**

Weekly report number **Report-2022-15**

Alert submitted by **Hungary**

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public authorities

**Recall of the product from end users
Distributor**

Date of entry into force

24/03/2022

Measures ordered by public authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

24/03/2022

Alert number **[A12/00571/22](#)**

Product **Night light**



Risk type **Electric shock**

The light source can be unscrewed without removing the luminaire from the mains socket. As a result, live parts become accessible and this could lead to an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the relevant European standards EN 60598 and EN IEC 60238.

Category **Lighting equipment**

Type **Consumer**

Description **Night light with switch, E27 lamp socket and sphere-shaped LED light source for decorative purposes. The product can be plugged directly into the socket.**

Packaging description **Colourful cardboard box.**

Brand **LE ROYAL**

Name **LED COPPER LAMP**

Type / number of model **R22614-30**

Barcode **9582261400306**

Weekly report number **Report-2022-15**

Alert submitted by **Hungary**

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

24/03/2022

Measures ordered by public authorities

**Recall of the product from end users
Distributor**

Date of entry into force

24/03/2022

Alert number **[A12/00567/22](#)**

Product **Lighting chain**



Risk type **Electric shock**

The cable is not properly anchored, the conductors in the wires are too thin, and the distance between the plug and the first lamp or lampholder is too short. Furthermore, the control device cap can be easily removed. A user could consequently touch live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.

Category **Lighting chains**

Type **Consumer**

Description **Rated voltage 230 - 250 V, rated power 6 W, lamp type LED, number of lamps 100 pcs, electric shock protection class - II, garland type - non-replaceable lamps, IP protection according to IEC 60529 - IP44. Product sold online.**

Packaging description **Cardboard box with CE marking.**

Brand **Unknown**

Name **Garland 100 LED bulbs**

Type / number of model **G226**

Batch number **022-03**

3405502969409

Barcode	3821612607558
Weekly report number	Report-2022-15
Alert submitted by	Lithuania
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	05/04/2022

Alert number **[A12/00560/22](#)**

Product **Plastic doll**



Risk type **Chemical**

The toy contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 28.6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll**

Packaging description **Transparent foil bag, with cardboard closure.**

Brand **Unknown**

Name **Brianna**

Type / number of model **B07**

Barcode **5902496166619**

Weekly report number **Report-2022-15**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Warning consumers of the risks
Importer**

Date of entry into force

07/03/2022

Measures ordered by public
authorities

**Destruction of the product
Importer**

Date of entry into force

07/03/2022

Measures taken by economic
operators

**Withdrawal of the product from the market
Importer**

Date of entry into force

07/03/2022

Alert number


[A12/00572/22](#)

Product

Lighting chain



220V-240VAC 50Hz 6W
150LED96 fény-fa
1. Az égőt ne csavarja ki, illetve ne helyezze be mindaddig amíg a készülék be van kapcsolva a hálózatba.
2. A kiégett égőket azonnal cserélje ki a túlmelegedés elhárítása érdekében.
3. A készüléket csak az követően kapcsolja a hálózatba, miután a csomagolásból kivette.
4. Ne kapcsolja össze a készüléket elektromosan más világító szer

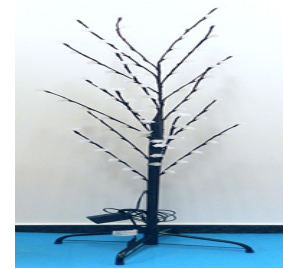

Risk type

**Burns
Electric shock
Fire**

The cable is not properly anchored and is too thin. The accessible wires have inadequate insulation. The cable could overheat, leading to burns or fire. The user could touch accessible live parts, which may cause an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.

Category

Lighting chains

Type

Consumer

Description

Tree shaped decorative floor lamp with 96 rose-shaped pink LEDs.

Packaging description

Packaging: transparent plastic bag.

Brand	Unknown
Name	fény-fa
Type / number of model	150LED96
Weekly report number	Report-2022-15
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	Unknown
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	05/04/2022

Alert number

[A12/00573/22](#)

Product

Christmas tree with lighting chain



Risk type

**Burns
Electric shock
Fire**

The cable is not properly anchored and is too thin. The accessible wires have inadequate insulation. The dimensions of the mains plug are substantially less than required. The product is not protected against moisture. The cable could overheat, leading to burns or fire. Water could penetrate the product or the user could touch accessible live parts, which may cause an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.

Category

Lighting chains

Type

Consumer

Description

Decorated Christmas tree shaped desk lamp with white lighting chain of LED lamps.

Packaging description

The product was sold without packaging.

Brand

Unknown

Name

LAMPKI CHOINKOWE LED

Type / number of model

KL-II

Weekly report number

Report-2022-15

Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	Unknown
Measures ordered by public authorities	Withdrawal of the product from the market Retailer
Date of entry into force	01/04/2022

Alert number **[A12/00577/22](#)**

Product **Toy slime**



Risk type **Chemical**

The migration of boron from the toy is too high (measured value up to 1133 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system.

The product does not comply with the requirements of the Toy Safety Directive nor the European standard EN 71-3.

Category **Toys**

Type **Consumer**

Description **Orange toy slime.**

Packaging description **Transparent plastic container**

Brand **midex**

Name **Gadzet rozrywkowy**

Type / number of model **D37408**

Barcode **5900733599626**

Weekly report number **Report-2022-15**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	14/03/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	14/03/2022
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	14/03/2022

Alert number **[A12/00576/22](#)**

Product **Toy slime**



Risk type **Chemical**

The migration of boron from the toy is too high (measured value up to 1177 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system.

The product does not comply with the requirements of the Toy Safety Directive nor the European standard EN 71-3.

Category **Toys**

Type **Consumer**

Description **Pink toy slime.**

Packaging description **Transparent plastic container.**

Brand **midex**

Name **Gadzet rozrywkowy**

Type / number of model **D37404**

Barcode **5900733599589**

Weekly report number **Report-2022-15**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	14/03/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	14/03/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	14/03/2022

Alert number **[A11/00062/22](#)**

Product **USB charger**



Risk type **Electric shock**

The insulation of the product is inadequate. The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the standard EN IEC 62368.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Black and white battery charger with 2 USB ports.**

Packaging description **Transparent plastic box**

Brand **S&W**

Name **USB Travel charger**

Type / number of model **J18, 63912**

Barcode	8588588639123
Weekly report number	Report-2022-15
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Ban on the marketing of the product and any accompanying measures Distributor
Date of entry into force	31/03/2022

Alert number **[A11/00061/22](#)**

Product **Lighting chain**



Risk type **Electric shock**

Live parts can become accessible when the lamps are being replaced or if they break. The user could touch accessible live parts and receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.

Category **Lighting chains**

Type **Consumer**

Description **Lighting chain with 100 replaceable, warm white miniature lamps.**

Packaging description **Transparent plastic bag with cardboard closure**

Brand **CMI**

Name **Chain of mini fairy lights**

Type / number of model **DM-100L / Article Number 301819**

Barcode **4048123018195**

Weekly report number **Report-2022-15**

Alert submitted by **Hungary**

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures taken by economic operators

**Withdrawal of the product from the market
Distributor**

Date of entry into force

07/02/2022

Alert number

[A12/00581/22](#)

Product

Children's watch



Risk type

**Chemical
Choking**

The button battery compartment of the product may not be adequately secured and the button battery may be accessible by children. A child may put it in the mouth, which could cause damage to the child's gastrointestinal tract or a risk of choking.

The product does not comply with the requirements of the Toy Safety Directive.

Category

Toys

Type

Consumer

Description

Fun character slap band wristwatch for children.

Packaging description

Paper wrap with warnings.

Brand

Smiggle

Name

Smiggle Fun Character Slapband Watch

Type / number of model

444313

Batch number

0821

Weekly report number

Report-2022-15

Alert submitted by

Ireland

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures taken by economic operators

**Recall of the product from end users
Retailer**

Date of entry into force

04/03/2022

Company recall code

-
https://www.smiggle.co.uk/SM/aurora/pdf/WATCH_SLAPBAND_FUN_RECALL_UK_IRE_OL.pdf

Alert number **[A12/00580/22](#)**

Product **Helmet**



Risk type **Injuries**

The helmet can easily break during an impact, thus not sufficiently protecting the user from injuries to the head.

The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 1078.

Category **Protective equipment**

Type **Consumer**

Description **The helmet is green / black, has ventilation / conditioning openings throughout, a removable safety spout on the front and a protective padding (foam) on the inside. Size 58-62 cm, 235 g. Product sold online.**

Packaging description **Plastic bag.**

Brand **Polisport Sport Ride**

Name **Helmet for cyclists**

Type / number of model **B010**

Batch number **2021-04 (2021/W19)**

Barcode **5604415094279**

Weekly report number **Report-2022-15**

Alert submitted by	Lithuania
Is the product counterfeit?	No
Country of origin	Portugal
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	08/04/2022

Alert number **[INFO/00084/22](#)**

Product **Bracelet**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured value: 95% by weight). Cadmium is harmful to human health because it accumulates in the body, may damage the kidneys and the bones, and is carcinogenic.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Bracelet with two individual silver dragonheads with a fastening mechanism. Product sold online, in particular via AliExpress.**

Packaging description **Individually packaged/ repackaged by the seller in a transparent zipper bag.**

Brand **Unknown**

Name **202 Armband mit Drachenkopf in silber. 2 einzelne Drachenköpfe mit Schließmechanismus**

Weekly report number **Report-2022-15**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin

Unknown

Measures taken by economic operators

**Stop of sales
Retailer**

Alert number [**INFO/00085/22**](#)

Product **Hair jewellery**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured value: 90% by weight). Cadmium is harmful to human health because it accumulates in the body, may damage the kidneys and the bones, and is carcinogenic.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Spiral hair ring, beard ring, silver, 2 pieces with dark black elements. Product sold online, in particular via AliExpress.**

Packaging description **Individually packaged/ repackaged by the seller in transparent zipper bags.**

Brand **Unknown**

Name **Modeschmuck Keltischer Haar Schmuck 2 Spiralen im Set Kringelförmig silber**

Weekly report number **Report-2022-15**


Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators

**Stop of sales
Retailer**

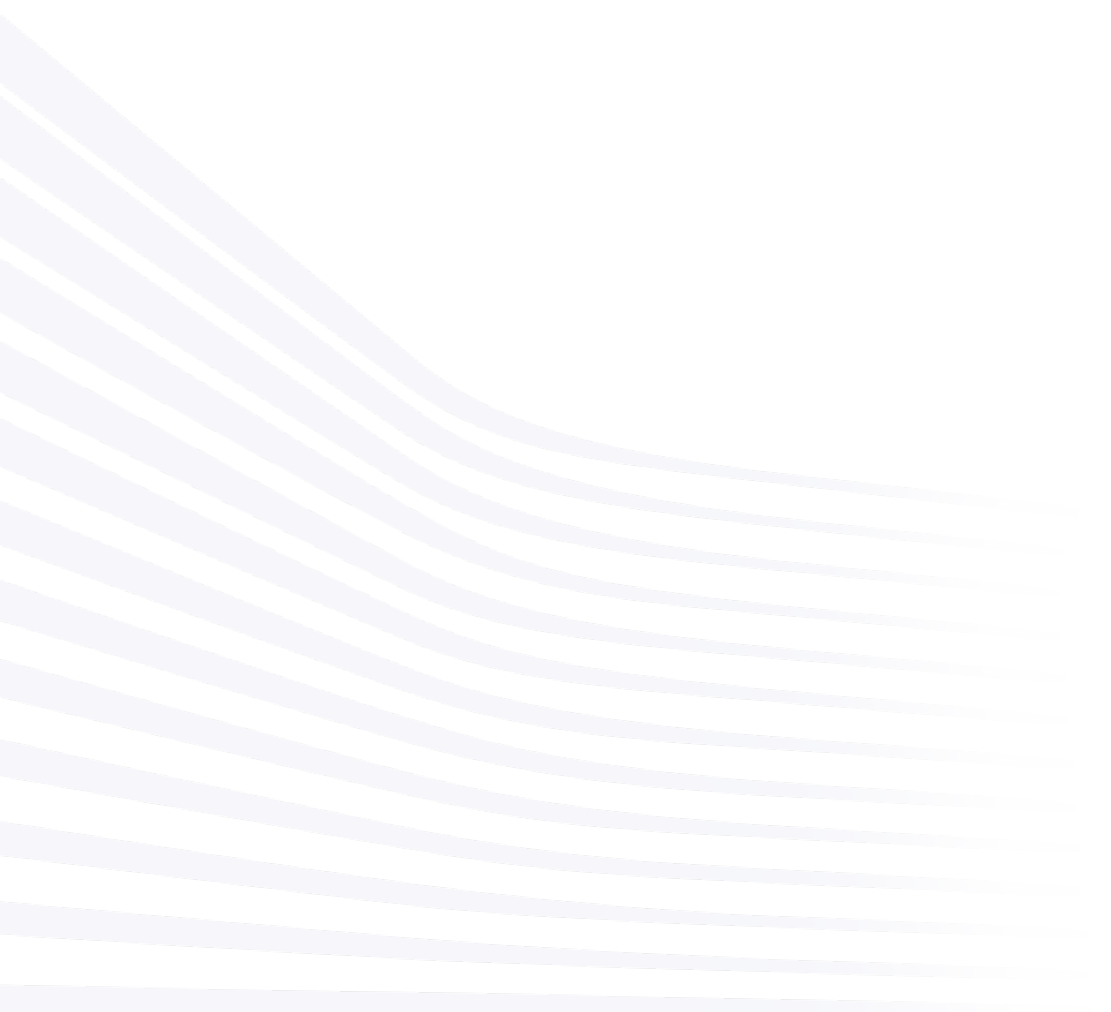

Alert number [**INFO/00086/22**](#)

Product **Bracelets set**



Risk type **Chemical**

The product contains an excessive amount of cadmium (measured value: 55% by weight). Cadmium is harmful to human health because it accumulates in the body, may damage the kidneys and the bones, and is carcinogenic.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Set comprising 5 bracelets made of gold chains with various pendants (flowers, hearts and spheres). Product sold online.**

Packaging description **Individually packaged/repackaged by the seller in transparent zipper bags.**

Brand **Unknown**

Name **Set mehrere Armbänder aus goldfarbenen Ketten mit vers. Anhänger in Blumen, Herzen, und Kugeln**

Weekly report number **Report-2022-15**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin

Unknown

Measures taken by economic operators

**Stop of sales
Retailer**