

Alert number **[A12/00749/22](#)**

Product **Wet wipes**



Corrigendum

**At the request of the notifying authority, the notification type of alert INFO/00090/22 has been changed from "For Information" to "Art. 12 GPSD". The Case number was therefore automatically changed to A12/00749/22.**

Risk type

**Microbiological**

**The product is microbiologically contaminated with the mesophilic bacteria (*Pseudomonas aeruginosa*). This poses a risk of infection, particularly to persons/individuals in intensive care in hospitals or persons with a weakened immune system.**

**The product does not comply with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Wet wipes used for skin cleansing. The product was also sold online. All batches are affected.**

Packaging description	<b>Soft plastic packaging in white and green (unperfumed) and blue and white (perfumed). Comes in various pack sizes. Wipes can be removed individually.</b>
Brand	<b>Oasis</b>
Name	<b>Bedbath, Bedbath Unperfumed</b>
Weekly report number	<b>Report-2022-20</b>
Alert submitted by	<b>Ireland</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>United Kingdom</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>14/04/2022</b>

Alert number **[A12/00744/22](#)**

Product **Shampoo cap**



Corrigendum **Notification upgraded to 'Article 12'.**

Risk type **Microbiological**

**The product is microbiologically contaminated with mesophilic aerobic bacteria *Pseudomonas aeruginosa*. This poses a risk of infection, particularly to persons/individuals in intensive care in hospitals or persons with a weakened immune system.**

**The product does not comply with the Cosmetic Products Regulation.**

Category **Cosmetics**

Type **Professional**

Description **A shampoo cap used to clean hair. Product sold online. All batches of Oasis Shampoo Cap and Oasis Shampoo Cap Unperfumed.**

Packaging description **Soft plastic packaging in white and green. Comes in various pack sizes.**

Brand **Oasis**

Name **Shampoo Cap; Shampoo Cap Unperfumed**

Weekly report number **Report-2022-20**

Alert submitted by **Ireland**

Is the product counterfeit?

**No**

Country of origin

**United Kingdom**

Measures taken by economic operators

**Recall of the product from end users  
Other**

Date of entry into force

**14/04/2022**

Alert number **[A12/00748/22](#)**

Product **Wet wipes**



Corrigendum

**At the request of the notifying authority, the notification type of alert INFO/00091/22 has been changed from "For Information" to "Art. 12 GPSD". The Case number was, therefore, automatically changed to A12/00748/22.**

Risk type

**Microbiological**

**The product is microbiologically contaminated with the mesophilic bacteria (*Pseudomonas aeruginosa*). This poses a risk of infection, particularly to persons/individuals in intensive care in hospitals or persons with a weakened immune system.**

**The product does not comply with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Wet wipes used for skin cleansing. The product was also sold online. All batches are affected.**

Packaging description	<b>Soft plastic packaging of various dimensions in lime green colour or in light blue with a white corner. Cloths can be removed individually.</b>
Brand	<b>Conti</b>
Name	<b>Wet Wipes Skin Cleansing Wipes</b>
Weekly report number	<b>Report-2022-20</b>
Alert submitted by	<b>Ireland</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>United Kingdom</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>14/04/2022</b>

Alert number **[A12/00738/22](#)**

Product **Rings**



Risk type **Chemical**

**The product releases an excessive amount of nickel (measured value up to 0.74 µg/cm<sup>2</sup>/week). Nickel is a strong sensitiser and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Rings marked as steel and with the name of the importer**

Packaging description **Transparent plastic sachets**

Brand **Unknown**

Type / number of model **KXY-156**

Weekly report number **Report-2022-20**

Alert submitted by **Italy**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public **Import rejected at border**

authorities

**Importer**

Date of entry into force

**08/02/2022**



Alert number

**[A12/00743/22](#)**

Product

**Bits for horses**



Risk type

**Other : Blow, break, bruise, fracture, concussion, sprain, dislocation.**

**The plastic connectors of the bit become brittle and can break. A rider could lose control of the horse, fall and suffer injuries.**

**The product does not comply with the requirements of the General Product Safety Directive.**

Category

**Hobby/sports equipment**

Type

**Consumer**

Description

**Single and double jointed horse bits with built-in plastic connectors and a pink "N" sticker on the bit end, for use in horses' mouth to guide and control the horse. The product was also sold online.**

Brand

**Nathe**

Barcode

**4022853239129, 4022853239136,  
4022853239143, 4022853239150,  
4022853239167, 4022853243461,  
4022853239181, 4022853239198,  
4022853239204, 4022853239211,  
4022853239228, 4022853239112,  
4022853239235, 4022853239242,  
4022853239259, 4022853239266,  
4022853239273, 4022853239280,  
4022853239297, 4022853239303,  
4022853239310, 4022853239327,  
4022853239334, 4022853239341,  
4022853239426, 4022853239433,  
4022853239440, 4022853239457,  
4022853239464, 4022853239419,  
4022853239549, 4022853239556,  
4022853239563, 4022853239570,**

4022853239587, 4022853239532,  
4022853239600, 4022853239617,  
4022853239624, 4022853239631,  
4022853239648, 4022853239594  
4022853239778, 4022853239785,  
4022853239792, 4022853239808,  
4022853239815, 4022853239822,  
4022853240217, 4022853240224,  
4022853240231, 4022853240248,  
4022853240255, 4022853240262,  
4022853240378, 4022853243348,  
4022853240392, 4022853240408,  
4022853240439, 4022853243324,  
4022853240453, 4022853240460,  
4022853243317, 4022853240422,  
4022853243331, 4022853240361,  
4022853243416, 4022853239174,  
4022853243423, 4022853243430,  
4022853243454, 4022853243409,

Weekly report number	<b>Report-2022-20</b>
Alert submitted by	<b>Germany</b>
Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Germany</b>
Measures taken by economic operators	<b>Recall of the product from end users Manufacturer</b>
Date of entry into force	<b>25/04/2022</b>
Company recall code	- <a href="https://pferdesport.sprenger.de/qualitaet-marken/nathegebisse/">https://pferdesport.sprenger.de/qualitaet-marken/nathegebisse/</a> - <a href="https://pferdesport.sprenger.de/qualitaet-marken/nathegebisse/">https://pferdesport.sprenger.de/qualitaet-marken/nathegebisse/</a>
Products were found and measures were taken also in	<b>Slovenia</b>

---

Alert number **[A12/00732/22](#)**

Product **Passenger car**

---

Risk type **Injuries**

**An erroneous notch in the impact absorber may lead to failure of the tube sensor for the actuation of the active hood. In case of an accident, the active hood for pedestrian protection might be lifted too late or not at all, increasing the risk of injury to the pedestrian involved.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **MERCEDES-BENZ**

Name **C-Class,**

EC-type approval/model **R2CS, R2CW  
e1\*2018/858\*00016\*01, e1\*2018/858\*00016\*02,  
e1\*2018/858\*00017\*01, e1\*2018/858\*00017\*02**

Production dates **01.10.2021 - 30.11.2021**

Company recall code **8891007**

Weekly report number **Report-2022-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

- **<http://www.mercedes-benz.de/>**

Company recall code

Products were found and  
measures were taken also in

**France**  
**Croatia**  
**The Netherlands**  
**Poland**  
**Romania**

Alert number **[A12/00733/22](#)**

Product **Vehicle part / roof box**



Risk type **Injuries**

**Due to lack of robustness, one or more lock plates of the roof box lid might become damaged during use. This could lead to the opening of the roof box and the loss of parts of the baggage during driving, posing a risk to other road users.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Roof box, Skoda Roof Box 400 I**

Brand **SKODA**

Name **Skoda Roof Box 400I**

EC-type approval/model **000 071 175 C (silver);  
000 071 175 D (black);**

Production dates **1.06.2021 - 31.01.2022**

Company recall code **6749 Dachbox**

Weekly report number **Report-2022-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Czechia**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number **[A12/00742/22](#)**

Product **Passenger car**

Risk type **Injuries**

**Damaged cables or connections on the accelerator pedal sensor because of corrosion may cause unintentional acceleration or no start condition, increasing the risk of an accident.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Volvo cars XC40 Recharge left hand drive, model year 2021 - 2022, Model (Chassis): 0439208 - 0663838.**

Packaging description

Brand **Volvo**

Name **XC40 Recharge**

EC-type approval/model **536**

Production dates **2021 - 2022**

Company recall code **R10170**

Weekly report number **Report-2022-20**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Belgium**

Measures taken by economic operators **Recall of the product from end users  
Distributor**

Products were found and  
measures were taken also in

**Belgium**  
**France**  
**The Netherlands**  
**Poland**  
**Sweden**



Alert number **[A12/00737/22](#)**

Product **Hairpin**

Risk type **Chemical**

**The metal material of the hairpins contains an excessive amount of cadmium (measured value 72% by weight). Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones, and it may cause cancer. The metal material of hairpins also contain an excessive amount of lead (measured value: 81 % by weight). Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may also affect breast-fed or unborn children.**

**The product does not comply with the REACH Regulation.**

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Rhinestone decorated hairpins in 3 different styles. Packed in a clear plastic pouch. Black cardboard with text 'Lucky Look' and importers product information on back.**

Packaging description **Clear plastic pouch with black cardboard.**

Brand **Lucky Look**

Name **Nutturakoriste**

Type / number of model **KUU-0254  
KUU-0282  
KUU-0474**

Barcode **6419773842627  
6419773852930  
6419773866920**

Weekly report number **Report-2022-20**

Alert submitted by **Finland**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Destruction of the product  
Importer**

Date of entry into force

**03/05/2022**



Alert number **[A12/00751/22](#)**

Product **Puffer toy**



Risk type **Choking**

**Small parts can easily detach (fins). A small child may put them in the mouth and choke.**

**The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **3 puffer fish toys (blue, green, orange) with soft spikes and fins and painted eyes, with foam ball stuffing**

Packaging description **Blister pack, and adhesive label**

Brand **Super Water Fun**

Name **Diving Toys**

Type / number of model **024518**

Barcode **8719987397516**

Weekly report number **Report-2022-20**

Alert submitted by **Austria**

Is the product counterfeit? **No**

Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>05/05/2022</b>
Company recall code	- <a href="https://www.ages.at/mensch/produktwarnungen-produktrueckrufe/produkt/tauchspielzeug-super-water-fun#pk_campaign=Produktwarnung&amp;pk_kwd=PW-ID1022">https://www.ages.at/mensch/produktwarnungen-produktrueckrufe/produkt/tauchspielzeug-super-water-fun#pk_campaign=Produktwarnung&amp;pk_kwd=PW-ID1022</a>

---

Alert number **[A12/00731/22](#)**

Product **Passenger car**

---

Risk type **Fire**

**The fuel supply pipe may have been installed improperly, which may result in a fuel leak. If a fuel leak occurs, this can result in an engine compartment fire.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **KIA**

Name **Sorento (MQ4)**

EC-type approval/model **e4\*2007/46\*1530\*00**

Production dates **03/2020 - 11/2021**

Company recall code **221003**

Weekly report number **Report-2022-20**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **The Netherlands  
Sweden  
Slovakia**

Alert number **[A12/00735/22](#)**

Product **Passenger car**

Risk type **Fire**

**The positive temperature coefficient heater of vehicles fitted with diesel engines may overheat due to potential damage of the wiring harness connector, increasing the risk of fire.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **KIA**

Name **Sorento (UM)**

EC-type approval/model **e4\*2007/46\*0894\*07; e4\*2007/46\*0894\*08;  
e4\*2007/46\*0894\*10; e4\*2007/46\*0894\*01;  
e4\*2007/46\*0894\*04; e4\*2007/46\*0894\*05;  
e4\*2007/46\*0894\*06; e4\*2007/46\*0894\*01;  
e4\*2007/46\*0894\*10;**

Production dates **05/2014 - 02/2020**

Company recall code **221026**

Weekly report number **Report-2022-20**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and  
measures were taken also in

**France**  
**Croatia**  
**The Netherlands**  
**Portugal**  
**Sweden**  
**Slovenia**  
**Slovakia**

Alert number **[A12/00755/22](#)**

Product **Light commercial vehicle**



Risk type **Injuries**

**One or both cushions of the two-person front row seat might not be locked to the backrests. As a consequence, the head restraint may become completely detached from the seat backrest, increasing the risk of injury to the occupants in the event of a sudden stop or accident.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Light commercial vehicle, WMI: YAR**

Brand **TOYOTA**

Name **Proace**

EC-type approval/model **e2\*2007/46\*0538\*18  
e2\*2007/46\*0538\*19**

Production dates **24.11.2021 - 15.12.2021**

Company recall code **22SMD-046**

Weekly report number **Report-2022-20**



Alert submitted by	<b>Bulgaria</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>Belgium</b>
Measures taken by economic operators	<b>Recall of the product from end users Importer</b>
Products were found and measures were taken also in	<b>The Netherlands Poland Sweden</b>

Alert number **[A12/00745/22](#)**

Product **Inflatable boat**



Risk type **Drowning**

**There are no instructions on re-boarding in the manual, which is also missing other required information and warnings. If a user falls into the water, it may be difficult to re-board as it is not easy to see how to. The user risks to suffer hypothermia or to drown.**

**The product does not comply with the requirements of the Recreational Craft and Personal Watercraft Directive.**

Category **Recreational crafts**

Type **Consumer**

Description **Inflatable boat.**

Brand **BUSH**

Name **BUSH Boat Crab**

Type / number of model **K-330**

Weekly report number **Report-2022-20**

Alert submitted by **Latvia**

Is the product counterfeit? **No**

Country of origin **Latvia**

Measures taken by economic operators

**Other : Conformity defects will be resolved by manufacturer  
Manufacturer**

Date of entry into force

**04/04/2022**

Alert number **[A12/00736/22](#)**

Product **Pruning shears**



Risk type **Chemical**

**The handles of the pruning shears contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 17 % by weight). These phthalates may harm the health of children, possibly causing damage to their reproductive systems.**

**The product does not comply with the REACH Regulation.**

Category **Hand tools**

Type **Consumer**

Description **20 cm pruning shears with plastic handles of different colours.**

Packaging description **Cardboard background with plastic cover.**

Brand **Tarmo**

Name **Pruner / Oksasakset**

Type / number of model **289422**

Barcode **6410412894229**

Weekly report number **Report-2022-20**

Alert submitted by **Finland**

Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Import rejected at border Importer</b>
Date of entry into force	<b>05/05/2022</b>
Products were found and measures were taken also in	<b>Estonia</b>

Alert number **[A12/00739/22](#)**

Product **Hot plate**





Risk type	<b>Electric shock</b>
	<b>The mains connection cable can melt due to contact with hot parts and live parts can become accessible.</b>
	<b>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335.</b>
Category	<b>Electrical appliances and equipment</b>
Type	<b>Consumer</b>
Description	<b>Electric, portable, single cooking plate with red indicator light. Size: 235 mm x 254 mm x 58 mm</b>
Packaging description	<b>Colourful cardboard box</b>
Brand	<b>HOOMEI</b>
Name	<b>Single hot Plate</b>

Type / number of model	<b>HM-5610 SX-B07</b>
Barcode	<b>8052743880076</b>
Weekly report number	<b>Report-2022-20</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>02/05/2022</b>

Alert number **[A11/00066/22](#)**

Product **Hot plate**

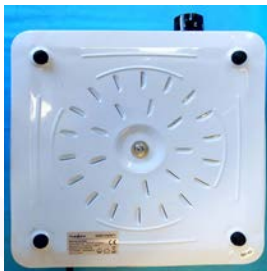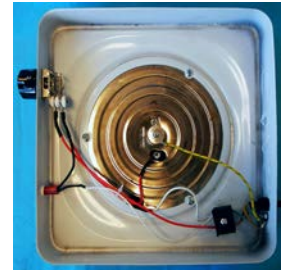

Corrigendum **Notification A11/00066/22: at the request of the notifying authority the notification has been updated with additional information on the product identification.**

Risk type **Electric shock**

**The protective conductor of the mains cord connected to the appliance is tensioned earlier than the other conductors. When pulled, the continuity of the protective conductor may be interrupted and the accessible metal parts may become live. A user could receive an electric shock.**

**The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335.**

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Electric portable single cooking plate with red indicator light and with a 185 mm diameter cast iron burner.**



Packaging description	<b>Colourful cardboard box</b>
Brand	<b>Nedis</b>
Name	<b>Electrical Hot Plate</b>
Type / number of model	<b>KAEP150EWT1</b>
Batch number	<b>010691/2010280015</b>
Barcode	<b>5412810293124</b>
Weekly report number	<b>Report-2022-20</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>23/03/2022</b>
Products were found and measures were taken also in	<b>Slovenia</b>

---

Alert number **[A12/00754/22](#)**

Product **Passenger car**

---

Risk type **Fire  
Injuries**

**The bolt for the 48V ground connection under the passenger seat may have been secured with insufficient torque. As a result, the electrical resistance of the connection could increase and the temperature may therefore rise in this area, posing a risk of fire.**

**The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.**

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **MERCEDES-BENZ**

Name **GLE-Class, GLS-Class**

EC-type approval/model **H1GLE  
e1\*2007/46\*1885\*00 -\*16**

Production dates **17.10.2018 - 21.11.2021**

Company recall code **5491807**

Weekly report number **Report-2022-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<http://www.mercedes-benz.de/>**

Products were found and  
measures were taken also in

**The Netherlands**  
**Poland**  
**Romania**  
**Slovakia**



---

Alert number **[A12/00753/22](#)**

Product **Motorcycle**

---

Risk type **Injuries**

**Improper thread shape on the rear axle may result in inactivation of the mating bolt thread lock compound. Consequently the brake disc mounting screws may loosen and come into contact with other components of the vehicle, causing the rider to fall.**

**The product does not comply with the Regulation on the approval and market surveillance of two- or three wheel vehicles and quadricycles.**

Category **Motor vehicles**

Type **Consumer**

Description **Motorcycle**

Brand **Triumph**

Name **Speed Triple 1200 RR, Speed Triple 1200 RS**

EC-type approval/model **PB01  
e9\*168/2013\*11690\*00, e9\*168/2013\*11690\*01,  
e9\*168/2013\*11690\*02**

Production dates **1.09.2020 - 13.02.2022**

Company recall code **SB596**

Weekly report number **Report-2022-20**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Thailand**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Company recall code - **<https://www.triumphmotorcycles.de/owners/recalls>**

Products were found and  
measures were taken also in

**France**  
**Ireland**  
**The Netherlands**  
**Poland**



Alert number **[A12/00734/22](#)**

Product **Plastic swing**



Risk type **Injuries**

**The swing is not sufficiently resistant to load. As a consequence, under load the seat may separate from the rope and the child may fall off the swing and suffer injuries.**

**The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-8.**

Category **Toys**

Type **Consumer**

Description **Green plastic disc swing. Maximum load capacity: 100 kg**

Packaging description **Plastic mesh**

Brand **Mochtoys**

Name **Round Swing**

Type / number of model **12081**

Barcode **5907442120813**

Weekly report number **Report-2022-20**

Alert submitted by **Hungary**

Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>Poland</b>
Measures ordered by public authorities	<b>Other : Call for corrective action Distributor</b>
Date of entry into force	<b>03/05/2022</b>
Measures taken by economic operators	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>03/05/2022</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>03/05/2022</b>

Alert number **[A12/00752/22](#)**

Product **Electric motor**



Risk type **Electric shock**

**Accessible metal parts can become live due to that the wire ends of the main cable are not properly anchored and inadequate insulation of the conductive parts may cause interruption of the protective conductor continuity. A user could receive an electric shock from accessible live parts.**

**The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60204.**

Category **Machinery**

Type **Consumer**

Description **Red single-phase asynchronous motor with 2.5 kW rated power. Size: 36 cm x 21 cm x 23,5 cm. Product also sold online.**

Packaging description **Brown cardboard box**

Brand **Unknown**



Name	<b>SINGLE PHASE MOTOR</b>
Type / number of model	<b>EC.016071-001/CN</b>
Barcode	<b>SZX266349-20211214200211</b>
Weekly report number	<b>Report-2022-20</b>
Alert submitted by	<b>Hungary</b>
Is the product counterfeit?	<b>No</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>29/04/2022</b>
Measures ordered by public authorities	<b>Recall of the product from end users Distributor</b>
Date of entry into force	<b>29/04/2022</b>

Alert number

**[EM/00001/22](#)**

Product

**Baby teether, teething toy**



Risk type **Suffocation**

**The mushroom head of the soother can flip around creating a very tight suction which can block airways (nose and mouth) of a child causing suffocation.**

**The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Category **Toys**

Type **Consumer**

Description **Baby teether in shape of mushroom; silicone mushroom pacifier with stems that helps with better development of the mouth structure, available in multiple colors. The product is also sold on Amazon with ASIN numbers: B09H2RH1QT B09JWL234H B09H2SBX.**

Packaging description **Transparent plastic blister.**

Brand **Unknown**

Name **Mushroom Teether Toys for Newborn Babies, Toddlers, Infants, Relieve Sore Gum - BPA-Free Chew Toy**

Type / number of model **Mushroom Teether**

Weekly report number **Report-2022-20**

Alert submitted by **Luxembourg**

Is the product counterfeit?	<b>Unknown</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users</b> <b>Other</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market</b> <b>Other</b>
Measures taken by economic operators	<b>Warning consumers of the risks</b> <b>Other</b>
Products were found and measures were taken also in	<b>Germany</b> <b>Ireland</b> <b>Malta</b>





Alert number

**[A11/00065/22](#)**

Product

**Salicylic Acid Cleanser**

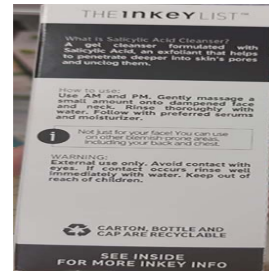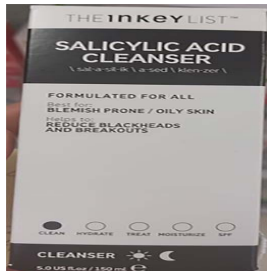

Risk type

**Chemical**

**The product contains an excessive level of salicylic acid (measured values: up to 3.39%). Salicylic acid applied on the skin may cause chemical burns.**

**This product does not comply with the Cosmetic Products Regulation.**

Category

**Cosmetics**

Type

**Consumer**

Description

**Salicylic acid cleanser used for blemish prone/oily skin. Advertised as "helping to reduce blackheads and breakouts". The product is sold online, in particular via Amazon.**

Packaging description

**The product is sold in a 150ml black and white rectangular cardboard box.**

Brand

**The Inkey List**

Name

**The Inkey List Salicylic Acid Cleanser**

Batch number

**102504**

Barcode

**5060422297179**

Weekly report number

**Report-2022-20**

Alert submitted by

**Ireland**

Is the product counterfeit?

**No**

Country of origin

**United Kingdom**

Measures taken by economic operators

**Stop of sales  
Other**

Alert number **[A12/00750/22](#)**

Product **Bangle**



Risk type **Chemical**

**The product contains an excessive amount of cadmium (measured value: 85% by weight). Cadmium is harmful to human health, since it accumulates in the body, can harm the kidneys and bones as well as causing cancer.**

**The product does not comply with the REACH Regulation.**

Category **Jewellery**

Type **Consumer**

Description **Viking-style bangle Hugin & Munin with Celtic knots 2 gold. Product sold online, in particular via Amazon, with ASIN number B082556JLF.**

Packaging description **Transparent plastic bag**

Brand **URBANTIMBER**

Name **Vikings bracelet**

Type / number of model **1031-3G**

Barcode **X00160L8P3**

Weekly report number **Report-2022-20**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Importer**

Date of entry into force **15/02/2022**