
Alert number **[A12/00853/22](#)**

Product **Children's shoes**



Risk type **Chemical**

The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured values up to 7.3 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Children's plastic shoes.**

Packaging description **The product is sold without packaging.**

Brand **Unknown**

Weekly report number **Report-2022-24**

Alert submitted by **Italy**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Importer**

Date of entry into force **29/03/2022**



Alert number **[A12/00862/22](#)**

Product **Puffer toy**



Risk type **Choking**

Small parts (the bow and the arms) can easily detach from the toy. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Puffer toy in the shape of a green, spiky bear with painted face and heart with a bow and with a LED light strobe inside.**

Packaging description **No packaging**

Brand **Teo`s**

Name **Fluffy Teddibär, Strizza e Brilla**

Batch number **17053811**

Barcode **8017967659211**

Weekly report number **Report-2022-24**

Alert submitted by **Austria**

Is the product counterfeit? **Unknown**

Country of origin **Italy**

Measures taken by economic operators **Withdrawal of the product from the market
Distributor**

Date of entry into force **02/06/2022**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **02/06/2022**

Alert number

[A12/00859/22](#)

Product

Toy gun set



Risk type

Damage to sight

The kinetic energy of the projectiles fired from the toy gun is too high and this can lead to eye injuries.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category

Toys

Type

Consumer

Description

Plastic toy gun with projectiles, battery powered.

Packaging description

The product is sold in a black and grey cardboard box.

Brand

Unknown

Name

BLAZE STORM

Type / number of model

ZC7077

Barcode	6920176739266
Weekly report number	Report-2022-24
Alert submitted by	Poland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	24/03/2022
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	24/03/2022

Alert number **[A12/00878/22](#)**

Product **Puffer toy and slime set**



Risk type **Choking**

Small parts (the eyes) can easily detach from the centipede toy. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Set consisting of: 1 pack of squishy figurines (cat and rabbit or fish and beaver), 1 centipede (neon yellow or green) with white eyes, 1 tin of slime (blue, green or red) 1 tin of modelling clay (yellow, green or pink), 1 squeezable banana (yellow, with mouldable filling and painted eyes) etc.**

Packaging description **Colourless plastic bucket with handle; 1 adhesive label.**

Brand **HTI**

Name **Jokes&Gags Fidget Toy Set sooooo stretchy sooooo squeazy**

Batch number **1374997**

Barcode **5050837499718**

Weekly report number **Report-2022-24**

Alert submitted by	Austria
Is the product counterfeit?	Unknown
Country of origin	Unknown
Measures taken by economic operators	Warning consumers of the risks Distributor
Date of entry into force	02/06/2022
Measures taken by economic operators	Withdrawal of the product from the market Distributor
Date of entry into force	02/06/2022

Alert number **[A12/00854/22](#)**

Product **Puffer toy**



Risk type **Choking**

Small parts (the eyes) can easily detach from the toy. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Puffer toy in the shape of a stretchy 'millipede' (orange, green, pink) with eyes.**

Packaging description **No packaging; 1 label attached.**

Brand **JOHN TOY**

Name **Strechy Centipede**

Type / number of model **21-401**

Batch number **21-638**

Barcode **8711866242511**

Weekly report number **Report-2022-24**

Alert submitted by **Austria**

Is the product counterfeit?	Unknown
Country of origin	Unknown
Measures taken by economic operators	Marking the product with appropriate warnings on the risks Retailer
Date of entry into force	01/06/2022
Products were found and measures were taken also in	Poland

Alert number **[A12/00875/22](#)**

Product **Passenger car**

Risk type **Injuries**

The notch locking mechanism of the headrest to the seat may be missing. As a result, the front headrests would not be locked and may eject in the event of a collision, increasing the risk of injury.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **PEUGEOT**

Name **Traveller / Expert 4**

EC-type approval/model **e2*2007/46*0533*19**

Production dates **16/11/2021 - 16/12/2021**

Company recall code **KVC**

Weekly report number **Report-2022-24**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **29/04/2022**

Products were found and
measures were taken also in

Germany
Denmark
Iceland
The Netherlands
Slovenia

Alert number **[A12/00874/22](#)**

Product **Passenger car**

Risk type **Injuries**

The notch locking mechanism of the headrest to the seat may be missing. As a result, the front headrests would not be locked and may eject in the event of a collision, increasing the risk of injury.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **CITROËN**

Name **SpaceTourer / Jumpy 4**

EC-type approval/model **e2*2007/46*0531*19**

Production dates **16/11/2021 - 16/12/2021**

Company recall code **JAS**

Weekly report number **Report-2022-24**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **29/04/2022**

Products were found and
measures were taken also in

Denmark
Iceland
The Netherlands
Slovenia



Alert number **[A12/00872/22](#)**

Product **Passenger van / Light commercial vehicle**

Risk type **Injuries**

Incorrect image (frozen picture) information may be displayed by the rear view camera at low temperatures. As a result, the driver will not have an accurate and reliable view of the areas behind the vehicle on the display screen when reversing, which could increase the risk of an accident

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger van / Light commercial vehicle**

Brand **Mercedes-Benz**

Name **Vito**

EC-type approval/model **639/2, 639/4, 639/5
e1*2007/46*0457*10-*25, e1*2007/46*0458*08-*20,
e1*2007/46*0459*06-*12**

Production dates **16.04.2014 - 23.07.2020**

Company recall code **VS2RU54KAM**

Weekly report number **Report-2022-24**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic **Recall of the product from end users**

operators

Manufacturer

Products were found and
measures were taken also in

Croatia
The Netherlands

Alert number **[A12/00863/22](#)**

Product **Puffer toy**



Risk type **Choking**

Small parts (the eyes) can easily detach from the toy. A small child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Puffer toy in the shape of stretchy centipedes (pink, mint green, yellow colours) with white eyes**

Packaging description **No packaging**

Brand **ToiToys**

Name **Super Stretchy Centipede**

Type / number of model **35244Z**

Batch number **2100311**

Barcode **8714627352443**

Weekly report number **Report-2022-24**

Alert submitted by **Austria**

Is the product counterfeit? **Unknown**

Country of origin **The Netherlands**

Measures taken by economic operators **Marking the product with appropriate warnings on the risks
Retailer**

Date of entry into force **02/06/2022**

Measures taken by economic operators **Withdrawal of the product from the market
Retailer**

Date of entry into force **02/06/2022**

Alert number **[A12/00855/22](#)**

Product **Magnetic balls**



Risk type **Injuries**

The toy is made of small parts (balls) with a high magnetic flux. If a child swallows them, they could attract one another causing intestinal blockage or perforation.

The product does not comply with the requirements of the Toy Safety Directive nor with the relevant European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Set of silver coloured magnetic balls.**

Packaging description **Metal box and plastic packaging.**

Brand **Unknown**

Name **Kulki magnetyczne 5mm / NdFeB Magnet**

Type / number of model **KM-2**

Weekly report number **Report-2022-24**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Destruction of the product
Importer**

Date of entry into force

10/03/2022

Measures ordered by public authorities

**Warning consumers of the risks
Importer**

Date of entry into force

10/03/2022

Measures ordered by public authorities

**Withdrawal of the product from the market
Importer**

Date of entry into force

10/03/2022



Alert number **[A12/00870/22](#)**

Product **Gloves**



Risk type **Chemical**

The product contains chromium VI (measured value: 5.2 mg/kg). Chromium (VI) is sensitising and can trigger allergic reactions.

The product does not comply with the REACH Regulation.

Category **Protective equipment**

Type **Consumer**

Description **Gloves with white goat-leather gripping surface, black plastic backhand, black elastic wristband and fleece-like lining.**

Packaging description **Cardboard tag**

Brand **Gebol**

Name **Uni Fit Thermo**

Type / number of model **70 93 40**

Batch number **1720360**

Barcode **9002701934012**

Weekly report number **Report-2022-24**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Austria**

Measures taken by economic operators **Stop of sales
Retailer**

Date of entry into force **27/05/2022**

Alert number **[A12/00852/22](#)**

Product **Bunk bed**



Risk type **Injuries**

The opening in the safety barriers at the upper sleeping level is too wide. A child may fall out of the bed through the opening and suffer injuries.

The product does not comply with the requirements of the General Product Safety Directive nor with the European standard 747.

Category **Furniture**

Type **Consumer**

Description **White-lacquered solid wood mezzanine children's bunk bed (optional accessories, with upper shelf). Product sold online, in particular via Amazon.**

Brand **BIBEX**

Name **Alpin chalet lit mezzanine pour enfant, lit double, lit de maison, bois massif laqué blanc**

Weekly report number **Report-2022-24**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic **Removal of this product listing by the online marketplace**

operators

Other

Date of entry into force

11/02/2022

Alert number **[A12/00860/22](#)**

Product **Face cream**



Risk type **Cuts**

The glass vial may burst when opening it, causing cuts to the user.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Toning and moisturising concentrate for facial skin, in a brown glass vial containing 1.8ml. The product is also sold online.**

Packaging description **The product is contained in a sterile single-use, brown glass vial containing 1.8ml, and sold in a cardboard packaging with red partial border, large red 'V' under the brand and an image of a vial made of brown glass, and containing 1 ("sample"), 10 or 30 vials.**

Brand **Vichy**

Name **Liftactiv Specialist Peptide-C Anti-Aging-Ampullen**

Type / number of model **MB167200
MB180500
MB223800**

Barcode **301578800
30162990
3337875670630
3433425339887**

Weekly report number	Report-2022-24
Alert submitted by	Germany
Is the product counterfeit?	No
Country of origin	France
Measures taken by economic operators	Stop of sales Distributor
Date of entry into force	27/05/2022
Measures taken by economic operators	Removal of this product listing by the online marketplace Distributor
Date of entry into force	27/05/2022
Measures taken by economic operators	Recall of the product from end users Distributor
Date of entry into force	27/05/2022
Measures taken by economic operators	Withdrawal of the product from the market Distributor
Date of entry into force	27/05/2022
Company recall code	- https://www.vichy.de/gesicht/peptide-c-ampullen-liftactiv/p46288.aspx
Products were found and measures were taken also in	Austria Estonia Poland Romania

Alert number **[A12/00851/22](#)**

Product **Bunk bed**



Risk type **Injuries**

The opening in the guard rail is too wide. A person (child) may fall out of the bed through the opening and suffer injuries.

The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 747.

Category **Furniture**

Type **Consumer**

Description **Bunk bed for 3, with steel frame and wooden slats. Product sold online, in particular via Amazon.**

Brand **BEFARA**

Name **FAM**

Type / number of model **FAM_120/90-190_P**

Weekly report number **Report-2022-24**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators


**Removal of this product listing by the online marketplace
Other**

Date of entry into force

14/02/2022

Alert number **[A12/00864/22](#)**

Product **Bunk bed**

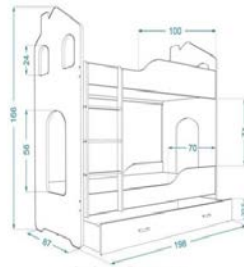

Risk type **Injuries**

The opening in the safety barriers at the upper sleeping level is too wide. A child may fall out of the bed through the opening and suffer injuries.

The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 747.

Category **Furniture**

Type **Consumer**

Description **Children's bunk bed with two mattresses measuring 160/190x80 cm. Material: acrylonitrile-butadiene-styrene. Product sold online, in particular via Amazon, ASIN B09JG82NLD.**

Brand **FurnitureByJDM**

Name **David maison II**

Type / number of model **Princesse de rose 190x80**

Weekly report number **Report-2022-24**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Date of entry into force

11/02/2022

Alert number **[A12/00857/22](#)**

Product **Bath toy**



Risk type **Chemical**

The foam in the product contains an excessive amount of Tris(2-chloro-1-methylethyl) phosphate (TCPP) (measured value: up to 70 mg/kg) and Tris[2-chloro-1-(chloromethyl)ethyl] phosphate (TDCP) (measured value: more than 100 mg/kg). TCPP and TDCP might cause cancer.

The product does not comply with the requirements of the Toy Safety Directive.

Category **Toys**

Type **Consumer**

Description **Bath toy in the form of a book, made of soft plastic material filled with foam.**

Brand **Aksjomat**

Name **Książeczka kąpielowa "Zwierzatka na łące"**

Barcode **9788381066518**

Weekly report number **Report-2022-24**

Alert submitted by **Poland**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Destruction of the product
Manufacturer**

Date of entry into force

10/05/2022

Measures ordered by public authorities

**Warning consumers of the risks
Manufacturer**

Date of entry into force

10/05/2022

Measures ordered by public authorities

**Withdrawal of the product from the market
Manufacturer**

Date of entry into force

10/05/2022

Alert number **[A12/00858/22](#)**

Product **Rattle toy**



Risk type **Choking**

The rattles can easily break, generating small parts. A child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71.

Category **Toys**

Type **Consumer**

Description **Rattle with handle, in green, yellow or pink colour.**

Brand **Unknown**

Type / number of model **9088**

Weekly report number **Report-2022-24**

Alert submitted by **Estonia**

Is the product counterfeit? **No**

Country of origin **Unknown**

Measures taken by economic operators **Recall of the product from end users
Retailer**

Date of entry into force **19/05/2022**

Alert number **[A12/00871/22](#)**

Product **Inflatable plastic ball**



Risk type **Chemical**

The toy contains an excessive concentration of diisobutyl phthalate (DIBP) (measured value up to 25.5% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Green, blue and red plastic ball.**

Packaging description **Net bag.**

Brand **Unknown**

Name **Pilka**

Type / number of model **Z6043-Z6043-2908**

Barcode **5900949413631**

Weekly report number **Report-2022-24**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	16/03/2022
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	16/03/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	16/03/2022
Measures ordered by public authorities	Recall of the product from end users Importer
Date of entry into force	16/03/2022

Alert number **[A12/00869/22](#)**

Product **Plastic doll**



Risk type **Chemical**

The plastic material of the toy contains an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 2.16% by weight). This phthalate may harm the health of children, possibly causing damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll.**

Packaging description **Transparent plastic packaging.**

Brand **Midex**

Name **Kety FASHION DOLL**

Type / number of model **B1527249/AD12**

Barcode **5900733591002**

Weekly report number **Report-2022-24**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	31/03/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	31/03/2022
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	31/03/2022

Alert number **[A12/00866/22](#)**

Product **Power supply**



Risk type **Environment**

The solders contain an excessive concentration of lead (measured value up to 51.6% by weight). Lead poses a risk to the environment.

The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Antenna power supply**

Packaging description **Plastic bag**

Brand **LIBOX**

Name **Zasilacz antenowy uniwersalny**

Type / number of model **LBZ -01**

Barcode **5902689073977**

Weekly report number **Report-2022-24**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Importer**

Date of entry into force **11/05/2022**

Measures ordered by public authorities **Warning consumers of the risks
Importer**

Date of entry into force **11/05/2022**

Alert number **[A12/00868/22](#)**

Product **Toy slime**



Risk type **Chemical**

The migration of boron from the toy is too high (measured value up to: 725 mg/kg). Contact with an excessive quantity of boron may harm the health of children by damaging their reproductive system.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-3.

Category **Toys**

Type **Consumer**

Description **Toy slime.**

Packaging description **Plastic container.**

Brand **Unknown**

Name **Plynnna plastelina**

Type / number of model **NGKL0023**

Barcode **5903321177640**

Weekly report number **Report-2022-24**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Warning consumers of the risks
Importer**

Date of entry into force **27/04/2022**

Measures ordered by public authorities **Destruction of the product
Importer**

Date of entry into force **27/04/2022**

Measures ordered by public authorities **Withdrawal of the product from the market
Importer**

Date of entry into force **27/04/2022**

Alert number **[A12/00877/22](#)**

Product **Passenger car**

Risk type **Fire**

The electrical supply to the water heater unit can shut off too soon when the vehicle is stopped. Fuel can therefore remain in the heater, producing smoke and fuel leakage. Moreover, the information about atmospheric pressure sent by the BSI to the water heating unit is incorrect, so the unit is unable to operate. The unburnt fuel may remain inside the unit may produce smoke when next activated and fuel may potentially leak, increasing the risk of fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **PEUGEOT**

Name **508 II**

EC-type approval/model **e2*2007/46*0628*00 - e2*2007/46*0628*11**

Production dates **16/01/2018 - 29/01/2021**

Company recall code **KRJ**

Weekly report number **Report-2022-24**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force

16/03/2022

Products were found and
measures were taken also in

**Denmark
The Netherlands
Poland
Slovenia**

Alert number **[A12/00876/22](#)**

Product **Passenger car**

Risk type **Fire**

The electrical supply to the water heater unit can shut off too soon when the vehicle is stopped. Fuel can therefore remain in the heater, producing smoke and fuel leakage. Moreover, the information about atmospheric pressure sent by the BSI to the water heating unit is incorrect, so the unit is unable to operate. The unburnt fuel may remain inside the unit may produce smoke when next activated and fuel may potentially leak, increasing the risk of fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Citroen et DS automobile**

Name **Citröen C5 aircross / DS7 Crossback**

EC-type approval/model **C5 aircross e2*2007/46*0642*01 à 14
DS7 Crossback (X74) e2*2007/46*0601*00 - 13**

Production dates **C5 aircross 20/06/2018 - 11/10/2021
DS7 CROSSBACK 19/04/2017 - 26/11/2022**

Company recall code **HWZ**

Weekly report number **Report-2022-24**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic **Recall of the product from end users**

operators

Manufacturer

Date of entry into force

05/04/2022

Products were found and
measures were taken also in

**Denmark
The Netherlands
Poland**

Alert number **[A12/00867/22](#)**

Product **Vehicle part / Replacement wheels**



Risk type **Injuries**

Insufficient structural durability may lead to formation of cracks in the wheels and can cause the wheel to break. This leads to loss of control over the vehicle equipped with the replacement wheels, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Replacement wheels (vehicle parts)**

Brand **bd breyton-design GmbH**

Name **BR-I 9019**

EC-type approval/model **E1*124R00/01*1646*00-*01
BR-I 9019**

Production dates **22.10.2019 - 21.11.2019**

Weekly report number **Report-2022-24**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin

Malaysia

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in

Denmark

Alert number

[A12/00856/22](#)

Product

Skin-lightening cream



Risk type **Chemical**

According to the list of ingredients, the product contains hydroquinone, which is forbidden in leave-on cosmetics. Hydroquinone can cause skin irritation and dermatitis.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Skin-lightening beauty cream.**

Packaging description **The product is sold in bottles and jars of 200 ml, 300 ml and 500 ml. Both bottles and jars are mostly white, with an orange shade, and have an orange cap.**

Brand **Dream Cosmetics**

Name **Caro White**

Barcode **6181100530001
6181100530018
6181100530056**

Weekly report number **Report-2022-24**

Alert submitted by **Italy**

Is the product counterfeit? **Unknown**

Country of origin **Ivory Coast**

Measures ordered by public authorities **Withdrawal of the product from the market
Importer**

Date of entry into force **23/03/2022**

Alert number

[A12/00861/22](#)

Product

Inflatable life jacket



Risk type

Drowning

The life jacket may not inflate fast enough, increasing the risk of drowning when used.

The product does not comply with the Personal Protective Equipment Regulation.

Category

Protective equipment

Type

Consumer

Description

Life jacket equipped with the Hammar MA1 hydrostatic inflator and iSi CO2 cylinder combination, and its corresponding re-arming kits. The products were manufactured from August 2021 to January 2022 and sold from September 2021 to April 2022.

Packaging description

Labelled cardboard hanger.

Brand

**Accastillage diffusion by plastimo
Plastimo**

Name

Gilets de sauvetage équipés de l'ensemble déclencheur hydrostatique Hammar MA1 et cylindre CO2 ISI

Type / number of model

**EVO165 (65195-66965-66969-66971-66973-66975)
Kit de réarmement (58577-58461-64116-65088-65089-66435)
Kit de réarmement Hammar MA1 + ISI 33 et 60 gr (S28052-S28096-S28091)
PILOT 165ZIP (66807-66809-66811-66813-66815-66817-70992)
PILOT 290 (65579)
PILOT ZIP 165AD by plastimo (67624)**

**PILOTISO 275 (65072-66940-66941)
PILOTPRO 180 (65319-65321)
SL180 (64967-64970-65539-66917)**

Weekly report number	Report-2022-24
Alert submitted by	France
Is the product counterfeit?	No
Country of origin	France
Measures taken by economic operators	Withdrawal of the product from the market Manufacturer
Date of entry into force	13/04/2022
Measures taken by economic operators	Recall of the product from end users Manufacturer
Date of entry into force	13/04/2022
Company recall code	- https://rappel.conso.gouv.fr/fiche-rappel/6850/Interne - https://rappel.conso.gouv.fr/fiche-rappel/6844/Interne

Alert number

[A12/00873/22](#)

Product

Vehicle parts / Replacement wheels for cars

Risk type

Injuries

Due to a manufacturing defect, the rim of the wheel may break while the vehicle is in motion, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category

Motor vehicles

Type

Consumer

Description

Replacement wheels for cars (vehicle parts)

Brand

Zhejiang Xinghui Aluminium Wheel Co., Ltd

Name

XH2001

EC-type approval/model

**E1*124R00/01*1516*00
XH2001 7JX18CH**

Weekly report number

Report-2022-24

Alert submitted by

Germany

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

