

Alert number **[A12/00937/22](#)**Product **Plastic doll set**Risk type **Chemical**

The plastic material of the dolls contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured values: up to 28.3% by weight). This phthalate may harm the health of children, possibly causing damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**Type **Consumer**Description **Plastic doll with brown hair and green dress and a plastic snowman.**Packaging description **Cardboard box with transparent window**Brand **Unknown**Name **Frozen II**Type / number of model **SK-41891**Barcode **6880319418918**Weekly report number **Report-2022-27**Alert submitted by **Estonia**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Retailer**

Date of entry into force **22/06/2022**

Measures ordered by public authorities **Other : Informing importer about hazard in connection with a toy
Retailer**

Date of entry into force **27/06/2022**

Measures ordered by public authorities **Recall of the product from end users
Retailer**

Date of entry into force **23/06/2022**

Alert number **[A11/00080/22](#)**

Product **Inflatable boat**



Risk type **Drowning
Other : Hypothermia**

There are no instructions for re-boarding in the manual. Furthermore, the manual is missing other required information and warnings. A user who falls overboard will find it difficult to re-board since the user does not easily recognize the means of re-boarding. A user could suffer hypothermia and/or drown.

The product does not comply with the requirements of the Recreational Craft and Personal Watercraft Directive.

Category **Recreational crafts**

Type **Consumer**

Description **Inflatable boat**

Brand **GLADIATOR**

Name **GLADIATOR Inflatable**

Type / number of model **AK340**

Batch number **CN-WHB00060L020**

Weekly report number **Report-2022-27**

Alert submitted by **Latvia**

Is the product counterfeit? **No**

Country of origin

People's Republic of China

Measures taken by economic operators

**Marking the product with appropriate warnings on the risks
Importer**

Date of entry into force

18/05/2022

Alert number **[A12/00933/22](#)**

Product **Body cream**



Risk type **Chemical**

According to the list of ingredients the product contains a mixture of the preservatives methylchloroisothiazolinone and methylisothiazolinone (MCI and MI), which are forbidden in leave-on cosmetics. Dermal contact with MCI and MI can provoke allergic contact dermatitis in sensitive persons.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Moisturizing cream with honey, natural extract, 200ml.**

Packaging description **White plastic jar with a yellow screw cap.**

Brand **Vdl Natural Care ®**

Name **Vdl Natural Care ® Miel**

Type / number of model **00180600
19060700180600**

Batch number **0281575**

Barcode **8432583815757**

Weekly report number **Report-2022-27**

Alert submitted by	Czechia
Is the product counterfeit?	Unknown
Country of origin	Spain
Measures ordered by public authorities	Withdrawal of the product from the market Retailer
Date of entry into force	23/06/2022

Alert number **[A12/00932/22](#)**

Product **Body cream**



Risk type **Chemical**

According to the list of ingredients the product contains a mixture of the preservatives methylchloroisothiazolinone and methylisothiazolinone (MCI and MI), which are forbidden in leave-on cosmetics. Dermal contact with MCI and MI can provoke allergic contact dermatitis in sensitive persons.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Body cream with aloe vera, 200ml.**

Packaging description **White plastic jar with a white screw cap.**

Brand **MARIE LAURENT ML**

Name **Crema Corpo Rivitalizzante ALOE VERA**

Type / number of model **00190600
190607 EXP. 06/2022**

Batch number **-**

Barcode **8016543020049**

Weekly report number **Report-2022-27**

Alert submitted by	Czechia
Is the product counterfeit?	Unknown
Country of origin	Spain
Measures ordered by public authorities	Withdrawal of the product from the market Retailer
Date of entry into force	22/06/2022

Alert number **[A11/00081/22](#)**

Product **Inflatable boat**



Risk type **Drowning
Other : Hypothermia**

There are no instructions for re-boarding in the manual. Furthermore, the manual is missing other required information and warnings. A user who falls overboard will find it difficult to re-board since the user does not easily recognize the means of re-boarding. A user could suffer hypothermia and/or drown.

The product does not comply with the requirements of the Recreational Craft and Personal Watercraft Directive.

Category **Recreational crafts**

Type **Consumer**

Description **Inflatable rubber boat**

Brand **Aqua-Storm**

Name **Rubber boat - Aqua-Storm**

Type / number of model **STM-330**

Batch number **UA-CAS00432B118**

Weekly report number **Report-2022-27**

Alert submitted by **Latvia**

Is the product counterfeit? **No**


Country of origin **Ukraine**

Measures taken by economic operators **Marking the product with appropriate warnings on the risks
Importer**

Date of entry into force **18/05/2022**

Alert number **[A12/00965/22](#)**

Product **Magnetic balls**

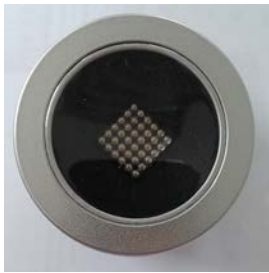

Risk type **Injuries**

The toy is made of small parts (balls) with a high magnetic flux. If a child swallows them, they could attract one another causing intestinal blockage or perforation.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Set of silver 3mm magnetic balls.**

Packaging description **Metal packaging.**

Brand **VERK GROUP**

Name **Kulki magnetyczne 3mm srebrne 216**

Type / number of model **18197**

Barcode **5907451323076**

Weekly report number **Report-2022-27**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	31/05/2022
Products were found and measures were taken also in	Slovenia

Alert number **[A12/00964/22](#)**

Product **Magnetic balls**



Risk type **Injuries**

The toy is made of small parts (balls) with a high magnetic flux. If a child swallows them, they could attract one another causing intestinal blockage or perforation.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Set of coloured 5 mm magnetic balls.**

Packaging description **Metal and plastic packaging.**

Brand **VERK GROUP**

Name **Kulki magnetyczne 5mm kolor 216**

Type / number of model **18196**

Barcode **5907451323069**

Weekly report number **Report-2022-27**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	31/05/2022
Products were found and measures were taken also in	Slovenia

Alert number **[A12/00963/22](#)**

Product **Magnetic balls**



Risk type **Injuries**

The toy is made of small parts (balls) with a high magnetic flux. If a child swallows them, they could attract one another causing intestinal blockage or perforation.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Set of coloured 3 mm magnetic balls**

Packaging description **Metal and plastic packaging.**

Brand **VERK GROUP**

Name **Kulki magnetyczne 3 mm kolor 216**

Type / number of model **18195**

Barcode **5907451323052**

Weekly report number **Report-2022-27**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	31/05/2022

Alert number **[A12/00962/22](#)**

Product **Stacking toy**



Risk type **Choking**

The eyes of the dog-shaped sphere on the top of the toy pyramid can easily detach, generating small parts. A child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71.

Category **Toys**

Type **Consumer**

Description **Stacking toy with an upper sphere in the shape of a dog head and with seven stackable plastic rings. The rings have different colours: red, yellow, orange, green, pink (twice), and blue.**

Packaging description **The toy is packed into a yellow net. A further label is applied on the base of the toy, and contains the CE marking, a barcode and a recommended age group "18 months".**

Brand **Unknown**

Name **Piramida pies**

Type / number of model **1198**

Barcode **5904361000943**

Weekly report number **Report-2022-27**

Alert submitted by	Estonia
Is the product counterfeit?	Unknown
Country of origin	Poland
Measures taken by economic operators	Recall of the product from end users Retailer
Date of entry into force	01/07/2022

Alert number **[A12/00966/22](#)**

Product **Ladder**



Risk type **Injuries**

The ladder does not have sufficient mechanical strength and can bend during use. During loading, the ascending stiles bend strongly. A user could fall and suffer injuries.

The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 131-2.

Category **Hand tools**

Type **Consumer**

Description **Aluminium step ladder with 3 steps and platform, manufactured in September 2021.**

Packaging description **The product is sold in a transparent polyethylene packaging. On the side, there are graphic symbols, giving information about the use and the standard.**

Brand **HAUSHALT**

Name **Aluminium Step Ladder**

Type / number of model **1914, 123000724**

Batch number **09/2021**


Barcode **3871880001558**

Weekly report number **Report-2022-27**

Alert submitted by	Latvia
Is the product counterfeit?	Unknown
Country of origin	Lithuania
Measures taken by economic operators	Destruction of the product Distributor
Date of entry into force	26/01/2022

Alert number **[A12/00967/22](#)**

Product **Ladder**

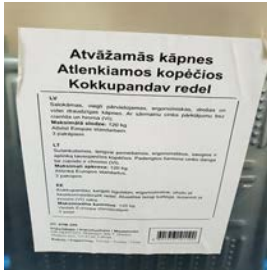

Risk type **Injuries**

The ladder does not have sufficient mechanical strength and can bend during use. During loading, the steps and platform bend strongly. A user could fall and suffer injuries.

The product does not comply with the requirements of the General Product Safety Directive nor with the European standards EN 131-1 and 131-2.

Category **Hand tools**

Type **Consumer**

Description **Aluminium step ladder with 2 steps and platform.**

Packaging description **The product is sold in a transparent polyethylene packaging. There are graphic symbols, giving information about the use and the standard.**

Brand **ATM® (ATES MADENI ESYA SAN. TIC. LTD. STI.)**

Name **Aluminium Step Ladder**

Type / number of model **202195
ATM-200**

Barcode **8691913101100**

Weekly report number **Report-2022-27**

Alert submitted by	Latvia
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures taken by economic operators	Destruction of the product Distributor
Date of entry into force	26/01/2022

Alert number

[A12/00944/22](#)

Product

Cabinet with mirror



Risk type

Injuries

The mirror film reverse backing is unable to bond with either adhesive or tape. Therefore, the mirror of the door may fall off and break, resulting in glass shards causing injuries.

The product does not comply with the requirements of General Product Safety Directive.

Category

Furniture

Type

Consumer

Description

Wall-mounted cabinet and freestanding bathroom cabinet with mirror on the door. Each furniture is in colours satin white, satin blue and satin grey.

Brand

GoodHome

Name

GoodHome Perma Wall-Mounted Mirrored Cabinet, and GoodHome Perma tall freestanding mirrored cabinet

Type / number of model	Perma
Barcode	5059340257075, 5059340018256, 5059340257082 5059340018140, 5059340256986, 5059340018157 5059340018706, 5059340257235, 5059340018249 5059340256993, 5059340018690, 5059340257228
Weekly report number	Report-2022-27
Alert submitted by	Ireland
Is the product counterfeit?	No
Country of origin	Romania
Measures taken by economic operators	Recall of the product from end users Distributor
Date of entry into force	20/05/2022

Alert number **[A12/00976/22](#)**

Product **Passenger car**

Risk type **Fire
Injuries**

The micro gas generator inside the seat belt retractor may not have been manufactured to specifications. This may lead to an impairment of the restraint function in case of an accident, increasing the risk of injury. Moreover, there may be spark formation in case of a pressure release outside of the inflator damaged tube, increasing the risk of fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **BMW**

Name **i3, i4, M3, X1, X2, 2er (Grand Tourer), 3er (Limousine+Touring)**

EC-type approval/model **F2X, F2GT, F1X, G3L, G3K, G4C, G234M, BMWi-1 e1*2007/46*1824, e1*2007/46*1677, e1*2007/46*1676, e1*2007/46*1947, e1*2007/46*2017, e1*2018/858*00122, e1*2018/858*00003, e1*2007/46*1213**

Production dates **11.01.2022 - 02.03.2022**

Company recall code **0072430200, 0072440200, 0072450200**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Company recall code

- <https://www.bmw.de/de/topics/service-zubehoer/bmw-service/rueckrufe.html>

Products were found and measures were taken also in

**France
The Netherlands
Poland**

Alert number **[A12/00975/22](#)**

Product **Passenger car**

Risk type **Fire
Injuries**

The micro gas generator inside the seat belt retractor may not have been manufactured to specifications. This may lead to an impairment of the restraint function in case of an accident, increasing the risk of injury. Moreover, there may be spark formation in case of a pressure release outside of the inflator damaged tube, increasing the risk of fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **MINI**

Name **MINI Cabrio, MINI Clubman, MINI Countryman, MINI Cooper (5-Türer)**

EC-type approval/model **FMK, FML4, FMCA, FMX
e1*2007/46*1683, e1*2007/46*1680, e1*2007/46*1679,
e1*2007/46*1682**

Production dates **12.01.2022 - 03.03.2022**

Company recall code **0072430200, 0072440200, 0072450200**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Company recall code

- <https://www.bmw.de/de/topics/service-zubehoer/bmw-service/rueckrufe.html>

Products were found and measures were taken also in




**The Netherlands
Poland**

Alert number

[A12/00952/22](#)

Product

Circular saw blade

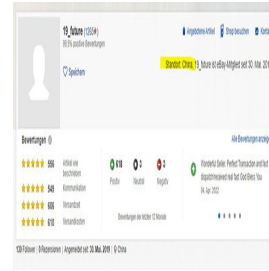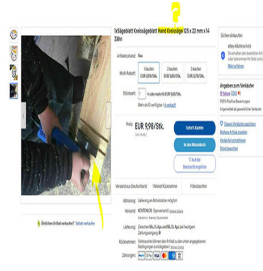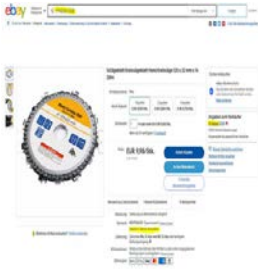

Risk type

Cuts

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.

The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.

Category

Electrical appliances and equipment

Type

Consumer

Description

Chainsaw blade with a diameter of 125 mm and a bore of 22 mm, with 14 teeth, advertised for angle grinders. Product sold online, in particular via eBay with item number 174920041028.

Brand

Wood Carving Disc, Carve, Cut or Shape

Name

1xSägeblatt Kreissägeblatt Hand Kreissäge 125 x 22 mm x 14 Zähn

Type / number of model

125x 22 mm

Weekly report number

Report-2022-27

Alert submitted by

Germany

Is the product counterfeit? **Unknown**


Country of origin **People's Republic of China**

Measures taken by economic operators **Removal of this product listing by the online marketplace
Other**

Date of entry into force **05/04/2022**

Alert number **[A12/00953/22](#)**

Product **Circular saw blade**

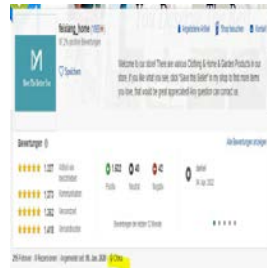

Risk type	<p>Cuts</p> <p>The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.</p> <p>The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.</p>
Category	Electrical appliances and equipment
Type	Consumer
Description	Chainsaw blade with 125 mm diameter and 22 mm bore, advertised for angle grinders. Product sold online, in particular via eBay, with item number 313939066994.
Brand	Wood Curving Disc, Curve, Cut or Shape
Name	for 12733 5" Circular Saw Blade Angle Grinder Cutter Wood Carving disk Chain Saw
Type / number of model	125x22-23mm
Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	Unknown

Country of origin

People's Republic of China

Measures taken by economic operators



**Removal of this product listing by the online marketplace
Other**

Date of entry into force

05/04/2022

Alert number **[A12/00954/22](#)**

Product **Circular saw blade**

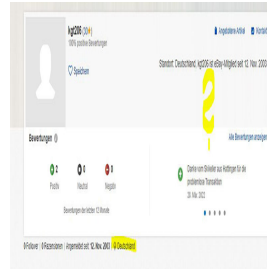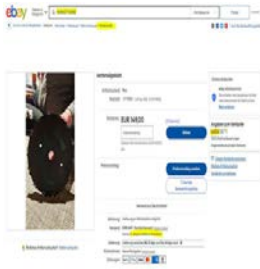

Risk type **Cuts**

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.

The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Chainsaw blade without indication of diameter, advertised for angle grinders. Product sold online, in particular via eBay, with item number 194952715966.**

Brand **Unknown**

Name **Kettensägeblatt für Winkelschleifer beworben**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators




**Removal of this product listing by the online marketplace
Other**

Date of entry into force

05/04/2022

Alert number **[A12/00955/22](#)**

Product **Circular saw blade**

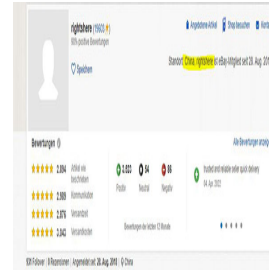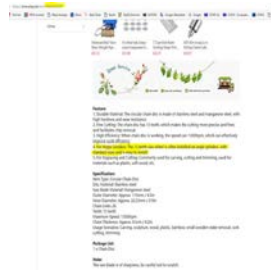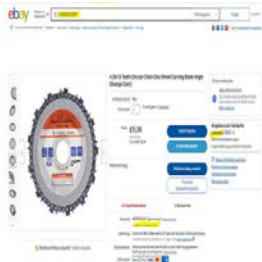

Risk type	Cuts
	The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.
	The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.
Category	Electrical appliances and equipment
Type	Consumer
Description	Chainsaw blade with a diameter of 115x22.23 mm and 13 teeth, advertised for angle grinders. Product sold online, in particular via eBay, with item number 134060633597.
Brand	Wood Carving Disc, Curve, Cut or Shape
Name	4.5in 13 Teeth Circular Chain Disc Wheel Carving Blade Angle (Orange Card)
Type / number of model	125x22.23mm
Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	Unknown

Country of origin

People's Republic of China

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Date of entry into force

05/04/2022

Alert number **[A12/00956/22](#)**

Product **Circular saw blade**



Impressum

Name des Unternehmens: Marusz Kowalczyk
 Vorname: Marusz
 Nachname: Kowalczyk
 Adresse: Rötigestr. 4
 86343 Königshorn
 Deutschland

Handelsregisternummer: 09772163
 USt-IDNr.: DE 330585065
 Telefonnummer: 015254003679
 E-Mail-Adresse: kowalhu@web.de

Ergänzende Angaben:
 USt-Id Nr. DE330585065 WEEE-Reg.Nr. DE8101072
 Verpack.-Reg.Nr. DE40300508919 V-Bau-Reg.Nr. DE
 12778024 Plattform der EU-Kommission zur Online-
 Streitbeilegung: <https://ec.europa.eu/consumers/odr> sind
 zur Teilnahme an einem Streitbelegungsverfahren vor einer
 Verbraucherschlichtungsstelle wieder verpflichtet noch bereit,
 Informationspflichten gemäß § 18 Abs. 2 Elektro- und
 Informationsgesetz (IfG) zu erfüllen.

Risk type **Cuts**

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.

The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Circular saw blade with a diameter of 125x22.23 mm and 3 teeth, advertised for angle grinders. Product sold online, in particular via eBay, with item number 28473319142.**

Brand **Tediam**

Name **3T CARBIDE SAW BLADE**

Type / number of model **125mmx22.23mmx3T**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin


People's Republic of China

Measures taken by economic operators

Recall of the product from end users
Other

Alert number **[A12/00957/22](#)**

Product **Circular saw blade**

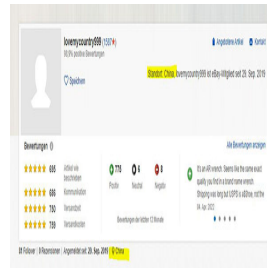

Risk type	Cuts
	<p>The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.</p> <p>The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.</p>
Category	Electrical appliances and equipment
Type	Consumer
Description	Chainsaw blade with a diameter of 125 mm and a bore of 22 mm, advertised for angle grinders. Product sold online, in particular via eBay, with item number 373732757338.
Brand	Wood Carving Disc, Curve, Cut or Shape
Name	Sägeblatt Metall Aluminium Kreissägeblatt Kreis Kapp Säge Blatt 125x22mm 14 Zähne
Type / number of model	125 x 22 mm
Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	Unknown

Country of origin

People's Republic of China

Measures taken by economic operators


**Withdrawal of the product from the market
Other**

Date of entry into force

05/04/2022

Alert number **[A12/00958/22](#)**

Product **Circular saw blade**

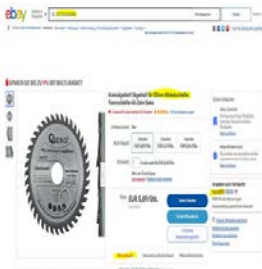

Impressum

Name des Unternehmens: Pavel Brandt
 Vorname: Pavel
 Nachname: Brandt
 Adresse: Rottgenstr. 36
 42897 Remscheid
 Deutschland
 USt-IDNr.: DE 815524889
 Telefonnummer: 015733235410
 E-Mail-Adresse: pavelbrandt@web.de

Ergänzende Angaben:
 Plattform der EU-Kommission zur Online-Streitbeilegung:
<https://ec.europa.eu/consumers/odr/>

Risk type **Cuts**

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.

The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Circular saw blade with a diameter of 125 mm, a bore of 22 mm and with 40 teeth, advertised for angle grinders. Product sold online, in particular via eBay, with item number 275120339368.**

Brand **GEKO**

Name **Kreissägeblatt Sägeblatt für 125mm Winkelschleifer Trennschleifer 40-Zahn Geko**

Type / number of model **125x22x40T**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**


Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market
Other**

Date of entry into force **05/04/2022**

Alert number **[A12/00959/22](#)**

Product **Circular saw blade**

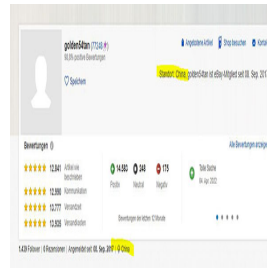

Risk type	<p>Cuts</p> <p>The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.</p> <p>The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.</p>
Category	Machinery
Type	Consumer
Description	Saw blade with a diameter of 125 mm and 3 teeth, advertised for angle grinders. Product sold online, in particular via eBay, with item number 124999649737.
Brand	speedcutter
Name	125mm Hartmetall Speedcutter 3 Zähne Holz Winkelschleifer Holz Kreissägeblatt
Type / number of model	125 mm
Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	Unknown

Country of origin

People's Republic of China

Measures taken by economic operators

**Withdrawal of the product from the market
Other**

Date of entry into force

05/04/2022

Alert number **[A12/00960/22](#)**

Product **Circular saw blade**



Impressum

Name des Unternehmens: Rovial GmbH
 Vorname: Geschäftsführer: Alexander
 Nachname: Romanenko
 Adresse: Siemensstr. 14 A
 35463 Fernwald, Annerod
 Deutschland
 Handelsregisternummer: Amtsgericht Gießen HRB 9471
 USt-IDNr.: DE 319232049
 Telefonnummer: 064136052064
 Faxnummer: 064136053348
 E-Mail-Adresse: eshop@rovial.de
 Ergänzende Angaben:
<https://ec.europa.eu/consumers/odr/>

Risk type **Cuts**

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.

The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Circular saw blade with a diameter of 115 mm and a bore of 22 mm, advertised for angle grinders. Product sold online, in particular via eBay, with item number 164877033509.**

Brand **Yato**

Name **Sägeblatt Holz 115 x 22,2 mm Raspelscheibe Fräsen Winkelschleifer Trennschleifer**

Type / number of model **115 x 5 x 22.2 mm
YT-58171**

Barcode **5906083025709**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market
Other**

Date of entry into force **06/04/2022**

Alert number **[A12/00982/22](#)**

Product **Circular saw blade**



Impressum

Name des Unternehmens: Trade-Shop
 Vorname: Yalub
 Nachname: Eldin
 Adresse: Röhlsberg 20
 37081 Odtlingen
 Deutschland
 USt-IDNr.: DE 246287906
 Telefonnummer: 0551-7079645
 Faxnummer: 0551-60065206
 E-Mail-Adresse: support@trade-shop-online.de

Ergänzende Angaben:
 Alle Preise verstehen sich inklusive der in Deutschland gültigen gesetzlichen MwSt. und zzgl. der jeweils anfallenden Versandkosten.
 Link auf die Online-Streitbelegungs-Plattform der EU:
<https://ec.europa.eu/consumers/odr/>

Risk type **Cuts**

The circular saw blade may be mounted on an angle grinder and could therefore, against its intended use, be used as a hand-held circular saw. As a consequence, this could cause kickback or loss of control over the tool, resulting in injuries.

The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60745-2-3.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Chainsaw blade with a diameter of 125 mm and a bore of 22 mm, 24 teeth. Product sold online, in particular via eBay, article number 353630446786.**

Brand **Trade Shop**

Type / number of model **125 x 22 mm**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Date of entry into force

06/04/2022

Alert number **[A12/00977/22](#)**

Product **Passenger car**



Risk type **Injuries**

Due to a manufacturing error, sharp edges at the upper part of the metal structure of the front seats may cause occupants of the rear seat injuries in case of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **TOYOTA**

Name **Highlander**

EC-type approval/model **e6*2018/858*00001*00**

Production dates **06.12.2019 - 17.06.2021**

Company recall code **22SMD-053**

Weekly report number **Report-2022-27**

Alert submitted by **Bulgaria**

Is the product counterfeit?

No

Country of origin

United States

Measures taken by economic operators

**Recall of the product from end users
Importer**

Date of entry into force



31/05/2022

Products were found and measures were taken also in

**Estonia
The Netherlands
Poland
Slovakia**

Alert number **[A12/00968/22](#)**

Product **Passenger car**

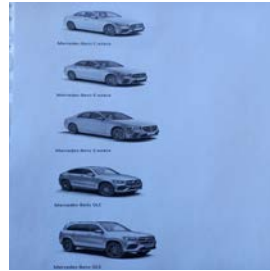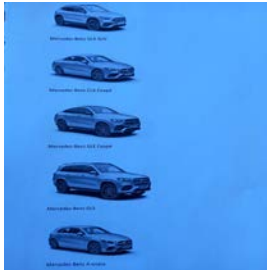

Risk type **Injuries**

Due to a defect in the high fuel pressure manifold the engine might be damaged. This may lead to reduced engine power and to inability to start the vehicle, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **CLA (model series 117), CLA (model series 118), GLA (model series 156), GLE/GLS (model series 167), A-Class (model series 177), AMG GT (model series 190), C-Class (model series 205), E-Class (model series 213), S-Class Coupe/convertible (model series 217), S-Class (model series 222)**

Packaging description **SL (model series 231), E-Class Coupe/convertible (model series 238), B-Class (model series 246), B-Class/GLB (model series 247), GLC (model series 253), CLS (model series 257), AMG GT 4-door coupe (model series 290) and G-Class (model series 463)**

Brand **MERCEDES-BENZ**

Name **CLA, GLA, GLE/GLS, A-Class, AMG GT, C-Class, E-Class, S-Class Coupe/convertible, S-Class**

EC-type approval/model	e1*2007/46*1878*03
Production dates	2019
Company recall code	0792034
Weekly report number	Report-2022-27
Alert submitted by	Bulgaria
Is the product counterfeit?	No
Country of origin	Germany
Measures taken by economic operators	Recall of the product from end users Importer
Products were found and measures were taken also in	The Netherlands

Alert number

[A12/00971/22](#)

Product

Passenger van / Light commercial vehicle

Risk type

Injuries

A chemical change in the active substance in the front airbag gas generator can cause an increase in the internal pressure. In the event of an accident, the gas generator may burst and injure the occupants of the vehicle with metal fragments. Furthermore, the airbag will not unfold and protect properly in this situation.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category

Motor vehicles

Type

Consumer

Description

Passenger van / Light commercial vehicle

Brand

MERCEDES-BENZ

Name

Sprinter

EC-type approval/model

e1*2001/116*0354/04

Production dates

2006-2015

Company recall code

9192152

Weekly report number

Report-2022-27

Alert submitted by **Bulgaria**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Importer**

Alert number **[A12/00970/22](#)**

Product **Pickup truck**

Risk type **Injuries**

Heavy loading may cause the rear differential to fail. The vehicle may lose drive or the rear wheels can lock, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Pickup truck**

Brand **FORD**

Name **Ranger**

EC-type approval/model **e11*2007/46*0154*17, e5*2007/46*0080*00-*02
2AB**

Production dates **1.09. 2018 - 31.05.2019**

Company recall code **22S30**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **South Africa**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <http://www.etis.ford.com/>**

Products were found and **France**

measures were taken also in **Slovakia**



Alert number

[A12/00951/22](#)

Product

Smartphone for explosive atmospheres



Risk type

**Burns
Injuries**

The device fails to meet the design requirements for Intrinsic safety required for use in potentially explosive atmospheres. The power output is excessive and the battery is not sufficiently protected. This increases the risk of ignition in explosive atmospheres.

The product does not comply with the requirements of the ATEX Directive nor with the European standard EN 60079-11.

Category

Explosive atmospheres equipment

Type

Consumer

Description

Smartphone for use in potentially explosive atmospheres. Product sold online, in particular via AliExpress.

Brand

Conquest

Type / number of model

S12

Weekly report number

Report-2022-27

Alert submitted by

Germany

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public authorities

Removal of this product listing by the online marketplace
Other

Measures taken by economic operators

Removal of this product listing by the online marketplace
Other



Alert number

[A12/00948/22](#)

Product

Smartphone for explosive atmospheres



Risk type

**Burns
Injuries**

The device fails to meet the design requirements for Intrinsic safety required for use in potentially explosive atmospheres. The power output is excessive and the battery is not sufficiently protected. This increases the risk of ignition in explosive atmospheres.

The product does not comply with the requirements of the ATEX Directive nor with the European standard EN 60079-11.

Category

Explosive atmospheres equipment

Type

Consumer

Description

Smartphone for use in potentially explosive atmospheres. Product sold online, in particular via AliExpress.

Brand

Conquest

Type / number of model

S18

Weekly report number

Report-2022-27

Alert submitted by

Germany

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public authorities

Removal of this product listing by the online marketplace
Other



Alert number **[A12/00947/22](#)**

Product **Smartphone for explosive atmospheres**



Risk type	<p>Burns Injuries</p> <p>The device fails to meet the design requirements for Intrinsic safety required for use in potentially explosive atmospheres. The power output is excessive and the battery is not sufficiently protected. This increases the risk of ignition in explosive atmospheres.</p> <p>The product does not comply with the requirements of the ATEX Directive nor with the European standard EN 60079-11.</p>
Category	Explosive atmospheres equipment
Type	Consumer
Description	Smartphone for use in potentially explosive atmospheres. Product sold online, in particular via AliExpress.
Brand	Conquest
Type / number of model	S19
Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	No
Country of origin	People's Republic of China

Measures ordered by public authorities

Removal of this product listing by the online marketplace
Other



Alert number **[A12/00946/22](#)**

Product **Smartphone for explosive atmospheres**



Risk type **Burns
Injuries**

The device fails to meet the design requirements for "Intrinsic safety" required for use in potentially explosive atmospheres. The power output is excessive and the battery is not sufficiently protected. This increases the risk of ignition in explosive atmospheres.

The product does not comply with the requirements of the ATEX Directive nor with the European standard EN 60079-11.

Category **Explosive atmospheres equipment**

Type **Consumer**

Description **Smartphone for use in potentially explosive atmospheres. Product sold online, in particular via AliExpress.**

Brand **Conquest**

Type / number of model **S20**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public authorities

Removal of this product listing by the online marketplace
Other

Measures taken by economic operators

Removal of this product listing by the online marketplace
Other

Measures taken by economic operators

Recall of the product from end users
Other



Alert number

[A12/00949/22](#)

Product

Tablet for explosive atmospheres



Risk type

**Burns
Injuries**

The device fails to meet the design requirements for Intrinsic safety required for use in potentially explosive atmospheres. The power output is excessive and the battery is not sufficiently protected. This increases the risk of ignition in explosive atmospheres.

The product does not comply with the requirements of the ATEX Directive nor with the European standard EN 60079-11.

Category

Explosive atmospheres equipment

Type

Consumer

Description

Tablet for use in potentially explosive atmospheres. Product sold online, in particular via AliExpress.

Brand

Conquest

Type / number of model

S22

Weekly report number

Report-2022-27

Alert submitted by

Germany

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public authorities

Removal of this product listing by the online marketplace
Other



Alert number **[A11/00079/22](#)**

Product **Electric kettle**



Risk type **Burns
Electric shock**

The power connector is not adapted to the electric kettle, resulting in overheating. The non-metallic parts of the product are not sufficiently resistant to ignition. Users may touch live parts which are overheated or where the insulation has been damaged, and receive burns or an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-2-15 and EN 60695-2-11.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White plastic electric kettle in protection class II. Power plug, 220-240V, 50/60Hz, and 1000-1200W. Capacity: 1.0 liters.**

Packaging description **Colourful cardboard box.**

Brand	OFESTA BARCELONA
Name	OFESTA WK 226
Type / number of model	3801023 (v01) WK 226
Batch number	20512504
Barcode	5060337470254
Weekly report number	Report-2022-27
Alert submitted by	Latvia
Is the product counterfeit?	No
Country of origin	United Kingdom
Measures taken by economic operators	Withdrawal of the product from the market Importer
Date of entry into force	17/11/2021

Alert number

[**A12/00981/22**](#)

Product

Bicycle part / saddle joint

Risk type

Injuries**Other : Multiple injuries possible: crushing, fractures, concussion, internal injuries.****The saddle joint may break due to material fatigue during use. The user may lose control of the bicycle, fall and suffer injuries.****The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 15194.**

Category

Hobby/sports equipment

Type

Consumer

Description

Articulated aluminum seat post with two adapter sleeves with integrated saddle joint for mountain bike, which offers the possibility of moving the assembled saddle by 15° in either direction, product sold online.

Brand

freibeik

Barcode

4066684063850

Weekly report number

Report-2022-27

Alert submitted by

Germany

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public authorities

**Other : Official monitoring of the recall
Other**

Date of entry into force

15/06/2022

Measures taken by economic operators

**Recall of the product from end users
Importer**

Date of entry into force

15/06/2022

Alert number **[A12/00974/22](#)**

Product **Passenger car**

Risk type **Injuries**

A software error may disengage the parking (brake) mechanism. This can lead to the vehicle moves uncontrolled, increasing the risk of injuries.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **KIA**

Name **EV6 (CV)**

EC-type approval/model **e9*2018/858*11073*00**

Production dates **2021 - 2022**

Company recall code **221058**

Weekly report number **Report-2022-27**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Estonia
Greece
The Netherlands
Slovakia**

Alert number **[A12/00969/22](#)**

Product **Motorcycle**

Risk type **Injuries**

The Standing Assist System (parking brake) does not release immediately after deactivation and continues to block the front suspension, causing a risk for the user to fall and suffer injuries.

The product does not comply with the Regulation on the approval and market surveillance of two- or three wheel vehicles and quadricycles.

Category **Motor vehicles**

Type **Consumer**

Description **Motorcycle, three-wheel scooter model**

Brand **YAMAHA**

Name **MWD300 (Tricity 300)**

EC-type approval/model **SH16, SH20
e13*168/2013*00673, e13*168/2013*00907**

Production dates **1.02.2020 - 28.02.2022**

Company recall code **Standing Assist System**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Thailand**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <http://www.yamaha-motor.de/>**

Products were found and **France**

measures were taken also in

The Netherlands
Poland
Romania



Alert number **[A12/00973/22](#)**

Product **Passenger car**

Risk type **Injuries**

Due to a manufacturing error, involving an insufficient amount of glue, the motor hood can completely detach, which poses a risk of injury.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **VW**

Name **Crafter Grand California**

EC-type approval/model **SYMWE, SYMVE
e1*2007/46*1935*, e1*2007/46*1953***

Production dates **06.12.2019 - 09.04.2021**

Company recall code **75A2**

Weekly report number **Report-2022-27**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Poland**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **France
The Netherlands**

Alert number

[A12/00950/22](#)

Product

Smartphone for explosive atmospheres



Risk type

**Burns
Injuries**

The device fails to meet the design requirements for Intrinsic safety required for use in potentially explosive atmospheres. The power output is excessive and the battery is not sufficiently protected. This increases the risk of ignition in explosive atmospheres.

The product does not comply with the requirements of the ATEX Directive nor with the European standard EN 60079-11.

Category

Explosive atmospheres equipment

Type

Consumer

Description

Smartphone for use in potentially explosive atmospheres. Product sold online, in particular via AliExpress.

Brand

Conquest

Type / number of model

S21

Weekly report number

Report-2022-27

Alert submitted by

Germany

Is the product counterfeit?

No

Country of origin

People's Republic of China

Measures ordered by public authorities

Removal of this product listing by the online marketplace
Other



Alert number **[A12/00938/22](#)**

Product **Hair dye**



Risk type **Chemical**

According to the list of ingredients, the product contains Barium peroxide, which is forbidden in cosmetics and releases barium; the latter substance was found in the product (measured value: 18.1%). Barium can be easily absorbed and has toxic effects on the body impairing muscle, heart and kidney activity, leading to arrhythmia, paralysis or gastrointestinal alterations. Furthermore, the product contains p-phenylenediamine (PPD)(measured value: 9.7%, respectively) with an insufficient coupling agent. Uncoupled PPD is an extreme skin sensitiser and can trigger allergic contact dermatitis.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Henna hair dye. The product appears as a dark brown powder, with a hay-like smell.**

Packaging description **The product is sold in a red printed sachet, with an outer packaging consisting of a sachet and printed folding cardboard.**

Brand **Royal**

Name **Black Henna**

Batch number **025**

Barcode	8901371090015
Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	India
Measures ordered by public authorities	Destruction of the product Retailer
Date of entry into force	28/03/2022

Alert number **[A12/00941/22](#)**

Product **Hair dye**



Risk type **Chemical**

The product contains Toluene-2,5-Diamine, 5-Amino-o-cresol, p-aminophenol and p-phenylenediamine (PPD)(measured values: 0.2%, 0.8%, 4.1% and 2.7%, respectively) with an insufficient coupling agent. Toluene-2,5-Diamine, 5-Amino-o-cresol,, and uncoupled p-aminopohenol and PPD are extreme skin sensitisers and can trigger allergic contact dermatitis. Furthermore, Toluene-2,5-Diamine may cause cancer, is mutagenic and might affect fertility.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Henna hair dye. The product appears as a fine granular green-brown powder, with a hay-like smell.**

Packaging description **The product is sold in a red printed sachet, with an outer packaging consisting of a dark brown printed sachet and printed folding cardboard.**

Brand **Royal**

Name **Brown Henna**


Batch number **165**

Barcode **8901371090022**

Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	India
Measures ordered by public authorities	Destruction of the product Retailer
Date of entry into force	28/03/2022

Alert number **[A12/00972/22](#)**

Product **Plastic swing**

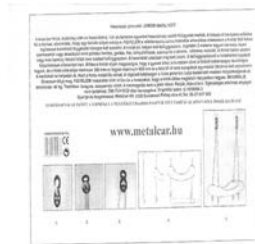

Risk type **Injuries**

The ropes can be fixed to the swing seat with knots that may easily loosen. A child may fall down and suffer injuries.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-8.

Category **Toys**

Type **Consumer**

Description **Colourful plastic sheet swing with two ropes for children over 4 years, to be assembled at home. The suspension rope can be fastened with a knot without the use of a fastening element. Max. Load capacity: 40 kg.**

Packaging description **Transparent plastic bag**

Brand **Junior**

Name **Junior Hinta**

Type / number of model **1227**

Barcode **5997421702277**

Weekly report number **Report-2022-27**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **Hungary**

Measures ordered by public authorities **Recall of the product from end users
Distributor**

Date of entry into force **20/05/2022**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**


Date of entry into force **20/05/2022**

Alert number

[A12/00942/22](#)

Product

Hair styling mousse

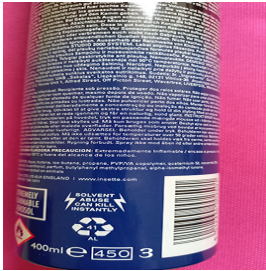

Risk type

Chemical

According to the list of ingredients, the product contains butylphenyl methylpropional (BMHCA), which is forbidden in cosmetic products. BMHCA may harm the reproductive system, may harm the health of the unborn child and may cause skin sensitisation.

The product does not comply with the Cosmetic Products Regulation.

Category

Cosmetics

Type

Consumer

Description

Hair styling mousse. Manufacturing date 14/12/2020; best used until 12/01/2023.

Packaging description

The product is sold in an aerosol aluminum bottle (400 ml).

Brand

Studio 2000 System

Name

Professional Mouse Pro-vitamin B5

Batch number

012

Barcode

5012334002501

Weekly report number

Report-2022-27

Alert submitted by

Lithuania

Is the product counterfeit?

No

Country of origin

United Kingdom

Measures ordered by public
authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

14/06/2022

Alert number	<u>A12/00939/22</u>
Product	Motorcycle helmet



Risk type	Injuries
	The impact absorption capacity of the helmet is insufficient. In the event of an impact, users may suffer head injuries.
	The product does not comply with the requirements of the Regulation ECE 22-05.
Category	Protective equipment
Type	Consumer
Description	Dark motorcycle helmet with a visor. Type-approval number: E1 05300489/J; Type designation: OF801.
Brand	YANGJIANG BAOGANGTANG TRADE INDUSTRY CO., LTD.
Name	YS, HELMO, CGM, SKA-P, TIFONE, BKS
Type / number of model	E1 05300489/J OF801
Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic	Recall of the product from end users

operators

Manufacturer



Alert number **[A12/00940/22](#)**

Product **Air humidifier**



Risk type **Microbiological**

The non-antibacterial water tank is not accessible for cleaning and the appliance does not emit a warning sound to change the water required. This could lead to the development of molds that can cause allergic reactions when spread by air.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White plastic-covered ultrasonic air humidifier with transparent water tank.**

Packaging description **The product is sold in a colourful cardboard box.**

Brand **Steba**

Name	Luftbefeuchter
Type / number of model	LB 9 SPS-728
Barcode	4011833302021
Weekly report number	Report-2022-27
Alert submitted by	Hungary
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	01/04/2022
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	01/04/2022

Alert number **[A12/00961/22](#)**

Product **Toy gun**



Risk type **Environment**

The solder joint in the toy has an excessive concentration of lead (measured value up to 76.1% by weight). Lead poses a risk to the environment.

The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Category **Toys**

Type **Consumer**

Description **Plastic/metal battery toy in the shape of space gun, 2 x AA 1,5 V. Length 35 cm**

Packaging description **Plastic transparent cover.**

Brand **Unknown**

Name **BLACK ICE / SPACE GUN**

Type / number of model **999S-7A**

Barcode **6967470699971**

Weekly report number **Report-2022-27**

Alert submitted by **Czechia**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Retailer**

Date of entry into force **14/06/2022**

Alert number **[A12/00943/22](#)**Product **USB Charger**Risk type **Electric shock
Fire**

The electrical insulation is insufficient and the clearance /creepage distances between the primary and accessible secondary circuits are not sufficient; consequently, a user may receive an electric shock. Furthermore, the plastic case of the product is not sufficiently resistant to heat and could catch fire.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60950-1.

Category **Electrical appliances and equipment**Type **Consumer**Description **USB charger. Product sold online, in particular via Bol.com.**Brand **Eisenz**Barcode **6970463501014**Weekly report number **Report-2022-27**Alert submitted by **Belgium**Is the product counterfeit? **Unknown**Country of origin **Unknown**

Measures taken by economic operators

**Recall of the product from end users
Importer**

Date of entry into force

20/04/2022

Alert number

[A12/00945/22](#)

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 46%). Furthermore, one of the two filter layers does not provide full coverage (missing from the upper chin, cheek and lower chin area). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 149.

Category

Protective equipment

Type

Consumer

Description

Black protective respiratory filtration half-face mask with black ear-bands, marked with FFP2 and with the CE marking printed on it. Product sold online, in particular via AliExpress.

Packaging description	The product is sold in a transparent/white plastic pouch containing 10 units, with the instructions printed on it, with both claims FFP2 and KN95, and with the CE marking printed on it.
Brand	Unknown
Name	KN95 Professional protection
Weekly report number	Report-2022-27
Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	Unknown
Measures ordered by public authorities	Removal of this product listing by the online marketplace Other
Measures taken by economic operators	Destruction of the product Importer

Alert number **[A12/00931/22](#)**

Product **Passenger car**



Risk type **Injuries**

The hub bolts of the wheels can loosen, resulting in detachment of the wheels from the vehicle. This can lead to loss of control of the vehicle, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Toyota**

Name **bZ4X - XEAM10-YEAM15/ JTM**

EC-type approval/model **e6*2018/858*00144*00**

Production dates **02.11.2021 - 15.06.2022**

Company recall code **22SMD-064**

Weekly report number **Report-2022-27**

Alert submitted by **Bulgaria**

Is the product counterfeit?

No

Country of origin

Japan

Measures taken by economic operators

**Recall of the product from end users
Importer**

Products were found and measures were taken also in

**Poland
Romania
Slovakia**

Alert number **[A12/00934/22](#)**

Product **Plastic doll**



Risk type **Chemical**

The toy contains an excessive amount of bis (2-ethylhexyl) phthalate (DEHP) (measured value up to: 12,4% by weight). This phthalate may harm the health of children, possibly causing damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll, size 28 cm.**

Packaging description **Cardboard box with plastic window.**

Brand **ANDAR**

Name **Pretty girl**

Type / number of model **ADR21798**

Barcode **5903321111378**

Weekly report number **Report-2022-27**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	31/05/2022

Alert number **[A12/00935/22](#)**

Product **Plastic doll**



Risk type **Chemical**

The doll contains an excessive concentration of bis (2-ethylhexyl) phthalate (DEHP) (measured value up to: 14,9% by weight). This phthalate may harm the health of children, possibly causing damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll size 28 cm.**

Packaging description **Cardboard box with plastic window.**

Brand **ANDAR**

Name **Beautiful girl**

Type / number of model **ADR21797**

Barcode **5903321111361**

Weekly report number **Report-2022-27**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Warning consumers of the risks Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	31/05/2022
Measures ordered by public authorities	Destruction of the product Importer
Date of entry into force	31/05/2022

Alert number **[A12/00936/22](#)**

Product **Portable power station**



Risk type	<p>Electric shock</p> <p>The electrical insulation as well as the clearance /creepage distances between the primary and accessible secondary circuits are not sufficient. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 62040-1, EN 60950-1, and EN 62368-1.</p>
Category	Electrical appliances and equipment
Type	Consumer
Description	Portable power station with battery, AC input, AC socket output and multiple DC outputs (USB). The product can be used as a Uninterrupted Power Source. Product also sold online.
Packaging description	The product is sold in a printed cardboard box.
Brand	EcoFlow RIVER 600

Name	Portable power station
Type / number of model	EF4
Barcode	4897082662983
Weekly report number	Report-2022-27
Alert submitted by	Finland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	21/06/2022
Measures ordered by public authorities	Recall of the product from end users Importer
Date of entry into force	21/06/2022

Alert number **[A12/00978/22](#)**

Product **Children's sweatshirt**



Risk type **Strangulation**

The sweatshirt has functional cords with free ends in the hood. They can become trapped during various activities of a child, leading to strangulation.

The product does not meet the requirements of the General Product Safety Directive nor of the European standard EN 14682.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Black sweatshirt with hood printed with a dinosaur motif. The product was also sold online, in particular via Rakuten France.**

Packaging description **Plastic bag**

Brand **Pixel évolution**

Name **Sweat à capuche Godzilla**

Type / number of model **MEDI 05/2020**

Weekly report number **Report-2022-27**

Alert submitted by **France**

Is the product counterfeit? **Unknown**

Country of origin **India**

Measures taken by economic operators **Removal of this product listing by the online marketplace
Other**

Date of entry into force **16/08/2021**

Alert number	<u>A12/00979/22</u>
Product	Children's sports outfit



Risk type	Strangulation The product bears cords with free ends in the hood that can become trapped during various activities of a child, leading to strangulation. The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14682.
Category	Clothing, textiles and fashion items
Type	Consumer
Description	A set of 3 sports garments consisting of red and white trousers, a red and white bra and a hooded top in open honeycomb stitch with drawstrings in the neck area. The product was also sold online, in particular via Rakuten France.
Packaging description	Transparent plastic blister.
Brand	130 - hopscotch
Type / number of model	199055
Weekly report number	Report-2022-27
Alert submitted by	France
Is the product counterfeit?	Unknown

Country of origin

People's Republic of China

Measures taken by economic operators

**Removal of this product listing by the online marketplace
Other**

Alert number **[A12/00980/22](#)**

Product **Children's swimsuit**



Risk type	Strangulation
	The product bears functional cords close to the neck and in the back area. The cords may become trapped during various activities of a child, leading to strangulation.
	The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 14682.
Category	Clothing, textiles and fashion items
Type	Consumer
Description	Children's two-piece swimming costume printed with pink flamingo and vegetation.
Brand	Unknown
Name	Casual maillot de bain bébé fille Bikini Set Flamingo maillot de bain Costume nouveau-né enfant
Type / number of model	C03532
Weekly report number	Report-2022-27
Alert submitted by	France
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China

Measures taken by economic operators

Removal of this product listing by the online marketplace
Other

Products were found and measures were taken also in

Ireland