

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

week 11 - 2016

Notification A12/1352/15 has been withdrawn from Report 44-2015 at the request of the notifying authority as the product was a sample not intended for sale. Notification A12/0258/16 from Report 09-2016 has been updated at the request of the notifying authority in order to include two additional model numbers.

**Alert number:** A12/0315/16

**Product:** Children's travel cot

**Name:** Unknown

**Risk:** Strangulation, Suffocation

**Category:** Childcare articles and children's equipment

**Brand:** Carello

**Type/number of model:** Play2

**Risk level:** Serious risk

The plastic mattress base can easily be lifted: a child could be trapped underneath and suffocate. There are protruding parts to which garments of children could get hanged, causing strangulation. In addition, the presence of long cords and strings may also cause strangulation. Also, the defective locking mechanism may cause the cot to fold inadvertently, causing injuries to the child and the gap between the side bars and the changing unit is too large, which may cause entrapment of fingers between the unit and the side of the cot. The product does not comply with the relevant European standard EN 716.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Children's blue and green travel cot with two wheels, a changing table and a mosquito net. The side of the cot is decorated with two carriages with animals and the inscription "My 1st Ride". Small toys are hanging from a semicircular bar on the top of the cot. The product is packed in a brown cardboard box.

**Batch number/Barcode:** 0298254000031

**Country of origin:** China

**Alert submitted by:** Greece



**Alert number:** A12/0334/16

**Product:** Children's car seat

**Name:** Baby Car Seat

**Risk:** Injuries

**Category:** Childcare articles and children's equipment

**Brand:** Bebehut

**Type/number of model:** Model: BAB001D.

**Risk level:** Serious risk

The shoulder part of the seat can break apart releasing the child restraint mechanism in the event of a car accident or sudden braking of the vehicle. The product does not comply with the relevant national standard.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Convertible baby car seat and booster, intended for groups 1, 2 and 3, fitted with harness. Blue in colour. Product packaged in plain cardboard box.

**Batch number/Barcode:** July 2015 to November 2015

**Country of origin:** China

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Germany



**Alert number:** A12/0322/16

**Product:** Children's clothing set

**Name:** Unknown

**Risk:** Injuries, Strangulation

**Category:** Clothing, textiles and fashion items

**Brand:** Arino

**Type/number of model:** 94023

**Risk level:** Serious risk

The drawstring with free ends in the hood and in the trousers may become trapped during various activities of the child, leading to strangulation or injuries respectively. The product does not comply with the relevant European standard EN 14682.


**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Outfit for boys consisting of trousers and a jacket with hood and zip-fastener. The hood of the jacket includes a non-fixed drawstring with free ends. The waistband of the trousers includes an unattached drawstring with free ends. The product is decorated with inscriptions. Size: 134, 140, 152

**Batch number/Barcode:** 2010040940233

**Country of origin:** China

**Alert submitted by:** Hungary

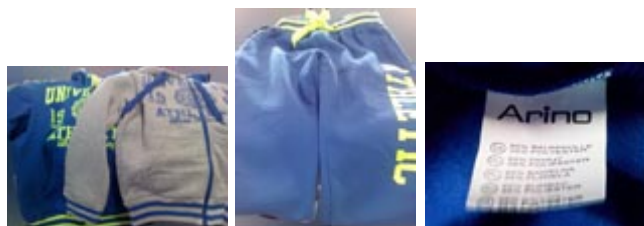

**Alert number:** A12/0324/16

**Product:** Children's clothing set

**Name:** Unknown

**Risk:** Strangulation

**Category:** Clothing, textiles and fashion items

**Brand:** Arino

**Type/number of model:** 94021

**Risk level:** Serious risk

The drawstring with free ends in the hood could become trapped during various activities of the child, leading to strangulation. The product does not comply with the relevant European standard EN 14682.


**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Blue outfit for children consisting of leisure trousers and sweatshirt with hood. The hood of the sweatshirt includes an unattached drawstring with free ends. The product is decorated with inscriptions "16 NEW YORK Varsity SINCE 1985". Size: 134, 140, 146, 152, 158, 164.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary

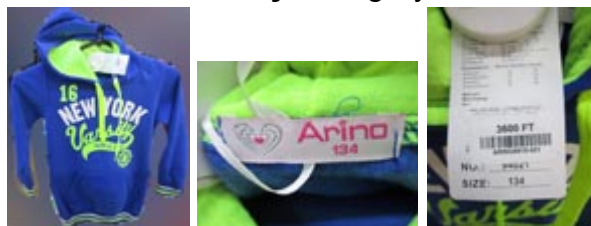

**Alert number:** A12/0328/16

**Product:** Teeth whitening strips

**Name:** Whitestrips SUPREME

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Crest

**Type/number of model:** Unknown

**Risk level:** Serious risk

The product contains hydrogen peroxide as a bleaching substance (measured concentration 12.7% by weight). Hydrogen peroxide at high concentrations causes skin irritation and is harmful if swallowed. The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Teeth whitening strips in white and blue aluminium packaging; 2 strips in each packaging. Unregistered import by third-party distributor. The manufacturer did not produce it

for direct distribution to consumers in the EU.

**Batch number/Barcode:** (L)5240V444

**Country of origin:** United States

**Alert submitted by:** The Netherlands



**Alert number:** A12/0329/16

**Product:** Teeth whitening strips

**Name:** 3D White Whitestrips LUXE - Supreme FLEXFIT

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Crest

**Type/number of model:** Unknown

**Risk level:** Serious risk

The product contains hydrogen peroxide as a bleaching substance (measured concentration 10.6% by weight). Hydrogen peroxide at high concentrations causes skin irritation and is harmful if swallowed. The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Teeth whitening strips in dark blue aluminium packaging; 2 strips in each packaging. Unregistered import by third-party distributor. The manufacturer did not produce it for direct distribution to consumers in the EU.

**Batch number/Barcode:** (L)4335V445

**Country of origin:** United States

**Alert submitted by:** The Netherlands

**Products were found and measures were taken also in:** Slovenia



**Alert number:** A12/0330/16

**Product:** Teeth whitening strips

**Name:** 3D White Whitestrips - 1 hr EXPRESS

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Crest

**Type/number of model:** 0101009030705

**Risk level:** Serious risk

The product contains hydrogen peroxide as a bleaching substance (measured concentration 6% by weight). Hydrogen peroxide at high concentrations causes skin irritation and is harmful if swallowed. The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Teeth whitening strips in blue aluminium packaging; 2 strips in each packaging. Unregistered import by third-party distributor. The manufacturer did not produce it for direct distribution to consumers in the EU

**Batch number/Barcode:** (L)4346V435

**Country of origin:** United States

**Alert submitted by:** The Netherlands



**Alert number:** A12/0340/16

**Product:** Teeth whitening product

**Name:** HOME KIT - TEETH WHITENING

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Beautiful Smile

**Type/number of model:** Unknown

**Risk level:** Serious risk

The product contains hydrogen peroxide as a bleaching substance (measured concentration 8.8% by weight). Hydrogen peroxide at high concentrations causes skin irritation and is harmful if swallowed. The product does not comply with the Cosmetic Products Regulation

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Teeth whitening set including 3x3 ml teeth whitening syringe gel, 2 mouth trays, 1 tray box, 1 user manual and 1 shade guide; supplied in a blue coloured box.

**Batch number/Barcode:** 2500181664216

**Country of origin:** China

**Alert submitted by:** The Netherlands



**Alert number:** A12/0335/16

**Product:** Artificial Christmas tree

**Name:** Sapin de Noël Super Luxe Enneigé 60 cm

**Risk:** Injuries

**Category:** Decorative articles

**Brand:** BABOU

**Type/number of model:** Unknown

**Risk level:** Serious risk

The metallic tip of the tree presents a sharp edge. If someone falls on this small tree, contact with the sharp metallic tip could lead to an injury, notably an eye perforation. The product does not comply with the national legislation and the relevant standard.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Snow-covered tree packed in a white cardboard box with a red label.

**Batch number/Barcode:** Code: 218934

**Country of origin:** China

**Alert submitted by:** France**Alert number:** A12/0332/16**Product:** Nylon sling for climbing**Name:** Nylon Runner**Risk:** Injuries**Category:** Hobby/sports equipment**Brand:** Black Diamond**Type/number of model:** 1) 18 mm Nylon Runner 60 cm long (item No 380060) 2) 18 mm Nylon Runner 120 cm long (item No 380061).**Risk level:** Serious risk

The nylon sling may be held together merely with adhesive tape. If this is the case, the sling cannot hold a weight and will fail under a normal load. As a consequence, the user could fall from a height. The product does not comply with the requirements of the Personal Protective Equipment Directive.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)**Description:** Nylon sling, 18 mm wide and 60 cm or 120 cm long, used for climbing. Colour: solid colours red, blue, gold, green, grey and purple.**Batch number/Barcode:** Manufacturing codes 2014 and 2015.**Country of origin:** United States**Alert submitted by:** Austria**Products were found and measures were taken also in:** Finland, France, Sweden**Alert number:** A12/0333/16**Product:** Carabiner / quickdraw**Name:** Wiregate Carabiners, Solid Gate Carabiners, Locking Screwgate Carabiners**Risk:** Injuries**Category:** Hobby/sports equipment**Brand:** Black Diamond**Type/number of model:** Locking Screwgate Carabiners: Rocklock Screwgate, Positron Screwgate, Mini Pear Biner Screwgate, Vaporlock Screwgate, Nitron Screwgate., Solid Gate Carabiners: Positron, Nitron, "D", Oval., Wiregate Carabiners: Hotwire, Oz, Neutrino, Ovalwire, Hoodwire.**Risk level:** Serious risk

A defect in the gate of the carabiner could cause the carabiner to fail or function incorrectly. As a consequence, the user could fall from a height. The product does not comply with the requirements of the Personal Protective Equipment Directive.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)**Description:** Carabiner / quickdraw used for climbing to protect against falls from a height.

**Batch number/Barcode:** Carabiners with an "A" in the production code are not concerned by the recall. Carabiners and quickdraws with a manufacturing code between 4350 and 6018 are affected.

**Country of origin:** United States

**Alert submitted by:** Austria

**Products were found and measures were taken also in:** Croatia, Finland, France, Spain, Sweden



**Alert number:** A12/0320/16

**Product:** Decorative light bulb

**Name:** Unknown

**Risk:** Electric shock

**Category:** Lighting equipment

**Brand:** Calex Holland

**Type/number of model:** LWE14d

**Risk level:** Serious risk

The cap of the light bulb is too long. The user can consequently touch the live cap when inserting the light bulb in a socket. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60432-1.

**Measures ordered by public authorities:** Recall of the product from end users

**Description:** Decorative light bulb, long and narrow

**Batch number/Barcode:** EAN 8712879132097

**Country of origin:** The Netherlands

**Alert submitted by:** Sweden

**Products were found and measures were taken also in:** Spain



**Alert number:** A12/0337/16

**Product:** Portable LED lamp

**Name:** LED SUPER TERANG DAN TAHAN LAMA YANG HEMAT ENERGI

**Risk:** Electric shock, Fire

**Category:** Lighting equipment

**Brand:** XB (on the product), FIRESHADE (on the packaging)

**Type/number of model:** HY-108

**Risk level:** Serious risk

The cross-sectional area of the wires is not sufficient. In case of a short-circuit, the wires may overheat and this could cause a fire. Moreover, the insulation of the plug is made of flammable material. The cover of the battery compartment can be easily removed and the dimensions of the plug are inadequate, which may leave live parts accessible and cause electric shock. In addition, the single insulated, internal connecting wires are easily accessible through the openings of the lamp housing, which may also cause an electric shock. The product does not

comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Portable LED lamp in the shape of an oil lamp, can be operated directly on mains or by battery (3x1,5V AA). The lamp has plastic housing and includes 16 LEDs. The product is available in different colours and is supplied with a charger in a cardboard box. Technical parameters: AC 250V-110V/50 Hz.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Hungary



**Alert number:** A12/0316/16

**Product:** Lorry

**Name:** Actros

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type/number of model:** Type: 934.241 EC type-approval: e1\*2007/46\*0774

**Risk level:** Serious risk

An unfavourable flange angle on the rear axles may result in an unauthorized rake angle on the drive shaft for the first and second rear axles. As a result, the mounting bush or journal cross may come loose from its mounting, and fragments of the drive shaft may leave the area surrounding the vehicle.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Lorry

**Batch number/Barcode:** The vehicles concerned were manufactured between 1.7.2012 and 3.12.2014.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0317/16

**Product:** Lorry

**Name:** Series P, G, R and T

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Scania

**Type/number of model:** Type: A 4x2, B 4x2, B 4x4, A 6x2, B 6x2, A 6x2/4, B 6x2/4, A 6x2\*4, B 6x2\*4, A 6x4, B 6x6, B 8x2, B 8x2/4, B 8x2\*6, B 8x4, B 8x4\*4, B 10x4\*6 EC type-approval:



e4\*2007/46\*0032\*, e4\*2007/46\*0031\*, e4\*2007/46\*0030\*, e4\*2007/46\*0038\*,  
e4\*2007/46\*0039\*, e4\*2007/46\*0040\*, e4\*2007/46\*0045\*, e4\*2007/46\*0046\*,  
e4\*2007/46\*0032\*

**Risk level:** Serious risk

Faulty screws were used in the vehicles affected to attach the cab-entry handholds and the seat-belt brackets. Failure of the relevant mounting on entering the cab or in an accident cannot be ruled out, and there is therefore an increased risk of accident and injury.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Lorry

**Batch number/Barcode:** The vehicles concerned were manufactured in 2014.

**Country of origin:** Sweden

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Croatia, Norway, Sweden

**Alert number:** A12/0323/16

**Product:** Motorcycle

**Name:** NSS300AD and NSS300D

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Honda

**Type/number of model:** EU Type-approval numbers: e13\*2002/24\*0625\*00 and e13\*2002/24\*0625\*00.

**Risk level:** Serious risk

The rear brake pipe could leak brake fluid. This could lead to reduced brake performance, or the brake not working, and a crash may occur.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Motorcycle

**Batch number/Barcode:** Model year: 2013. Production period: from 11 January 2013 to 7 October 2013.

**Country of origin:** Thailand

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Croatia, Estonia, Germany, Slovakia, The Netherlands

**Alert number:** A12/0325/16

**Product:** Passenger car

**Name:** S60, S60CC, V60, V60CC, XC60, V70 and XC70

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Volvo

**Type/number of model:** Models with 5-cylinder diesel engine.

**Risk level:** Serious risk

While driving, the Engine Control Module (ECM) may reset causing the engine to momentarily cut-off and restart while driving. It could also lead to a loss of power-steering assistance.

**Measures taken by economic operators:** Recall of the product from end users (By:

Distributor)

**Description:** Passenger car

**Batch number/Barcode:** Year model: 2016

**Country of origin:** Belgium, Sweden

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Iceland, Ireland, Netherlands, Poland, Romania, Slovakia, Slovenia, Sweden

**Alert number:** A12/0326/16

**Product:** Passenger car

**Name:** Zoe

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type/number of model:** Model type: BFMAEU; type-approval numbers: e2\*2007/46\*0251\*00, e2\*2007/46\*0251\*01 and e2\*2007/46\*0251\*02

**Risk level:** Serious risk

The rear part of the front rear arch liner may be incorrectly mounted. This could lead to the flexible brake hose becoming worn as a result of friction with the wheel arch liner. Damage thus caused to the brake hose could lead to a loss of braking efficiency.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger car

**Batch number/Barcode:** Production period: until 06/10/2014

**Country of origin:** France

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Estonia, Germany, Ireland, Malta, Norway, Poland, Romania, Sweden, The Netherlands

**Alert number:** A12/0336/16

**Product:** Passenger car

**Name:** 308

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Peugeot

**Type/number of model:** Type: EC type approvals: e2\*2007/46\*0405\*04, e2\*2007/46\*0405\*06, e2\*2007/46\*0405\*07, e2\*2007/46\*0405\*11

**Risk level:** Serious risk

The steering track rod may break while driving.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Affected vehicles manufactured between 14 October 2015 and 20 October 2015.

**Country of origin:** France

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Iceland, Netherlands, Norway,

Slovakia

**Alert number:** A12/0319/16

**Product:** Work gloves

**Name:** Unknown

**Risk:** Chemical

**Category:** Protective equipment

**Brand:** DELTAPLUS

**Type/number of model:** DC 103 10

**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value up to 18.6 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the requirements of the Personal Protective Equipment Directive and with the REACH Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Work gloves in green-coloured suede leather with blue/black/red fabric trim on the back of the gloves; size 10.

**Batch number/Barcode:** 3295249018863

**Country of origin:** China

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** France, Spain



**Alert number:** A12/0318/16

**Product:** Plastic rattles

**Name:** Baby Toys

**Risk:** Choking

**Category:** Toys

**Brand:** FEI PAN

**Type/number of model:** NO.326-418 ITEM NO.39049

**Risk level:** Serious risk

The rattles can easily break, generating small parts which could be put in the mouth by a small child and block the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


**Measures ordered by public authorities:** Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market

**Description:** Set of three colourful plastic rattles in the shape of a butterfly, a flower and a phone receiver. Packaged in a transparent plastic bag stapled with a cardboard label.

**Batch number/Barcode:** 7521890390499

**Country of origin:** China

**Alert submitted by:** Slovakia

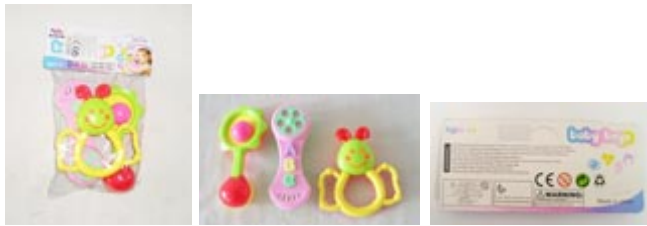

**Alert number:** A12/0327/16

**Product:** Toy ponies

**Name:** Rony - SHOW Fashion

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** HLX054734 (on the label) , NO.SL635 (on the package)

**Risk level:** Serious risk

The plastic material of the ponies contains di-(2-ethylhexyl) phthalate (DEHP) (measured values: 11.5% by weight - pink pony; 21.1% by weight - grey pony). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.


**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures, Warning consumers of the risks

**Description:** A set of two plastic ponies: the small one is pink, the big one grey, supplied in a pink cardboard box with a transparent plastic window.

**Batch number/Barcode:** 6900000002506 (on the label)

**Country of origin:** China

**Alert submitted by:** Slovakia

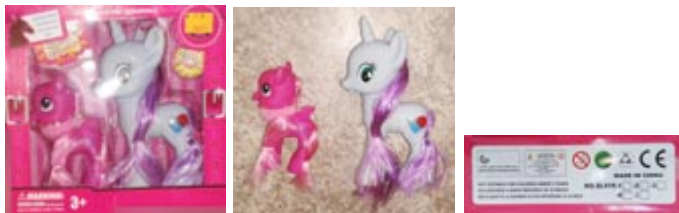

**Alert number:** A12/0331/16

**Product:** Baseball glove

**Name:** Unknown

**Risk:** Chemical, Environment

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** Article number 417 37

**Risk level:** Serious risk

The glove contains di-2-ethylhexyl phthalate (DEHP), dibutyl phthalate (DBP), diisononyl phthalate (DINP) and diisodecyl phthalate (DIDP) (measured values: up to 15,9%, 0,12%, 2,34% and 0,67% respectively). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles, while phthalates DINP, DIDP and DNOP are prohibited in toys or childcare articles that can be placed in the mouth by children. In addition, it poses a risk for the environment because it contains short chain chlorinated paraffins (SCCP) (measured value: up to 1,36%). The product does not comply

with the Regulation on persistent organic pollutants (POP Regulation).

**Measures taken by economic operators:** Destruction of the product, Withdrawal of the product from the market (By: Importer)

**Description:** Baseball glove in light brown synthetic leather. Supplied without packaging.

**Batch number/Barcode:** Serial/Batch number 1693282/Bar code 7330878417376

**Country of origin:** China

**Alert submitted by:** Sweden



**Alert number:** A12/0338/16

**Product:** Toy aeroplane

**Name:** Mon Avion à friction

**Risk:** Chemical, Choking

**Category:** Toys

**Brand:** Toup'ti/BABOU

**Type/number of model:** GD-170218; 211562

**Risk level:** Serious risk

The transparent plastic of the wheels contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 19.35% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. Moreover, a wheel can be detached easily, generating small parts. A small child may put it in the mouth and choke. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.


**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Friction aeroplane made of blue and yellow plastic, for children aged more than 12 months.

**Batch number/Barcode:** 3610140451852; 04/2014

**Country of origin:** China

**Alert submitted by:** France

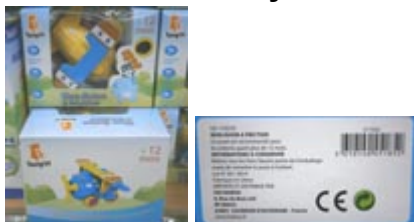

**Alert number:** A12/0339/16

**Product:** Plush toy

**Name:** Unknown

**Risk:** Choking

**Category:** Toys

**Brand:** Paul Import

**Type/number of model:** Article No. 5082

**Risk level:** Serious risk

The eye of the toy pig can easily detach and a child may put it in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Plush toy in the shape of a pig with pink ears and nose and a cord loop attached. The product is supplied without packaging.

**Batch number/Barcode:** 4026272050822

**Country of origin:** China

**Alert submitted by:** The Netherlands



**Alert number:** A12/0341/16

**Product:** Toy fire engine (with sweets)

**Name:** Unknown

**Risk:** Choking

**Category:** Toys

**Brand:** CAPZ & CANDY

**Type/number of model:** Unknown

**Risk level:** Serious risk

The wheels and windows of the toy fire engine can easily detach. A child could put these small parts in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Plastic toy fire engine with orange ladder, supplied in plastic cardboard with sweets.

**Batch number/Barcode:** 6942971506171

**Country of origin:** Unknown

**Alert submitted by:** Belgium

**Products were found and measures were taken also in:** Spain, Sweden



**Alert number:** A12/0342/16

**Product:** Toy plane (with sweets)

**Name:** Funny

**Risk:** Choking

**Category:** Toys

**Brand:** CAPZ & CANDY

**Type/number of model:** Unknown

**Risk level:** Serious risk

The wheels easily come off the toy. A child could put these small parts in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Orange coloured, toy plane with sweets inside.

**Batch number/Barcode:** 6942971504313

**Country of origin:** Unknown

**Alert submitted by:** Belgium

**Products were found and measures were taken also in:** Sweden



**Alert number:** A12/0343/16

**Product:** Toy car

**Name:** 26 Mini Race

**Risk:** Choking

**Category:** Toys

**Brand:** CAPZ & CANDY

**Type/number of model:** NO 1318

**Risk level:** Serious risk

The small wheels come off easily and the car can easily be dismantled, giving access to the internal engine mechanism. A small child may put these small parts in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Yellow plastic toy car with stickers on the front, representing a face.

**Batch number/Barcode:** 6991204449556

**Country of origin:** China

**Alert submitted by:** Belgium

**Products were found and measures were taken also in:** Spain, Sweden



**Alert number:** A11/0028/16

**Product:** Valve oil for musical instruments

**Name:** Valve Oil

**Risk:** Chemical

**Category:** Chemical products

**Brand:** Fonda U.S.A.

**Type/number of model:** Unknown

**Risk level:** Other risk level

The product poses an aspiration hazard and lacks the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product, leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Lubricant oil for musical instrument in transparent plastic bottle (30 ml) with white plastic cap and black labelling.

**Batch number/Barcode:** Unknown

**Country of origin:** United States

**Alert submitted by:** Germany



**Alert number:** A11/0027/16

**Product:** Trumpet cleaning kit with valve oil

**Name:** Trumpet Care Kit

**Risk:** Chemical

**Category:** Other

**Brand:** Unknown

**Type/number of model:** Art. No.: 00021843

**Risk level:** Other risk level

The product poses an aspiration hazard and lacks the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product, leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).


**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Trumpet cleaning kit including a plastic bottle of oil for lubricating the valves. The bottle bears the following inscription: "classic cantabile".

**Batch number/Barcode:** 4260118484277

**Country of origin:** Unknown

**Alert submitted by:** Germany

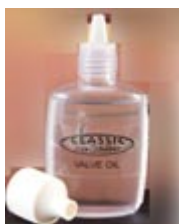



**Alert number:** A11/0026/16

**Product:** Fabric doll

**Name:** Unknown

**Risk:** Choking

**Category:** Toys

**Brand:** QWEENIE DOLLS

**Type/number of model:** 12.014.011 - 60 cm

**Risk level:** Other risk level

The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. The stuffing material may cause choking if put in the mouth by children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Doll made of fabric in a pink dress, with pink braided pigtails and a pink hat; sold without packaging.

**Batch number/Barcode:** 6912393170205; Lot : 20140314

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A11/0029/16

**Product:** Plush toy

**Name:** Unknown

**Risk:** Choking

**Category:** Toys

**Brand:** BABOU

**Type/number of model:** 220541

**Risk level:** Other risk level

The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. The stuffing material may cause choking when put in the mouth by children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Plush teddy bear (brown or white).

**Batch number/Barcode:** 3610140502158; batch 05/2014

**Country of origin:** China

**Alert submitted by:** France

