

# The Rapid Alert System for Non-Food Products (RAPEX)

## RAPEX - Weekly overview report of notifications

week 18 - 2016

Notification A12/0450/16 from Report 15 has been modified at the request of the notifying authority in order to make a small correction to the Type Number of the product. Notification A12/0501/16 has been permanently removed from Report 2016-017 as the product had already been published in Report 2015-047 (see notification A12/1484/15).

**Alert number:** A12/0542/16

**Product:** Child's car seat

**Name:** 'Confort' range

**Risk:** Injuries

**Category:** Childcare articles and children's equipment

**Brand:** Monsieur bébé

**Type/number of model:** 9/18 kg and 15/36kg Comfort range

**Risk level:** Serious risk

The restraining system does not protect the head of the children in the event of an impact. The buckle does not open easily after an accident. Moreover, information relating to safe use of the product is lacking. The product does not comply with Regulation UNECE No 44-04.

**Measures taken by economic operators:** Withdrawal of the product from the market, Recall of the product from end users (By: Importer)

**Description:** Child's car seat.

**Batch number/Barcode:** EGK1508 - Production: May 2015

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0522/16

**Product:** Boys' swimming shorts

**Name:** Unknown

**Risk:** Injuries

**Category:** Clothing, textiles and fashion items

**Brand:** TRIDAGNA

**Type/number of model:** 1) E4201, 2) E4204

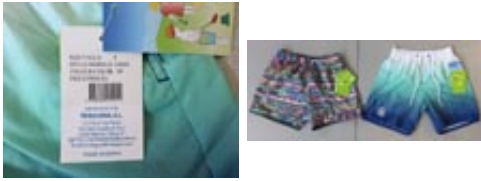
**Risk level:** Serious risk

The cords in the waist area of the shorts are too long and may become trapped during various activities of a child, causing injuries. The product does not comply with the relevant European standard EN 14682.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Two models of swimming shorts for boys up to 14 years: 1) blue, shading paler ultimately into white; 2) multicoloured ethnic design. Both have a cord in the waist area; samples sizes 4 and 6.

**Batch number/Barcode:** 2) 360000010011, 1) 359400010011

**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0523/16**Category:** Clothing, textiles and fashion items**Product:** Ladies' sandals**Brand:** Lola Cruz**Name:** Unknown**Type/number of model:** Model 057P15BK**Risk:** Chemical**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value up to 8.7 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Ladies' sandals with white leather upper and white synthetic sole. There is a buckle on the front strap and another on the ankle strap. A label on the sole of the sandal gives details of the composition, brand and size. Packaging: grey cardboard box. Sample's size: 40.

**Batch number/Barcode:** Unknown**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0525/16**Category:** Clothing, textiles and fashion items**Product:** Ladies' sandals**Brand:** BIBI LOU**Name:** Unknown**Type/number of model:** Ref 757Z10VK**Risk:** Chemical**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value: 4.5 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Ladies' leather sandals with decorative rhinestones; fastened with an ankle strap. There is a label on the sole of the sandal indicating the composition, brand and size of the shoe. Packaging: white cardboard box. Sample size: 40.

**Batch number/Barcode:** Unknown**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0527/16**Category:** Clothing, textiles and fashion items**Product:** Leather belt**Brand:** Unknown**Name:** Gürtel - Belt**Type/number of model:** Model No: 2022959 / Article No: 5119961**Risk:** Chemical**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value up to 19 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Silver-grey/black, patterned leather belt (snake-skin effect), with rivets and metal clasp; length: 105 cm, width: 3.7 cm.

**Batch number/Barcode:** 2020229590012

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0532/16

**Product:** Babies' dungarees

**Name:** Unknown

**Risk:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** Lourdes

**Type/number of model:** Reference V16092

**Risk level:** Serious risk

The press studs between the legs of the trouser part of the garment come off easily, generating small parts. A small child may put them in the mouth and choke. The product does not comply with the relevant national standard UNE 40902.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Purple dungarees with straps, for babies of up to 18 months. On the front part there is a picture of a dog and a cat. On the lower part of the garment there are press studs and on the straps there are buttons. Attached to the product is a cardboard label. Packaging: transparent plastic bag bearing the brand name.

**Batch number/Barcode:** Unknown

**Country of origin:** India

**Alert submitted by:** Spain



**Alert number:** A12/0533/16

**Product:** Men's sandals

**Name:** Unknown

**Risk:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** Traveris

**Type/number of model:** Ref 1808

**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value: 37 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Brown leather sandals for men. Packaging: a black cardboard box. Sample's size: 42.

**Batch number/Barcode:** Unknown

**Country of origin:** Pakistan

**Alert submitted by:** Spain



**Alert number:** A12/0547/16

**Product:** Girls' dress

**Name:** Unknown

**Risk:** Choking

The buttons become detached easily, generating small parts. A small child may put them in the mouth and choke. The product does not comply with the relevant national standard EN 40902.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Girls' plaid dress in sizes 12-18 M, fastens at the back with buttons and comes with a belt with another two buttons.

**Batch number/Barcode:** Unknown

**Country of origin:** India

**Category:** Clothing, textiles and fashion items

**Brand:** Patricia Mendiluce

**Type/number of model:** Model 465/W15

**Risk level:** Serious risk



**Alert submitted by:** Spain

**Alert number:** A12/0548/16

**Product:** Women's sandals

**Name:** Unknown

**Risk:** Chemical

The amount of chromium (VI) found in the leather of the insole is too high (measured value 21.9 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Recall of the product from end users (By: Retailer)

**Description:** Women's sandals in black and in white. Leather insole.

**Batch number/Barcode:** 104781/00 EAN 2000002217305/2000002217312

**Country of origin:** China

**Category:** Clothing, textiles and fashion items

**Brand:** INFINITY

**Type/number of model:** Unknown

**Risk level:** Serious risk



**Alert submitted by:** Germany

**Alert number:** A12/0552/16

**Product:** Baby clothing set

**Name:** Unknown

**Risk:** Choking

The buttons come off easily. A child could put them in the mouth and choke. The product does not comply with the relevant national standard EN 40902.

**Measures ordered by public authorities:** Import rejected at border

**Description:** The product is a baby clothing set consisting of a blouse and flowered pants.

**Batch number/Barcode:** Unknown

**Country of origin:** Morocco

**Category:** Clothing, textiles and fashion items

**Brand:** Dolce Petit

**Type/number of model:** Ref. 2110/23

**Risk level:** Serious risk

**Alert submitted by:** Spain



**Alert number:** A12/0557/16

**Product:** Hair colouring product

**Name:** Permanent Powder Hair Colour

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Sta-Sof-Fro

**Type/number of model:** 1) Black - 60060, 5) Auburn - 60062, 4) Medium Chestnut - 60064, 3) Brown black - 60061 , 2) Jet Black - 60063

**Risk level:** Serious risk

The hair dyes contain sodium perborate. Sodium perborate in high doses is toxic and it may damage fertility or the unborn child. The product does not comply with the Cosmetic Products Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Retailer)

**Description:** Hair dye in a brown glass bottle with a black lid, supplied in a beige and brown cardboard box with a package leaflet and measuring beaker. Sodium perborate is included in the list of ingredients.

**Batch number/Barcode:** 5) 5017587040638, 1) 5017857040368 , 2) 5017857040610, 3) 5017857040624, 4) 5017857040627

**Country of origin:** South Africa

**Alert submitted by:** Germany



**Alert number:** A12/0544/16

**Product:** Extension cable

**Name:** Enrollable Manguera

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Hepoluz

**Type/number of model:** Ref. 37226 and 37251

**Risk level:** Serious risk

The cable anchorage is not secure and the cable can detach leaving live parts accessible. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61242.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Extension cable/cable reel: 25-metres long (ref 37226) or 50-metres long (ref 37251). Packaging: cardboard box.

**Batch number/Barcode:** 8425156372269 and 8425156372511

**Country of origin:** China

**Alert submitted by:** Spain





**Alert number:** A12/0553/16**Product:** Heated towel rail**Name:** Unknown**Risk:** Burns**Category:** Electrical appliances and equipment**Brand:** Haverland**Type/number of model:** TE-425E, TE-700E and TE-700I**Risk level:** Serious risk

The pressure inside the heater may build up which could result in the heater developing a crack through which steam or antifreeze could escape causing burns to the user. The product does not comply with the requirements of the Low Voltage Directive.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Heated towel rail, 425W or 700W.

**Batch number/Barcode:** Only models from 2013 are affected., 8423055001761, 8423055001778 and 8423055001785

**Country of origin:** Spain**Alert submitted by:** Spain**Alert number:** A12/0556/16**Product:** Charms**Name:** Unknown**Risk:** Chemical**Category:** Jewellery**Brand:** Xenos**Type/number of model:** Art. No. 398.098**Risk level:** Serious risk

The charms contain lead (measured value up to 95% by weight). Lead is harmful for human health. The product does not comply with the REACH regulation.

**Measures taken by economic operators:** Ban on the marketing of the product and any accompanying measures (By: Retailer)

**Description:** A labelled plastic box containing 14 metal charms: eight simple, spherical, hollow and without ornaments; six with a more complex structure (one without ornaments, one with three white bead-shaped ornaments and four with red-violet rhinestones).

**Batch number/Barcode:** 8716963498113

**Country of origin:** China**Alert submitted by:** Germany**Alert number:** A12/0524/16**Product:** Passenger car**Name:** Superb**Risk:** Injuries**Category:** Motor vehicles**Brand:** Skoda**Type/number of model:** Superb III. Code: 3V5\***Risk level:** Serious risk

The sunroof could cause crushing injuries when it is closed with the key because the closing force is too high.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Passenger car with an electric, sliding, panoramic sunroof.

**Batch number/Barcode:** Model year 2016.

**Country of origin:** Czech Republic

**Alert submitted by:** Spain

**Alert number:** A12/0528/16

**Product:** Passenger car

**Name:** Mokka

**Risk:** Fire

**Category:** Motor vehicles

**Brand:** Opel/Vauxhall

**Type/number of model:** Type: J-A; EC type-approval: e3\*2007/46\*0537\*11-\*14

**Risk level:** Serious risk

Water ingress in the Electronic Brake Control Module control unit may cause a short-circuit. There is a risk of fire in the vehicle even once the engine has been switched off.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** The vehicles concerned were manufactured in 2015 and 2016.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0529/16

**Product:** Passenger car

**Name:** Cayenne

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Porsche

**Type/number of model:** Type-approval number / type: e13\*2007/46\*1085\*/ 92A

e13\*2007/46\*1106\*/92AN

e13\*2007/46\*1107\*/92AH

e13\*2007/46\*1108\*/92AHN; model: Cayenne, Cayenne S, Cayenne GTS, Cayenne Turbo, Cayenne Turbo S, Cayenne Diesel, Cayenne S Diesel, Cayenne S Hybrid, Cayenne "Platinum Edition", Cayenne Diesel "Platinum Edition".

**Risk level:** Serious risk

A securing collar on the bearing block of the pedal cluster may come loose and hinder the action of the brake pedal.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** The vehicles affected were produced between 15.1.2010 and 11.1.2016.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0531/16

**Product:** Passenger car

**Name:** Sebring, Stratus

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Chrysler, Dodge

**Type/number of model:** Type: ST

**Risk level:** Serious risk

If the airbag deploys, a folded-down sun visor on the front passenger side may, depending on the angle, be torn from its mounting and propelled in the direction of the front passenger seat.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Production period: 17.4.2000 to 21.2.2005.

**Country of origin:** United States

**Alert submitted by:** Germany

**Alert number:** A12/0540/16

**Category:** Motor vehicles

**Product:** Bus  
**Name:** Setra, Travego, Tourismo  
**Risk:** Injuries

**Brand:** Evobus  
**Type/number of model:** Type: 410 01, 410 02, 410 03, 632 02, 632 03, 632 04 EC type-approval number: e1\*2007/46\*0013\*, e1\*2007/46\*1133\*, e1\*2007/46\*1160\*, e1\*2007/46\*0025\*, e1\*2007/46\*0023\*, e1\*2007/46\*0022\* Sales description: Setra S 431 DT; Setra S 515 HDH; Setra S 516 HDH; Setra S 517 HDH; Setra S 511 HD; Setra S 515 HD; Setra S 516 HD/2; Setra S 516 HD; Setra S 517 HD; Setra S 519 HD; Setra S 516 MD; Travego RHD; Travego RHD-M; Travego RHD-L; Tourismo RHD-L; Tourismo RHD-M.

**Risk level:** Serious risk

Vehicles were delivered without a fire alarm system for the toilet tank heating.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Bus

**Batch number/Barcode:** The vehicles concerned were manufactured between 2014 and 2016.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Alert number:** A12/0543/16

**Product:** Passenger car

**Name:** Kadjar

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type/number of model:** e2\*2007/46\*0475\*00; e2\*2007/46\*0475\*01; e2\*2007/46\*0475\*02; e2\*2007/46\*0475\*03.

**Risk level:** Serious risk

In case of an accident, the thorax airbag and the curtain airbag can fail to deploy, or their functioning can be reversed in case of a lateral shock.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number/Barcode:** Right hand drive vehicles, manufactured from the beginning of production until 16 March 2016.

**Country of origin:** France

**Alert submitted by:** Malta

**Alert number:** A12/0551/16

**Product:** Passenger car

**Name:** Quattroporte, Ghibli

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Maserati

**Type/number of model:** Unknown

**Risk level:** Serious risk

The driver's side floor mat can move out of place and cause the accelerator pedal to become trapped.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles manufactured in 2013, 2014 and 2015.

**Country of origin:** Italy

**Alert submitted by:** Spain



**Alert number:** A12/0554/16**Product:** Passenger car**Name:** Tiida**Risk:** Injuries

Deterioration of the inflator propellant's density can result in abnormal driver airbag deployment in case of an accident causing injuries to the driver.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)**Description:** Passenger car.**Batch number/Barcode:** The recall concerns 2007 – 2014 model year vehicles, produced from 13/11/2007 to 08/01/2014, with Type Approval No.: e11\*2001/116\*0296\*00.**Country of origin:** Mexico**Category:** Motor vehicles**Brand:** Nissan**Type/number of model:** C11**Risk level:** Serious risk**Alert submitted by:** Greece**Alert number:** A12/0555/16**Product:** Van**Name:** Citan**Risk:** Injuries

Due to a faulty connection of the rear left seatbelt, the functioning of the seatbelt cannot be guaranteed. This could lead to an increased risk of injury in the event of an accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)**Description:** Van**Batch number/Barcode:** The vehicles concerned were manufactured between 23 November 2015 and 27 November 2015.**Country of origin:** Germany**Category:** Motor vehicles**Brand:** Mercedes-Benz**Type/number of model:** Type-approval numbers: e2\*2007/46\*0129\* and e2\*2007/46\*0130\* Type: 415**Risk level:** Serious risk**Alert submitted by:** Germany**Alert number:** A12/0526/16**Product:** Soft toy**Name:** Flying a kite and white cloud**Risk:** Choking

The suction cup can be easily detached from the toy and small children could put it in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures, Warning consumers of the risks**Description:** Soft toy, in the form of a pink pig, with a suction cup.**Batch number/Barcode:** Unknown**THE PRODUCT IS COUNTERFEIT****Country of origin:** China**Category:** Toys**Brand:** Peppa Pig (COUNTERFEIT)**Type/number of model:** 84254; 52203**Risk level:** Serious risk**Alert submitted by:** Slovakia**Alert number:** A12/0530/16**Category:** Toys

**Product:** Whistles**Name:** Playme**Risk:** Choking**Brand:** Vending Sabadell**Type/number of model:** LT24502N /

LT42656N

**Risk level:** Serious risk

Small parts and the mouthpiece detach easily from the whistle. A child could put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Toy whistles in different shapes: 1) a plastic hammer with a whistle at one end 2) a plastic ball with a whistle. Packaging: a transparent plastic bag.

**Batch number/Barcode:** Unknown**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0534/16**Product:** Toy gun set**Name:** SOFT BULLET GUN**Risk:** Choking**Category:** Toys**Brand:** GF TOYS**Type/number of model:** GF30155 - 6286**Risk level:** Serious risk

The suction cups can be easily detached from the projectiles and could be put in the mouth by a child and block the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Plastic toy set consisting of a machine gun, soft projectiles, a target, ducklings, a camel and an elephant. Packaging: a blister pack.

**Batch number/Barcode:** 8433760301551**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0535/16**Product:** Bow and arrow set**Name:** ANGRY BIRDS**Risk:** Choking**Category:** Toys**Brand:** GF TOYS**Type/number of model:** GF70609 - 1924B-2**Risk level:** Serious risk

The suction cups can be easily detached from the arrows and could be put in the mouth by a child and block the airways. The product does not comply with the requirements of the Toy Safety

Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Set consisting of a plastic bow and arrows with suction cups. Blister packaging with cardboard back.

**Batch number/Barcode:** 8433760706097

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0536/16

**Category:** Toys

**Product:** Pull-along toy

**Brand:** GF TOYS

**Name:** Unknown

**Type/number of model:** GF70635 - 223-1

**Risk:** Choking

**Risk level:** Serious risk

The ring easily becomes detached from the cord, generating a small part. A small child may put it in the mouth and choke on it. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Toy tractor made of plastic with eyes and brightly coloured wheels. Can be pulled along by means of a cord with a ring. The packaging is a clear plastic bag closed at the top with a strip of cardboard.

**Batch number/Barcode:** 4433760706356

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0537/16

**Category:** Toys

**Product:** Plastic doll

**Brand:** Unknown

**Name:** YONG

**Type/number of model:** ITEM NO:

**Risk:** Chemical

AH2618419

**Risk level:** Serious risk

The plastic material of the head of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 11.4%). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Plastic doll, approximately 30 cm tall, with long hair packed in a plastic transparent bag decorated with motifs of flowers and a inscription "JP".

**Batch number/Barcode:** 6927833184919

**Country of origin:** Unknown

**Alert submitted by:** Czech Republic



**Alert number:** A12/0538/16

**Product:** Toy kitchen sets

**Name:** Kitchen Play Set / Play at Home

**Risk:** Choking

**Category:** Toys

**Brand:** Fantástiko

**Type/number of model:** 1. 84633, 2. 84634

**Risk level:** Serious risk

The handles of the tools may easily detach, generating small parts. A small child may put these small parts in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Toy kitchen sets made of a range of kitchen tools supplied in blister packaging.

**Batch number/Barcode:** 2. 8424345846345, 1. 8424345846338

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0541/16

**Product:** Soap bubble toy

**Name:** Bubble Stick

**Risk:** Microbiological

**Category:** Toys

**Brand:** Marcos Toys

**Type/number of model:** References 1) 1637 ,  
2) 1638

**Risk level:** Serious risk

The soap solution of the toy contains mesophilic aerobic bacteria (measured quantity up to 130000 cfu/ml). Moreover, one model (ref. 1638) contains also enterobacteriaceae (measured quantity up to 530 cfu/ml). When the solution comes in contact with the mouth, hands or eyes or is inhaled this might lead to contracting infections. The product does not comply with requirements of the Toy Safety Directive.

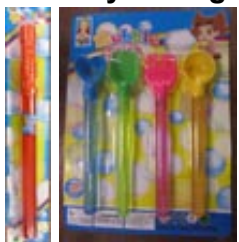
**Measures ordered by public authorities:** Import rejected at border

**Description:** 1) Plastic tube filled with a soapy liquid for making bubbles. 2) Set of 4 plastic tubes ending in a spoon, a rake, a paddle and a sieve in the shape of a heart, filled with a soapy liquid for making bubbles. Packaging: a blister pack with cardboard back.

**Batch number/Barcode:** 2) 8435399016387, 1) 8435399016370

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0545/16

**Product:** Plastic dolls

**Name:** Beauty - My vogue girl

**Category:** Toys

**Brand:** Victoria Party

**Type/number of model:** Ref. 1) E6334009, 2)



**Risk:** Chemical

E6334010

**Risk level:** Serious risk

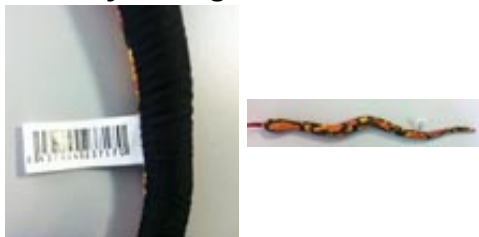
The heads of the dolls contain di-(2-ethylhexyl) phthalate (DEHP) (measured value up to 20% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.

**Measures ordered by public authorities:** Import rejected at border

**Description:** 1) This doll comes with different outfits. 2) This doll comes with one outfit and other accessories (plastic guitar, handbag, brush and mirror, as well as two bracelets). Packaging: the products are packaged in a blister pack with cardboard back.

**Batch number/Barcode:** 2) 8435284097538, 1) 8435284097521**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0546/16**Category:** Toys**Product:** Soft toy**Brand:** Carles Fradera**Name:** Unknown**Type/number of model:** Unknown**Risk:** Choking**Risk level:** Serious risk

The eyes of the snake become detached easily, generating small parts. A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border**Description:** Soft toy in the form of a snake made of polyester and filled with sand.**Batch number/Barcode:** 8437004237170**Country of origin:** Thailand**Alert submitted by:** Spain**Alert number:** A12/0549/16**Category:** Toys**Product:** Plastic doll**Brand:** Xin Yien Ly|GF Toys**Name:** 'Debbie' - Beautiful girl**Type/number of model:** Ref GF30145 - L  
5708**Risk:** Chemical**Risk level:** Serious risk

The heads of the dolls contain di-(2-ethylhexyl) phthalate (DEHP) (measured value up to 20% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Doll with a pushchair containing a smaller doll and other accessories. Packed in blister packaging with a cardboard back.

**Batch number/Barcode:** 8433760301452

**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0550/16**Category:** Toys**Product:** Doctor set with a doll**Brand:** GF Toys**Name:** Doctor Set**Type/number of model:** GF30158 - 969.**Risk:** Chemical**Risk level:** Serious risk

The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 20% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. In addition, it contains also di-isononyl phthalate (DINP) (measured value: 5% by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles, while the phthalates DINP, DNOP and DIDP are prohibited in toys and childcare articles that can be placed in the mouth by children.

**Measures ordered by public authorities:** Import rejected at border**Description:** A plastic doll with a doctor's kit and various accessories. Packed in blister packaging.**Batch number/Barcode:** 8433760301582**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A11/0042/16**Category:** Chemical products**Product:** Valve oil for musical instruments**Brand:** Al Cass**Name:** FAST**Type/number of model:** Unknown**Risk:** Chemical**Risk level:** Other risk level

The product has an aspiration hazard and lacks the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

**Measures ordered by public authorities:** Withdrawal of the product from the market**Description:** Valve, slide and key oil supplied in a clear plastic bottle (2 oz) with a white plastic cap and black labelling.**Batch number/Barcode:** 850370002001**Country of origin:** United States**Alert submitted by:** Germany**Alert number:** A11/0041/16**Category:** Construction products



**Product:** Carbon monoxide detector

**Brand:** XTREME

**Name:** Detektor Tlenku Wegla XC 10

**Type/number of model:** 50-611#

**Risk:** Asphyxiation

**Risk level:** Other risk level

The product is not sufficiently sensitive with respect to the detection of carbon monoxide. The product does not comply with the relevant European standard EN 50291.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Carbon monoxide detector, battery-powered, packed in a cardboard box.

**Batch number/Barcode:** 5900804068396

**Country of origin:** Poland

**Alert submitted by:** Latvia

