

The Rapid Alert System for Non-Food Products (RAPEX)

RAPEX - Weekly overview report of notifications

week 19 - 2016

Alert number: A12/0587/16

Product: Amber necklace

Name: BIJOUX EN AMBRE POUR BÉBÉ
(‘amber jewellery for babies’)

Risk: Choking

The cord can easily break, releasing the beads. A small child may put them in the mouth and choke.

Measures taken by economic operators: Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

Description: Amber necklace for babies.

Batch number/Barcode: Unknown

Country of origin: Lithuania

Category: Childcare articles and children's equipment

Brand: UN AMOUR D'AMBRE

Type/number of model: CA1 and CA10C

Risk level: Serious risk

Alert submitted by: France

Alert number: A12/0588/16

Product: Pushchair

Name: ONYX

Risk: Injuries

There are accessible areas where the bars forming the hood are connected, as well as exposed edges and protruding parts which could injure the child. Moreover, the front wheels can easily break while the pushchair is in use. The product does not comply with the relevant European standard EN1888.

Measures ordered by public authorities: Withdrawal of the product from the market

Description: Folding pushchair, with 4 double wheels, a movable footrest, a shopping basket, and a hood. The product is supplied in cardboard box.

Batch number/Barcode: Batch: 38001519439 YY

Country of origin: China

Category: Childcare articles and children's equipment

Brand: LORELLI

Type/number of model: Item: 1002087 XXXX
(the last digits differ depending on the colour of the pushchair and the collection), E-559,
Order No.: PO_013021

Risk level: Serious risk

Alert submitted by: Bulgaria



Alert number: A12/0568/16

Product: Men's shoes

Category: Clothing, textiles and fashion items

Brand: t2in

Name: reality shoe**Type/number of model:** Ref. R-193**Risk:** Chemical**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value: 14.3 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

Measures ordered by public authorities: Import rejected at border**Description:** Black leather shoes for men, sample size 42. The shoes are supplied in a black cardboard box.**Batch number/Barcode:** Unknown**Country of origin:** India**Alert submitted by:** Spain**Alert number:** A12/0573/16**Category:** Clothing, textiles and fashion items**Product:** Children's shoes**Brand:** Paez**Name:** Unknown**Type/number of model:** Recreo Mid - 131**Risk:** Chemical

REMTAUCA

Risk level: Serious risk

The amount of Chromium (VI) in the insole of the shoes is too high (measured value: 4.8 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

Measures ordered by public authorities: Import rejected at border**Description:** Children's shoes in pink fabric with brown sides.**Batch number/Barcode:** 7791815088385**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0576/16**Category:** Clothing, textiles and fashion items**Product:** Children's sweatshirt**Brand:** GUAN DA YUAN**Name:** Unknown**Type/number of model:** F21-193**Risk:** Strangulation**Risk level:** Serious risk

The drawstring in the hood with free-ends could become trapped during various activities of a child, causing strangulation. The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market**Description:** Children's red and black sweatshirt with hood and zip-fastener. The hood includes a drawstring with knotted ends. The product is decorated with various inscriptions. Size: 140-170.**Batch number/Barcode:** Unknown**Country of origin:** China**Alert submitted by:** Hungary



Alert number: A12/0577/16

Product: Children's sweatshirt

Name: Unknown

Risk: Strangulation

The drawstring in the hood with free ends could become trapped during various activities of a child causing strangulation. The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market

Description: Children's grey sweatshirt with hood and zip-fastener. The hood includes a drawstring with free ends. The product is decorated with an inscription: "FASHIONS 1989 MOVEMENT". Size: 134, 140, 146, 158

Batch number/Barcode: Unknown

Country of origin: Unknown

Category: Clothing, textiles and fashion items

Brand: H.plenty

Type/number of model: ZF-1122

Risk level: Serious risk

Alert submitted by: Hungary



Alert number: A12/0580/16

Product: Children's outfit

Name: Unknown

Risk: Injuries, Strangulation

The cords with free ends in the neck area and the unattached cords in the waist area may become trapped during various activities of a child, causing strangulation or injuries. The product does not comply with the relevant European standard EN 14682.

Measures ordered by public authorities: Withdrawal of the product from the market

Description: Children's outfit made of a sweatshirt and a pair of trousers, in sizes intended for children aged 7-14.

Batch number/Barcode: Unknown

Country of origin: China


Category: Clothing, textiles and fashion items

Brand: Setty Koop

Type/number of model: JB- 533

Risk level: Serious risk

Alert submitted by: Bulgaria

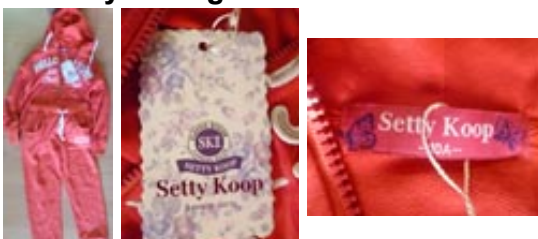

Alert number: A12/0571/16

Product: Travel plug adapter

Name: Adaptador Europeo

Category: Electrical appliances and equipment

Brand: Narken

Risk: Electric shock**Type/number of model:** Ref 9625**Risk level:** Serious risk

It is possible to insert one pin of a plug in one hole of the live socket while the other live pin of the plug remains accessible. If the user touches the live accessible pin they would get an electric shock.

Measures ordered by public authorities: Import rejected at border**Description:** Plug adaptor for UK plugs, packaged in a blister pack.**Batch number/Barcode:** Unknown**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0562/16**Product:** Thermos flask**Name:** FOOD JAR**Risk:** Chemical**Category:** Kitchen/cooking accessories**Brand:** DAYDAYS**Type/number of model:** Article 61469, capacity 1.2 litre**Risk level:** Serious risk

The separators of the double glass wall of the thermos flask contain asbestos fibres. If the thermos breaks, the users may inhale asbestos fibres, which are carcinogenic. The product does not comply with the REACH Regulation.

Measures ordered by public authorities: Ban on the marketing of the product and any accompanying measures**Description:** Thermos flask of 1.2 l capacity with plastic casing and a carrying handle on the top.**Batch number/Barcode:** 8301182614699**Country of origin:** China**Alert submitted by:** Italy**Alert number:** A12/0563/16**Product:** Thermos flask**Name:** VACUUM FLASK**Risk:** Chemical**Category:** Kitchen/cooking accessories**Brand:** DAYDAYS**Type/number of model:** Article 62197, capacity 1 litre**Risk level:** Serious risk

The separators of the double glass wall of the thermos flask contain asbestos fibres. If the thermos breaks, the users may inhale asbestos fibres, which are carcinogenic. The product does not comply with the REACH Regulation.

Measures ordered by public authorities: Ban on the marketing of the product and any accompanying measures**Description:** 1-litre thermos flask with orange plastic casing.**Batch number/Barcode:** 8058250621973

Country of origin: China**Alert submitted by:** Italy**Alert number:** A12/0564/16**Category:** Kitchen/cooking accessories**Product:** Thermos flask**Brand:** DAYDAYS**Name:** FOOD JAR**Type/number of model:** Article X15629, capacity 1 litre.**Risk:** Chemical**Risk level:** Serious risk

The separators of the double glass wall of the thermos flask contain asbestos fibres. If the thermos breaks, the users may inhale asbestos fibres, which are carcinogenic. The product does not comply with the REACH Regulation.

Measures ordered by public authorities: Ban on the marketing of the product and any accompanying measures

Description: 1-litre thermos flask with plastic casing and a carrying handle on the top.

Batch number/Barcode: 8088909156297

Country of origin: China**Alert submitted by:** Italy**Alert number:** A12/0581/16**Category:** Lighting equipment**Product:** Rechargeable head torch**Brand:** LONGTENG**Name:** Rechargeable Working Headlight**Type/number of model:** 1766

Helmets / Led Headlight

Risk level: Serious risk**Risk:** Fire, Electric shock

The basic insulated internal wires of the head torch can be damaged by the sharp edges of the cover fixing screws during adjustment of the head torch. The dimensions of the battery charger are not correct and when connecting the plug the user may consequently touch the live parts of the plug or the live connector terminal sockets. The cross-sectional area of the core of the wires is insufficient: in case of a short circuit the wires may overheat. The heat and flame resistance of the insulating material that holds the pins of the built-in plug in position is not sufficient and the product may thus cause a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market

Description: Rechargeable head torch with battery charger. Packaging: cardboard box.

Batch number/Barcode: Unknown

Country of origin: China**Alert submitted by:** Hungary



Alert number: A12/0582/16

Product: Rechargeable torch

Name: ПЕРЕЗАРЯЖАЕМЫЙ
АККУМУЛЯТОРНЫЙ СВЕТИЛЬНИК

Risk: Fire, Electric shock

The pins of the built-in plug and plug adapter do not have an insulating collar. The plug adapter allows single-pole insertion of a plug, leaving the remaining free live pin accessible. The cover for the LED can be removed by hand during charging, leaving live parts accessible. The cross-sectional area of the core of the wires is insufficient: in case of a short circuit the wires may overheat and can cause a fire. The heat and flame resistance of the insulating material that hold the pins of the built-in plug in position is insufficient. The product does not comply with the requirements of the Low Voltage Directive and the relevant standards EN 60598 and IEC 60884.

Measures ordered by public authorities: Recall of the product from end users, Withdrawal of the product from the market

Description: Rechargeable torch with 15 LEDs. The battery can be charged via the built-in plug with telescopic pins. A plug adapter is supplied with the product. Packaging: cardboard box.

Batch number/Barcode: 2 000126 537969

Country of origin: China

Category: Lighting equipment

Brand: Feron

Type/number of model: TH2295

Risk level: Serious risk

Alert submitted by: Hungary



Alert number: A12/0584/16

Product: LED light bulb

Name: High Lumen LEDSpot

Risk: Electric shock

Internal wires are only soldered and not attached mechanically. The windings on the transformer are touching. The metal parts of the bulb may become live as a consequence, leading to the user receiving an electrical shock if the bulb is touched. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 62560 and EN 62471.

Measures taken by economic operators: Withdrawal of the product from the market (By: Importer)

Description: Pack of 4 LED light bulbs in clear plastic packaging within a printed cardboard box.

Batch number/Barcode: 81098

Country of origin: China

Category: Lighting equipment

Brand: Top-Max

Type/number of model: GU10 4W.
H45396P4

Risk level: Serious risk

Alert submitted by: United Kingdom



Alert number: A12/0585/16

Product: LED floodlight

Name: LED Flood Light

Risk: Electric shock

The internal earth lead is not adequately attached to the body, resulting in inadequate protection from electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Measures taken by economic operators: Destruction of the product (By: Distributor)

Description: 10W small floodlight in silver colour with bracket and yellow LED. Packaged in red and white cardboard box.

Batch number/Barcode: S010000000020918403

Country of origin: China

Category: Lighting equipment

Brand: GLW - Green Life Green World

Type/number of model: MoS-LW2-10W-CW

Risk level: Serious risk

Alert submitted by: United Kingdom



Alert number: A12/0558/16

Product: Brake component

Name: Unknown

Risk: Injuries

The chambers of the actuator may not have been correctly assembled and the load from power spring and pressure is not fully taken. Under certain circumstances, the parking side and the service sides of the actuator could separate and the actuator could lose functionality. Ultimately this could lead to a loss of braking functionality and/or brake failure.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Motor vehicle component - actuator (type of spring brake cylinder).

Batch number/Barcode: Build dates: 05/05/2014 to 16/08/2015

Country of origin: The Netherlands

Category: Motor vehicles

Brand: WABCO TRISTOP

Type/number of model: Unknown

Risk level: Serious risk

Alert submitted by: United Kingdom

Alert number: A12/0559/16

Product: Lorry

Name: Econic

Risk: Injuries

A wrongly positioned yaw rate sensor in vehicles with a long wheelbase may result in incorrect ESP (electronic stability programme) intervention.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Lorry

Category: Motor vehicles

Brand: Mercedes-Benz

Type/number of model: Type-approval numbers: e1*2007/46*1221, e1*2007/46*1222; types: NGE-L64, NGE-L62N

Risk level: Serious risk

Batch number/Barcode: The vehicles affected were produced between 01/10/2013 and 01/10/2015.

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/0560/16

Product: Van

Name: Movano

Risk: Injuries

Category: Motor vehicles

Brand: Opel/Vauxhall

Type/number of model: Type: MS, MR; MT; MU; MW EC type-approval:

e1*2007/46*0362*17; e1*2007/46*0405*07;

e1*2007/46*0471*14 and 15

e1*2007/46*0472*07; e1*2007/46*0579.

Risk level: Serious risk

An oil hose may be incorrectly crimped. If the oil hose becomes completely detached, oil could escape, run on the road and endanger following vehicles.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number/Barcode: The vehicles concerned were manufactured in 2015.

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/0561/16

Product: Van

Name: Master

Risk: Injuries

Category: Motor vehicles

Brand: Renault

Type/number of model: Master 3. Type: MA, MB, VB, VD, ML; EC type-approval:

e2*2007/46*0016*, e2*2007/46*0019*,

e2*2007/46*0049*, e2*2007/46*0050*,

e2*2007/46*0022*

Risk level: Serious risk

An oil hose may be incorrectly crimped. If the oil hose becomes completely detached, oil could escape, run on the road and endanger following vehicles.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Van.

Batch number/Barcode: Vehicles with an M9T engine, produced between September 2015 and October 2015, are affected.

Country of origin: France

Alert submitted by: Germany

Alert number: A12/0565/16

Product: Van

Name: Vivaro

Risk: Injuries

Category: Motor vehicles

Brand: Opel/Vauxhall

Type/number of model: Type-approval numbers: e1*2007/46*0575*12 and *13 Type: F7

Risk level: Serious risk

An incorrectly installed passenger airbag module may increase the risk of injury in the event of an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Van

Batch number/Barcode: The vehicles affected were manufactured in 2013 and 2014.

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/0566/16

Product: Motorcycle

Name: ZIP 50 2T, ZIP 50 4T

Risk: Fire

Category: Motor vehicles

Brand: Piaggio

Type/number of model: Type:C25E00 (2T) / C25C00 (4T) EC-type approval:

e4*2002/24*0551 / e4*2002/24*0551

Risk level: Serious risk

A fault in the fuel level sensor can lead to the leaking of fuel and the risk of a fire.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Motorcycle.

Batch number/Barcode: Vehicles manufactured in 2015 are affected.

Country of origin: Italy

Alert submitted by: Germany

Alert number: A12/0567/16

Product: Passenger car

Name: Phaeton

Risk: Injuries

Category: Motor vehicles

Brand: VW

Type/number of model: Type-approval number: e1*2001/116*0189*; Type: 3D

Risk level: Serious risk

Summer tyres may have been mounted with the wrong rubber mixture in the running surface. The use of the wrong rubber mixture results in a clear reduction in the tyres' adhesion to the road in wet weather.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car with summer tyres (size 255/40ZR19 100Y XL).

Batch number/Barcode: The vehicles affected were produced between 02/07/2012 and 27/01/2016. The tyres in question were mounted on reconditioned, used cars at the plant.

Country of origin: Germany

Alert submitted by: Germany

Alert number: A12/0569/16

Product: Passenger car

Name: Compass, Patriot

Risk: Fire

Category: Motor vehicles

Brand: Jeep

Type/number of model: Type: PK EC type-approval: e11*2001/116*0142*22

Risk level: Serious risk

The power steering return hose clamp may not be correctly attached. Consequently, power steering oil may leak which could lead to a fire.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number/Barcode: The vehicles affected were produced between 4.1.2015 and 12.5.2015.

Country of origin: United States

Alert submitted by: Germany

Alert number: A12/0574/16

Product: Passenger car

Name: Veyron 16.4

Risk: Injuries

Category: Motor vehicles

Brand: Bugati

Type/number of model: Type-approval numbers: e1 * KS07/46 * 0008 * 03

Risk level: Serious risk

As a result of a deficiency in the bonding between the RPS (reference point system) plates and the monocoque, corrosion may occur. As a result, it is possible for the RPS plates to fall off.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number/Barcode: The vehicles concerned were manufactured between 10.3.2006 and 14.10.2014.

Country of origin: France

Alert submitted by: Germany

Alert number: A12/0575/16

Category: Motor vehicles

Product: Passenger car

Brand: Renault

Name: Kadjar

Type/number of model: Type: RFE Type-approval number: e2 * 2007/46 * 0475

Risk: Injuries

Risk level: Serious risk

A possible lack of welding points on the rear side members may, in the event of a collision, affect the strength of the side members. Consequently, fatigue strength, collision resistance and anchoring of the rear safety belts may be affected.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number/Barcode: The vehicles concerned were manufactured between 16.10.2015 and 25.11.2015.

Country of origin: Spain

Alert submitted by: Germany

Alert number: A12/0578/16

Category: Motor vehicles

Product: Passenger car

Brand: Aston Martin

Name: DB9, DBS, Vanquish & Virage

Type/number of model: Unknown

Risk: Injuries

Risk level: Serious risk

When the front, right seat is operated to rearward position, the seat runner can compress the battery supply cable. If the cable is repeatedly compressed, the insulation of the electrical cable can be damaged and a short-circuit can occur between the cable and the runner, resulting in smoke in the vehicle cabin. The smoke could cause the driver to be distracted and increase the risk of an accident.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number/Barcode: Certain vehicles built between March 2007 and November 2015.

Country of origin: United Kingdom

Alert submitted by: United Kingdom

Alert number: A12/0579/16

Category: Motor vehicles

Product: Passenger car

Brand: Jaguar

Name: XF

Type/number of model: Unknown

Risk: Injuries

Risk level: Serious risk

If the vehicle is involved in a high speed crash that triggers the second stage deployment of the driver frontal airbag, the second stage of the airbag will not deploy properly for this crash condition. This increases the risk of injury to the driver, particularly unbelted drivers.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Passenger car.

Batch number/Barcode: Vehicles built between 21/09/2010 and 28/10/2014.

Country of origin: United Kingdom

Alert submitted by: United Kingdom

Alert number: A12/0586/16

Product: Hydrostatic release units

Name: SAFETMADE

Risk: Drowning

Category: Other

Brand: Safetbag

Type/number of model: LR-1 or EP-1

Risk level: Serious risk

The hydrostatic release unit may not automatically release the necessary safety equipment in an emergency situation. This product does not comply with the requirements of the directive on marine equipment.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Hydrostatic release units used in the maritime sector for automatically releasing life rafts and Emergency Position Indicating Radio Beacons in an emergency situation.

Batch number/Barcode: All batches of the models concerned are affected

Country of origin: Turkey

Alert submitted by: Sweden



Alert number: A12/0570/16

Product: Push-along toys

Name: Unknown

Risk: Choking

Category: Toys

Brand: Victoria Party

Type/number of model: Ref.1) E6325711 , 2) E6316944

Risk level: Serious risk

The plastic eggs are small parts and may be put in the mouth by small children, causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Import rejected at border

Description: Plastic, push-along toys in the shape of a dinosaur and a bird, and plastic eggs. The products come in a transparent plastic bag sealed with a cardboard strip.

Batch number/Barcode: 2) 8435284083555, 1) 8435284098603

Country of origin: China

Alert submitted by: Spain



Alert number: A12/0572/16

Product: Plastic doll

Category: Toys

Brand: Victoria Party

Name: Beaut**Type/number of model:** Reference E6270747**Risk:** Chemical**Risk level:** Serious risk

The plastic material of the doll's head contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 20% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures ordered by public authorities: Import rejected at border**Description:** Doll with accessories (earrings, wand). Packaging: the doll comes in a blister pack with cardboard back.**Batch number/Barcode:** 8435284058942**Country of origin:** China**Alert submitted by:** Spain**Alert number:** A12/0583/16**Category:** Toys**Product:** Plastic doll set**Brand:** Sweet Home**Name:** Small Naughty Love Bath**Type/number of model:** J57981 / 275920**Risk:** Chemical**Risk level:** Serious risk

The plastic material of the doll's face contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 24% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

Measures ordered by public authorities: Import rejected at border**Description:** A plastic baby doll with a pink bath tub, soap, rubber duck and baby powder. Packed in transparent plastic.**Batch number/Barcode:** 6410412759207**Country of origin:** China**Alert submitted by:** Finland**Alert number:** A11/0043/16**Category:** Chemical products**Product:** Valve oil for musical instruments**Brand:** Stagg**Name:** TRUMPET CARE KIT**Type/number of model:** Unknown**Risk:** Chemical**Risk level:** Other risk level

The product lacks the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

Measures ordered by public authorities: Withdrawal of the product from the market

Description: Trumpet cleaning kit with valve oil (in a clear plastic bottle with white plastic cap and black labelling).

Batch number/Barcode: 5414428170552

Country of origin: Unknown

Alert submitted by: Germany



Alert number: A11/0044/16

Product: Valve oil for musical instruments

Name: Valve Oil

Risk: Chemical

Category: Chemical products

Brand: La Tromba

Type/number of model: 1.) T1 with silicone - 760565 , 2.) T2 special - 55200

Risk level: Other risk level

The product lacks the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

Measures ordered by public authorities: Withdrawal of the product from the market

Description: 1) white plastic bottle with white cap and black labelling; 2) clear plastic bottle with blue cap and blue/yellow labelling

Batch number/Barcode: 2) T2: 038827215921, 1) T1: 038827057132

Country of origin: Switzerland

Alert submitted by: Germany

