

Alert number **[A12/01307/22](#)**

Product **Passenger car**

Risk type **Fire**

The high voltage wiring harness may be defective. This could result in an increased risk of fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Peugeot**

Name **Expert, Traveller, 208, 2008**

EC-type approval/model **e2*2007/46*0532*18, e2*2007/46*0533*20, e2*2007/46*0639*18**

Production dates **17.03.2022 - 30.04.2022**

Company recall code **KYX**

Weekly report number **Report-2022-38**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <https://www.peugeot.de/tools/pruefung-ihres-fahrzeugs-auf-rueckrufaktionen.html>**

Products were found and measures were taken also in **Croatia
France
Ireland**

Alert number **[A12/01315/22](#)**

Product **Passenger car**

Risk type **Fire**

The fuel line can rub against other components, leading to fuel leaks, which create a risk of fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **PEUGEOT**

Name **208**

EC-type approval/model **U
e2*2007/46*0639*14, e2*2007/46*0639*15, e2*2007/46*0639*16,
e2*2007/46*0639**17**

Production dates **5.08.021 - 23.11.2021**

Company recall code **KVL**

Weekly report number **Report-2022-38**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Morocco**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Croatia
France
Poland**

Alert number **[A12/01318/22](#)**

Product **Baby gym**



Risk type **Choking**

Small parts can easily detach from the toy. A child could put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive and the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Babygym which must be assembled. Sold online, in particular via Bol.com.**

Packaging description **Cardboard box.**

Brand **Eco Toys**

Name **Piano Fitness Rack**

Type / number of model **HE0603**

Barcode **8719425387840**

Weekly report number **Report-2022-38**

Alert submitted by **The Netherlands**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

02/09/2022

Company recall code

- <https://Mamaloesbabysjop.nl>

Alert number **[A12/01325/22](#)**

Product **Children's hat**



Risk type **Choking**

Small decorative stones can easily detach from the hat. A child may put these small stones in the mouth and choke.

The product doesn't comply with the requirements of the General Product Safety Directive nor with the European standard 71-1.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Light yellow hat for children aged between 18-24 months, size 40-42. Small decorative stones are glued on the front of the hat.**

Brand **AJS**

Type / number of model **42-009**

Weekly report number **Report-2022-38**

Alert submitted by **Romania**

Is the product counterfeit? **Unknown**

Country of origin **Poland**

Measures ordered by public authorities **Withdrawal of the product from the market
Retailer**

Date of entry into force **05/09/2022**

Alert number [**A12/01309/22**](#)

Product **Vehicle part**



Risk type **Injuries**

A crack may lead to the pivot breaking, which can cause a trailer to be disconnected, creating a risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Professional**

Description **Vehicle part, kingpin used for connecting semi-trailer to a towing vehicle.**

Brand **SAF**

Name **Kingpin 50165S15L**

EC-type approval/model **50S15L
E1*55R01/09*2422*01**

Production dates **01.01.2014 - 05.11.2020**

Company recall code **SI-2108-220505-DE**

Weekly report number **Report-2022-38**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin

Germany

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Alert number **[A12/01308/22](#)**

Product **Laser marking machine**



Risk type	Damage to sight
	<p>The screens of the machine do not reach the required protection level of 1. Due to the defective plate, reflected or diffused laser radiation can escape from the working area of the machine and cause damage to the sight of the machine operator/third parties.</p> <p>The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 11553.</p>
Category	Machinery
Type	Professional
Description	Laser marking machine, laser power 30W, wavelength range 1064 nm. Product sold online, in particular via AliExpress
Brand	Unknown
Type / number of model	RF-F-30W
Weekly report number	Report-2022-38

Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Import rejected at border Importer
Date of entry into force	02/09/2022

Alert number

A12/01311/22

Product

Particle filter mask



Risk type

Health risk / other

The particle/filter retention of the material is insufficient (measured values: as low as 14%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 149.

Category

Protective equipment

Type

Consumer

Description	White particle filter mask, with the designation KN95 embossed on it.
Packaging description	Transparent plastic packaging with black and blue print with instructions in English, supplemented by 2 paper stickers with Czech text with basic information, including the claim "FFP2" and the CE marking. Each packaging contains 5 masks.
Brand	SHOUHUDUN
Name	Particle filter mask KN95 5 pack
Barcode	8595235913215
Weekly report number	Report-2022-38
Alert submitted by	Czechia
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Retailer
Date of entry into force	21/01/2022

Alert number **[A12/01317/22](#)**

Product **Bicycle light set**



Risk type **Environment**

The product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and di-n-butyl phthalate (DBP) (measured values up to 9.48% and 0.13% by weight respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).

Category **Lighting equipment**

Type **Consumer**

Description **Front and rear bicycle light**

Packaging description **Sold in a black-orange cardboard box.**

Brand **MUDDYFOX**

Name **LED 100 silver**

Type / number of model **937843**

Batch number **06/2019, AER/114**

Barcode **2937843110000**

Weekly report number **Report-2022-38**

Alert submitted by	Slovenia
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Distributor
Date of entry into force	26/08/2022

Alert number [**A12/01316/22**](#)

Product **Motorcycle**

Risk type **Injuries**

The fuel injection system may malfunction, causing the fuel injection and ignition to stop working. The engine may stall while driving, creating a risk of an accident. As regards dual-clutch transmission vehicles, malfunctioning of the fuel injection program may cause the clutch to disengage, resulting in a loss of power.

The product does not comply with the Regulation on the approval and market surveillance of two- or three wheel vehicles and quadricycles.

Category **Motor vehicles**

Type **Consumer**

Description **2021 ~ 2022YM GL1800DA/BD; 2020 ~ 2022YM CBR1000SP/ST; 2020 ~ 2022YM CRF1100A/D; 2020 ~ 2022YM CRF1100A2/D2/A4/D4; 2022YM NT1100D.**

Brand **Honda**

Name **GL1800DA/BD, CBR1000SP/ST, CRF1100A/D/A2/D2/A4/D4, NT1100D**

EC-type approval/model **e4*168/2013*00075*03, e4*168/2013*00126*00, e4*168/2013*00126*01, e4*168/2013*00155*00, e4*168/2013*00118*00, e4*168/2013*00118*01, e4*168/2013*00115*00, e4*168/2013*00115*01**

Production dates **CBR1000SP: 09.12.2019 - 12.07.2022; NT1100D: 27.09.2021 - 14.06.2022; CRF1100A/D: 09.12.2019 - 25.04.2022; CRF1100D2/D4: 20.08.2019 - 31.05.2022; CRF1100A2/A4: 20.08.2019 - 08.07.2021. GL1800DA: 04.12.2020 - 27.04.2022; GL1800BD: 02.12.2020 - 08.06.2022; CBR1000ST: 26.12.2019 - 10.06.2022;**

Company recall code **3MS**

Weekly report number **Report-2022-38**

Alert submitted by **Portugal**

Is the product counterfeit? **No**

Country of origin **Japan**

Measures taken by economic **Recall of the product from end users**

operators

Importer

Products were found and
measures were taken also in

**Croatia
Estonia
France
Ireland
The Netherlands
Poland
Slovakia
Sweden**

Alert number **[A12/01324/22](#)**

Product **Piercings set**



Risk type **Chemical**

The gold-coloured piercing releases an excessive amount of nickel (measured values: up to: 3.1 µg/cm²/week). Nickel is a strong sensitiser and causes allergic reactions if present in articles that come into direct and prolonged contact with the skin.

The product does not comply with the REACH Regulation.

Category **Jewellery**

Type **Consumer**

Description **Set of 8 piercings of different colours, with small stones at the end.**

Packaging description **Attached to a black cardboard.**

Brand **Language of Jewels**

Name **316L Surgical Steel**

Type / number of model **LP7301**

Barcode **6804110100995**

Weekly report number **Report-2022-38**

Alert submitted by **Greece**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Importer
Date of entry into force	12/04/2022
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Importer
Date of entry into force	12/04/2022

Alert number

[A12/01319/22](#)

Product

Children's leather shoes

Risk type

Chemical

The leather in the product contains chromium (VI) (measured values: up to 8.8 mg/kg). Chromium (VI) is sensitising, can trigger allergic reactions and can cause cancer.

The product does not comply with REACH Regulation.

Category

Clothing, textiles and fashion items

Type

Consumer

Description

Children's black leather shoes, size 32, with two velcro straps on the top.

Brand

CROCODILINO

Name

CROCODILINO ANATOMIC SHOES

Type / number of model

6402 99.93

Barcode

21081402332220

Weekly report number

Report-2022-38

Alert submitted by

Greece

Is the product counterfeit?

Unknown

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Ban on the marketing of the product and any accompanying measures
Retailer**

Date of entry into force

23/03/2022

Measures ordered by public
authorities

**Withdrawal of the product from the market
Retailer**

Date of entry into force

23/03/2022

Alert number **[A12/01320/22](#)**

Product **Plastic tablecloth**



Risk type **Chemical**

The plastic material of the product contains an excessive amount of bis(2-ethylhexyl) phthalate (DEHP) (measured values 5.32% by weight). This phthalate may harm the health by causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Kitchen/cooking accessories**

Type **Consumer**

Description **Plastic tablecloth, sold by measure, consisting of white printed PVC sheet and non-woven fabric backing.**

Brand **Unknown**

Weekly report number **Report-2022-38**

Alert submitted by **Greece**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **30/05/2022**

Measures ordered by public **Ban on the marketing of the product and any accompanying measures**

authorities **Distributor**

Date of entry into force **30/05/2022**

Alert number **[A12/01322/22](#)**

Product **Silicone sealant**



Risk type **Chemical**

According to the information in the safety data sheet, the product contains an excessive concentration of tris(2-methoxyethoxy)vinylsilane (declared value: up to 3%). Tris(2-methoxyethoxy)vinylsilane may damage fertility and the unborn child.

The product does not comply with the REACH Regulation nor with the Regulation on classification, labelling and packaging of substances and mixtures (CLP).

Category **Chemical products**

Type **Consumer**

Description **Red silicone sealant with high temperature stability up to 300°C.**

Packaging description **Blister packaging with paperboard.**

Brand **MANNOL**

Name **9914 GASKET MAKER Red**

Type / number of model **991405**

Barcode **4036021991405**

Weekly report number **Report-2022-38**

Alert submitted by **Lithuania**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Importer**

Alert number [**A12/01323/22**](#)

Product **Silicone sealant**



Risk type **Chemical**

According to the information in the safety data sheet, the product contains an excessive concentration of tris(2-methoxyethoxy)vinylsilane (declared value up to 3%). Tris(2-methoxyethoxy)vinylsilane may damage fertility and the unborn child.

The product does not comply with the REACH Regulation nor with the Regulation on classification, labelling and packaging of substances and mixtures (CLP).

Category **Chemical products**

Type **Consumer**

Description **Black silicone sealant with high temperature stability up to 230°C.**

Packaging description **Blister packaging with paperboard.**

Brand **MANNOL**

Name **9912 GASKET MAKER Black**

Type / number of model **991207**

Barcode **4036021991207**

Weekly report number **Report-2022-38**

Alert submitted by **Lithuania**

Is the product counterfeit? **Unknown**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Importer**

Alert number **[A12/01310/22](#)**

Product **Electric kettle**



Risk type **Electric shock**

The metal housing of the kettle is only separated from the active heating element with basic insulation. The mains lead has no protective conductor. If the basic insulation fails, the metal housing of the kettle may become live, and the user may receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and EN 60335-2-15.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **White and blue electric kettle. Capacity: 2.0 liters**

Packaging description **Colourful cardboard box.**

Brand **CiaoBosi**

Name **BOLLITORE ELETTRICO**

Type / number of model **TX-9942**

Barcode **6 972785 799421**

Weekly report number **Report-2022-38**

Alert submitted by **Hungary**

Is the product counterfeit? **No**

Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	02/07/2022
Measures ordered by public authorities	Recall of the product from end users Distributor
Date of entry into force	02/07/2022

Alert number **[A12/01321/22](#)**

Product **Baby carrier**



Risk type **Injuries**

Due to the insufficient attachment options on the baby carrier, the support is inadequate and the baby may slip out of the carrier. The baby may fall and suffer serious injuries.

The product does not comply with the requirements of General Product Safety Directive nor with the European standard EN 13209-2

Category **Childcare articles and children's equipment**

Type **Consumer**

Description **Baby carrier with leg openings, to be carried at the front with the baby facing backwards**

Brand **VEDOUCÉ**

Type / number of model **VD006**

Weekly report number **Report-2022-38**

Alert submitted by	Germany
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Manufacturer
Date of entry into force	10/05/2022
Measures taken by economic operators	Recall of the product from end users Manufacturer
Date of entry into force	31/08/2022

Alert number [**INFO/00123/22**](#)

Product **Vase**



Risk type **Injuries**

The vase can spontaneously break, causing injuries to the user.

The product does not comply with the requirements of the General Product Safety Directive.

Category **Decorative articles**

Type **Consumer**

Description **Blue glass vase**

Brand **Next**

Name **Blue Glass Vase**

Type / number of model **351715**

Batch number **QE8606503
QE8606516
QE8608624**

Weekly report number **Report-2022-38**

Alert submitted by **Ireland**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic **Recall of the product from end users**

operators **Distributor**

Date of entry into force **06/07/2022**

Company recall code - <https://www.next.ie/en/recall>

Alert number **[A12/01326/22](#)**
 Product **Skin whitening cream**



Risk type **Chemical**

The product contains mercury (measured value: 1.03% by weight). Mercury accumulates in the body and can damage the kidneys, brain and nervous system. Additionally, it may damage the unborn child.

The product does not comply with the Cosmetic Products Regulation.

Category **Cosmetics**

Type **Consumer**

Description **Skin whitening cream in light yellow colour. Best before December 2024.**

Packaging description **Container and outer packaging**

Brand **Unknown**

Name **Shivanya Beauty Cream**

Barcode **6000980911049**

Weekly report number **Report-2022-38**

Alert submitted by **Sweden**

Is the product counterfeit? **Unknown**

Country of origin **Pakistan**

Measures ordered by public
authorities

**Import rejected at border
Importer**

Date of entry into force

05/09/2022


Alert number **[A12/01312/22](#)**Product **Passenger van / Light commercial vehicle**Risk type **Injuries**

The rear brake may be defective, which could result in a loss of service brake effectiveness which in turn could increase the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**Type **Consumer**Description **Passenger van / Light commercial vehicle**Brand **Citroen**Name **Jumpy, Spacetourer**EC-type approval/model **V
e2*2007/46*0530*17, e2*2007/46*0530*19**Production dates **20.01.2022 - 28.01.2022**Company recall code **JGJ**Weekly report number **Report-2022-38**Alert submitted by **Germany**Is the product counterfeit? **No**Country of origin **United Kingdom**Measures taken by economic operators **Recall of the product from end users
Manufacturer**Company recall code **- <http://www.citroen>**Products were found and measures were taken also in **Croatia
France
Ireland**

Poland
Sweden

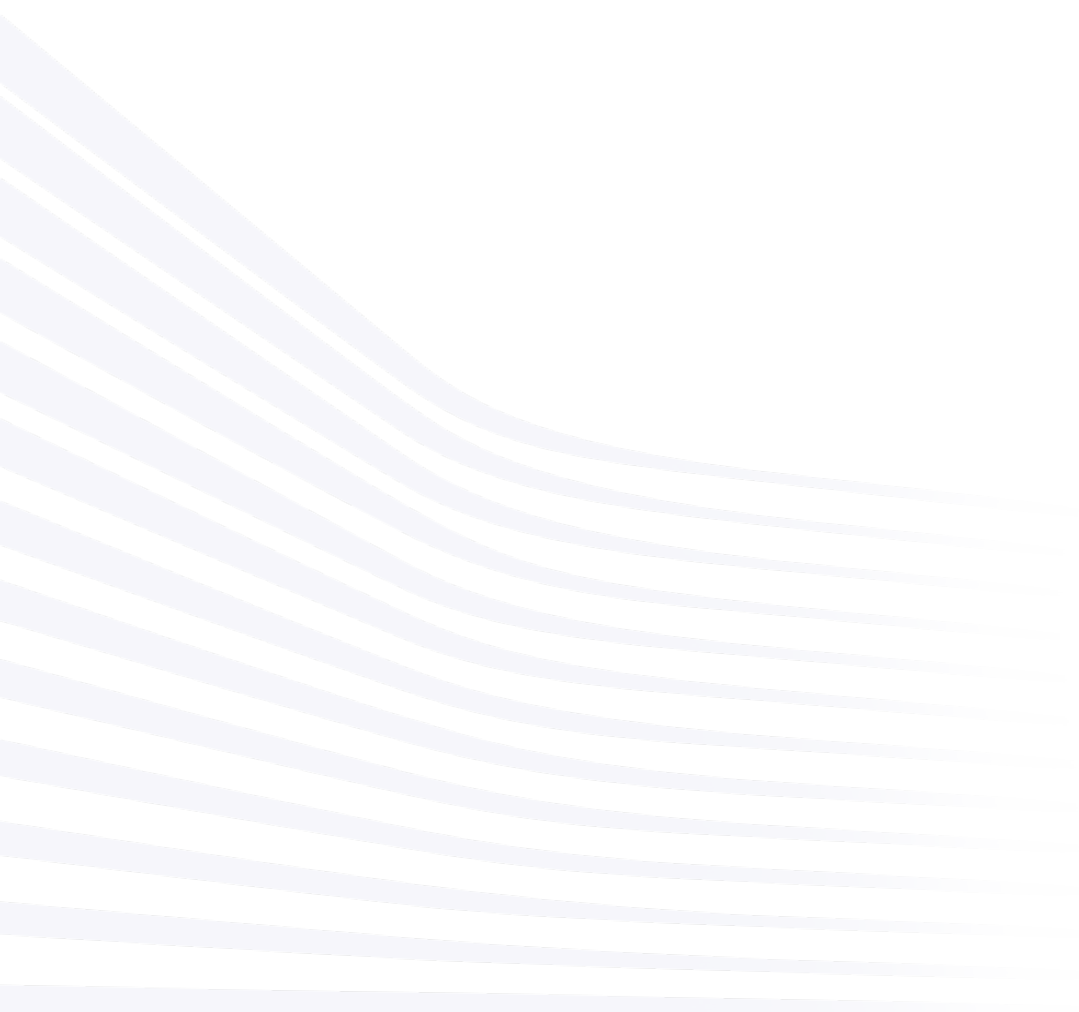

Alert number **[A12/01313/22](#)**

Product **Passenger car**

Risk type **Injuries**

The rear brake may be defective, reducing the service brake performance, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **OPEL**

Name **Vivaro C, Zafira Life (KO)**

EC-type approval/model **V
e2*2007/46*0532*17, e2*2007/46*0532*19**

Production dates **20.01.2022 - 28.01.2022**

Company recall code **KAT**

Weekly report number **Report-2022-38**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Croatia
France
Ireland
Poland
Slovakia**

Alert number **[A12/01314/22](#)**

Product **Passenger car**

Risk type **Injuries**

The rear brake may be defective, leading to reduced service brake performance, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **PEUGEOT**

Name **Expert, Traveller**

EC-type approval/model **V
e2*2007/46*0532*17, e2*2007/46*0532*19**

Production dates **20.01.2022 - 28.01.2022**

Company recall code **KZY**

Weekly report number **Report-2022-38**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <http://www.peugeot>**

Products were found and measures were taken also in **France
Ireland
Poland**