

Alert number **[A12/01344/22](#)**

Product **Fireworks**



Risk type **Burns
Damage to hearing
Injuries**

The noise level is too high (measured values: up to 125 dB). Consequently it can cause damage to hearing. Furthermore, the product is not stable, hence it may fall over and shoot in the wrong direction. A user may be hit, getting injured. Moreover, the ignition fuse burns too fast, consequently the product may explode at too low altitude and burst too close to the ground. As a result, the user may get injured or burnt. Finally, burning pieces may fall off from the fireworks. Bystanders can be hit by parts of the firework, causing burns.

The product does not comply with the requirements of the Pyrotechnics Directive nor with the European standard EN 15947-5.

Category **Pyrotechnic articles**

Type **Consumer**

Description **Single shot tube battery with 12 shots.**

Packaging description **Wrapped in a black paper with fireworks depicted.**

Brand **Pyroshow**

Name **Final Cake - Silver Blink**

Type / number of model **2905**

Batch number **2905-2019-1**

Barcode **8714214041958**

Weekly report number	Report-2022-39
Alert submitted by	Denmark
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Temporary ban on the supply, offer to supply and display of the product Distributor
Date of entry into force	19/04/2022

Alert number **[A12/01345/22](#)**

Product **Fireworks**



Risk type	Burns Injuries <p>The product may explode at too low altitude and can burst too close to the ground. Bystanders can be hit by parts of the firework, causing burns.</p> <p>The product does not comply with the requirements of the Pyrotechnics Directive nor with the European standard EN 15947-5.</p>
Category	Pyrotechnic articles
Type	Consumer
Description	Rocket of category F2.
Packaging description	Wrapped in a green paper with the product name written in red across the article.
Brand	Fyrværkerieksperten A/S
Name	Komet raket
Type / number of model	1.5055
Batch number	21-10018
Weekly report number	Report-2022-39
Alert submitted by	Denmark
Is the product counterfeit?	No

Country of origin **Denmark**

Measures taken by economic operators **Withdrawal of the product from the market
Manufacturer**

Date of entry into force **22/04/2022**

Alert number **[A12/01346/22](#)**

Product **Fireworks**



Risk type **Burns
Damage to hearing
Fire
Injuries**

The noise level is too high (measured values: up to 122 dB). Consequently it can cause damage to hearing. Furthermore, the product may explode at too low altitude and can burst too close to the ground, while burning pieces may fall off from the fireworks. Bystanders can be hit by parts of the firework, causing burns.

The product does not comply with the requirements of the Pyrotechnics Directive nor with the European standard EN 15947-5.

Category **Pyrotechnic articles**

Type **Consumer**

Description **600-shots compound battery.**

Packaging description **Wrapped in a black paper background with fireworks depiction.**

Brand **Aalborg Fyrværkerifabrik A/S**

Type / number of model **BA-LI-600-19-02**

Batch number **21-BLK600-237**

Weekly report number **Report-2022-39**

Alert submitted by **Denmark**

Is the product counterfeit? **No**

Country of origin	People's Republic of China
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Manufacturer
Date of entry into force	22/04/2022

Alert number **[A12/01353/22](#)**

Product **Fireworks**



Risk type **Burns
Fire
Injuries**

Burning pieces may fall off from the fireworks and within the safety distance on the ground. Bystanders can be hit by these parts, causing burns. The product also leaves smoldering embers which may start a fire, and a user may suffer burns.

The product does not comply with the requirements of the Pyrotechnics Directive nor with the European standard EN 15947-5.

Category **Pyrotechnic articles**

Type **Consumer**

Description **25 shot fan battery of shot tubes**

Packaging description **The product is sold wrapped in a black paper with the depiction of bursting fireworks and a dancing crowd.**

Brand **Aalborg Fyrværkerifabrik A/S**

Name **Aalborg Vinkelbatteri**

Type / number of model **BA-CE-25-18-18**

Batch number **21-ALB100-021**

Barcode **5707127070613**

Weekly report number **Report-2022-39**

Alert submitted by	Denmark
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Manufacturer
Date of entry into force	26/04/2022

Alert number **[A12/01354/22](#)**

Product **Fireworks**



Risk type **Burns
Fire
Injuries**

Burning pieces may fall off from the fireworks and within the safety distance on the ground. Bystanders can be hit by these parts causing burns. The product leaves smoldering embers which may start a fire, and a user may suffer burns.

The product does not comply with the requirements of the Pyrotechnics Directive nor with the European standard EN 15947-5.

Category **Pyrotechnic articles**

Type **Consumer**

Description **30 shot fan battery of shot tubes**

Packaging description **The product is sold wrapped in black paper background with the depiction of bursting fireworks and Chinese ideograms.**

Brand **MING - Art of Fireworks**

Name **Isbjerg 30 Skuds Viftebatteri**

Type / number of model **1425030008**

Batch number **21-2726-164**

Barcode **5714217873627**

Weekly report number **Report-2022-39**

Alert submitted by	Denmark
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Manufacturer
Date of entry into force	27/04/2022

Alert number **[A11/00111/22](#)**

Product **Fireworks**



Risk type **Burns
Fire
Injuries**

The product does not work properly, exceeding its ignition time. A user may try to re-ignite it and suffer injuries and burns. Furthermore, the product is not stable, and may fall over and shoot in the wrong direction. A user or bystander may be hit and suffer injuries.

The product does not comply with the requirements of the Pyrotechnics Directive nor with the European standard EN 15947-5.

Category **Pyrotechnic articles**

Type **Consumer**

Description **7 shot battery of fountains. The product has the shape of a half circle.**

Packaging description **The product is sold wrapped in a black paper background with depictions of bursting fireworks and of a man wearing an orange hat pointing towards the fireworks.**

Brand **Fyrværkerieksperten A/S**

Name **Mesterens Fyrværkeri**

Type / number of model **27.2095**

Batch number **21-15281**

Barcode **5704777053980**

Weekly report number **Report-2022-39**

Alert submitted by	Denmark
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Manufacturer
Date of entry into force	22/04/2022

Alert number **[A12/01327/22](#)**

Product **Passenger car**

Risk type **Injuries**

In the event of an accident, there is a risk that the load in the baggage compartment will shoot forwards to the partition grille and cause the bracket to detach from the body, increasing the risk of injury to the passengers.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Cupra**

Name **Leon**

EC-type approval/model **KL
e9*2007/46*3167***

Production dates **22.10.2020 - 18.06.2022**

Company recall code **68I3**

Weekly report number **Report-2022-39**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **France
Sweden**

Alert number **[A11/00108/22](#)**

Product **Portable lamp**



Risk type **Electric shock**

The protection against accidental loosening of lamp's casing is inadequate, the cross-sectional area of the wires is too thin, the wires pass through sharp metal parts and could become damaged due to insufficient protection of the insulating material, the wire is not secured against pulling, and the plug has inadequate dimensions. Live parts may become accessible, hence a user may receive an electric shock.

The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-1.

Category **Lighting equipment**

Type **Consumer**

Description **Portable lamp with a clip-shaped base and a 1.1 m long plug cord. The lamp diffuser is in metal, available in different colours. 230 V, for E27 lightbulbs.**

Packaging description **White cardboard box.**

Brand **EVG**

Name **Lampka CLIPS NEW**

Type / number of model **L0S-01-03**

Barcode **5900779703834**

Weekly report number **Report-2022-39**

Alert submitted by	Poland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Manufacturer
Date of entry into force	08/08/2022
Measures ordered by public authorities	Warning consumers of the risks Manufacturer
Date of entry into force	08/08/2022

Alert number [**INFO/00126/22**](#)

Product **Chair**



Risk type	Injuries The chair has insufficient strength and can break under load, injuring the user. The product does not comply with the General Product Safety Directive, nor with the European standard EN 12520.
Category	Furniture
Type	Consumer
Description	Beige upholstered dining chair, decorated with small stones.
Brand	Unknown
Weekly report number	Report-2022-39
Alert submitted by	Bulgaria
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Import rejected at border Importer
Date of entry into force	14/09/2022

Alert number

[A12/01334/22](#)

Product

Inflatable baby swimming float



Risk type

Chemical

The plastic material of the product contains an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured values: up to 20% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation, nor with the European standard EN 71.

Category

Hobby/sports equipment

Type

Consumer

Description

Coloured inflatable plastic seat in the shape of a car, with a plastic steering wheel in the centre of which is a horn producing sound. Product sold online.

Packaging description

Packed in a plastic bag, inside the package there is a paper leaflet with a picture of the product and information about the unsuitability of the product for children under three years of age.

Brand

SEA 700

Name	Baby yacht - plavecký kruh
Batch number	S85333560C002
Barcode	2000606843870
Weekly report number	Report-2022-39
Alert submitted by	Czechia
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	07/09/2022

Alert number [**A12/01329/22**](#)

Product **Vehicle part**



Risk type **Injuries**

Improper ball joint shafts may lead to a loss of connection between the steering column in the driver's cab and the steering gear, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Professional**

Description **Ball joint shaft**

Brand **BOSCH**

Name **Kugelgelenkwelle, Bosch TTN: 7035.955.153**

EC-type approval/model -

Production dates **16.05.2018 - 25.06.2019**

Company recall code **FSA_2022_21**

Weekly report number **Report-2022-39**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin

Hungary

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Alert number [**A12/01330/22**](#)

Product **Flip flops**



Risk type **Chemical
Environment**

The plastic material of the product contains excessive concentrations of dibutyl phthalate (DBP) (measured value up to 11% by weight) and short chain chlorinated paraffins (SCCPs) (measured value up to 8,3%). DBP may harm the health by causing possible damage to the reproductive system. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bioaccumulate in wildlife and humans, posing a risk to human health and the environment.

The product does not comply with the REACH Regulation nor with the Persistent Organic Pollutants (POPs) Regulation.

Category **Clothing, textiles and fashion items**

Type **Consumer**

Description **Flip flops, sizes 36-41, manufactured between: August 2020 and February 2021.**

Packaging description **Paper label attached to the product.**

Brand **PEPCO**

Type / number of model **SKU 320218**

Weekly report number **Report-2022-39**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Manufacturer
Measures taken by economic operators	Recall of the product from end users Manufacturer
Company recall code	- https://pepco.pl/wycofane_produkty/sku-320218-japonki-damskie-36-41/
Products were found and measures were taken also in	Estonia Slovakia

Alert number **[A12/01348/22](#)**Product **Motorcycle**Risk type **Injuries**

The signalling horn can fold down under certain conditions. This severely limits the available turning angle to the left, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of two or three wheel vehicles and quadricycles.

Category **Motor vehicles**Type **Consumer**Description **Motorcycle, electric scooter**Brand **BMW**Name **CE 04**EC-type approval/model **MCEV
e1*168/2013*00279*00**Production dates **05.11.2020 - 29.08.2022**Company recall code **0000611700**Weekly report number **Report-2022-39**Alert submitted by **Germany**Is the product counterfeit? **No**Country of origin **Germany**Measures taken by economic operators **Recall of the product from end users
Manufacturer**Products were found and measures were taken also in **Croatia
France
Ireland
Slovenia
Sweden**

Alert number **[A12/01343/22](#)**

Product **Passenger car**

Risk type **Fire**

The high voltage battery has a cell voltage mismatch. This could cause fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **PEUGEOT**

Name **3008, 508**

EC-type approval/model **M, F
e2*2007/46*0534*12, e2*2007/46*0628*05-*06**

Production dates **01.10.2019 - 13.12.2019**

Company recall code **KWA**

Weekly report number **Report-2022-39**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <https://www.peugeot.de/tools/pruefung-ihres-fahrzeugs-auf-rueckrufaktionen.html>**

Products were found and measures were taken also in **France
The Netherlands**

Alert number **[A12/01335/22](#)**

Product **Slap wrap with LED**



Risk type	Injuries
	The product does not reflect light. As a result, the user is not sufficiently visible in situations where high visibility is essential, and may suffer injuries.
	The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 13356.
Category	Protective equipment
Type	Consumer
Description	Slap wrap with LED, available in different colours, proposed as a high-visibility accessory. Product sold online.
Packaging description	Fastened to a dark cardboard with a hole in the middle, from where the product is hanging. The cardboard has pictures of a cyclist and a runner who wear the slap wrap.
Brand	Nite Ize
Name	Slaplit Led Slap Wrap
Type / number of model	Slaplit Led Slap Wrap
Batch number	SLP2-33-R3
Barcode	094664035683
Weekly report number	Report-2022-39

Alert submitted by	Finland
Is the product counterfeit?	No
Country of origin	United States
Measures ordered by public authorities	Recall of the product from end users Importer
Date of entry into force	07/06/2022
Company recall code	- https://www.nordictrail.fi/nite-ize

Alert number **[A12/01350/22](#)**

Product **Passenger car**

Risk type **Fire**

The high voltage battery has a cell voltage mismatch. This could cause a fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **PEUGEOT**

Name **3008, 508**

EC-type approval/model **M, F
e2*2007/46*0534*12, e2*2007/46*0628*05-*06**

Production dates **01.10.2019 - 13.12.2019**

Company recall code **KXD**

Weekly report number **Report-2022-39**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <https://www.peugeot.de/tools/pruefung-ihres-fahrzeugs-auf-rueckrufaktionen.html>**

Products were found and measures were taken also in **France
The Netherlands**

Alert number **[A12/01349/22](#)**

Product **Passenger car**

Risk type

Fire

The high voltage battery has a cell voltage mismatch. This could cause a fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category

Motor vehicles

Type

Consumer

Description

Passenger car

Brand

DS

Name

DS 7 Crossback

EC-type approval/model

**J
e2*2007/46*0601*08**

Production dates

04.10.2019 - 26.11.2019

Company recall code

JBS

Weekly report number

Report-2022-39

Alert submitted by

Germany

Is the product counterfeit?

No

Country of origin

France

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Company recall code

- <https://www.dsautomobiles.de/services-finanzierung/instandhaltung-pflege/pruefung-ihres-fahrzeugs-auf-rueckrufaktionen.html>

Products were found and measures were taken also in

**France
The Netherlands**

Alert number **[A12/01340/22](#)**

Product **Foldable pouffe**



Risk type **Chemical**

The outer plastic material of the pouffe contains an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 11,23 % by weight). This phthalate may harm the health by causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Furniture**

Type **Consumer**

Description **Foldable pouffe.**

Brand **PEPCO**

Name **Mickey**

Type / number of model **SKU 326076**

Weekly report number **Report-2022-39**

Alert submitted by **Poland**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Measures taken by economic operators

**Withdrawal of the product from the market
Manufacturer**

Company recall code

- https://pepco.pl/wycofane_produkty/sku-326076-skladany-puf-mickey/

Products were found and measures were taken also in



**Estonia
Slovakia**

Alert number

[A12/01332/22](#)

Product

Particle filter mask

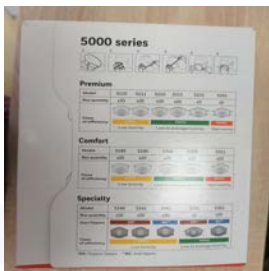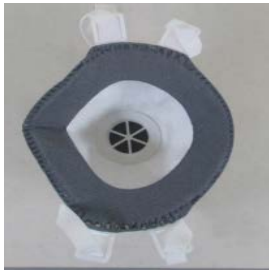

Risk type

Health risk / other

The total filtration capacity of the mask is insufficient (measured mean values: as low as 70%). Consequently, the product does not fulfil the health and safety requirements; thus, even if combined with other recommended measures, it may not properly protect.

The product does not comply with the Personal Protective Equipment Regulation nor with the European standard EN 149.

Category

Protective equipment

Type

Consumer

Description	Protective respiratory filtration half-face mask, of uniform white and red material and with valve. The mask has straps that fit around the ears.
Packaging description	The product is sold in white/red cardboard boxes, containing a total of 5 masks, with claims of FFP3 category and CE mark.
Brand	Honeywell
Name	Filtering half mask
Type / number of model	5321 XL
Batch number	17860132
Barcode	3603830051265
Weekly report number	Report-2022-39
Alert submitted by	Slovenia
Is the product counterfeit?	Unknown
Country of origin	Tunisia
Measures ordered by public authorities	Withdrawal of the product from the market Distributor
Date of entry into force	15/06/2022

Alert number **[A12/01347/22](#)**

Product **Passenger car**

Risk type **Injuries**

Improper tyre pressure label in the tank cap may result in the tyre pressure not being identified based on the vehicle load and thus the vehicle operating with insufficient tyre pressure. As a result, the tyre may be damaged, increasing the risk of an accident.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car, Mercedes-Benz, C-Class (model series 206)**

Brand **Mercedes-Benz**

Name **C-Class (C 300 e)**

EC-type approval/model **R2CS
e1*2018/858*00017*02-*04**

Production dates **02.07.2021 - 12.11.2021**

Company recall code **4092211**

Weekly report number **Report-2022-39**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Company recall code **- <https://www.mercedes-benz.de/?emhsort=price-asc&emhvehicleAssortment=new-passenger-cars>**


France

Products were found and
measures were taken also in

The Netherlands
Sweden

Alert number **[A12/01339/22](#)**

Product **Clothing set**

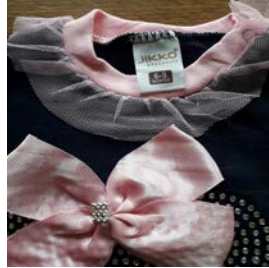

Risk type

Choking

The small decorative elements on the product (the pebbles glued) can be easily detached. A small child may put them in the mouth and choke on them.

The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 71-1.

Category

Clothing, textiles and fashion items

Type

Consumer

Description

The outfit consists of a long-sleeved blue t-shirt and pink trousers, intended for babies aged between 6 - 9 months. Small decorative pebbles (in the shape of Minnie Mouse) are glued on the front of the t-shirt.

Packaging description

The product was sold without packaging.

Brand

Jikko Exclusive

Weekly report number

Report-2022-39

Alert submitted by

Romania

Is the product counterfeit?

Unknown

Country of origin

Turkey

Measures ordered by public authorities

**Withdrawal of the product from the market
Retailer**



Alert number

[A12/01337/22](#)

Product

Mobile musical toy



Risk type

Choking

Small parts can easily detach (teddy bear's eyes) and the stuffing material is easily accessible. A small child may put these in the mouth and choke on them.

The product does not comply with the requirements of the Toy Safety Directive nor with the relevant European standard EN 71-1.

Category

Toys

Type

Consumer

Description

Baby musical mobile toy with a pull-up, musical star-shaped rotating unit and with four swinging soft animals.

Packaging description

Colourful cardboard box with window.

Brand

Heng Run Toys

Name

Happy Shaking Bell / Zenél játék kiságyra

D122

Type / number of model	
Barcode	6898000511114
Weekly report number	Report-2022-39
Alert submitted by	Hungary
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Distributor
Date of entry into force	13/05/2022
Measures taken by economic operators	Withdrawal of the product from the market Distributor
Date of entry into force	13/05/2022

Alert number [**INFO/00127/22**](#)

Product **Chair**



Risk type	Injuries
	The chair has insufficient strength and can break under load, injuring the user.
	The product does not comply with the General Product Safety Directive, nor with the European standard EN 12520.
Category	Furniture
Type	Consumer
Description	Dining chair with wooden legs and damasks in different colours.
Brand	Unknown
Weekly report number	Report-2022-39
Alert submitted by	Bulgaria
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Import rejected at border Importer
Date of entry into force	03/08/2022

Alert number **[A12/01363/22](#)**

Product **Passenger car**

Risk type **Environment
Fire**

Improperly tightened diesel particulate filter mounting frame fittings may lead to loosening or detachment of the fittings, which will cause stress to the exhaust joints and, over time, increase the possibility of unmeasured exhaust gas leaks. In the event of an exhaust leak, hot exhaust gases can leak under the vehicle or under the engine compartment, which can damage engine components increasing the risk of a fire.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **LAND ROVER**

Name **Range Rover**

EC-type approval/model **e9*2018/858*11120***

Production dates **23.09.2020 - 07.06.2022**

Company recall code **N719**

Weekly report number **Report-2022-39**

Alert submitted by **France**

Is the product counterfeit? **No**

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **12/09/2022**

Products were found and
measures were taken also in **Croatia
Ireland
Poland**

Alert number [**A12/01336/22**](#)

Product **Plastic doll**



Risk type **Chemical**

The plastic material of the head contains an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 42.2% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll about 40cm tall, with purple hair pulled back in a ponytail. The package includes pink shoes and other fashion accessories.**

Packaging description **Cardboard box with transparent window.**

Brand **HAPPY PARTNER !**

Name **FASHION GIRLS**

Type / number of model **2086**

Batch number **3-144-42.4
TB-3148**

Barcode **8591016031482**

Weekly report number **Report-2022-39**

Alert submitted by **Czechia**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Retailer**

Date of entry into force **12/08/2022**

Alert number **[A12/01338/22](#)**

Product **Toy rattle set**



Risk type **Choking**

The rattles can easily break, generating small parts. A child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71.

Category **Toys**

Type **Consumer**

Description **The toy set consists of four colourful plastic rattles.**

Packaging description **Plastic bag with cardboard closure**

Brand **FP326 Fei Pan**

Name **Baby Toys**

Type / number of model **326-959**

Barcode **8335669171306**

Weekly report number **Report-2022-39**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

08/07/2022

Measures ordered by public
authorities

**Recall of the product from end users
Distributor**

Date of entry into force

08/07/2022

Alert number **[A12/01355/22](#)**

Product **Plastic doll**



Risk type **Chemical**

The plastic material of the head of the doll contains an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 13.18 % by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic doll about 27 cm tall with different coloured long hair, clothes and accessories (bow, handbag and other).**

Packaging description **Cardboard box with transparent window.**

Brand **PRETTY GIRLS**

Name **Beauty, FASHION MODELS**

Type / number of model **1866**

Batch number **TT6248K52**

Barcode **8590624820204**

Weekly report number **Report-2022-39**

Alert submitted by **Czechia**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Retailer**

Date of entry into force **24/08/2022**

Alert number **[A12/01331/22](#)**

Product **Rattle toy set**



Risk type **Choking**

The rattles can easily break, generating small parts. A child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **The toy set consists of five colourful plastic rattles.**

Packaging description **Plastic bag with light cardboard closure.**

Brand **MBX**

Name **Rattle Set**

Type / number of model **MBX064**

Weekly report number **Report-2022-39**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users
Distributor**

Date of entry into force **02/05/2022**

Measures ordered by public authorities **Withdrawal of the product from the market
Distributor**

Date of entry into force **02/05/2022**

Alert number **[A12/01356/22](#)**

Product **Key ring**



Risk type **Chemical**

The plastic material of the head of the doll contains an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 22.79% by weight). This phthalate may harm the health of children, causing possible damage to their reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Key ring in the shape of a doll with a knitted hat, 8 cm tall. The doll has closed eyes and a pacifier in her mouth.**

Packaging description **Without packaging.**

Brand **Unknown**

Type / number of model **503961**

Barcode **8000005039618**

Weekly report number **Report-2022-39**

Alert submitted by **Czechia**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public
authorities

**Withdrawal of the product from the market
Retailer**

Date of entry into force

31/08/2022

Alert number **[A12/01359/22](#)**

Product **UV lamp**



Risk type	Electric shock
	The product insulation is insufficient and live parts are accessible. A user may receive an electric shock.
	The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-1.
Category	Electrical appliances and equipment
Type	Consumer
Description	31 cm long white UV-C lamp of type T5, with a power of 8W and a wave length of 85 nm. Input: 110-220V, 50 Hz.
Packaging description	Cardboard box
Brand	Forever Light
Name	UV germicidal table lamp
Barcode	5900495853172
Weekly report number	Report-2022-39
Alert submitted by	Poland
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures ordered by public	Warning consumers of the risks

authorities	Manufacturer
Date of entry into force	24/06/2022
Measures ordered by public authorities	Withdrawal of the product from the market Manufacturer
Date of entry into force	24/06/2022

Alert number **[A12/01362/22](#)**

Product **Plastic doll**



Risk type **Chemical**

The plastic material of the head of the doll contains an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 29.8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system.

The product does not comply with the REACH Regulation.

Category **Toys**

Type **Consumer**

Description **Plastic mermaid about 33 cm tall with a colourful fin, attached to the doll's body.**

Packaging description **Cardboard box with transparent window, size 36x13x4.5cm.**

Brand **Unknown**

Name **Magical MERMAID**

Type / number of model **2007**

Batch number **TN1508-60**

Barcode **2021042120073**

Weekly report number **Report-2022-39**

Alert submitted by **Czechia**

Is the product counterfeit? **Unknown**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market
Retailer**

Date of entry into force **20/09/2022**

Alert number **[A12/01358/22](#)**

Product **Rattle toy**



Risk type **Choking**

The rattle can easily break, generating small parts. A child may put them in the mouth and choke.

The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.

Category **Toys**

Type **Consumer**

Description **Green and white plastic rattle.**

Packaging description **Plastic bag with light cardboard closure.**

Brand **Abababy**

Name **Toys**

Type / number of model **339+240 PCS**

Barcode **6903879512398**

Weekly report number **Report-2022-39**

Alert submitted by **Hungary**

Is the product counterfeit? **Unknown**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Ban on the marketing of the product and any accompanying measures
Distributor**

Date of entry into force

04/04/2022

Measures ordered by public
authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

04/04/2022

Alert number **[A12/01361/22](#)**
 Product **Activity play mat**



Risk type	Choking
	One of the rattles of the activity play mat can easily break, generating small parts. A child may put them in the mouth and choke.
	The product does not comply with the requirements of the Toy Safety Directive nor with the European standard EN 71-1.
Category	Toys
Type	Consumer
Description	Pool-like square play mat, with two flexible arches, on which can be hung 3 multi-coloured plastic rattles (1 of the rattles is a battery-operated musical toy) and 1 teething toy. The toy also includes 20 plastic balls of different colours with a diameter of 50 mm.
Packaging description	Transparent plastic carrying bag
Brand	Konig Kids
Name	3 in 1 Play center

Type / number of model	63577
Weekly report number	Report-2022-39
Alert submitted by	Hungary
Is the product counterfeit?	Unknown
Country of origin	People's Republic of China
Measures taken by economic operators	Withdrawal of the product from the market Importer
Date of entry into force	05/05/2022
Measures taken by economic operators	Recall of the product from end users Importer
Date of entry into force	05/05/2022

Alert number **[A12/01352/22](#)**

Product **Notebook**



Risk type	Chemical
	The product contains an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and diisobutyl phthalate (DIBP) (measured values: 17.5% and 0.1% by weight, respectively). These phthalates may harm the health of children, causing possible damage to their reproductive system.
	The product does not comply with the REACH Regulation.
Category	Stationery
Type	Consumer
Description	A dark blue notebook with plastic cover, with 20 striped sheets.
Brand	UNIPAP
Name	UNI PAP
Barcode	5202361326118
Weekly report number	Report-2022-39
Alert submitted by	Greece
Is the product counterfeit?	Unknown
Country of origin	Greece
Measures ordered by public authorities	Withdrawal of the product from the market Manufacturer



Alert number **[A12/01333/22](#)**

Product **Wax heater**



Risk type **Burns
Electric shock**

The product's enclosure has no heat protection and can therefore overheat and melt, hence live parts will become accessible. Furthermore, the protective earthing connection is not adequately secured and the earthing resistance is not adequate, hence accessible parts will become live. A user may touch the product and receive an electric shock, or get burned.

The product does not comply with the requirements of the Low Voltage Directive nor with the relevant European standard EN 60335-1.

Category **Electrical appliances and equipment**

Type **Consumer**

Description **Round wax heater in white plastic and a purple lid.**

Brand **Unknown**

Name **POP UP BEAUTY WAX HEATER**

Type / number of model **RWH015**

Weekly report number **Report-2022-39**

Alert submitted by **Sweden**

Is the product counterfeit? **No**

Country of origin **People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market
Distributor**

Date of entry into force

07/09/2022

Company recall code

- <https://www.normal.se/%C3%A5terkallelser/>

Alert number **[A12/01357/22](#)**
 Product **Children's sandals**



Risk type	Injuries
	The tread part of the interlayer bond between the upper and the sole may tear and break easily, leading to the detachment of the sole from the upper part of the sandal. As a result of this, a child may trip and fall, getting injured.
	The product does not comply with the requirements of the General Product Safety Directive.
Category	Clothing, textiles and fashion items
Type	Consumer
Description	Black and green sandals for children, with Velcro straps and a blue insole, size 38.
Packaging description	Grey cardboard box with an orange lid, on which 2 labels are stuck.
Brand	Unknown
Name	MEMPHIS ONE
Type / number of model	1570000
Weekly report number	Report-2022-39
Alert submitted by	Slovakia
Is the product counterfeit?	No
Country of origin	Unknown

Measures ordered by public authorities

**Recall of the product from end users
Distributor**

Date of entry into force

18/07/2022

Measures ordered by public authorities

**Withdrawal of the product from the market
Distributor**

Date of entry into force

18/07/2022

Company recall code

- <https://corpsite.deichmann.com/sk-sk/allgemein/stiahnutie-produktu-z-predaja/>
- <https://www.soi.sk/sk/nebezpecne-vyrobky/Narodny-trh-SR/ciarno-zelene-sandale-na-suchy-zips-memphis-one.soi?ind=>

Alert number **[A12/01341/22](#)**

Product **Chair**



Risk type	Injuries
	The chair has insufficient strength and can break under load, injuring the user.
	The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 12520.
Category	Furniture
Type	Consumer
Description	Dining chair with wooden legs and damasks in different colours.
Brand	Milano
Name	Emilio
Weekly report number	Report-2022-39
Alert submitted by	Bulgaria
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Import rejected at border Importer
Date of entry into force	19/08/2022

Alert number **[A12/01342/22](#)**

Product **Chair**



Risk type	Injuries
	The chair has insufficient strength and can break under load, injuring the user.
	The product does not comply with the requirements of the General Product Safety Directive nor with the European standard EN 12520.
Category	Furniture
Type	Consumer
Description	Dining chair with metal legs and artificial leather upholstery.
Brand	Praktik
Name	Pearl chair
Weekly report number	Report-2022-39
Alert submitted by	Bulgaria
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Import rejected at border Importer
Date of entry into force	19/08/2022

Alert number **[INFO/00125/22](#)**

Product **Chair**



Risk type	Injuries
	The chair has insufficient strength and can break under load, injuring the user.
	The product does not comply with the requirements of the General Product Safety Directive, nor with the European standard EN 12520.
Category	Furniture
Type	Consumer
Description	Metal chair with upholstered seat, fabric damask in different colours.
Packaging description	Plastic wrap around the sitting area, with paper leaflet.
Brand	Unknown
Name	Berru
Weekly report number	Report-2022-39
Alert submitted by	Bulgaria
Is the product counterfeit?	Unknown
Country of origin	Turkey
Measures ordered by public authorities	Import rejected at border Importer
Date of entry into force	19/08/2022

Alert number **[A12/01328/22](#)**

Product **Passenger car**

Risk type **Injuries**

In the event of an accident, there is a risk that the load in the baggage compartment will shoot forwards to the partition grille and cause the bracket to detach from the body, increasing the risk of injury to the passengers.

The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.

Category **Motor vehicles**

Type **Consumer**

Description **Passenger car**

Brand **Seat**

Name **Leon**

EC-type approval/model **KL
Te9*2007/46*3167***

Production dates **31.07.2020 - 4.06.2022**

Company recall code **68I3**

Weekly report number **Report-2022-39**

Alert submitted by **Germany**

Is the product counterfeit? **No**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **France
Slovakia
Sweden**

Alert number **[A11/00109/22](#)**

Product **Air compressor**



Risk type

Injuries

The product has a valve which does not correspond to the safety requirements, the materials are too thin to withstand pressure, the pressure container supports (wheels, standing support) are not correctly welded and the purging device has been installed in a place where it may not perform adequately. Furthermore, the pressure indicator device has no warning signs for excessive pressure. Finally, the simple pressure container constituting the air compressor is a falsified product, and bears a CE marking without having undergone the conformity assessment by a relevant competent European conformity assessment body. Consequently, the product may explode, injuring the users.

The product does not comply with the requirements of the Simple Pressure Vessels Directive nor with the European standard EN 286-1.

Category

Pressure equipment/vessels

Type

Consumer

Description

Simple pressure vessel PS = 8 bar — PT = 12 bar V = 24 L TS = 0/+ 100 °C Product sold online.

Packaging description

Coloured cardboard box.

Brand

Quartz (Counterfeit)

Name

QUARTZ SIL540Q

Type / number of model

**OD 245
Quartz SIL540Q**

Barcode

3373270011401

Weekly report number	Report-2022-39
Alert submitted by	France
Is the product counterfeit?	Yes
Country of origin	People's Republic of China
Measures ordered by public authorities	Recall of the product from end users Other
Date of entry into force	20/02/2020
Measures ordered by public authorities	Ban on the marketing of the product and any accompanying measures Other
Date of entry into force	20/02/2020
Measures taken by economic operators	Recall of the product from end users Distributor
Date of entry into force	20/02/2020
Measures taken by economic operators	Withdrawal of the product from the market Importer
Date of entry into force	20/02/2020

Alert number [A11/00110/22](#)

Product **Safety valve**



Risk type

Injuries

The valve can be easily blocked, and its settings can be easily changed by mistake by the user, who could be injured. Furthermore, the product bears a CE marking without having undergone the conformity assessment by a relevant competent European conformity assessment body.

The product does not comply with the requirements of the Pressure Equipment Directive nor with the European standard EN 4126-1.

Category

Pressure equipment/vessels

Type

Consumer

Description

Safety valve with shaft and ring. PS: 0.8-0.88 MPa EC 0036

Brand

SNPN

Name

SNPN 3804

Type / number of model

**3804A
3804B**

Weekly report number	Report-2022-39
Alert submitted by	France
Is the product counterfeit?	No
Country of origin	People's Republic of China
Measures ordered by public authorities	Withdrawal of the product from the market Other
Date of entry into force	05/03/2020
Measures ordered by public authorities	Recall of the product from end users Other
Date of entry into force	05/03/2020
Measures ordered by public authorities	Withdrawal of the product from the market Other
Date of entry into force	05/03/2020
Measures ordered by public authorities	Recall of the product from end users Other
Date of entry into force	05/03/2020
Measures taken by economic operators	Ban on the marketing of the product and any accompanying measures Importer
Date of entry into force	05/03/2020