



European Commission ([http://ec.europa.eu/index\\_en.htm](http://ec.europa.eu/index_en.htm)) Consumers ([http://ec.europa.eu/consumers/index\\_en.htm](http://ec.europa.eu/consumers/index_en.htm))

Consumers safety ([http://ec.europa.eu/consumers/consumers\\_safety/index\\_en.htm](http://ec.europa.eu/consumers/consumers_safety/index_en.htm))

Safety products ([http://ec.europa.eu/consumers/consumers\\_safety/safety\\_products/rapex/index\\_en.htm](http://ec.europa.eu/consumers/consumers_safety/safety_products/rapex/index_en.htm))

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

week 22 - 2016

Alert number: A12/0673/16

Product: Glue

Name: Unknown

Risk type: Chemical

Category: Chemical products

Brand: Matrix

Type / number of model: EH14816-1

Risk level: Serious risk

The product contains chloroform (measured value 40.3% by weight). Chloroform in high doses causes skin irritation and can damage health if inhaled or swallowed. The product does not comply with the REACH Regulation.


Measures ordered by public authorities: Withdrawal of the product from the market

Description: A red, yellow and blue tube of glue in a blister pack on cardboard.

Batch number / Barcode: 2165489855546

Country of origin: Japan

Alert submitted by: Cyprus

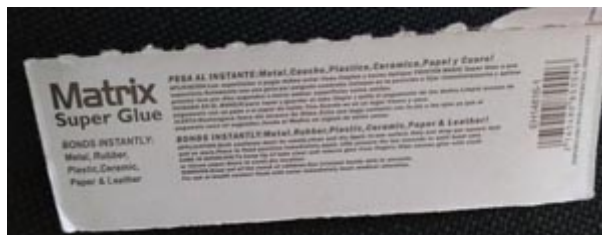

Alert number: A12/0674/16

Product: Glue

Name: 110 Super Glue

Risk type: Chemical

Category: Chemical products

Brand: BAQIANG

Type / number of model: Unknown

Risk level: Serious risk

The product contains chloroform (measured value 23.1% by weight). Chloroform in high doses causes skin irritation and can damage health if inhaled or swallowed. The product does not comply with the REACH Regulation.

Measures ordered by public authorities: Withdrawal of the product from the market

Description: A white bottle of super glue (5g) supplied in a blister pack on white and green cardboard.

Batch number / Barcode: 6943211887562

Country of origin: China

Alert submitted by: Cyprus



**Alert number:** A12/0678/16

**Product:** Lederhose (Leather trousers)

**Name:** Unknown

**Risk type:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** Distler Original

**Type / number of model:** Colour: dark brown, Order: 191394-006

**Risk level:** Serious risk

The amount of Chromium (VI) found in the leather is too high (measured value up to 26 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Women's mid-brown coloured, dyed leather shorts with a front flap and appliqué work; there is a row of buttons on each leg. Sample size 36.

**Batch number / Barcode:** 1009971240363 ; Batch No: 3414-0365683-440;

**Country of origin:** India

**Alert submitted by:** Germany



**Alert number:** A12/0692/16

**Product:** Leather belt

**Name:** Unknown

**Risk type:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** AWG Mode Center

**Type / number of model:** 730210/542698 (reference number of importer: 1100549)

**Risk level:** Serious risk

The amount of Chromium (VI) found in the leather is too high (measured value 8.2 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market, Withdrawal of the product from the market (By: Distributor, Importer)

**Description:** Black leather belt for men, sample size 100.

**Batch number / Barcode:** 4025911042266

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/0693/16

**Product:** Men's sandals

**Name:** Unknown

**Risk type:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** TRAVERIS

**Type / number of model:** References 1807, 1939 and 2817

**Risk level:** Serious risk

The amount of chromium (VI) found in the leather is too high (measured value up to 6.8 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Three different models of men's sandals made of brown leather uppers and synthetic soles. The packaging is a grey cardboard box with orange lid. Sample sizes 40-42.

**Batch number / Barcode:** Unknown

**Country of origin:** India

**Alert submitted by:** Spain



**Alert number:** A12/0669/16

**Product:** Eau de Toilette

**Name:** CUBA GOLD FOR MEN

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** CUBA ORIGINAL by PARFUMS DES CHAMPS,

**Type / number of model:** LOT: N: 9655,

**Risk level:** Serious risk

The eau de toilette contains the allergenic substances Limonen, Linalool, Cinnamaldehyd, Eugenol, alfa-isomethylionon, Lilial, Coumarin, Amylcinnamyl aldehyd, Lyral and Hexylcinnamaldehyd in excess of 0.001%. They are not indicated in the list of ingredients and consumers are not made aware of the presence of these substances that can induce allergic reactions and sensitisation. The product does not comply with the Cosmetic Products regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Eau de toilette (100 ml) in a brown bottle in the shape of a cigar. Outer orange packaging is a metallic, cylindrical box with lid.

**Batch number / Barcode:** 5425017732389

**THE PRODUCT IS COUNTERFEIT**

**Country of origin:** Belgium

**Alert submitted by:** Czech Republic

**Products were found and measures were taken also in:** France, Slovakia





**Alert number:** A12/0670/16

**Product:** Eau de Toilette

**Name:** Women in Green

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Shirley May

**Type / number of model:** PD.04-14; ED. 04-19

**Risk level:** Serious risk

The eau de toilette contains the allergenic substances Limonen, Linalool, Benzyl alcohol, Citronellol, Geraniol, Citral, Hydroxycitronellal, Lilial, Farnesol, Amylcinnamyl aldehyd, Lyral, Hexylcinnamaldehyd and Benzyl salicylate in excess of 0.001%. They are not indicated in the list of ingredients and consumers are not made aware of the presence of these substances that can induce allergic reactions and sensitisation. The product does not comply with the Cosmetic Products regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Eau de toilette (50 ml) in a glass bottle in the form of a woman, with a green lid. The packaging is a green cardboard box, wrapped in cellophane.

**Batch number / Barcode:** 6295124003639 (on the outer packaging), B. 462174D (On the bottle)

**Country of origin:** United Arab Emirates

**Alert submitted by:** Czech Republic



**Alert number:** A12/0671/16

**Product:** Eau de Parfum

**Name:** Miss AMERICA - Parfum de Toilette

**Risk type:** Chemical

**Category:** Cosmetics

**Brand:** Unknown

**Type / number of model:** NO.3777 (only on the outer package)

**Risk level:** Serious risk

The eau de parfum contains the allergenic substances Linalool, Citral, Hydroxycitronellal, Linal, Coumarin, Farnesol and Hexylcinnamaldehyd in excess of 0.001%. They are not indicated in the list of ingredients and consumers are not made aware of the presence of these substances that can induce allergic reactions and sensitisation. The product does not comply with the Cosmetic Products regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Eau de parfum in a bottle (55ml) with a silver cap, supplied in a cardboard box in the colours of the US flag. There is picture of the Statue of Liberty on the bottle and the box.

**Batch number / Barcode:** 6937926304339

**Country of origin:** China

**Alert submitted by:** Czech Republic





**Alert number:** A12/0672/16

**Product:** Stand fan

**Name:** 16 Inch Stand Fan

**Risk type:** Electric shock, Injuries

**Category:** Electrical appliances and equipment

**Brand:** OSCAR PLUS

**Type / number of model:** FS-40G

**Risk level:** Serious risk

The electrical insulation is not adequate and accessible parts could become live. In addition, the blades are not adequately protected by the grille. Fingers can be caught between the grille guard and the rotating blade, causing cuts or fractures. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** White stand fan supplied in blue cardboard package.

**Batch number / Barcode:** 8436011055012

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/0691/16

**Product:** Electric blanket

**Name:** Warm Cloud

**Risk type:** Health risk / other

**Category:** Electrical appliances and equipment

**Brand:** TnS Home Collection

**Type / number of model:** QD(150\*80)/0.9m2-SD-DT

**Risk level:** Serious risk

The electric blanket can be connected directly to the power supply without the control unit. If used in this way, the electric blanket will overheat in the absence of a thermostat and a vulnerable person could suffer heatstroke.

The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** The product consists of a white blanket containing the heating element and powered by a white power cord and controller. The product comes in an orange and red cardboard box with a photo of the device on the outside.

**Batch number / Barcode:** 5204558999679

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/0686/16

**Product:** Bicycles

**Name:** Syncros 2016 FL1.0 Offset Seat Posts

**Risk type:** Injuries

**Category:** Hobby/sports equipment

**Brand:** SCOTT

**Type / number of model:** Model: Syncros 2016 FL1.0 Offset Seat Posts with a 27.2mm diameter assembled on SCOTT 2016 Road bikes.

**Risk level:** Serious risk

The seat posts can fracture leading to immediate loss of rider control which may cause accidents and injuries.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Model year 2016 SCOTT men's and women's road bicycles with SYNCROS FL 1.0 seat posts. "SCOTT" is printed on the bicycle down tube and "SYNCROS" is printed on the seat post. The bicycles are sold in black, grey and white with yellow, orange, green or blue decals.

**Batch number / Barcode:** Bicycle models included in the recall are: Addict CX 10 disc, Addict SL, Addict Team Issue, Addict 10, Addict 15, Addict 20, Addict Gravel disc, Solace Premium disc, Solace 10 disc, Frame set Addict 10 (HMF), Frame set Addict CX 10 disc (HMX) mech / Di2 and Seatpost Syncros FL1.0 Carbon Offset 27.2mm. A complete list of serial numbers included in the recall can be found at <http://www.scott-sports.com/global/en/company/safety-and-recalls>.

**Country of origin:** Taiwan

**Alert submitted by:** Greece

**Products were found and measures were taken also in:** Austria, Croatia, Denmark, France, Ireland, Sweden



**Alert number:** A12/0684/16

**Product:** Lighting chain

**Name:** Christmas LED Light 8 MULTIFUNCTION

**Risk type:** Electric shock, Fire

**Category:** Lighting chains

**Brand:** Blumagix / Orion

**Type / number of model:** BMCL-LSL20R200

**Risk level:** Serious risk

The dimensions of the plug are too small and the wire ends soldered to the terminals of the flashing unit and the LED are not adequately protected against pulling and twisting. The accessible, basic insulated, wires can come into contact with sharp edges of the flashing switch and control unit. The cross-sectional area of the external and internal wires is too small and the wires could overheat and cause a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** The lighting chain includes 201 serial-parallel connected, non-replaceable, red LED lamps. The product can be operated with a flashing switch and control unit. It is supplied in a colourful cardboard box and plastic bag.

**Batch number / Barcode:** 5 998314 590094

**Country of origin:** China

**Alert submitted by:** Hungary





**Alert number:** A12/0685/16

**Product:** Lighting chain

**Name:** Christmas LED light 8 MultiFunction

**Risk type:** Electric shock, Fire

**Category:** Lighting chains

**Brand:** BluMagix / Orion

**Type / number of model:** BMCL-LSL10RGB100

**Risk level:** Serious risk

The product poses a risk of electric shock for the following reasons. Firstly, the dimensions of the plug are substantially less than required. Secondly, the wire ends soldered to the terminals of the flashing unit and the LEDs are not adequately protected against pulling and twisting. Thirdly, the accessible basic insulated wires can come into contact with sharp edges of the flashing switch and control unit. Finally, the insulation provided by the shrink tubing for the lamps is inadequate. Moreover, the cross-sectional area of the external and internal wires is too small and the wires could overheat and cause a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** The lighting chain includes serial-parallel connected non-replaceable 100 pcs LED lamps (25 green, 25 yellow, 25 blue, 25 red) The product can be operated with flashing switch and control unit. Technical specifications: 220 V, 10 m, 100 LED Packaging: colourful cardboard box and plastic bag. Inscription on the packaging: 'Christmas LED light 8 Multi Function', 'Energy efficient LED string lights'.

**Batch number / Barcode:** 5 998314 590018

**Country of origin:** China

**Alert submitted by:** Hungary



Alert number: A12/0690/16

Product: Sander

Name: PSS Series

Risk type: Electric shock, Injuries

Category: Machinery

Brand: Bosch

Type / number of model: PSS 2, PSS 20, PSS 190, PSS 200, PSS 250 and PSS 2000

Risk level: Serious risk

A breakage in the ventilation wheel could lead to small parts being ejected in the direction of the user leading to puncture wounds and further injuries. Moreover, live parts may become accessible, which could cause an electric shock. The product does not comply with the requirements of the Machinery Directive.

Measures taken by economic operators: Recall of the product from end users (By: Manufacturer)

Description: Green and black sanders.

Batch number / Barcode: Manufacture period from June to August 2007

Country of origin: Germany

Alert submitted by: Malta

Products were found and measures were taken also in: Finland, Greece, Ireland, Slovakia





**Alert number:** A12/0662/16

**Product:** Passenger car

**Name:** S 500 Hybrid, C 350 Hybrid, GLC 350 Hybrid Plus 4Matic, ML 500 4Matic Hybrid

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type / number of model:** EC type-approval: e1\*2001/116\*0335\*29 ff, type: 221, EC type-approval: e1\*2001/116\*0457\*29 ff, type: 204K EEC type-approval: e1\*2001/116\*0431\*35 ff, type: 204, EC type-approval: e1\*2001/116\*0480\*16 ff, type: 204X EC-type approval: e1\*2001/46\*0598\*15 ff, type: 166.

**Risk level:** Serious risk

The on-board high-voltage battery charger may malfunction. As a consequence it may incorrectly detect that an external charging cable has been inserted. If the vehicle is travelling at a speed of less than 5 km/h, this could lead to the activation of the park-lock function which would prevent further movement of the vehicle.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Plug-in, hybrid electric vehicle.

**Batch number / Barcode:** Vehicles produced from March 2015 to September 2015 are affected.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Finland, Romania, Slovenia, The Netherlands, United Kingdom

**Alert number:** A12/0664/16

**Product:** All-terrain vehicle

**Name:** RZR XP 900, RZR 900, RZR XP 1000

**Risk type:** Fire

**Category:** Motor vehicles

**Brand:** Polaris

**Type / number of model:** Unknown

**Risk level:** Serious risk

The alternator regulator could overheat which may lead to a fire.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Side-by-Side / all-terrain vehicle

**Batch number / Barcode:** Certain vehicles built between 03/10/2012 and 15/02/2016

**Country of origin:** United States

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Denmark, Finland, Greece, Norway, Portugal, Sweden

**Alert number:** A12/0665/16

**Product:** Passenger car

**Name:** Discovery, Range Rover and Range Rover Sport

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Land Rover

**Type / number of model:** Land Rover Discovery 4: 2012 and 2013 model year vehicles. , Range Rover 2013 and 2014 model year vehicles., Range Rover Sport: 2012 and 2013 model year vehicles.

**Risk level:** Serious risk

Due to a problem linked with the electronics, the engine may cut out without any detectable warning signs. This could potentially cause a crash.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** Certain vehicles built between 02/04/2012 and 02/05/2013

**Country of origin:** United Kingdom

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Croatia, Finland, Greece, Iceland, Ireland, Romania, Sweden

**Alert number:** A12/0666/16

**Product:** Passenger car

**Name:** XF and XJ

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Jaguar

**Type / number of model:** XF: 2012 and 2013 Model Year vehicles., XJ: 2012 and 2013 Model Year vehicles.

**Risk level:** Serious risk

Due to a problem linked with the electronics, the engine may cut out without any detectable warning signs. This could potentially cause a crash.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number / Barcode:** Certain vehicles built between 01/06/2012 and 31/10/2012

**Country of origin:** United Kingdom

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Finland, Ireland, Sweden

**Alert number:** A12/0677/16

**Product:** Passenger car

**Name:** Insight

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Honda

**Type / number of model:** EC type-approval: e6\*2001/116\*0130; Type: ZE2

**Risk level:** Serious risk

Due to a defect in the gas generator of the driver's air bag, deployment of the air bag could result in small metal fragments being released which could injure the occupants.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number / Barcode:** The vehicles affected were produced from 2012 to 2013.

**Country of origin:** Japan

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Denmark, Ireland, Portugal, Romania, Sweden, The Netherlands, United Kingdom

**Alert number:** A12/0679/16

**Product:** Motorcycle

**Name:** SH

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Honda

**Type / number of model:** EU Type-approval numbers: e4\*2002/24\*2896\*00, e4\*2002/24\*2897\*00, e4\*2002/24\*2896\*01 and e4\*2002/24\*2897\*01. , Model years 2013 and 2014, Models: SH125 and SH150

**Risk level:** Serious risk

The surface of the resin inlet cover in the fuel pump may deform, reducing the clearance between the inlet cover and the fuel pump's impeller. Consequently, the two components may interfere with each other. As a result, the impeller locks, stopping fuel flow to the engine which may cause the engine to suddenly stall.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Motorcycles.

**Batch number / Barcode:** Production period: from 10th July 2012 to 31st January 2015.

**Country of origin:** Italy

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Bulgaria, Croatia, Estonia, Finland, Germany, Greece, Poland, Slovakia, Slovenia, Sweden, The Netherlands, United Kingdom

**Alert number:** A12/0680/16

**Product:** Van

**Name:** Trafic

**Risk type:** Injuries

**Category:** Motor vehicles

**Brand:** Renault

**Type / number of model:** Model: Trafic III (X82) Types: FGMA, FGMB, FGMD, FGME, JGMA, JGMB, JGMD and JGME.

**Risk level:** Serious risk

Mounting screws may be missing on the cross member of the dashboard of the passenger airbag. The absence of mounting screws on the airbag may affect its correct functioning in the event of an impact.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Van.

**Batch number / Barcode:** Affected vehicles are manufactured between the 14/05/2014 and 1/12/2014.

**Country of origin:** France

**Alert submitted by:** Portugal

**Products were found and measures were taken also in:** Croatia, Denmark, Finland, Germany, Ireland, Norway, Slovakia, Slovenia, Sweden, The Netherlands, United Kingdom

**Alert number:** A12/0663/16

**Product:** Plastic toy

**Name:** Shrilling Chicken

**Risk type:** Chemical

**Category:** Toys

**Brand:** ZIX

**Type / number of model:** Unknown

**Risk level:** Serious risk

The plastic material of the chicken contains di-(2-ethylhexyl) phthalate (DEHP) (measured value more than 20.0 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.


**Measures ordered by public authorities:** Import rejected at border

**Description:** A plastic chicken that makes a sound when squeezed. Description of packaging: a plastic net closed by means of a cardboard strip.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Spain

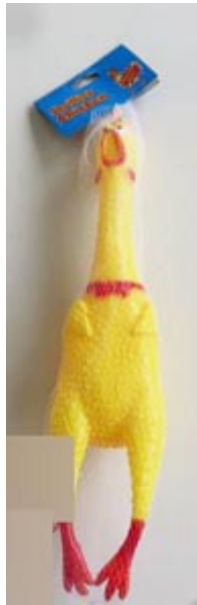

**Alert number:** A12/0667/16

**Product:** Toy playset

**Name:** 'Coffee Set' and 'Kitchen Set'

**Risk type:** Choking, Suffocation

**Category:** Toys

**Brand:** Kitchen Collection

**Type / number of model:** 1) Ref. 8108 , 2) Ref. 8930

**Risk level:** Serious risk

The lids of the saucepan and paella dish have a hemispheric shape and could therefore cover the nose and mouth of small children, leading to suffocation. Moreover, the handle and the lid of the coffee pot break easily, generating small parts. A small child could put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** 1) Kitchen playset consisting of various kitchen utensils made of colourful plastic, supplied in a plastic net with cardboard label; 2) Coffee playset with various coffee utensils made of colourful plastic, supplied in a blister packaging with cardboard label.

**Batch number / Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/0668/16

**Product:** Erasers

**Name:** Puzzle Eraser - 1) Eraser Japanese Sweets 2) Eraser Sushi 3) Eraser Anmitsu Shop

**Risk type:** Choking

**Category:** Toys

**Brand:** IWAKO



Type / number of model: 1) ER-BRI009 omokeshi set 05 Japanese Sweets set , 2) ER-961082 omokeshi set 03 Sushi, 3) ER-BRI033 omokeshi set 28 Anmitsu Shop

Risk level: Serious risk

A small child may put the small erasers in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures taken by economic operators: Destruction of the product

Description: Erasers in the shape of Japanese sweets, sushi and other food, packaged in blister packs with cardboard back.

Batch number / Barcode: 1) 4 991685 200266, 2) 4 991685 961082 , 3) 4 991685 130105

Country of origin: Japan

Alert submitted by: United Kingdom



**Alert number:** A12/0681/16

**Product:** Baby Rattles

**Name:** Mobile

**Risk type:** Choking, Cuts

**Category:** Toys

**Brand:** CHENG FENG

**Type / number of model:** Item No.: 8201-101, Model: 740291

**Risk level:** Serious risk

All the rattles (except the fruit-shaped rattle), as well as the black plastic pieces attached to the end of the cord included in the outer hat, can easily break and generate small parts. A small child could put them in the mouth and choke on them. Moreover, the head of the bear-shaped rattle and the handle of the rattle marked 'Happy Music' can obstruct the airways, causing a risk of choking. In addition, several of the rattles can easily break and expose children to sharp points and edges, possibly causing cuts. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** A set of 8 multicoloured rattles in different shapes made from hard plastic. The rattles are packed in a transparent plastic bottle (approx. height: 22 cm) in the shape of a child with an orange face and hat that is screwed on to the top of the bottle.

**Batch number / Barcode:** Barcode: 074029100001, LOT: PI2000

**Country of origin:** China

**Alert submitted by:** Greece



Alert number: A12/0682/16

Product: Baby rattles

Name: Unknown

Risk type: Choking

Category: Toys

Brand: BABY TOYS

Type / number of model: Item No.: 160-8, Model: 740259

Risk level: Serious risk

The following small parts can easily detach from the rattles: the right ear of the dog rattle, the lemon of the fruit rattle, and the inner balls. A small child could put these small parts in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Measures ordered by public authorities: Withdrawal of the product from the market

Description: Set of 2 multicoloured rattles made from hard plastic. Packing: transparent plastic bag, sealed with paper label with brand "Baby-Toys" and inscription "Best gift for your baby".

Batch number / Barcode: Barcode: 074025900001, LOT: 13/1018

Country of origin: China

Alert submitted by: Greece





**Alert number:** A12/0683/16

**Product:** Baby rattle

**Name:** Unknown

**Risk type:** Choking, Cuts

**Category:** Toys

**Brand:** BABY TOYS

**Type / number of model:** Item No.: 160-13, Model: 740258

**Risk level:** Serious risk

The rattle and the inner ball can easily break and generate small parts and hazardous sharp points, posing a risk of choking and cuts for children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Multicoloured rattle made from hard plastic, consisting of a small purple/white ball in an orange (outer)/yellow (inner) sphere. Packing: transparent plastic bag, sealed with paper label.

**Batch number / Barcode:** Barcode: 074025800001, LOT: 13/1018

**Country of origin:** China

**Alert submitted by:** Greece



**Alert number:** A12/0687/16

**Product:** Rattles

**Name:** Baby Star

**Risk type:** Choking

**Category:** Toys

**Brand:** LE BAO TOYS

**Type / number of model:** Item No.: 343, Model: 740289

**Risk level:** Serious risk

The metal rod that links the blue plastic pieces of the flower rattle detaches and generates small parts. A small child could put the small parts in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Set of 2 multicoloured rattles made of hard plastic supplied in blister packaging with paper back.

**Batch number / Barcode:** 074028900001

**Country of origin:** China

**Alert submitted by:** Greece



**Alert number:** A12/0688/16

**Product:** Rattle

**Name:** Unknown

**Risk type:** Chemical, Suffocation

**Category:** Toys

**Brand:** ANIMAL ALLEY

**Type / number of model:** Item No.: GH61095, Code: 5161095

**Risk level:** Serious risk

The plastic of the packaging is too thin and, if a child plays with it, the plastic can cover the mouth and nose causing the child to suffocate. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1. The plastic parts of the product contain di-(2-ethylhexyl) phthalate (DEHP) (measured value 21% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The product also contains di-isononyl phthalate (DINP) (measured value 1.9% by weight). According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DNOP and DIDP are prohibited in toys and childcare articles that can be placed in the mouth by children.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Multicoloured rattle in the shape of a drum made of soft material. Inside the drum there are 3 plastic balls with small bells. The product is supplied in a transparent plastic bag.

**Batch number / Barcode:** Barcode: 5205193027857

**Country of origin:** China

**Alert submitted by:** Greece





**Alert number:** A12/0689/16

**Product:** Wooden shotgun

**Name:** Unknown

**Risk type:** Injuries

**Category:** Toys

**Brand:** B&SC

**Type / number of model:** Reference XM202

**Risk level:** Serious risk

The kinetic energy of projectiles fired from the shotgun is too high which can lead to injuries. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Toy wooden shotgun supplied in a transparent plastic bag together with projectiles made of rubber.

**Batch number / Barcode:** 8436037232657

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A11/0053/16

**Product:** Valve oil for musical instruments

**Name:** 1) Medium Rotor; 2) Rotor; 3) Light Bearing & Linkage; 4) Light key

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** Hetman

**Type / number of model:** 1.) Lubricant 11.5, 2.) Lubricant 12, 3.) Lubricant 13, 4.) Lubricant 16

**Risk level:** Other risk level

The products lack the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** White plastic bottle with metal pipette and green cap (Rotor Lubricant 12 has a red cap). Labelling in green.

**Batch number / Barcode:** Unknown

**Country of origin:** United States

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Slovenia



**Alert number:** A11/0054/16

**Product:** Valve oil for musical instruments

**Name:** Valve Oil

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** REKA

**Type / number of model:** Unknown

**Risk level:** Other risk level

The product lacks the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Valve oil for musical instruments supplied in a white plastic bottle (50 ml) with blue cap and blue/yellow labelling.

**Batch number / Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Germany



**Alert number:** A11/0055/16

**Product:** Valve oil for musical instruments

**Name:** Ventilöl ('Valve oil')

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** JOACHIM KREUL

**Type / number of model:** V511

**Risk level:** Other risk level

The product has an aspiration hazard and lacks the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Valve oil (yellow liquid) supplied in a clear plastic bottle (pen form) with metal pipette tip and red plastic cap.

**Batch number / Barcode:** 4038827057385

**Country of origin:** Unknown

**Alert submitted by:** Germany



**Alert number:** A11/0056/16

**Product:** Valve oil for musical instruments

**Name:** "La Tromba" Valve Oil

**Risk type:** Chemical

**Category:** Chemical products

**Brand:** La Tromba

**Type / number of model:** Unknown

**Risk level:** Other risk level

The product has an aspiration hazard and lacks the required labelling, child-resistant fastening and tactile warning of danger. Children could accidentally swallow some of the product leading to aspiration toxicity including chemical pneumonia. The product does not comply with the Regulation on the classification, labelling and packaging of substances and mixtures (CLP).

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Valve oil supplied in a clear plastic bottle with a red cap and labelling in gold and red.

**Batch number / Barcode:** Unknown

**Country of origin:** Switzerland

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Slovenia, The Netherlands

