

# The Rapid Alert System for Non-Food Products (RAPEX)

## RAPEX - Weekly overview report of notifications

week 29 - 2016

Notification A12/0851/16 from report 2016-28 has been withdrawn at the request of the notifying country.

**Alert number:** A12/0883/16

**Product:** Baby nest and carrier

**Name:** Unknown

**Risk:** Injuries, Strangulation

**Category:** Childcare articles and children's equipment

**Brand:** Normii

**Type/number of model:** Model: 01001 Rose Model: 01002 Blue Model: 01003 Grey

**Risk level:** Serious risk

The handles might become loose or detach while lifting the baby, which may cause the baby to fall and suffer injuries. In addition, the adjustable cords in the lower part of the nest may create long loops which can cause strangulation. The product does not comply with the relevant European standard EN 1466.

**Measures ordered by public authorities:** Warning consumers of the risks, Withdrawal of the product from the market

**Description:** Baby nest and carrier 3 different colours (rose, blue and grey) made of soft material, which enables the baby to lay and sleep.

**Batch number/Barcode:** Unknown

**Country of origin:** Denmark

**Alert submitted by:** Denmark



**Alert number:** A12/0893/16

**Product:** Sunscreen

**Name:** Unknown

**Risk:** Chemical

**Category:** Cosmetics

**Brand:** Aloha

**Type/number of model:** 1) SPF 8 Sun Lotion, 250ml; 2) SPF 30 Sun Lotion, 50 ml; 3) SPF 50 Kids Lotion, 50 ml; 4) Sensitive SPF 30, 200 ml; 5) Sensitive SPF 50, 200 ml; 6) SPF 15 Spray Lotion, 200 ml; 7) SPF 30 Spray Lotion, 200 ml.

**Risk level:** Serious risk

The cream contains methylisothiazolinone (MI) and methylchloroisothiazolinone (MCI). Dermal contact with MCI/MI-containing products can provoke allergic contact dermatitis to sensitised persons. According to the Cosmetic Products Regulation, MCI/MI is prohibited in leave-on cosmetic products and shall not be made available on the Union market as from 16 April 2016.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Different models of sunscreen with different sun protection factors. Plastic bottle or tube in white and yellow.

**Batch number/Barcode:** 1) 5037378002850 – batch n° 11823, 42324, 12181, 17314, 16112, 15462, 14512;; 2) 5037378005011 – batch n° 29244;; 3) batch n° 37014, 52835, 50725;; 4) 503737005059 – batch n° 49555, 37084, 51585, 24813, 50525, 13633, 14353, 27993;; 5) 5037378005073 – batch n° 50725, 28624, 28573, 11853, 28003, 14893, 14997, 29854;; 6) 5037378004038 – batch n° 30014, 11863, 11473, 52925;; 7) 5037378004045 - batch n° 63266, 58915, 49225, 51725, 23433, 11873, 50515, 51765.

**Country of origin:** United Kingdom

**Alert submitted by:** Portugal



**Alert number:** A12/0891/16

**Product:** Set of decorative candles

**Name:** Velas

**Risk:** Choking

**Category:** Decorative articles

**Brand:** PAMPY

**Type/number of model:** ref. 323673

**Risk level:** Serious risk

The candles, due to their characteristic form, colour and size may be mistaken for foodstuff. Small parts can be easily detached from the product and this may lead children to put them in the mouth, swallow or ingest them. The product does not comply with the requirements of the Directive 87/357/EEC on products which, appearing to be other than they are, endanger the health or safety of consumers.


**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Pack of five candles in the form of cupcakes of different colours, each one mounted on a stick. Packaging: transparent plastic blister pack, at the base of which the labelling appears on a white background with coloured stripes.

**Batch number/Barcode:** 8430173236739

**Country of origin:** China

**Alert submitted by:** Spain

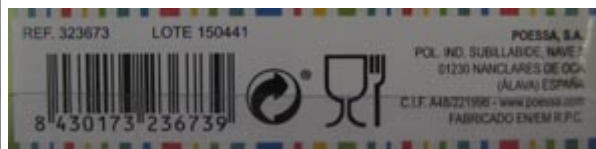

**Alert number:** A12/0878/16

**Product:** Halogen floodlight

**Name:** Unknown

**Risk:** Electric shock, Fire

**Category:** Electrical appliances and equipment

**Brand:** CEBA

**Type/number of model:** XG-1009

**Risk level:** Serious risk

The lamp housing and the connection box can easily break, which may give access to live parts or may generate a short circuit and a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Halogen floodlight, 400 W, for construction sites or DIY activities.

**Batch number/Barcode:** Batch: 981205

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0898/16

**Product:** Fridge/freezer

**Name:** Frostfri

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** IKEA

**Type/number of model:** Frostfri freezer A++ 227 ref: 70221871, Frostfri fridge A++ 395 ref: 30221868

**Risk level:** Serious risk

The upper panel of the fridge/freezer case may detach or break, leaving live parts accessible.

The product does not comply with the requirements of the Low Voltage Directive.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Fridge/freezer.

**Batch number/Barcode:** The affected models are produced between week 45 of 2015 (1545) and week 7 of 2016 (1607).

**Country of origin:** Sweden

**Alert submitted by:** Spain





**Alert number:** A12/0887/16

**Product:** Earrings

**Name:** Unknown

**Risk:** Chemical

**Category:** Jewellery

**Brand:** PARFOIS

**Type/number of model:** 139940PA/52107218/LAD

**Risk level:** Serious risk

The metal contains Cadmium (measured value 1.7 % by weight). Cadmium is harmful to human health, because it accumulates in the body and can damage organs and it may cause cancer. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Metal earrings on cardboard.

**Batch number/Barcode:** 5606428361867

**Country of origin:** China

**Alert submitted by:** Latvia



**Alert number:** A12/0890/16

**Product:** Lighting chain

**Name:** Guirlande Lumineuse Clignotante

**Risk:** Fire

**Category:** Lighting chains

**Brand:** Cindeco Lighting

**Type/number of model:** MXT 256111, 256123, 395610, 395614, 395618, 395619, Ref. 87642, Type No: LED 32B

**Risk level:** Serious risk

The product is not protected against moisture but is recommended for outdoor use. This may cause a short-circuit and cause a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Lighting chain with twinkling lights, 3 metres long, for indoor and outdoor use. The product is sold in a cardboard box wrapped in clear plastic.

**Batch number/Barcode:** 8713833700208

**Country of origin:** China

**Alert submitted by:** France





**Alert number:** A12/0894/16

**Product:** Lighting chain

**Name:** Unknown

**Risk:** Electric shock

**Category:** Lighting chains

**Brand:** HOMDAY'lights

**Type/number of model:** 199315

**Risk level:** Serious risk

The wires can easily pull out from the lights, exposing live parts. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598 and EN 61347.


**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Lighting chain for indoor use with 100 twinkling lights, 3.9 m.

**Batch number/Barcode:** 3491951993157; Batch 06/2010

**Country of origin:** China

**Alert submitted by:** France

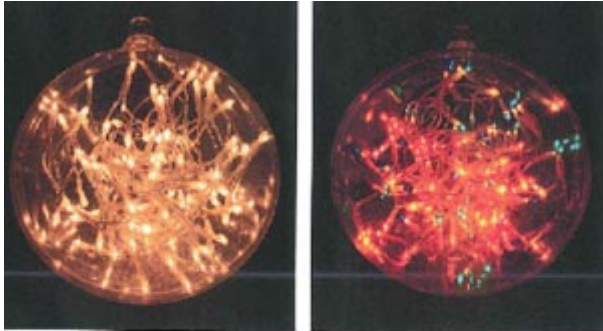

**Alert number:** A12/0885/16

**Product:** Suspended luminaire

**Name:** LaDina and LamegaDina

**Risk:** Burns, Fire

**Category:** Lighting equipment

**Brand:** ARES

**Type/number of model:** 'LaDina' and 'Lamegadina' ranges - ref. FOREZ PISCINES: NOMAD; Model FSM TC-TEL (TC-TSE).

**Risk level:** Serious risk

The product is not protected against moisture but is recommended for outdoor use. Water penetration may cause an electric shock or lead to a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Decorative portable lamp for outdoor/indoor use, available in 6 colours, delivered in cardboard packaging.

**Batch number/Barcode:** Unknown

**Country of origin:** Italy

**Alert submitted by:** France



**Alert number:** A12/0870/16

**Product:** Lorry

**Name:** Actros

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Mercedes-Benz

**Type/number of model:** Type-approval numbers: e1\*2007/46\*0737; Type: 963-4-E

**Risk level:** Serious risk

An inadequate screw connection may result in the loss of the side panel, endangering following road-users if this side panel falls on the roadway.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Lorry

**Batch number/Barcode:** Vehicles produced between 1 February 2015 and 30 April 2016 are affected.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** The Netherlands

**Alert number:** A12/0873/16

**Product:** All-terrain vehicle

**Name:** Ranger

**Risk:** Fire

**Category:** Motor vehicles

**Brand:** Polaris

**Type/number of model:** Ranger 570, Ranger 570 EPS, Ranger 570 EPS HD, Ranger Crew 570, Ranger Crew 570 EPS, Ranger 570 2x4 and Ranger 570 EPS ZUG

**Risk level:** Serious risk

The vehicles may have been manufactured with insufficient shielding between the engine exhaust and rearmost seat close-off panel. This could lead to the seat close-off panel overheating which may pose a fire hazard.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** All-terrain vehicles.

**Batch number/Barcode:** Vehicles built between 17/09/2013 and 07/06/2016.

**Country of origin:** Mexico

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Spain, Sweden, The Netherlands

**Alert number:** A12/0874/16

**Product:** Passenger cars

**Name:** Swift / Swift Sport

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Suzuki

**Type/number of model:** Models AZG412/AZG413D/AZG416

**Risk level:** Serious risk

A defect in the rear wheel brake may cause a sudden decrease of brake force.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger cars.

**Batch number/Barcode:** The recall concerns vehicles produced from 01/09/2014 until 22/12/2015.

**Country of origin:** Hungary

**Alert submitted by:** Greece

**Products were found and measures were taken also in:** Croatia, Denmark, Germany, Hungary, Slovakia, Sweden, The Netherlands

**Alert number:** A12/0875/16

**Product:** Motorcycles

**Name:** YZF-R3A and MT-03A

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Yamaha

**Type/number of model:** Models YZF-R3A (B023/4/B/C) and MT-03A (B082/3)

**Risk level:** Serious risk

The clutch pressure plate bearing may break when the clutch is operated frequently due to insufficient load rating of the bearing. As a consequence, the clutch may fail to operate and the transmission will not shift properly. There is a possibility that engine oil pressure may not regulate properly due to an improper design of the oil relief valve in the oil pump. As a consequence, the resin gear may break which could result in engine damage due to lack of oil supply.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Motorcycles.

**Batch number/Barcode:** 2015-2016 model year.

**Country of origin:** Indonesia

**Alert submitted by:** Greece

**Products were found and measures were taken also in:** Croatia, Denmark, Finland, Germany, Ireland, Slovakia, Slovenia, Sweden, The Netherlands

**Alert number:** A12/0876/16

**Product:** Passenger car

**Name:** Tribeca

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Subaru

**Type/number of model:** Model Tribeca (type WX)

**Risk level:** Serious risk

The hook in the bonnet safety system may not engage with the safety lock pin of the bonnet lock system. The bonnet may not close properly and may unexpectedly open while driving.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger car.

**Batch number/Barcode:** 2006 – 2014 model year vehicles.

**Country of origin:** United States

**Alert submitted by:** Greece

**Products were found and measures were taken also in:** Iceland, Ireland, The Netherlands

**Alert number:** A12/0877/16

**Product:** Van

**Name:** ProAce

**Risk:** Fire

**Category:** Motor vehicles

**Brand:** Toyota

**Type/number of model:** Unknown

**Risk level:** Serious risk

The connector between the return fuel pipe and the injector could wear out and could create an improper connection leading to a leakage. The fuel leakage can lead to fire.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Van.

**Batch number/Barcode:** Production dates: 24/04/2013 to 10/04/2014

**Country of origin:** Japan

**Alert submitted by:** Malta

**Products were found and measures were taken also in:** Denmark, Finland, The Netherlands



**Alert number:** A12/0879/16

**Product:** Passenger cars

**Name:** Maxima, Pulsar, Juke, Qashqai and X-Trail

**Risk:** Environment

**Category:** Motor vehicles

**Brand:** Nissan

**Type/number of model:** Models Maxima (A36), Pulsar (C13), Juke (F15), Qashqai (J11) and X-Trail (T32) Type Approval No.: A36: N/A C13: e9\*2007/46\*3086\*00 F15: e11\*2007/46\*0132\*04 J11: e11\*2007/46\*0963\*00 T32: e13\*2007/46\*1456\*07

**Risk level:** Serious risk

The sensor of the rear oxygen sensor might fail and does not set a Diagnostic Trouble Code (DTC) in case of inappropriate content of the exhaust gases. In such cases, the user is not warned through the Malfunction Indicator Light (MIL) on the dashboard.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger cars

**Batch number/Barcode:** Vehicles concerned: Model Year: Maxima (A36) 2015; Pulsar (C13) 2014-2016; Juke (F15) 2014-2016; Qashqai (J11) 2014-2016; X-Trail (T32) 2015-2016  
Manufacturing dates: A36: 14/04/2015-05/08/2015; C13: 23/09/2014-26/05/2016; F15: 05/06/2014-25/05/2016; J11: 24/04/2014-16/05/2016; T32: 10/04/2015-07/06/2016

**Country of origin:** Japan, Russian Federation, Spain, United Kingdom

**Alert submitted by:** Greece

**Products were found and measures were taken also in:** Croatia, Denmark, Germany, Malta, Slovakia, Slovenia, Sweden

**Alert number:** A12/0882/16

**Product:** Motorcycle

**Name:** Chief Classic, Chief Darkhorse, Vintage, Chieftain, Chieftain Darkhorse, Springfield and Roadmaster

**Risk:** Fire

**Category:** Motor vehicles

**Brand:** Indian Motorcycle Company

**Type/number of model:** VIN ranges 56KCCCAA0E3310503 - 56KTRAAAXG3338251

**Risk level:** Serious risk

In the event of an ignition misfire, unburned fuel can be routed into the exhaust system, which can cause high exhaust temperatures that may pose a fire hazard.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Motorcycle.

**Batch number/Barcode:** Specific vehicles built between 06/06/2013 and 28/04/2016

**Country of origin:** United States

**Alert submitted by:** United Kingdom

**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/0884/16

**Product:** Passenger car

**Name:** Grand Cherokee / Liberty

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Jeep

**Type/number of model:** EC-type approval: e4\*98/14\*0039\*09, e4\*98/14\*0058\*03; type: KJ, WG;

**Risk level:** Serious risk

A defect in the control unit of the occupant restraint system may cause the front airbag and/or the seat belt pre-tensioner to activate unintentionally.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger cars.

**Batch number/Barcode:** Affected vehicles are produced between 20 March 2003 and 9 December 2004.

**Country of origin:** United States

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Denmark, Finland, Ireland, Slovakia, Sweden, The Netherlands

**Alert number:** A12/0896/16

**Product:** Passenger car

**Name:** Kadjar

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** RENAULT

**Type/number of model:** e2\*2007/46\*0475\*00

**Risk level:** Serious risk

In the event of an impact, the curtain airbags may not deploy correctly.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car.

**Batch number/Barcode:** Vehicles affected have been produced from the date on which production started until 4 June 2015.

**Country of origin:** Spain

**Alert submitted by:** France

**Products were found and measures were taken also in:** Croatia, Denmark, Finland, Sweden, The Netherlands

**Alert number:** A12/0888/16

**Product:** LPG cylinders

**Name:** Compolite CS 10 and CS 6

**Risk:** Fire, Injuries

**Category:** Pressure equipment/vessels

**Brand:** Compolite CS

**Type/number of model:** CS 10 and CS 6

**Risk level:** Serious risk

The cylinders can quickly explode if exposed to a source of fire (e.g. a leaking gas grill). 6 accidents reported, one of which was fatal.

**Measures ordered by public authorities:** Recall of the product from end users

**Description:** 10 kg and 5 kg LPG cylinders made of plastic reinforced with glass fibre.

**Batch number/Barcode:** Unknown

**Country of origin:** Sweden, Vietnam

**Alert submitted by:** Denmark



**Alert number:** A12/0868/16

**Product:** Puzzle mat

**Name:** EVA PUZZLE MATS

**Risk:** Choking

**Category:** Toys

**Brand:** JIN wa wa, NOWA

**Type/number of model:** NGO0703 , NGO0704

**Risk level:** Serious risk

The puzzle contains small parts (some letters and some numbers). A small child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Foam puzzle mat with letters and numbers, supplied in a transparent plastic packaging with an attached paper label.

**Batch number/Barcode:** 5901531718738, 5901531718745

**Country of origin:** China

**Alert submitted by:** Slovakia



**Alert number:** A12/0872/16

**Product:** Plastic doll

**Name:** VERY FUNNY GIRL

**Risk:** Chemical

**Category:** Toys

**Brand:** OUSDY

**Type/number of model:** 0618

**Risk level:** Serious risk

The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 18.7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Plastic doll with pink hair and accessories (bag and drinking bottle); Packaging: pink cardboard (12cm x 10cm) with transparent window.

**Batch number/Barcode:** 8435426906001

**Country of origin:** China

**Alert submitted by:** France



**Alert number:** A12/0880/16

**Product:** Plastic toy animal

**Name:** LOVELY COLORFUL FISH

**Risk:** Choking

**Category:** Toys

**Brand:** RUN SHENG

**Type/number of model:** ITEM NO: 653

**Risk level:** Serious risk

Small parts from the fish tail may detach. A small child may put these small parts in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** A colourful plastic fish with a flywheel. The toy is supplied in a cardboard box of 13 items.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Slovakia





**Alert number:** A12/0881/16

**Product:** Plastic toy animal

**Name:** LOVELY WORM

**Risk:** Choking

**Category:** Toys

**Brand:** RUN SHENG

**Type/number of model:** ITEM NO: 685

**Risk level:** Serious risk

Small parts (the antennas of the worm) may easily detach from the toy. A small child may put these small parts in the mouth and choke on them. The product does not comply with the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** A blue plastic worm with a flywheel. The toy is supplied in a cardboard box with 11 items.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Slovakia



**Alert number:** A12/0889/16

**Product:** Gel with LED light

**Name:** Phantom Vert / Intelligente

**Risk:** Damage to sight

**Category:** Toys

**Brand:** CLVA

**Type/number of model:** Unknown

**Risk level:** Serious risk

The LED light is too powerful and may cause damage to sight. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 62115.

**Measures taken by economic operators:** Destruction of the product, Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Green gel that changes colour when exposed to light. The product is equipped with a small key ring with a LED light.

**Batch number/Barcode:** 8594164760945

**Country of origin:** United States

**Alert submitted by:** France



**Alert number:** A12/0895/16

**Product:** Finger paint

**Name:** PEINTURE À DOIGTS ('Finger paint')

**Risk:** Choking

**Category:** Toys

**Brand:** GIFL

**Type/number of model:** 347699 - 250 ml; 'fluo' model

**Risk level:** Serious risk

The nozzles of the bottles become detached easily, generating small parts. A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.



**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Importer)

**Description:** 3 packs of 4 x 250-ml pump bottles of finger paint in different colours, supplied in a cardboard-backed blister pack.

**Batch number/Barcode:** 12/2015

**Country of origin:** China

**Alert submitted by:** France

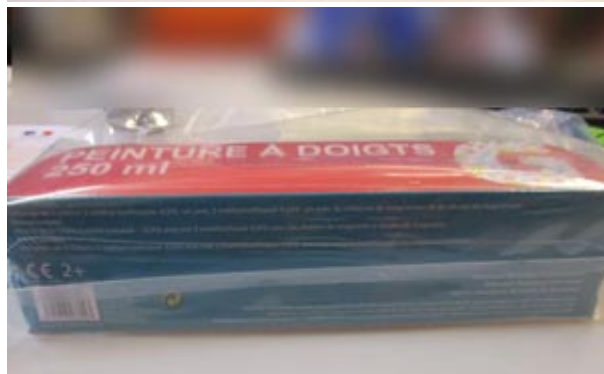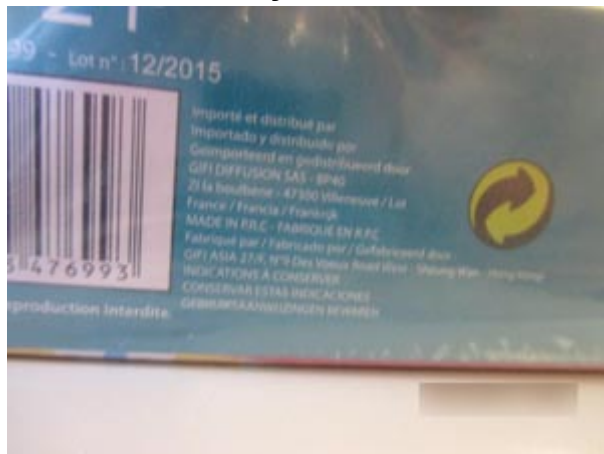

**Alert number:** A11/0066/16

**Product:** Pendant lamp

**Name:** Skygarden

**Risk:** Injuries

**Category:** Electrical appliances and equipment

**Brand:** FLOS

**Type/number of model:** Skygarden S1 and S2

**Risk level:** Other risk level

The suspension system might fail, the lamp could fall and hit persons underneath.

**Measures taken by economic operators:** Other, Temporary ban on the supply, offer to supply and display of the product (By: Manufacturer)

**Description:** Aluminium pendant lamp providing diffused lighting, with suspension system.

The cast plaster of the diffuser is painted white, while the outer finish can be rust, glossy black, glossy white or matt gold. Products manufactured before June 2016 should be sold with an additional safety kit.

**Batch number/Barcode:** FU641, FU642, Products manufactured before June 2016 are affected.

**Country of origin:** Italy

**Alert submitted by:** Italy

**Products were found and measures were taken also in:** Estonia, Ireland





**Alert number:** A11/0065/16

**Product:** Chainsaw

**Name:** Unknown

**Risk:** Burns, Fire

**Category:** Machinery

**Brand:** Echo / Shindaiwa

**Type/number of model:** CS2510TES, CS2510TESC-10, CS2510TESC-8, 250TS, 250TCs - 10, 250TCs-8

**Risk level:** Other risk level

Insufficient cooling may cause plastic components to become fused, which may lead to burns or to a fire if burning parts get in contact with sawdust.

**Measures taken by economic operators:** Recall of the product from end users (By: Importer)

**Description:** Pruning chainsaw with two-stroke spark ignition.

**Batch number/Barcode:** Unknown

**Country of origin:** Japan

**Alert submitted by:** Italy

**Products were found and measures were taken also in:** Germany



**Alert number:** A11/0067/16

**Product:** Swing

**Name:** 3 in 1 swing

**Risk:** Injuries

**Category:** Toys

**Brand:** NSH NORDIC

**Type/number of model:** 805-463/T805-463

**Risk level:** Other risk level

The rope is not adequately fixed and might move under the seat in case the weight on the swing is not in balance, e.g. the child is moving forward and the weight is shifted. In this case, the swing seat might tumble around with a risk of head injuries. One accident reported. The product does not comply with the requirements of the Toy Safety Directive.

**Measures taken by economic operators:** Recall of the product from end users, Temporary ban on the supply, offer to supply and display of the product, Withdrawal of the product from the market (By: Importer)

**Description:** 3in1 swing to be used for children from 1½ to 10 years. This swing consists of 3 parts (seat, back and t-bar). Safety-belt for children below 3 years. There is an adjustable rope on both sides (fixed under the seat).

**Batch number/Barcode:** 5705858041612

**Country of origin:** Denmark

**Alert submitted by:** Denmark

**Products were found and measures were taken also in:** Estonia

