

# The Rapid Alert System for Non-Food Products (RAPEX)

## *RAPEX - Weekly overview report of notifications*

week 40 - 2016

**Alert number:** A12/1234/16

**Product:** Cleaning gel

**Name:** Gel Líquido

**Risk:** Chemical

**Category:** Chemical products

**Brand:** MISTER POMEZ

**Type/number of model:** 1 litro

**Risk level:** Serious risk

The product is corrosive. As the tactile warning of danger, required for these kind of preparations, and the name of the substances as well as the precautionary statements are not indicated, the consumer has no information on a safe use of the product and the dangers incurred when the product comes into contact with the skin or if it is ingested. The product does not comply with Regulation (EC) No 648/2004 on detergents.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Liquid cleaning gel. The product is sold in a white opaque container with blue screw cap. A blue label is attached to the product.

**Batch number/Barcode:** 8412716210017

**Country of origin:** Spain

**Alert submitted by:** Spain



**Alert number:** A12/1267/16

**Product:** Descaling solution

**Name:** Détartrant forte solution ('Descaler strong solution')

**Risk:** Chemical

**Category:** Chemical products

**Brand:** PLANET PURE

**Type/number of model:** Fraîcheur Limette & Menthe

**Risk level:** Serious risk

The product is highly corrosive due to its high acidity (pH 1.7) and can cause skin burns or lesions. Since it lacks important safety information and warnings, the user has no information on the dangers incurred when the product comes into contact with the skin. The product does not comply with Regulation (EC) No. 1272/2008 on classification, labelling and packaging of substances and mixtures and with Regulation (EC) No. 648/2004 on detergents.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Lemon fresh and mint' descaling solution in 510 ml spray container.

**Batch number/Barcode:** 9120001460076 - 2015; 16.01.150

**Country of origin:** Austria

**Alert submitted by:** France



**Alert number:** A12/1220/16

**Product:** Girls' dress

**Name:** Unknown

**Risk:** Strangulation

**Category:** Clothing, textiles and fashion items

**Brand:** MONNALISA

**Type/number of model:** 7604

**Risk level:** Serious risk

The functional cords with free ends at the back of the dress can become trapped during various activities of a child, leading to strangulation. The product does not comply with the relevant European standard EN 14682.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** White dress with flower print, for girls of 4 years. The garment has functional cords in the neck area to be tied at the back.

**Batch number/Barcode:** 117924 / 9999990067579

**Country of origin:** Italy

**Alert submitted by:** Cyprus



**Alert number:** A12/1222/16

**Product:** Girls' bikini

**Name:** Unknown

**Risk:** Injuries

**Category:** Clothing, textiles and fashion items

**Brand:** HELLO BIKINI

**Type/number of model:** L3812

**Risk level:** Serious risk

The cords with free ends at the back of the bikini can become trapped during various activities of a child, leading to injury. The product does not comply with the relevant European standard EN 14682.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Fuchsia bikini for girls of 6 years. The two-part garment has cords to be tied at the back of the garment.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1227/16

**Product:** Clothing set

**Name:** Unknown

**Risk:** Strangulation

**Category:** Clothing, textiles and fashion items

**Brand:** Legendary RIDERS CAVALIERI

**Type/number of model:** 6267265.200.3A

**Risk level:** Serious risk

The drawstrings in the hood can become trapped during various activities of the child, leading to strangulation. The product does not comply with the relevant European standard EN 14682.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Boys' clothing set consisting of a blue sweater and grey trousers. Size 3 years. The sweatshirt has a hood with drawstrings.

**Batch number/Barcode:** 5290561821601

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1231/16

**Product:** Girls' bikini

**Name:** Unknown

**Risk:** Injuries, Strangulation

**Category:** Clothing, textiles and fashion items

**Brand:** LEONADO

**Type/number of model:** T15

**Risk level:** Serious risk

The cords with free ends at the back and in the neck area of the bikini can become trapped during various activities of a child, leading to injuries or strangulation. The product does not comply with the relevant European standard EN 14682.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Blue bikini for girls of 2 and 3 years. The two-part garment has halter neck cords and cords to be tied at the back.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1237/16

**Product:** Leather belt

**Name:** Unknown

**Risk:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** Never 2 hot

**Type/number of model:** Unknown

**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value: 13 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Pink leather belt with rivets.

**Batch number/Barcode:** 276841400002

**Country of origin:** Unknown

**Alert submitted by:** Slovenia



**Alert number:** A12/1241/16

**Product:** Girls' bikini

**Name:** Unknown

**Risk:** Injuries

**Category:** Clothing, textiles and fashion items

**Brand:** YES ! DO KID'S

**Type/number of model:** G99670

**Risk level:** Serious risk

The cords with free ends at the back of the bikini can become trapped during various activities of a child, leading to injuries. The product does not comply with the relevant European standard EN 14682.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Pink bikini for girls of 7/8 (9/10 on the label) years. The two-part garment has cords to be tied at the back.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Cyprus





**Alert number:** A12/1256/16

**Product:** Girls' dress

**Name:** SWEET ELBISE

**Risk:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** Bulsen

**Type/number of model:** KOD: 002

**Risk level:** Serious risk

The small decorative elements can be easily detached. A small child could put them in the mouth and choke on them.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Dress for girls with glued decorative elements. Size: 74.

**Batch number/Barcode:** 8680445160020

**Country of origin:** Turkey

**Alert submitted by:** Hungary



**Alert number:** A12/1257/16

**Product:** Girls' dress

**Name:** Unknown

**Risk:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** Esila

**Type/number of model:** BB0185

**Risk level:** Serious risk

The small decorative elements can be easily detached. A small child could put them in the mouth and choke on them.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** White dress for girls with glued decorative elements. Size: 98-3Y.

**Batch number/Barcode:** Unknown

**Country of origin:** Turkey

**Alert submitted by:** Hungary



**Alert number:** A12/1258/16

**Product:** Girls' dress

**Name:** Unknown

**Risk:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** R. Framboise

**Type/number of model:** LYS XRO-621

**Risk level:** Serious risk

The small decorative elements can be easily detached. A small child could put them in the mouth and choke on them.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** White dress for girls with decorative elements. Size: 6M.

**Batch number/Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Hungary



**Alert number:** A12/1259/16

**Product:** Babies' booties

**Name:** Unknown

**Risk:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** Bebesi

**Type/number of model:** 252

**Risk level:** Serious risk

The small pompoms can be easily detached. A small child could put them in the mouth and choke on them.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Booties for babies in different colours with glued pompoms.

**Batch number/Barcode:** 8699108402520

**Country of origin:** Turkey

**Alert submitted by:** Hungary



**Alert number:** A12/1260/16

**Product:** Babies' booties

**Name:** Unknown

**Risk:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** aura.via

**Type/number of model:** BV208

**Risk level:** Serious risk

The eyes and bells of the bears can be easily detached. A small child could put them in the mouth and choke on them.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Booties for babies in different colours, decorated with glued plush bears. The eyes of the bears are sewn beads. Bells are attached to the necks of the bears.

**Batch number/Barcode:** 140600301BV208012

**Country of origin:** Unknown

**Alert submitted by:** Hungary



**Alert number:** A12/1261/16

**Product:** Girls' dress

**Name:** Unknown

**Risk:** Choking

**Category:** Clothing, textiles and fashion items

**Brand:** Avid Diva

**Type/number of model:** KOD: 615

**Risk level:** Serious risk

The small decorative elements may be easily detached. A small child could put them in the mouth and choke on them.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Dress for girls with short-sleeved bolero. The dress has glued decorative elements. Size: 98 - 3 years.

**Batch number/Barcode:** 8000000 004158

**Country of origin:** Turkey

**Alert submitted by:** Hungary



**Alert number:** A12/1263/16

**Product:** False nails

**Name:** Nail Art

**Risk:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** MEIJIAER

**Type/number of model:** MJE - 060

**Risk level:** Serious risk

The glue contains dibutyl phthalate (DBP), which is toxic to reproduction. The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Set of plastic nails (12 pcs) in different designs and colours (yellow, purple and black), supplied with glue in an orange tube. Packed in a cardboard box with transparent window.

**Batch number/Barcode:** Unknown

**Country of origin:** Unknown

**Alert submitted by:** Romania



**Alert number:** A12/1264/16

**Product:** False nails

**Name:** Charming Nails

**Risk:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** KT

**Type/number of model:** Unknown

**Risk level:** Serious risk

The glue contains dibutyl phthalate (DBP), which is toxic to reproduction. The product does not comply with the Cosmetic Products Regulation.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Set of white plastic nails (13 pcs) in different designs and sizes, and supplied with glue in an orange tube. Packed in a plastic bag.

**Batch number/Barcode:** 01119333704-01224512124

**Country of origin:** China

**Alert submitted by:** Romania





**Alert number:** A12/1265/16

**Product:** Leather slippers

**Name:** Unknown

**Risk:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** Alenka

**Type/number of model:** art. 2021, 37-38

**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value: 43 mg/kg).

Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Pink leather slippers.

**Batch number/Barcode:** Unknown

**Country of origin:** Slovenia

**Alert submitted by:** Slovenia



**Alert number:** A12/1268/16

**Product:** Baby shoes

**Name:** Baby Lauflernschuhe (First-walker shoes for babies)

**Risk:** Chemical

**Category:** Clothing, textiles and fashion items

**Brand:** HSM Schuhmarketing

**Type/number of model:** EDM-Nr. 2586882009

**Risk level:** Serious risk

The amount of Chromium (VI) in the leather is too high (measured value up to 30.2 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Destruction of the product, Recall of the product from end users (By: Importer)

**Description:** 2 pairs of baby shoes in beige with a blue dog's head and a blue edge; sample size 18/19.

**Batch number/Barcode:** 4039653435767 (size 18/19); 4039653435804 (size 20/21); 4039653435842 (size 22/23)

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A12/1213/16

**Product:** Sunscreen product

**Name:** Sun oil

**Risk:** Health risk / other

**Category:** Cosmetics

**Brand:** Acorelle

**Type/number of model:** Ref 4602

**Risk level:** Serious risk

According to the ingredients list, this sunscreen product does not contain any of the UV filters listed in the Cosmetic products regulation, while sun protection can only be obtained by these UV filters. Instead, the product use karanja oil as a UV filter and the product is marketed as "sun oil high protection SPF 30" and "Sun oil effectively protects the skin from the harmful effects of UVA and UVB rays". A sunscreen product without any of the allowed UV filters presents a potential health risk when it comes to the effects of UVB and UVA radiation.

According to the Commission recommendation on the efficacy of sunscreen products and the claims made relating thereto (2006/647/EC) sunscreen products need to protect against both UVB and UVA radiation in order to prevent sunburn and the damage linked to photo-ageing and induced photoimmunosuppression.



**Measures taken by economic operators:** Withdrawal of the product from the market, Withdrawal of the product from the market (By: Distributor, Retailer)

**Description:** Sun oil packaged in a brown bottle with a white label. The product information is printed in white and orange. The bottle contains 75 ml.

**Batch number/Barcode:** 8511L7301, EAN code: 3700343046020, Expire date 12/2017

**Country of origin:** France

**Alert submitted by:** Sweden

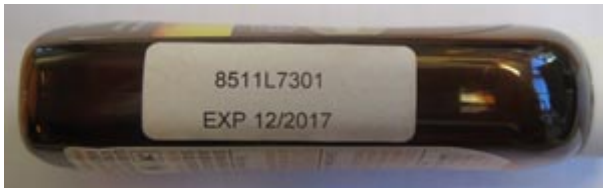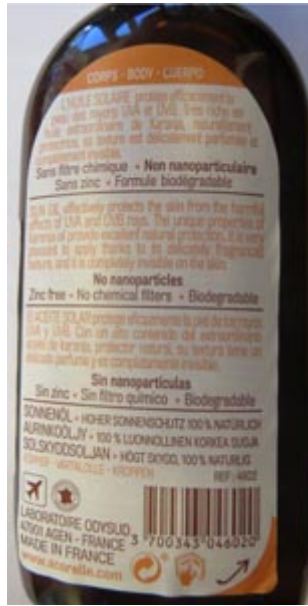

**Alert number:** A12/1223/16

**Product:** Travel plug adaptor

**Name:** Universal Travel Adaptor

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** Bitmore

**Type/number of model:** BM-UTA

**Risk level:** Serious risk

It is possible for two sets of plug pins to be open at the same time and for electrical continuity to exist between them. In this case, if one set of pins is plugged into a mains socket, the other set of pins will be live and accessible to the user. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Travel plug adaptor with USB outputs. Packaged in printed cardboard box.

**Batch number/Barcode:** 5 060275 390836

**Country of origin:** China

**Alert submitted by:** United Kingdom



**Alert number:** A12/1248/16

**Product:** Electric heater

**Name:** Unknown

**Risk:** Electric shock, Fire

**Category:** Electrical appliances and equipment

**Brand:** JOCEL

**Type/number of model:** RH06

**Risk level:** Serious risk

The product is not adequately earthed. This may cause an electric shock. In addition, the product is not sufficiently stable and may overheat: if it overturns at high temperatures, it may cause a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60335.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** White electric heater, with a carrying handle. The product is supplied in a black cardboard box.

**Batch number/Barcode:** 5601774012586

**Country of origin:** Unknown

**Alert submitted by:** Spain



**Alert number:** A12/1253/16

**Product:** Mosquito killer lamp

**Name:** Lámpara Eléctrica Mata Mosquitos

**Risk:** Electric shock

**Category:** Electrical appliances and equipment

**Brand:** La Bolata

**Type/number of model:** ref. 129478

**Risk level:** Serious risk

The power cable is not correctly protected against pulling or twisting, the plug is not appropriate, the cross section of the cables is smaller than required and the grille may still be live after the appliance is disconnected. As a result of these defects, the user could touch live parts. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Black electrical mosquito killer lamp.

**Batch number/Barcode:** 8401294780449

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/1215/16

**Product:** Radio controlled car

**Name:** RTR Super Sport

**Risk:** Electric shock

**Category:** Hobby/sports equipment

**Brand:** WaveRunner

**Type/number of model:** Battery charger: LJ-1000800D, Car:L959 2.4G

**Risk level:** Serious risk

The creepage distance between the live primary circuit and the accessible secondary circuit of the transformer of the battery charger is not sufficient. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Radio controlled car supplied with a battery charger ("AC/DC Adapter"). Sold in a cardboard box.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Finland



**Alert number:** A12/1216/16

**Product:** Heated gloves

**Name:** Electronic Thermal Gloves

**Risk:** Electric shock

**Category:** Hobby/sports equipment

**Brand:** Nevercold

**Type/number of model:** Battery charger: BLC 150840700WV, Gloves: Ontario

**Risk level:** Serious risk

The creepage distance between the live primary circuit and the accessible secondary circuit of the transformer of the battery charger is not sufficient. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.


**Measures ordered by public authorities:** Recall of the product from end users, Withdrawal of the product from the market

**Description:** Heated gloves supplied with a battery charger. Sold in a transparent package.

**Batch number/Barcode:** 6430038643612

**Country of origin:** China

**Alert submitted by:** Finland

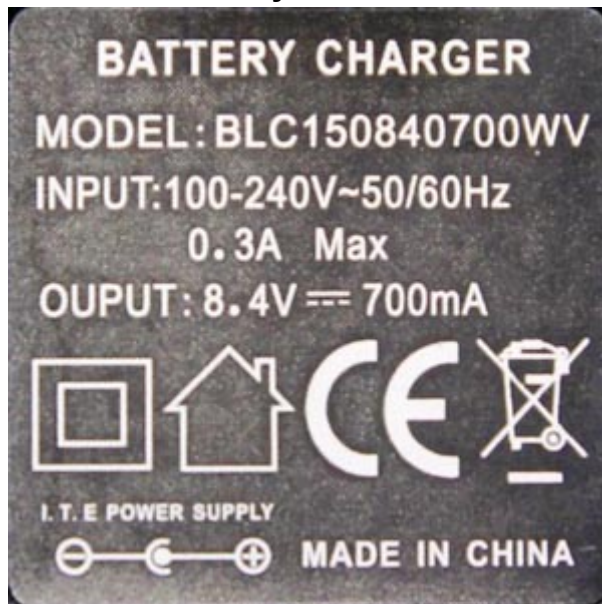



**Alert number:** A12/1247/16

**Product:** Bicycle repair kit

**Name:** BIKE REPAIR KIT / RED SUN (glue)

**Risk:** Chemical

**Category:** Hobby/sports equipment

**Brand:** FEIYUE TOOL

**Type/number of model:** Ref. 10139 and 600206 (with Red Sun glue)

**Risk level:** Serious risk

The product contains chloroform (measured concentration: 2 % by weight) and methylene chloride (measured concentration: 46 % by weight), both substances are suspected of causing cancer. The product lacks warnings and pictograms needed to inform consumers on how to use the product safely. Consumers using the glue may inhale or ingest it or it may accidentally come into contact with their skin causing skin irritation or health damage. The product does not comply with the REACH regulation.


**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Puncture repair kit containing various items: spanners, patches, a tube of RED SUN glue, etc. The product is packaged in a sealed cardboard blister pack.

**Batch number/Barcode:** 6900101301058, 8433878101395

**Country of origin:** China

**Alert submitted by:** Spain

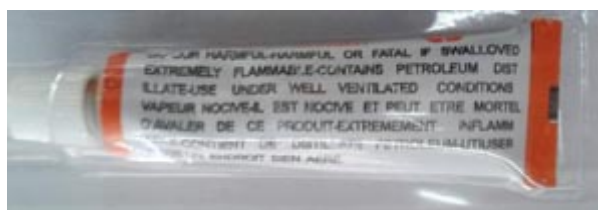

**Alert number:** A12/1214/16

**Product:** Bracelet

**Name:** Unknown

**Risk:** Chemical

**Category:** Jewellery

**Brand:** lo-ika

**Type/number of model:** Unknown

**Risk level:** Serious risk

The amount of nickel released by the metal in the bracelet beads is too high (measured values up to 1.8 µg/cm<sup>2</sup>/week). Nickel is a strong sensitizer and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. The product does not comply with the REACH Regulation.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Importer)

**Description:** Bracelet with yellow and silver coloured metal beads.

**Batch number/Barcode:** Unknown

**Country of origin:** Thailand

**Alert submitted by:** Sweden



**Alert number:** A12/1244/16

**Product:** Lighting chain

**Name:** LED 240 Bombillas, Luces de Arbol

**Risk:** Electric shock

**Category:** Lighting chains

**Brand:** OCEAN

**Type/number of model:** LED-ZHK-215

**Risk level:** Serious risk

The wiring connecting the flashing unit to the lights is too thin and not strong enough. It could break exposing live parts. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Lighting chain with 240 bulbs sold in a plastic box.

**Batch number/Barcode:** 5615000122154

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/1212/16

**Product:** Lampholder

**Name:** Portalamparas Blanco

**Risk:** Electric shock

**Category:** Lighting equipment

**Brand:** MUNCHINA

**Type/number of model:** LH04, ref. 70020

**Risk level:** Serious risk

When a lamp is inserted, the live lamp cap is accessible. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60238.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Black / white lampholder.

**Batch number/Barcode:** 8435322700208

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/1211/16

**Product:** Bus

**Name:** S 431 DT, S 511 HD, S 515 MD, S 515 HD, S 516 MD, S 516 HD/2, S 516 HD, S 517 HD, S 515 HDH, S 516 HDH, S 517 HDH S 519 HD, Travego, Citaro, Conecto, Turismo and various others

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Evobus

**Type/number of model:** EC type-approval: e1\*2007/46\*0013, e1\*2007/46\*1133, e1\*2007/46\*1160, e1\*2007/46\*1569, e1\*2007/46\*0087, e1\*2007/46\*0090, e1\*2007/46\*0036, e1\*2007/46\*0037, e1\*2007/46\*0024, e1\*2007/46\*0025, e1\*2007/46\*0023, e1\*2007/46\*0022, e1\*2007/46\*0008, e1\*2007/46\*0010, e1\*2007/46\*0132, e1\*2007/46\*0012, e1\*2007/46\*0021, e1\*2007/46\*0019, e1\*2007/46\*0014, e1\*2007/46\*0018, e1\*2007/46\*0202, e1\*2007/46\*0197  
Type: 410 01-04, 628 02+03, 628B01+B02, 632 01-07, 633 01-05, 634 01+02

**Risk level:** Serious risk

A leak may arise near the pressure sensor in the axle modulators, proportional relay valves and trailer control valves from the firm WABCO due to the loosening of the connection between pressure sensor and support. As a result, braking pressure may not be correctly regulated. The braking pressure applied may, under certain conditions, be too high on one side of the rear axle and higher than expected by the driver on the front axle.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Bus

**Batch number/Barcode:** The vehicles concerned were manufactured between July and August 2016.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Slovenia

**Alert number:** A12/1226/16

**Product:** Van

**Name:** Primastar

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Nissan

**Type/number of model:** Primastar (X83)

**Risk level:** Serious risk

There may be cracks in the metallic structure of the steering wheel and as a consequence the structural resistance of the steering wheel may be compromised. The steering wheel could break and become detached from the steering column, resulting in a loss of steering control.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Van

**Batch number/Barcode:** Vehicles manufactured between 25 September 2012 and 14 December 2013.

**Country of origin:** France

**Alert submitted by:** Spain

**Products were found and measures were taken also in:** Germany, Ireland, Sweden

**Alert number:** A12/1228/16

**Product:** Passenger car

**Name:** Grand Cherokee, Durango

**Risk:** Fire

**Category:** Motor vehicles

**Brand:** Jeep, Dodge

**Type/number of model:** Unknown

**Risk level:** Serious risk

A short circuit in the wiring of a lamp installed in the sunvisor may cause a fire.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Passenger car

**Batch number/Barcode:** Vehicles affected were manufactured in 2011 and 2012.

**Country of origin:** United States

**Alert submitted by:** Poland

**Products were found and measures were taken also in:** Germany, Ireland, The Netherlands

**Alert number:** A12/1236/16

**Product:** Passenger cars

**Name:** Escalade / Escalade ESV / Corvette / Encore / LaCrosse / Caprice / Silverado / Trax / Spark EV / SS / Suburban / Tahoe / Sierra / Yukon / Yukon XL

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Cadillac / Chevrolet / Buick / GMC

**Type/number of model:** European models: Cadillac Escalade, Escalade ESV, EC type-approval: e13\*2007/46\*1479\*00, type: K2XX; Chevrolet Corvette, EC type-approval: e13\*KS07/46\*1275\*00, type: Y1BC.

**Risk level:** Serious risk

Due to a software problem, the frontal airbags and seatbelt pretensioners may not deploy correctly, which may increase the risk of injury to occupants in the event of a crash.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger cars.

**Batch number/Barcode:** The vehicles concerned were manufactured between 2013 and 2016.

**Country of origin:** United States

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Sweden, The Netherlands

**Alert number:** A12/1238/16

**Product:** Passenger car

**Name:** Passat

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** VW

**Type/number of model:** Type-approval numbers: e1\*2001/116\*0307\*; type: 3C

**Risk level:** Serious risk

It is possible that one or more of the pump pistons in the Electronic Stability Control (ESC) control device may become stuck. A pump piston that becomes stuck leads to diminished pressure build-up/pressure reduction in the hydraulic system. The Electronic Stability Programme's regulating capability is thus restricted.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Passenger car

**Batch number/Barcode:** The vehicles concerned were produced between 27.4.2015 and 14.10.2015.

**Country of origin:** Germany

**Alert submitted by:** Germany

**Products were found and measures were taken also in:** Sweden

**Alert number:** A12/1240/16

**Product:** Motorcycle

**Name:** MSX, NSS

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Honda

**Type/number of model:** Honda MSX125 , Honda NSS300/A FORZA

**Risk level:** Serious risk

The fuel pump's cover made of composite may be deformed because of long-term contact with fuel. The deformation may cause a pump impeller to stop and damage pump's engine, consequently stopping the motorcycle engine with no possibility to start it. This defect can cause an accident.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Motorbikes.

**Batch number/Barcode:** Honda MSX125 manufactured from 22.02.2013 - 24.09.2015, Honda NSS300/A FORZA manufactured from 22.02.2013 - 24.09.2015

**Country of origin:** Thailand

**Alert submitted by:** Poland

**Products were found and measures were taken also in:** Ireland

**Alert number:** A12/1245/16

**Product:** Mobile crane/Special vehicle

**Name:** ATF

**Risk:** Injuries

**Category:** Motor vehicles

**Brand:** Tadano Faun

**Type/number of model:** Type: TF02, TF03, TF04, TF05, TF06 Authorisation No: TF04: e1 \* 2007/46 \* 1431 \* and individual approval; TF05: e1 \* 2007/46 \* 1598 \* and individual approval; TF02, TF03 AND TF06: individual approval

**Risk level:** Serious risk

There is a possibility that the pneumatic connecting lines are not attached properly and could detach themselves. The detachment of the lines could lead to a loss of pressure in the braking system, which could result in reduced braking performance and/or unintentional braking.

**Measures taken by economic operators:** Recall of the product from end users (By: Manufacturer)

**Description:** Mobile crane

**Batch number/Barcode:** The vehicles concerned were manufactured between 2013 and 2015.

**Country of origin:** Germany

**Alert submitted by:** Germany



**Alert number:** A12/1210/16

**Product:** Fancy-dress costume

**Name:** DISFRAZ (CHICA) ('Girls' costume')

**Risk:** Burns

**Category:** Toys

**Brand:** EM HOME

**Type/number of model:** ref. 9993285

**Risk level:** Serious risk

The headscarf is highly flammable and can cause burns if it catches fire. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-2.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Shepherdess fancy-dress costume consisting of a white blouse, black bodice decorated with red ribbons, a red dress decorated with black ribbons and a headscarf. The packaging is a transparent plastic bag sealed at the top by a cardboard strip.

**Batch number/Barcode:** 8435340632857

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/1217/16

**Product:** Plastic doll

**Name:** Pretty Fashionable

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** 802-4

**Risk level:** Serious risk

The head of doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 39.4% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Plastic doll with accessories supplied in a cardboard box.

**Batch number/Barcode:** 60801425

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1218/16

**Product:** Plastic doll set with accessories

**Name:** Pretty-Fashion Trend Girl

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** No: Q22F

**Risk level:** Serious risk

The dolls' heads contain bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 32.32 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Two plastic dolls (woman and man) with accessories in a cardboard box.

**Batch number/Barcode:** 60801630

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1219/16

**Product:** Toy cooking set

**Name:** Cooking Playset

**Risk:** Chemical

**Category:** Toys

**Brand:** XIE CHENG TOYS

**Type/number of model:** Item no. 610

**Risk level:** Serious risk

The plastic packing bag contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 15.5% by weight) and di-butyl phthalate (DBP) (measured value: 3.8% by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system.

According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Toy cooking set supplied in plastic bag with zipper.

**Batch number/Barcode:** 60803429

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1221/16

**Product:** Plastic doll

**Name:** Frozen

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** Unknown

**Risk level:** Serious risk

The head of the doll contains 38 % by weight of bis (2-ethylhexyl) phthalate (DEHP) and 0.76% by weight of di-'isononyl' phthalate (DINP). DEHP may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles articles which can be placed in the mouth by children.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Plastic doll in a cardboard box.

**Batch number/Barcode:** 8013510000011

**THE PRODUCT IS COUNTERFEIT**

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1224/16

**Product:** Body paints

**Name:** Tattoo Gel Pens

**Risk:** Microbiological

**Category:** Toys

**Brand:** PAMPY

**Type/number of model:** 314731

**Risk level:** Serious risk

The product is contaminated by moulds and yeasts (concentration  $2.7 \times 10^4$  cfu/g) The product does not meet the requirements of the Toy Safety Directive.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Body paints in six colours.

**Batch number/Barcode:** 8430173147318

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/1225/16

**Product:** Plastic doll

**Name:** my HORSE

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** NO.3908

**Risk level:** Serious risk

The head, the legs and the hands of the doll contain di-(2-ethylhexyl) phthalate (DEHP) (measured values up to 32.4% by weight) and the head also contains di-butyl phthalate (DBP) (measured value: 0.2% by weight). These phthalates may harm the health of children causing possible damage to the reproductive system. In addition they also contain di-'isononyl' phthalate (DINP) (measured values: up to 12.3 % by weight). Finally, the head of the doll contains also diisodecyl phthalate (DIDP) (measured value: 0.18% by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles that can be placed in the mouth by children.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Plastic doll with a toy horse, supplied in a cardboard box.

**Batch number/Barcode:** 6991207442219

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1229/16

**Product:** Plastic dolls

**Name:** HAPPY POP

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** NO.S4

**Risk level:** Serious risk

The plastic material of the dolls contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 39.3% by weight) and di-butyl phthalate (DBP) (measured value up to: 1.9%). These phthalates may harm the health of children, causing possible damage to the reproductive system. The product also contains diisodecyl phthalate (DIDP) (measured value up to: 1.9%) and di-'isononyl' phthalate (DINP) (measured value up to: 1.5%). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles that can be placed in the mouth by children.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Two plastic dolls with accessories in a cardboard box.

**Batch number/Barcode:** 4991207628088

**Country of origin:** China

**Alert submitted by:** Cyprus





**Alert number:** A12/1230/16

**Product:** Plastic educational toy

**Name:** Happy Shrimp

**Risk:** Choking

**Category:** Toys

**Brand:** Funny Toys

**Type/number of model:** No.3192/5088B

**Risk level:** Serious risk

The toy can easily break, generating small parts. Also the plastic figures are small parts. Small children may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Plastic toy helicopter in the shape of a shrimp with 4 plastic animal figures to be inserted; battery-operated emitting sounds and lights.

**Batch number/Barcode:** 7100201111710

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1232/16

**Product:** Plastic dolls

**Name:** Mexie girls

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** NO.1109

**Risk level:** Serious risk

The head, the hands and the legs of the doll with brown hair contain di-(2-ethylhexyl) phthalate (DEHP) (measured values up to: 41.6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. They also contain di-'isononyl' phthalate (DINP) (measured values up to: 0.8% by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles that can be placed in the mouth by children.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Two plastic dolls with accessories, supplied in a cardboard box.

**Batch number/Barcode:** 6991202703728

**THE PRODUCT IS COUNTERFEIT**

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1233/16

**Product:** Toy pushchair with doll

**Name:** Baby Toy

**Risk:** Injuries

**Category:** Toys

**Brand:** Warmbaby

**Type/number of model:** T05022

**Risk level:** Serious risk

The pushchair has only one safety lock and may easily collapse. Children's finger may become trapped between moving parts, causing injuries. The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Toy set with a doll and a pushchair supplied in a transparent bag.

**Batch number/Barcode:** 8675410039586

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1235/16

**Product:** Toy pushchair

**Name:** Baby Stroller

**Risk:** Injuries

**Category:** Toys

**Brand:** One Six Eight

**Type/number of model:** 7821

**Risk level:** Serious risk

The pushchair has only one safety lock and may easily collapse. Children's finger may become trapped between moving parts, causing injuries. The product does not comply with the Toy Safety Directive and with the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Toy pushchair for dolls, supplied in a plastic bag with a cardboard label on top.

**Batch number/Barcode:** 8675413033574

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1239/16

**Product:** Plastic doll

**Name:** Modern Girls, enjoy the living fun!

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** NO: 0939

**Risk level:** Serious risk

The head of doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 22.7 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Plastic doll about 25 cm tall packed in a cardboard and plastic packaging

**Batch number/Barcode:** ITEM NO: TT2434K30 / EAN: 8592434163175

**Country of origin:** China

**Alert submitted by:** Czech Republic



**Alert number:** A12/1242/16

**Product:** Toy gun set

**Name:** Shoot

**Risk:** Choking

**Category:** Toys

**Brand:** Super Gun

**Type/number of model:** Item number: 811405

**Risk level:** Serious risk

The suction cup of the dart can easily detach. If a child puts the dart in the mouth, the suction cup can detach leaving the airways obstructed by the suction cup. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Toy gun set which includes four plastic darts with suction cups.

**Batch number/Barcode:** 5899108114055

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1243/16

**Product:** Bow and arrow play set

**Name:** Toxophily Set

**Risk:** Choking

**Category:** Toys

**Brand:** King Sport

**Type/number of model:** 35881A

**Risk level:** Serious risk

The suction cup of the arrow can easily detach. If a child puts the arrow in the mouth, the suction cup can detach leaving the airways obstructed by the suction cup. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Bow and arrow play set. The arrows have suction cups.

**Batch number/Barcode:** 8013511415173

**Country of origin:** China

**Alert submitted by:** Cyprus



**Alert number:** A12/1246/16

**Product:** Plastic doll

**Name:** Fashion Princess Merida

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** NO.M9322

**Risk level:** Serious risk

The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 34 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles

**Measures ordered by public authorities:** Withdrawal of the product from the market


**Description:** Plastic doll with red hair, supplied in cardboard box with transparent window.

**Batch number/Barcode:** 6902214417268 , NV2-72-60

**THE PRODUCT MAY BE COUNTERFEIT**

**Country of origin:** China

**Alert submitted by:** Czech Republic

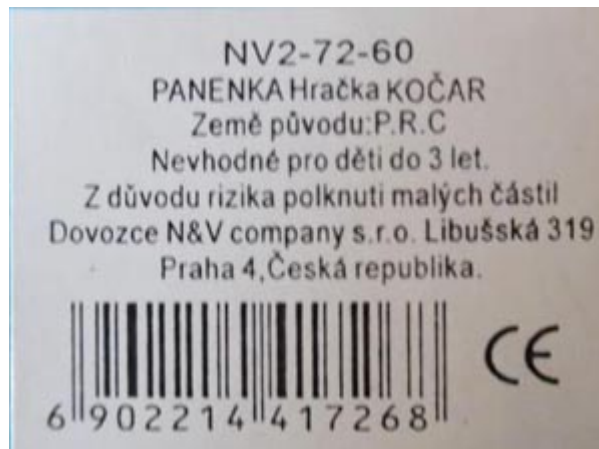

**Alert number:** A12/1249/16

**Product:** Plastic Doll

**Name:** Sparkle Girlz Winter Fairy

**Risk:** Chemical

**Category:** Toys

**Brand:** Sparkle Girlz / Funville

**Type/number of model:** Item No 24118

**Risk level:** Serious risk

The shoes of the doll contain bis-(2-ethylhexyl) phthalate (DEHP) (measured value 0.5% by weight) and dibutylphthalate (DBP) (measured value 12.5% by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.



**Measures taken by economic operators:** Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market (By: Importer)

**Description:** 10cm doll with long blue hair. The toy is supplied in blue cardboard packaging. Packaging size: 12cmx10cm.

**Batch number/Barcode:** 884978241180

**Country of origin:** China

**Alert submitted by:** Estonia



**Alert number:** A12/1250/16

**Product:** Wooden toy

**Name:** Unknown

**Risk:** Choking

**Category:** Toys

**Brand:** ALE-HOP

**Type/number of model:** Reference 692341 (21259).

**Risk level:** Serious risk

Small parts can be easily detached from the toy (the clown's shoes) and be put in the mouth by small children, causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard En 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Wooden toy representing a clown, with one string for hanging it up and another to pull, making the clown move its extremities (jumping jack). Description of the packaging: The toy is attached to a cardboard back.

**Batch number/Barcode:** 8432450073785

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/1251/16

**Product:** Plastic toy flower and xylophone

**Name:** Unknown

**Risk:** Choking

**Category:** Toys

**Brand:** IntelBI

**Type/number of model:** Flower 696111590 (HS0312304) and Xylophone: 696111990 (HS0308539).

**Risk level:** Serious risk

Small parts (the yellow cap on the handle of the flower and the screws from the xylophone) can easily be detached from the toy. A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Two colourful plastic toys : a flower and a xylophone. Description of the packaging: Transparent plastic with a sticker.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/1252/16

**Product:** Doctor play set

**Name:** Doctor play set

**Risk:** Chemical

**Category:** Toys

**Brand:** Unknown

**Type/number of model:** Unknown

**Risk level:** Serious risk

The stethoscope tube of doctor play set contains bis (2-ethylhexyl) phthalate (DEHP) and dibutylphthalate (DBP) (measured values: 7.1% by weight and 3.4% respectively). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.

**Measures taken by economic operators:** Recall of the product from end users, Warning consumers of the risks, Withdrawal of the product from the market (By: Importer)

**Description:** Doctor play set including a range of medical tools. Packed in a transparent plastic blister and cardboard packaging. Packaging size: 34cm x 26cm.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Estonia



**Alert number:** A12/1254/16

**Product:** Toy gun

**Name:** Unknown

**Risk:** Choking

**Category:** Toys

**Brand:** IntelBI

**Type/number of model:** Packaging: 696106190, Invoice: HS0282144.

**Risk level:** Serious risk

The suction cup of the projectiles can easily detach. If a child puts the projectile in the mouth, the suction cup can detach leaving the airways obstructed by it. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Toy gun with projectiles with suction cups.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Spain



**Alert number:** A12/1255/16

**Product:** Beach toy set

**Name:** Beach toys/Set de Playa

**Risk:** Choking

**Category:** Toys

**Brand:** IntelBI

**Type/number of model:** 696107890 on invoice: (HS0184910)

**Risk level:** Serious risk

The toy contains small parts (the mould in the shape of a duck) that can be put in the mouth by children, causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Import rejected at border

**Description:** Yellow beach bucket with orange, green and yellow accessories and moulds, supplied in a net with a label.

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Spain





**Alert number:** A12/1269/16

**Product:** Wooden toy

**Name:** Kugelbahn

**Risk:** Choking

**Category:** Toys

**Brand:** HABA

**Type/number of model:** TL72802

**Risk level:** Serious risk

The small green balls on the toy can detach. A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Wooden toy packed in a cardboard box.

**Batch number/Barcode:** EAN 4010168035802

**Country of origin:** Germany

**Alert submitted by:** The Netherlands



**Alert number:** A12/1270/16

**Product:** Plastic ball

**Name:** Unknown

**Risk:** Chemical

**Category:** Toys

**Brand:** Segmüller's Babyland

**Type/number of model:** 90594

**Risk level:** Serious risk

The plastic of the ball contains di-isobutyl phthalate (DiBP) (measured value 41% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The product does not comply with the requirements of the Toy Safety Directive.

**Measures taken by economic operators:** Recall of the product from end users (By: Distributor)

**Description:** Plastic green ball with picture of a blue dolphin, 20 cm diameter. The ball is sold without packaging.

**Batch number/Barcode:** 262679800000

**Country of origin:** China

**Alert submitted by:** Germany





**Alert number:** A12/1271/16

**Product:** Wooden toy

**Name:** Geburtstagskerze

**Risk:** Choking

**Category:** Toys

**Brand:** Bino

**Type/number of model:** 9981062

**Risk level:** Serious risk

Small parts can easily detach from the toy. A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

**Measures ordered by public authorities:** Ban on the marketing of the product and any accompanying measures

**Description:** Multicoloured, animal-shaped, wooden toy on four wheels. A candle holder is affixed to the animal's back.

**Batch number/Barcode:** 4019359810624

**Country of origin:** China

**Alert submitted by:** Germany



**Alert number:** A11/0089/16

**Product:** Repair kit

**Name:** Schlauchboot-Reparatur-Set (Repair kit for inflatable boat)

**Risk:** Chemical

**Category:** Hobby/sports equipment

**Brand:** Seilflechter

**Type/number of model:** 577566

**Risk level:** Other risk level

The glue contains toluene above the permitted level (measured value: 29.8% by weight). The product does not comply with the REACH Regulation.

**Measures ordered by public authorities:** Withdrawal of the product from the market

**Description:** Repair kit for boats in an orange plastic container, including glue, sand paper and patches.

**Batch number/Barcode:** 3838556 564571

**Country of origin:** Germany

**Alert submitted by:** Slovenia



**Alert number:** INFO/0181/16

**Product:** Lamp

**Name:** LED Akku-Knicklampe

**Risk:** Fire

**Category:** Lighting equipment

**Brand:** Würth

**Type/number of model:** Article No 0827940102961

**Risk level:** Other risk level

The lithium battery in the lamp can overheat whilst charging the lamp.

**Measures taken by economic operators:** Recall of the product from end users, Withdrawal of the product from the market (By: Distributor)

**Description:** Rechargeable LED lamp

**Batch number/Barcode:** Unknown

**Country of origin:** China

**Alert submitted by:** Austria



**Alert number:** A11/0088/16

**Product:** Electric hedge trimmer

**Name:** MHTP 710

**Risk:** Burns

**Category:** Machinery

**Brand:** Macallister

**Type/number of model:** Unknown

**Risk level:** Other risk level

During use, the engine may break down and sparks may come in contact with the user's hand causing burns to the user's skin. The product does not comply with the requirements of the Machinery Directive.

**Measures taken by economic operators:** Withdrawal of the product from the market (By: Distributor)

**Description:** Electric hedge trimmer.

**Batch number/Barcode:** CN: 8467298000

**Country of origin:** China

**Alert submitted by:** Poland

**Products were found and measures were taken also in:** Ireland